

# MECCANO



(TRADE MARKS 296321, 12633, 10274, 55/13476, 569/13, 884/25, 2913)

## INSTRUCTIONS

BOOK No. 1

### 2/6

Copyright by MECCANO LIMITED, LIVERPOOL, throughout the world

No. 27

ENGLISH EDITION





# MECCANO

## INSTRUCTIONS

BOOK No. 1

S/S

THE MECCANO COMPANY LIMITED, LONDON

As you  
perfectly-n  
feature of  
first havin

**F**OLLOW  
can be  
and o  
For co  
throughout  
one next h  
it a No. 2A  
by degrees  
The s

**T**HERE  
applic  
tions  
Manual en  
illustration  
motion tha  
in his new  
It will  
contained i  
reader sho  
Manual is  
model-buil



# A TALK WITH NEW MECCANO BOYS



**M**ECCANO OUTFITS contain accurately-made and highly-finished engineering parts with which any known mechanical movement may be reproduced in model form. With Meccano you can accomplish more than with any other constructional toy, for no other system has its possibilities. No study is needed to enable you to build models with Meccano—the genius is in the Meccano parts.

Already known as the greatest constructional system in the world, Meccano now has an additional attraction—the steel parts are richly coloured in red and green. Thus, not only are Meccano models real engineering structures in miniature, but they are also objects of beauty and charm. Each one you build, as it is completed and “tuned up,” will give you a thrill of pleasure such as you have never previously experienced.

Sooner or later you will find that you are not content to build the models shown in this Book of Instructions; it is always possible to make improvements in them and you will set to work with this object in view. Boys love to venture into unknown fields, and the Meccano hobby opens up a new and wide world for you to explore.

As you progress in Meccano you obtain a greater variety of parts, Gear-Wheels, Pulley-Wheels, Worm-Wheels, Couplings, Cranks, and all manner of perfectly-made real engineering parts. These enable you to construct complicated mechanical movements without any difficulty. The most wonderful feature of Meccano is that it is *real engineering*; it is fascinating and delightful and yet so simple that even an inexperienced boy may join in the fun without first having to study or learn anything.

## HOW TO BUILD WITH MECCANO

**F**OLLOW the instructions closely at first, and build the models just as you see them. Then take each model and try to improve our design. Every model can be made in a dozen different ways. Screw up all the nuts and bolts firmly and you will find that you can play with the trucks, cranes, signals, etc., and obtain many hours of fun.

For convenience Meccano parts are sold in nine Outfits of varying size, numbered 00 to 7. The quality and finish of the parts are of the same high standard throughout the series, but as the Outfits increase in size they contain larger quantities and greater varieties of parts. Each Outfit may be converted into the one next higher by the purchase of an Accessory Outfit (see page 208). Thus, if a No. 2 is the first Outfit bought, it may be converted into a No. 3 by adding to it a No. 2A. A No. 3A would then convert it into a No. 4 and so on up to No. 7. In this way, no matter with what Outfit you commence, you may build it up by degrees to a No. 7.

The separate Meccano parts may be bought at any time in any quantity (see price list on pages 3 and 4).

## “MECCANO STANDARD MECHANISMS”

**T**HERE are a number of Meccano movements that have to a certain extent become standardised; that is to say, they may be applied to more than one model—in most cases without any alteration, but in some few instances with only slight alterations to the original movement. These have been collected and classified, and may now be obtained in the form of a new Manual entitled “Meccano Standard Mechanisms.” This publication consists of 48 pages, 9½” x 6½”, and contains over 140 illustrations in half-tone. The various devices have been arranged so that immediate reference may be made to any particular motion that it is desired to incorporate in a model. No keen Meccano boy who wishes to embody correct engineering principles in his new structures will consider his equipment complete without a copy of “Meccano Standard Mechanisms.”

It will be observed that “Standard Mechanisms” are frequently mentioned in the instructions for building the larger models contained in this book. The “S.M.” Manual is included in Outfits 4A, 5, 6 and 7, and on referring to the details indicated the reader should have no difficulty whatever in understanding the construction of even the most intricate models. Although the Manual is not used in the smaller sets, all owners of Meccano Outfits should find it invaluable in assisting them in their model-building.







MECCANO GUILD  
MEMBER'S CERTIFICATE.

## THE MECCANO GUILD

THE MECCANO GUILD is an organisation for boys, started at the request of boys and conducted as far as possible by boys. The Guild is a great fraternal organisation of which all Meccano boys should become members, for its primary object is to bring them together. The Guild makes these boys feel that they are all members of a great brotherhood, each trying to help the other to get the very best out of life and it cannot fail to have a profound effect for good on the lives of its members.

## MECCANO CLUBS

MECCANO CLUBS are founded and established under the guidance of the Guild Secretary at Headquarters and at the present time there are active Clubs in over one hundred towns and villages in the United Kingdom and in many countries Overseas. Each Club has its Leader, Secretary, Treasurer, and other officials all of whom, with the exception of the Leader, are boys. Write for information how to form a club, if there is no club near you.

Special awards are given to Club members for good work in connection with their Club and medallions are awarded in connection with the Recruiting Campaign, full particulars of which will be sent on request.



SPECIAL MERIT MEDALLION.








RECRUITING MEDALLION.

## THE LIFE OF A MECCANO BOY


A MECCANO boy is the happiest boy in the world. He builds models from the Meccano Instruction books; invents new models; joins the Meccano Guild and a Meccano Club and by wearing the Guild badge proclaims himself to be the friend of millions of other Meccano boys all over the world. He reads the *Meccano Magazine* regularly and corresponds with his friend the Editor when he feels like it. Time never hangs heavily on his hands and he is too busy and happy to grumble.

The *Meccano Magazine* is the Meccano boy's newspaper. It tells him of the latest Meccano models; what Meccano Clubs are doing; how to correspond with other Meccano boys; the Competitions that are running, etc. It contains interesting articles on engineering and electrical subjects, and deals with many other topics of interest to boys, including suggestions from Meccano boys for new Meccano parts and correspondence columns in which the Editor replies to his readers' enquiries. Write to the Editor, *Meccano Magazine*, Binns Road, Liverpool, giving the names and addresses of three of your chums who are not Meccano boys and enclosing 6d. in stamps. He will then forward a specimen copy of the "M.M." post free. It is sent regularly to subscribers at the rate of 4/- for six issues, or it may be ordered from any Meccano dealer, newsagent or bookstall, price 6d. per copy.






## STRIPS, GIRDERS AND BRACKETS

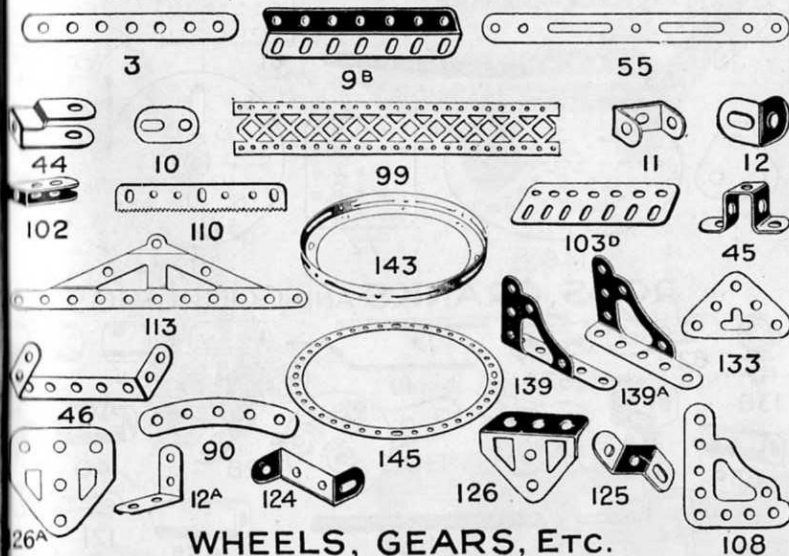

## WHEELS, GEARS, ETC.

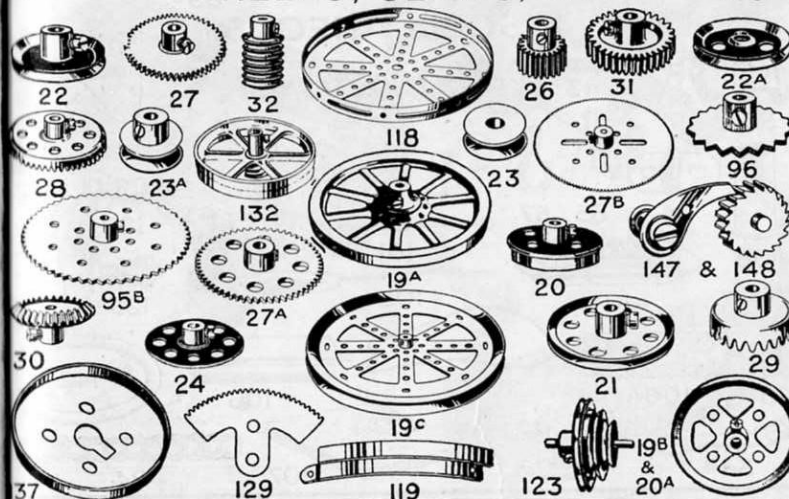

## Particulars and Prices of Meccano Parts

No.		s.	d.	No.		s.	d.
1.	Perforated Strips, 12 $\frac{1}{2}$ " long	1	0	27.	50 teeth to gear with $\frac{1}{2}$ " pinion	each	0 9
1a.	" " 9 $\frac{1}{2}$ " " "	"	0 9	27a.	57 " " " "	"	0 9
1b.	" " 7 $\frac{1}{2}$ " " "	"	0 8	27b.	133 " " " " (3 $\frac{1}{2}$ " dia.)	"	1 6
2.	" " 5 $\frac{1}{2}$ " " "	"	0 6	28.	Contrate Wheels, 1 $\frac{1}{2}$ " diam.	"	0 9
2a.	" " 4 $\frac{1}{2}$ " " "	"	0 5	29.	" " " " " "	"	0 6
3.	" " 3 $\frac{1}{2}$ " " "	"	0 4	30.	Bevel Gears, 1 $\frac{1}{2}$ " 26 teeth	"	0 10
4.	" " 3" " "	"	0 3	30a.	" " " " 16 " "	"	0 6
5.	" " 2 $\frac{1}{2}$ " " "	"	0 3	30b.	" " " " 24 " "	"	0 9
6.	" " 2" " "	"	0 3	30c.	" " " " 48 " "	"	1 3
6a.	" " 1 $\frac{1}{2}$ " " "	"	0 3	31.	Gear Wheels, 1 $\frac{1}{2}$ " 38 teeth	"	1 0
7.	Angle Girders, 24 $\frac{1}{2}$ " long	each	0 8	32.	Worm Wheels	"	0 6
7a.	" " 18 $\frac{1}{2}$ " " "	"	0 6	34.	Spanners	"	0 2
8.	" " 12 $\frac{1}{2}$ " " "	$\frac{1}{2}$ doz.	1 9	34b.	Box Spanners	"	0 3
8a.	" " 9 $\frac{1}{2}$ " " "	"	1 3	35.	Spring Clips	per box (doz.)	0 3
8b.	" " 7 $\frac{1}{2}$ " " "	"	1 2	36.	Screw Drivers	each	0 3
9.	" " 5 $\frac{1}{2}$ " " "	"	1 0	36a.	Extra Long	"	0 6
9a.	" " 4 $\frac{1}{2}$ " " "	"	0 10	37.	Nuts and Bolts, 7/32"	per box (doz.)	0 6
9b.	" " 3 $\frac{1}{2}$ " " "	"	0 8	37a.	Nuts	"	0 3
9c.	" " 3" " "	"	0 8	37b.	Bolts, 7/32"	"	0 3
9d.	" " 2 $\frac{1}{2}$ " " "	"	0 7	*38.	Washers	"	0 1
9e.	" " 2" " "	"	0 6	40.	Hanks of Cord	2 for	0 3
9f.	" " 1 $\frac{1}{2}$ " " "	"	0 6	41.	Propeller Blades	per pair	0 4
*10.	Flat Brackets	"	0 2	43.	Springs	each	0 2
*11.	Double Brackets	each	0 1	*44.	Cranked Bent Strips	"	0 1
*12a.	Angle Brackets, 1" x 1"	doz.	0 6	45.	Double Bent Strips	"	0 1
*12b.	" " 1" x 1"	each	0 1	46.	Double Angle Strips, 2 $\frac{1}{2}$ " x 1"	$\frac{1}{2}$ doz.	0 6
13.	Axle Rods, 11 $\frac{1}{2}$ " long	"	0 3	47.	" " " " 2 $\frac{1}{2}$ " x 1 $\frac{1}{2}$ "	"	0 9
13a.	" " 8" " "	"	0 3	47a.	" " " " 3" x 1 $\frac{1}{2}$ "	"	1 0
14.	" " 6 $\frac{1}{2}$ " " "	"	0 2	48.	" " " " 2 $\frac{1}{2}$ " x 1 $\frac{1}{2}$ "	"	0 4
15.	" " 5" " "	"	0 2	48a.	" " " " 2 $\frac{1}{2}$ " x 1 $\frac{1}{2}$ "	"	0 5
15a.	" " 4 $\frac{1}{2}$ " " "	"	0 1	48b.	" " " " 3 $\frac{1}{2}$ " x 1 $\frac{1}{2}$ "	"	0 6
16.	" " 3 $\frac{1}{2}$ " " "	"	0 1	48c.	" " " " 4 $\frac{1}{2}$ " x 1 $\frac{1}{2}$ "	"	0 9
16a.	" " 2 $\frac{1}{2}$ " " "	"	0 1	48d.	" " " " 5 $\frac{1}{2}$ " x 1 $\frac{1}{2}$ "	"	0 9
16b.	" " 3" " "	"	0 1	50.	Eye Pieces	each	0 2
17.	" " 2" " "	"	0 1	52.	Perforated Flanged Plates, 5 $\frac{1}{2}$ " x 2 $\frac{1}{2}$ "	"	0 5
18a.	" " 1 $\frac{1}{2}$ " " "	"	0 1	52a.	Flat Plates, 5 $\frac{1}{2}$ " x 3 $\frac{1}{2}$ "	"	0 5
18b.	" " 1" " "	"	0 1	53.	Perforated Flanged Plates, 3 $\frac{1}{2}$ " x 2 $\frac{1}{2}$ "	"	0 3
19.	Crank Handles (6" shaft)	"	0 3	53a.	Flat Plates, 4 $\frac{1}{2}$ " x 2 $\frac{1}{2}$ "	"	0 3
19s.	" (3 $\frac{1}{4}$ " shaft)	"	0 3	54.	Perforated Flanged Sector Plates	"	0 3
19a.	Wheels, 3" diam., with set screws	"	0 8	55.	Perforated Strips, slotted, 5 $\frac{1}{2}$ " long	"	0 2
20.	Flanged Wheels	"	0 6	55a.	" " " " 2" " "	"	0 1
19b.	3" dia. with centre boss and set screw	"	0 8	56.	Instruction Manuals, Complete	"	2 6
19c.	6" " " " " "	"	2 6	56a.	" " " " No. 0-3	"	1 0
20a.	2" " " " " "	"	0 6	56b.	" " " " No. 0	"	0 4
21.	1 $\frac{1}{2}$ " " " " " "	"	0 6	56c.	Standard Mechanisms Manuals	"	1 0
22.	1" " " " " "	"	0 4	57.	Hooks	"	0 1
23a.	1" " " " " "	"	0 4	57a.	" (Scientific)	"	0 1
23a.	1" " " " " "	"	0 4	57b.	" (Loaded)	"	0 5
23.	1" " " " " "	"	0 2	58.	Spring Cord	per length	0 9
23.	1" " " " " "	"	0 2	59.	Collars with Set Screws	each	0 2
25.	Bush Wheels	"	0 6	61.	Windmill Sails	"	0 2
25a.	Pinion Wheels, $\frac{1}{2}$ " diam.	"	0 6	62.	Cranks	"	0 3
25a.	" " " " " double width	"	0 9	62a.	Threaded Cranks	"	0 4
26.	Pinion Wheels, $\frac{1}{2}$ " diam.	"	0 4	62b.	Cranks with centre boss	"	0 3
26a.	" " " " " double width	"	0 6	63.	Couplings	"	0 6
26a.	" " " " " double width	"	0 6	63a.	Octagonal Couplings	"	0 8
				63b.	Strip Couplings	"	0 8

IMPORTANT.—Meccano Accessory Parts will be supplied in colours unless customers ask specially for nickelled parts.

\* These parts are available with nickel finish only.



## 4 Particulars and Prices of Meccano Parts (continued)

No.		s.	d.
63c.	Threaded Couplings ... ..	each	0 6
64.	Threaded Bosses ... ..	"	0 2
65.	Centre Forks ... ..	"	0 2
66.	Weights, 50 grammes ... ..	"	1 0
67.	" 25 ... ..	"	1 0
68.	Woodscrews, $\frac{1}{2}$ " ... ..	doz.	0 3
69.	Set Screws ... ..	"	0 4
69a.	Grub Screws, $\frac{5}{32}$ " ... ..	"	0 6
69b.	" $\frac{7}{32}$ " ... ..	"	0 3
70.	Flat Plates, $\frac{5}{8}$ " x $2\frac{1}{2}$ " ... ..	each	0 2
72.	" $\frac{2}{3}$ " x $2\frac{1}{2}$ " ... ..	"	0 2
76.	Triangular Plates, $\frac{2}{3}$ " ... ..	"	0 1
77.	" $\frac{1}{2}$ " ... ..	"	0 1
78.	Screwed Rods, $1\frac{1}{4}$ " ... ..	"	0 6
79.	" $\frac{1}{2}$ " ... ..	"	0 5
79a.	" $\frac{3}{8}$ " ... ..	"	0 4
80.	" $\frac{5}{8}$ " ... ..	"	0 3
80a.	" $\frac{3}{4}$ " ... ..	"	0 3
80b.	" $\frac{4}{5}$ " ... ..	"	0 3
81.	" $\frac{2}{3}$ " ... ..	"	0 2
82.	" $\frac{1}{2}$ " ... ..	"	0 1
89.	Curved Strips, $\frac{5}{8}$ " ... ..	"	0 2
90.	" $\frac{2}{3}$ " large radius ... ..	"	0 1
90a.	" $\frac{2}{3}$ " small radius ... ..	"	0 1
94.	Sprocket Chain ... ..	per 40" length	0 6
*95.	Sprocket Wheels, 2" diam. ... ..	each	0 5
*95a.	" $1\frac{1}{2}$ " ... ..	"	0 4
*95b.	" $3\frac{1}{2}$ " ... ..	"	0 6
*96.	" $1\frac{1}{2}$ " ... ..	"	0 3
*96a.	" $3\frac{1}{2}$ " ... ..	"	0 3
97.	Braced Girders, $\frac{3}{4}$ " long ... ..	$\frac{1}{2}$ doz.	0 9
97a.	" $\frac{3}{4}$ " ... ..	"	0 8
98.	" $\frac{2}{3}$ " ... ..	"	0 6
99.	" $\frac{1}{2}$ " ... ..	"	1 9
99a.	" $\frac{9}{16}$ " ... ..	"	1 6
99b.	" $\frac{7}{8}$ " ... ..	"	1 3
100.	" $\frac{5}{8}$ " ... ..	"	1 0
100a.	" $\frac{4}{5}$ " ... ..	"	0 10
101.	Healds, for looms ... ..	doz.	0 9
102.	Single Bent Strips ... ..	each	0 1
103.	Flat Girders, $\frac{5}{8}$ " long ... ..	$\frac{1}{2}$ doz.	1 0
103a.	" $\frac{9}{16}$ " ... ..	"	1 6
103b.	" $\frac{1}{2}$ " ... ..	"	2 0
103c.	" $\frac{4}{5}$ " ... ..	"	0 9
103d.	" $\frac{3}{4}$ " ... ..	"	0 7
103e.	" $\frac{3}{8}$ " ... ..	"	0 6
103f.	" $\frac{2}{3}$ " ... ..	"	0 5
103g.	" $\frac{2}{3}$ " ... ..	"	0 4
103h.	" $\frac{1}{2}$ " ... ..	"	0 3
103k.	" $\frac{7}{8}$ " ... ..	"	1 3
*104.	Shuttles, for looms ... ..	each	4 0
105.	Reed Hooks, for looms ... ..	"	0 4
106.	Wood Rollers ... ..	"	1 3
106a.	Sand Rollers ... ..	"	1 6
107.	Tables for Designing Machines ... ..	"	1 0
108.	Architraves ... ..	"	0 2
109.	Face Plates, $2\frac{1}{2}$ " diam. ... ..	"	0 4
*110.	Rack Strips, $\frac{3}{4}$ " ... ..	"	0 2
111.	Bolts, $\frac{1}{2}$ " ... ..	"	0 1
111a.	" $\frac{3}{8}$ " ... ..	2 for	0 1
111c.	" $\frac{1}{4}$ " ... ..	doz.	0 4

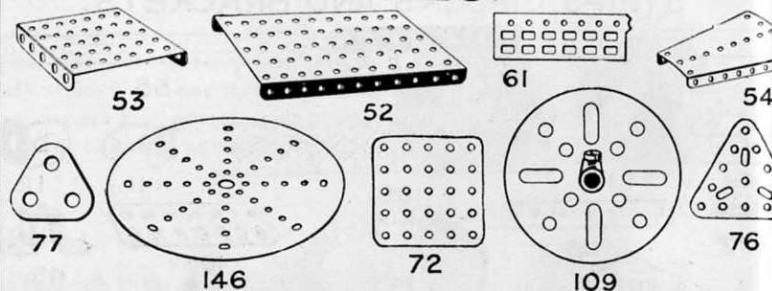
No.		s.	d.
113.	Girder Frames ... ..	each	0 2
*114.	Hinges ... ..	per pair	0 4
115.	Threaded Pins ... ..	each	0 2
*116.	Fork Pieces ... ..	"	0 3
117.	Steel Balls, $\frac{3}{8}$ " diam. ... ..	doz.	0 6
118.	Hub Discs, $\frac{5}{8}$ " diam. ... ..	each	1 3
119.	Channel Segments (8 to circle, $1\frac{1}{2}$ " diam.) ... ..	"	0 4
120.	Buffers ... ..	"	0 2
120a.	Spring Buffers ... ..	per pair	0 8
120b.	Springs for Spring Buffers ... ..	each	0 1
*121.	Train Couplings ... ..	"	0 2
122.	Miniature Loaded Sacks ... ..	"	0 2
123.	Cone Pulleys ... ..	"	1 3
*124.	Reversed Angle Brackets, $1\frac{1}{2}$ " ... ..	$\frac{1}{2}$ doz.	0 10
*125.	" $\frac{1}{2}$ " ... ..	"	0 6
126.	Trunnions ... ..	each	0 3
126a.	Flat Trunnions ... ..	"	0 2
127.	Simple Bell Cranks ... ..	"	0 3
128.	Boss Bell Cranks ... ..	"	0 4
*129.	Rack Segments, $3\frac{1}{2}$ " diam. ... ..	"	0 6
*130.	Triple Throw Eccentrics ... ..	"	1 3
131.	Dredger Buckets ... ..	"	0 2
132.	Flywheels, $2\frac{1}{4}$ " diam. ... ..	"	2 3
133.	Corner Brackets ... ..	"	0 3
*134.	Crank Shafts, $1\frac{1}{2}$ " stroke ... ..	"	0 3
135.	Theodolite Protractors ... ..	"	0 3
136.	Handrail Supports ... ..	"	0 3
137.	Wheel Flanges ... ..	"	0 4
138.	Ship's Funnels ... ..	"	0 4
138a.	Ship's Funnels (Cunard Type) ... ..	"	0 6
139.	Flanged Brackets (right) ... ..	"	0 2
139a.	" (left) ... ..	"	0 2
140.	Universal Couplings ... ..	"	0 9
141.	Wire Lines (for suspending clock weights) ... ..	"	0 9
142a.	Dunlop Tyre, 2" ... ..	"	0 4
142b.	" 3" ... ..	"	0 6
143.	Circular Girders, $5\frac{1}{4}$ " diam. ... ..	"	1 0
144.	Dog Clutches ... ..	"	0 6
145.	Circular Strips, $7\frac{1}{2}$ " diam. over all ... ..	"	1 0
146.	" Plates, 6" ... ..	"	1 3
*147.	Pawls, with pivot bolt and nuts ... ..	"	0 3
*147a.	Pawls ... ..	"	0 2
*147b.	Pivot Bolt with 2 nuts ... ..	"	0 2
148.	Ratchet Wheels ... ..	"	0 9
149.	Collecting Shoes, for Electric Locos ... ..	"	1 6
150.	Crane Grabs ... ..	"	0 6
151.	Pulley Blocks, single sheave ... ..	"	0 6
152.	" " two " ... ..	"	0 9
153.	" " three " ... ..	"	1 0
*154.	Corner Angle Brackets, $\frac{1}{2}$ " ... ..	$\frac{1}{2}$ doz.	0 6
*156.	Pointers, $2\frac{1}{4}$ " overall, with boss ... ..	each	0 3
157.	Fans, 2" diam. ... ..	"	0 3
158a.	Signal Arms, home ... ..	"	0 3
158b.	" " distant ... ..	"	0 3
*159.	Circular Saws ... ..	"	1 0
160.	Channel Bearings, $1\frac{1}{2}$ " x $1\frac{1}{2}$ " x $\frac{1}{4}$ " ... ..	"	0 2

IMPORTANT.—Meccano Accessory Parts will be supplied in colours unless customers ask specially for nickelled parts.


\* These parts are available with nickel finish only.

As new parts are frequently added to the Meccano system the foregoing list is not necessarily complete. The latest illustrated list should be obtained from your dealer, or from Meccano Ltd., Liverpool.


## PLATES.



## RODS, CRANKS AND COUPLINGS.

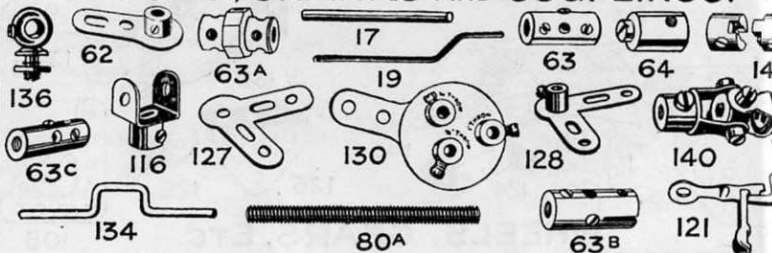


## MISCELLANEOUS.

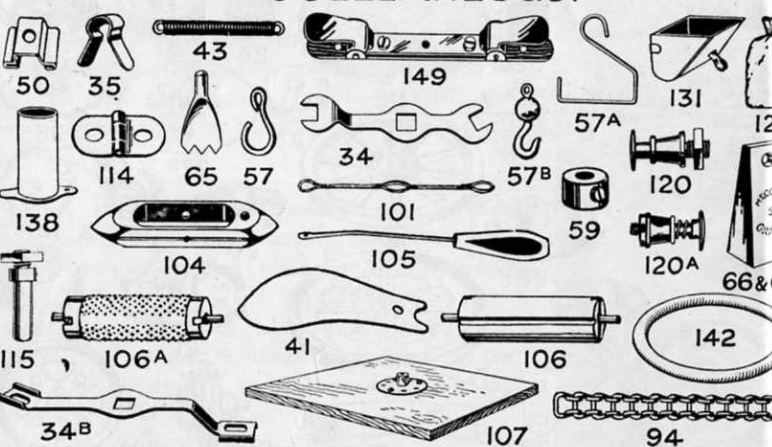



These Models can be made with MECCANO Outfit No. 0, or No. 00 and No. 00A.

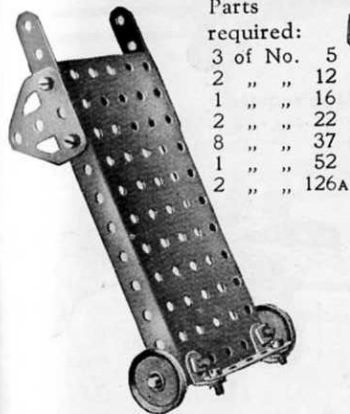**Model No. 1  
Flat Truck**



Parts required:

3 of No.	5
2 " "	12
1 " "	16
2 " "	22
8 " "	37
1 " "	52
2 " "	126A


**Model No. 2  
Luggage Cart**



Parts required:

2 of No.	2	2 of No.	37A
1 " "	16	1 " "	44
2 " "	17	2 " "	48A
3 " "	22	1 " "	52
4 " "	35	1 " "	111c
8 " "	37	2 " "	126A

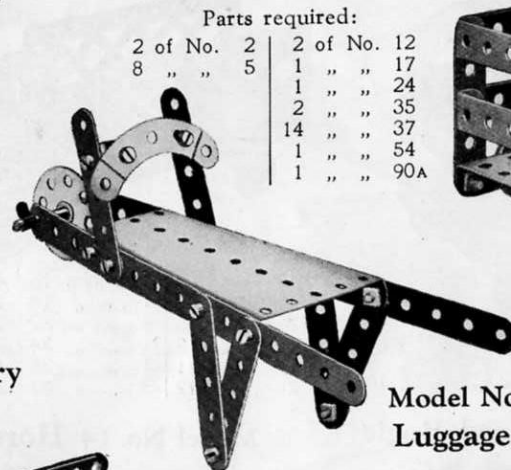
**Model No. 3  
Wheel Barrow**



Parts required:

2 of No.	2	2 of No.	12
8 " "	5	1 " "	17
		1 " "	24
		2 " "	35
		14 " "	37
		1 " "	54
		1 " "	90A


**Model No. 4 Truck with Sides**

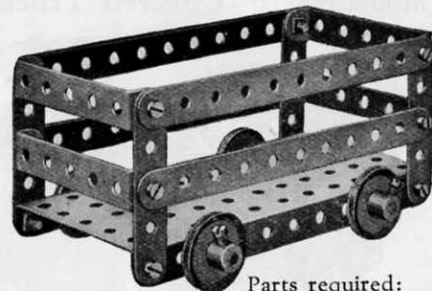

Parts required:

4 of No.	2	4 of No.	22
4 " "	5	12 " "	37
2 " "	16	4 " "	48A
		1 of No.	52

**Model No. 5 Ticca Gharry**

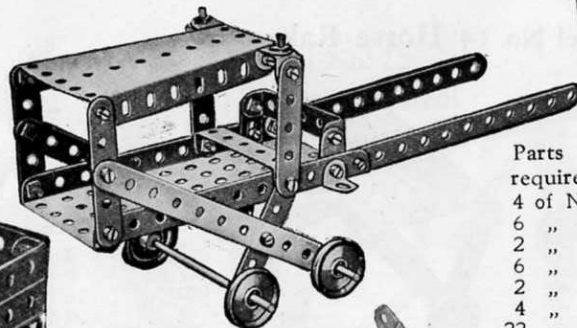

Parts required:

4 of No.	2
6 " "	5
2 " "	10
6 " "	12
2 " "	16
4 " "	22
22 " "	37
2 " "	48A
1 " "	52
1 " "	54


**Model No. 6  
Luggage Cart**



Parts required:

2 of No.	2	18 of No.	37
4 " "	5	1 " "	52
4 " "	12	2 " "	90A
1 " "	16	2 " "	100
2 " "	22	2 " "	126A

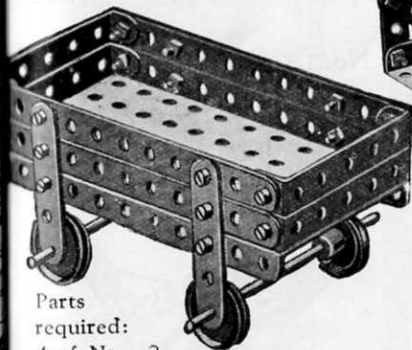
**Model No. 7  
Truck**



Parts required:

4 of No.	2
4 " "	5
2 " "	16
4 " "	22
20 " "	37
4 " "	48A
1 " "	52

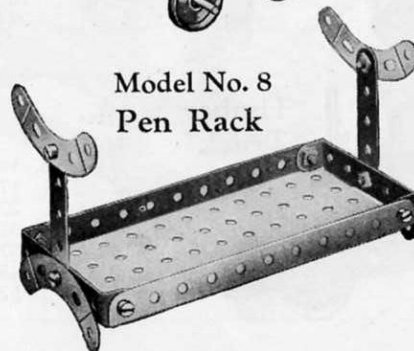
**Model No. 8  
Pen Rack**



Parts required:

2 of No.	5
8 " "	37
2 " "	48A
1 " "	52
4 " "	90A

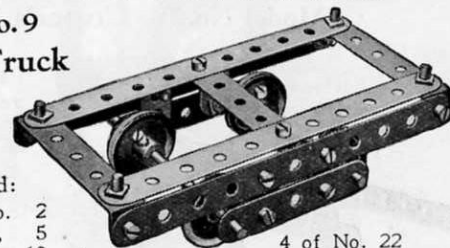**Model No. 9  
Bogie Truck**




Parts required:

4 of No.	2
3 " "	5
4 " "	10
2 " "	16
4 of No.	22
18 " "	37
2 " "	48A



These Models can be made with MECCANO Outfit No. 0, or No. 00 and No. 00A.

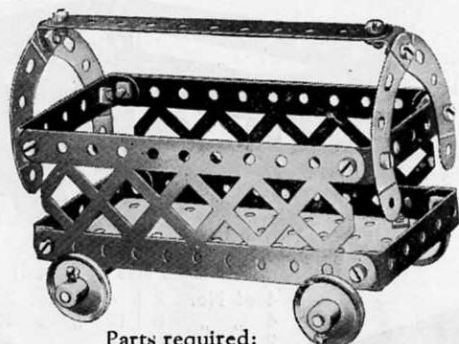
Model No. 10 Covered Truck



Parts required:

1 of No. 2	4 of No. 22	1 of No. 52
6 " " 12	20 " " 37	4 " " 90A
2 " " 16	4 " " 48A	2 " " 100

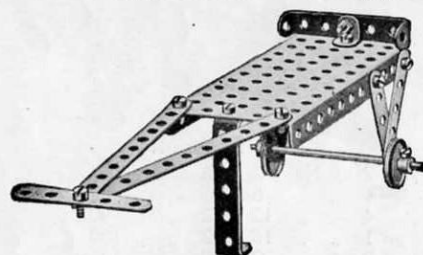
Model No. 13 Shipyard Bogie



Parts required:

2 of No. 2	2
5 " " 5	5
1 " " 12	12
1 " " 16	16
2 " " 22	22
10 " " 37	37
2 " " 48A	48A
1 " " 52	52

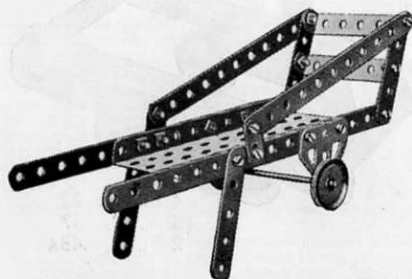
Model No. 16 Coster's Barrow



Parts required:


4 of No. 2	2
4 " " 5	5
1 " " 16	16
2 " " 22	22
16 " " 37	37
2 " " 48A	48A
1 " " 52	52
2 " " 126A	126A

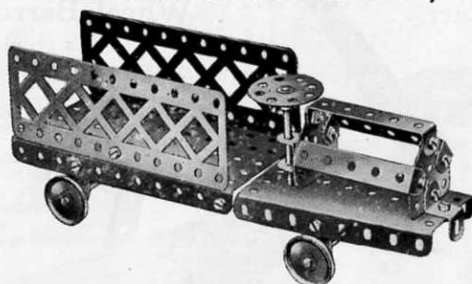Model No. 11 Motor Lorry



Parts required:	2 of No. 16	4 of No. 48A
2 of No. 5	1 " " 17	1 " " 52
4 " " 10	4 " " 22	1 " " 54
1 " " 11	1 " " 24	2 " " 100
2 " " 12	1 " " 35	1 " " 125
	23 " " 37	2 " " 126A

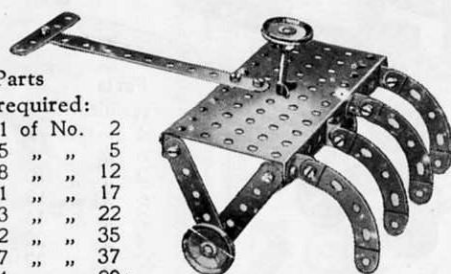
Model No. 14 Horse Rake



Parts required:

1 of No. 2	2
5 " " 5	5
8 " " 12	12
1 " " 17	17
3 " " 22	22
2 " " 35	35
17 " " 37	37
4 " " 90A	90A
2 " " 111c	111c

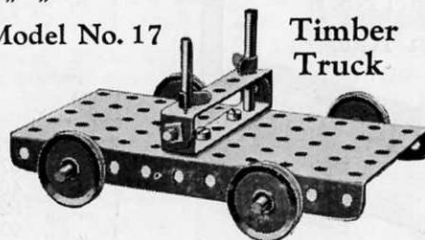Model No. 17



Timber Truck

Parts required:	2 of No. 16
2 " " 17	17
4 " " 22	22
4 " " 35	35
4 " " 37	37
2 " " 48A	48A
1 " " 52	52


Model No. 12 Timber Drag



Parts required:

4 of No. 2	2 of No. 16	8 of No. 37
2 " " 11	4 " " 22	4 " " 48A

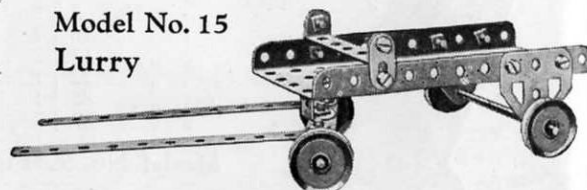Model No. 15 Lorry




Parts required:

2 of No. 2	2 of No. 16	2 of No. 48A
2 " " 10	4 " " 22	1 " " 52
1 " " 11	12 " " 37	2 " " 126A

Model No. 18 Go Chair

Parts required:


2 of No. 2	9 of No. 37
7 " " 5	4 " " 37A
2 " " 16	2 " " 48A
4 " " 22	2 " " 111c

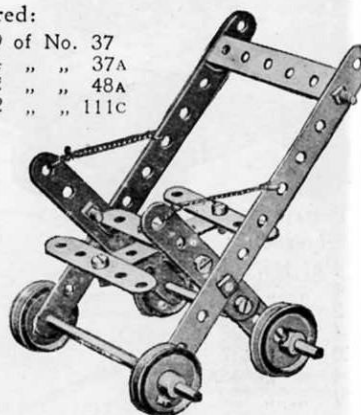

These Models can be made with MECCANO Outfit No. 0, or No. 00 and No. 00A.

7

### Model No. 19 Rock Drill

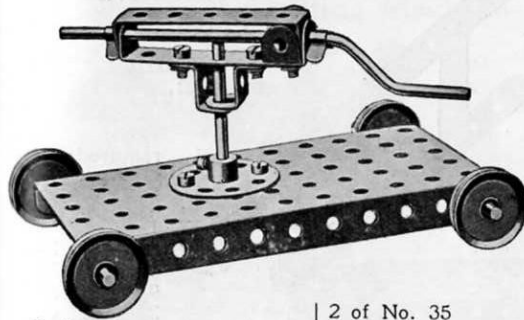


Parts required:	1 of No. 17	2 of No. 35
1 of No. 11	1 " " 19	2 " " 37
2 " " 16	4 " " 22	2 " " 48A
	1 " " 24	1 " " 52
		2 " " 125

### Model No. 21

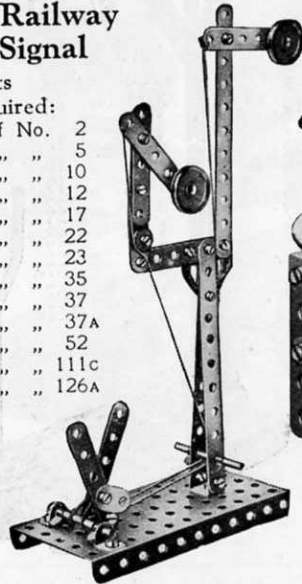
#### Railway Signal

Parts required:	
3 of No. 2	
7 " " 5	
2 " " 10	
6 " " 12	
2 " " 17	
2 " " 22	
1 " " 23	
4 " " 35	
14 " " 37	
6 " " 37A	
1 " " 52	
6 " " 111c	
1 " " 126A	



### Model No. 20 Travelling Crane

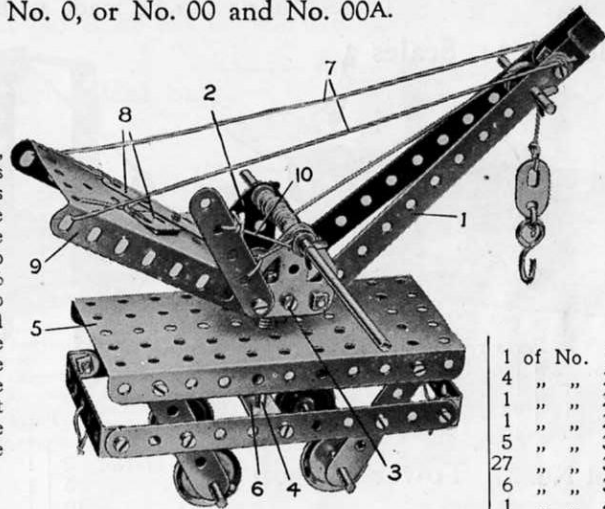The jib is pivoted to the flat trunnions 2, which are bolted at 3 to angle brackets secured to a bush wheel. The latter is nipped to a 2" rod 4 passing through the plate 5 and further supported in a double angle strip 6. A washer and spring clip mounted on the rod 4 below the strip 6 secure the crane to the carriage. The jib is supported by means of cords 7 tied to 2½" strips 8, the holes of which engage the shank of a bolt passed through the sector plate 9, and its elevation may be altered by inserting this bolt in different holes in the strips 8. The cord 10 of the brake lever is wound once round the crank handle, between two washers.



1 of No. 19	
4 " " 22	
1 " " 23A	
1 " " 24	
5 " " 35	
27 " " 37	
6 " " 38	
1 " " 44	
3 " " 48A	
1 " " 52	
1 " " 54	
1 " " 57	
2 " " 126A	

#### Parts required:

4 of No. 2	2 of No. 12
7 " " 5	2 " " 16
1 " " 10	2 " " 17

### Model No. 22 Potter's Wheel


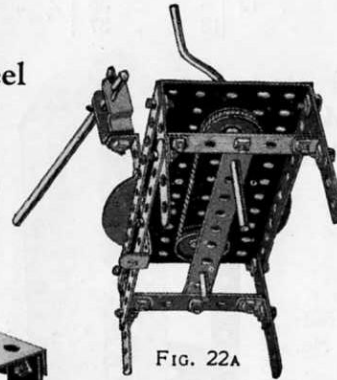


FIG. 22A

#### Parts required:

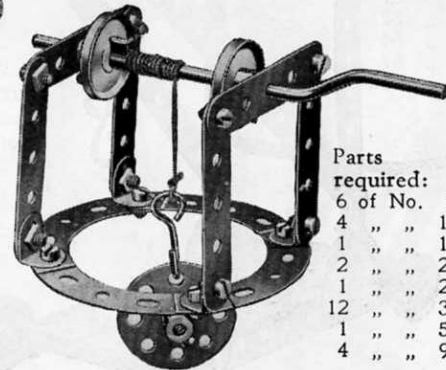2 of No. 2	1 of No. 24
4 " " 5	2 " " 35
1 " " 16	17 " " 37
1 " " 19	1 " " 44
2 " " 22	3 " " 48A
	1 of No. 52

### Model No. 23 Well Windlass




#### Parts required:

6 of No. 5	
4 " " 12	
1 " " 19	
2 " " 22	
1 " " 24	
12 " " 37	
1 " " 57	
4 " " 90	



These Models can be made with MECCANO Outfit No. 0, or No. 00 and No. 00A.

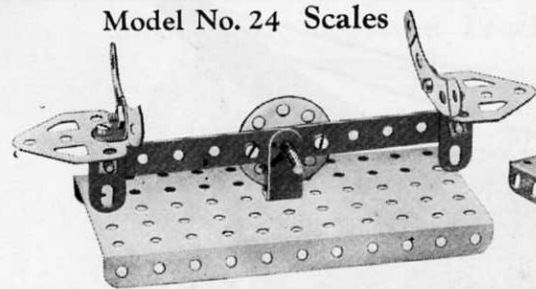Model No. 24 Scales




Parts required:		
1 of No. 2	1 of No. 17	1 of No. 52
2 " " 10	1 " " 24	2 " " 90A
2 " " 12	9 " " 37	2 " " 126A
	1 " " 44	

Model No. 27 Tower Wagon


Parts required:

4 of No. 2	
8 " " 5	
2 " " 16	
1 " " 17	
1 " " 19	
4 " " 22	
1 " " 23	
4 " " 35	
24 " " 37	
1 " " 52	
1 " " 54	
1 " " 57	
2 " " 126A	

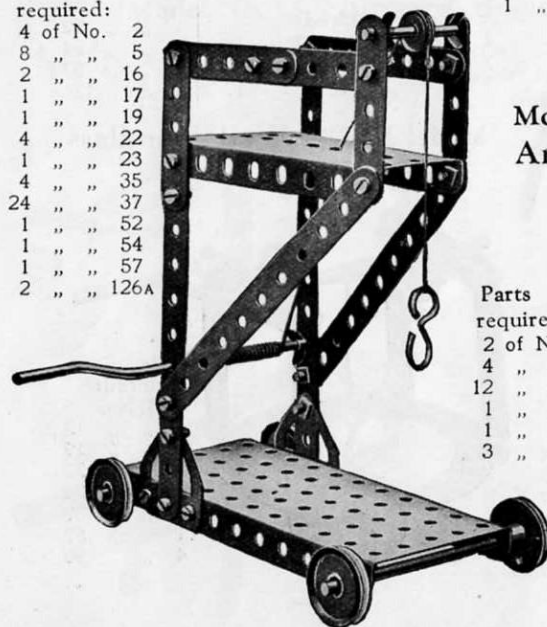


Model No. 28 Arm Chair

Parts required:		
2 of No. 2		
4 " " 5		
12 " " 37		
1 " " 48A		
1 " " 52		
3 " " 90A		

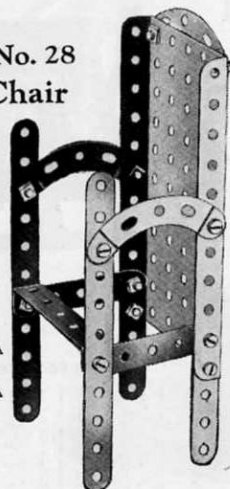

Model No. 25 Gangway

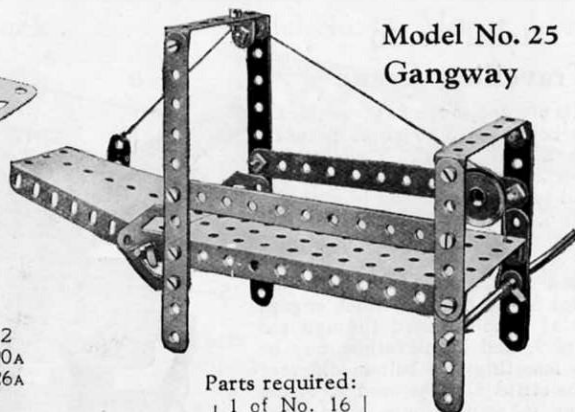


Parts required:

4 of No. 2	1 of No. 16	2 of No. 48A
4 " " 5	1 " " 22	1 " " 52
1 " " 10	1 " " 23	1 " " 54
1 " " 12	4 " " 35	2 " " 126A
	18 " " 37	

Model No. 29 Hoisting Block

Parts required:


4 of No. 2	
6 " " 5	
6 " " 12	
1 " " 17	
1 " " 22	
1 " " 23	
2 " " 35	
25 " " 37	
3 " " 38	
2 " " 48A	
1 " " 52	
1 " " 57	

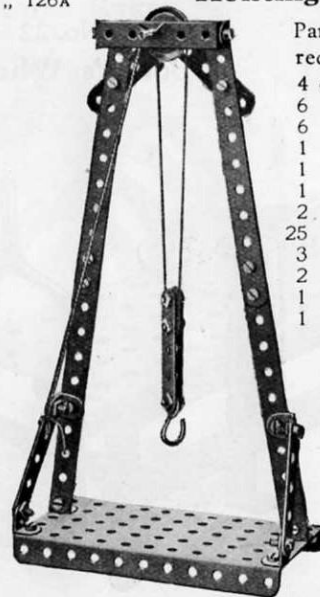

Model No. 26 Level Crossing Barrier

Parts required:


3 of No. 2	
2 " " 5	
1 " " 17	
4 " " 22	
1 " " 24	
9 " " 37	
2 " " 48A	
1 " " 52	
1 " " 111c	

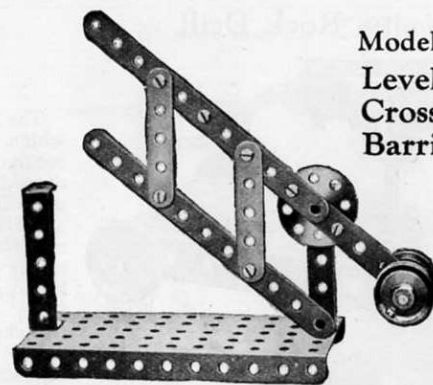

Model No. 30 Railway Signal


Parts required:

3 of No. 2	
4 " " 5	
4 " " 12	
1 " " 16	
1 " " 19	
3 " " 22	
1 " " 24	
7 " " 37	
4 " " 37A	
1 " " 52	
2 " " 111c	

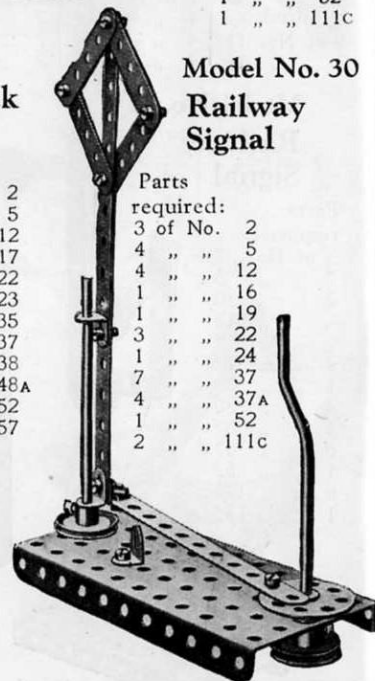

These Models can be made with MECCANO Outfit No. 0, or No. 00 and No. 00A.


### Model No. 31 Drilling Machine

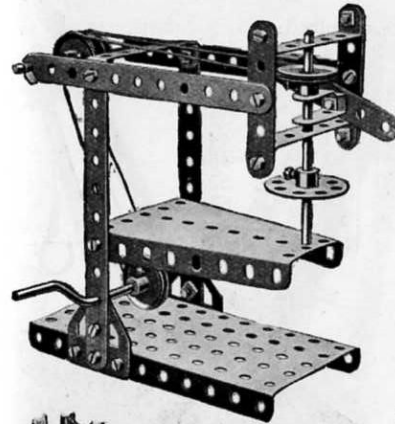

Parts required:

4 of No.	2
3 " "	5
1 " "	11
2 " "	16
1 " "	19
4 " "	22
1 " "	24
4 " "	35
19 " "	37
1 " "	44
3 " "	48A
1 " "	52
1 " "	54
2 " "	126A

### Model No. 32 Mechanical Saw

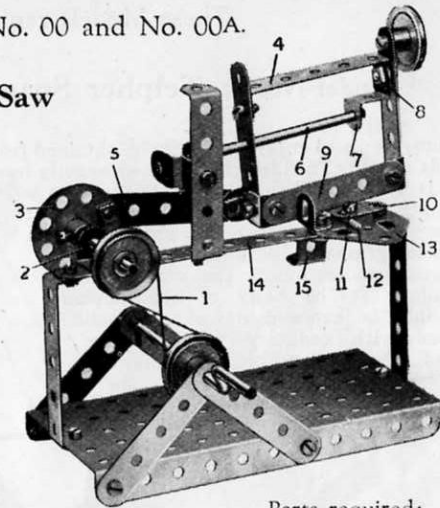

The strip 9 represents the saw. The crank handle drives through a belt 1 a short rod journaled in a double bracket 2 and carrying a bush wheel 3. The latter imparts a reciprocating motion to the saw frame 4 through a  $2\frac{1}{2}$ " strip 5 loosely mounted on bolts secured to the bush wheel and to an angle bracket bolted to the saw frame. This frame slides on a  $3\frac{1}{4}$ " rod 6, which acts as a guide, passing through the frame and supported in a reversed angle bracket 7. A washer is placed on the bolt 8 behind the bracket 7. A vice to secure the objects in position for cutting consists of a flat bracket 10 mounted on a bolt 11, a few turns of which causes the flat bracket to grip the object 12. The bolt 11 enters a nut held between the flat trunnion 13 and  $5\frac{1}{4}$ " strip 14, which are spaced apart for the purpose by washers placed on the two bolts holding the trunnion in position. The saw frame rests on the stop 15 when not in use. A 1" pulley secured to the top of the frame acts as a weight and helps to steady the saw.

### Model No. 34 Swing


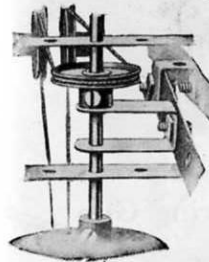



FIG. 31A  
(Detail of  
Drilling  
Machine)

### Model No. 33 Buffers

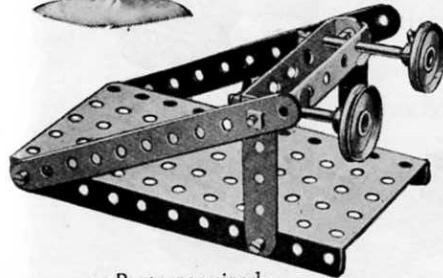

Parts required:


2 of No.	2	2 of No.	35
2 " "	5	6 " "	37
2 " "	17	2 " "	48A
2 " "	22	1 " "	52

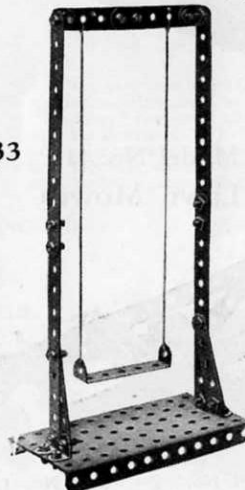

Parts required:

4 of No.	2	20 of No.	37
4 " "	5	1 " "	48A
6 " "	12	1 " "	52

### Model No. 35 Band Saw

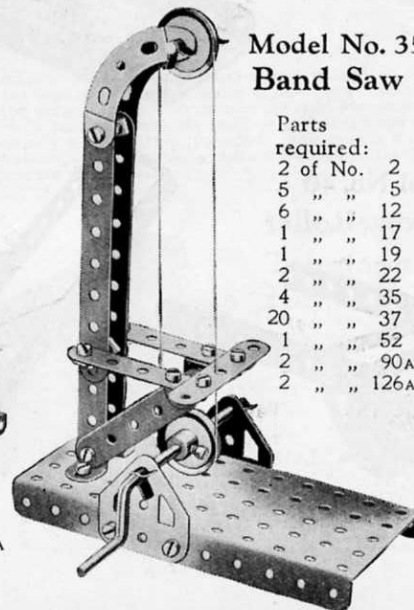

Parts required:

2 of No.	2
5 " "	5
6 " "	12
1 " "	17
1 " "	19
2 " "	22
4 " "	35
20 " "	37
1 " "	52
2 " "	90A
2 " "	126A


Parts required:

1 of No.	2	1 of No.	17	4 of No.	38
8 " "	5	1 " "	19	1 " "	44
1 " "	10	3 " "	22	4 " "	48A
1 " "	11	1 " "	24	1 " "	52
4 " "	12	3 " "	35	2 " "	125
1 " "	16	22 " "	37	1 " "	126A

### Model No. 36 Jib Crane

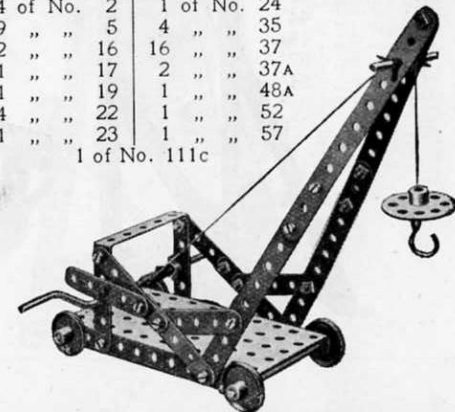Parts required:

4 of No.	2	1 of No.	24
9 " "	5	4 " "	35
2 " "	16	16 " "	37
1 " "	17	2 " "	37A
1 " "	19	1 " "	48A
4 " "	22	1 " "	52
1 " "	23	1 " "	57
1 of No. 111c			






**Model No. 37 Telfer Span**

Many hours of enjoyment may be obtained from this model. The illustration shows exactly how it is worked. The cords may be made to any length, and the load carried from one side of the room to the other. In order to give a better grip, the operating cord should be wound twice round the crank handle pulley. The body of the telfer should be screwed down to a solid base with ordinary wood screws, and the pulley bracket screwed in a suitable position on the opposite side of the room.



Parts  
required:

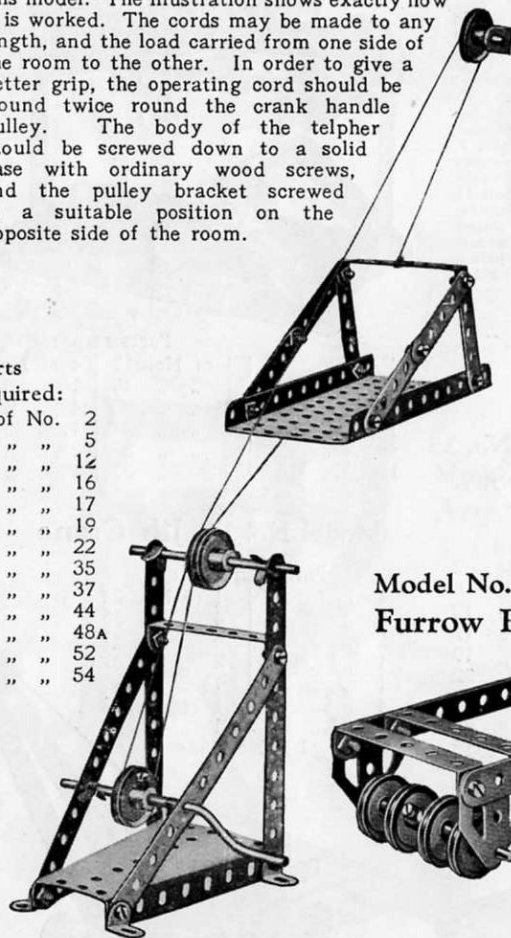4 of No.	2
6 " "	5
4 " "	12
1 " "	16
1 " "	17
1 " "	19
4 " "	22
4 " "	35
1 " "	37
1 " "	44
2 " "	48A
1 " "	52
1 " "	54

**Model No. 38 Windmill**


Parts  
required:

4 of No.	2
4 " "	5
1 " "	16
1 " "	19
2 " "	22
1 " "	24
4 " "	35
12 " "	37
2 " "	48A
1 " "	52

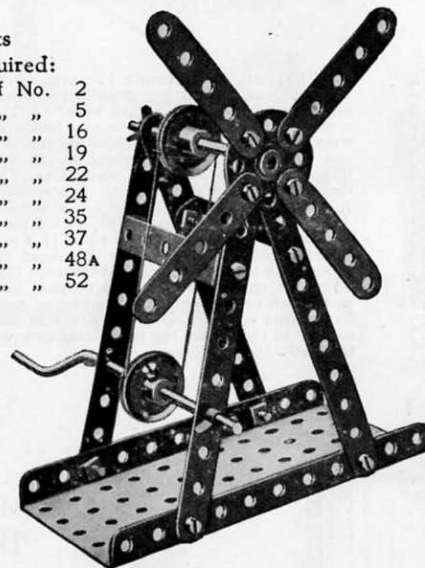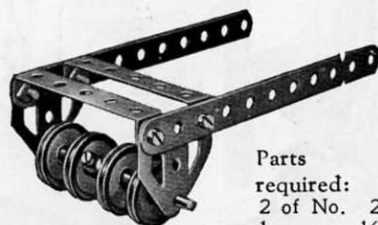**Model No. 40 Furrow Roller**

Parts  
required:

2 of No.	2
1 " "	16
4 " "	22
4 " "	37
2 " "	48A
2 " "	126A

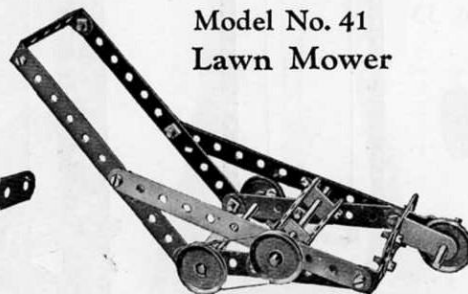**Model No. 41 Lawn Mower**



Parts required:

4 of No.	2	1 of No.	17
7 " "	5	4 " "	22
2 " "	11	19 " "	37
2 " "	16	1 " "	44
3 of No. 48A			

**Model No. 39 Swivelling Crane**

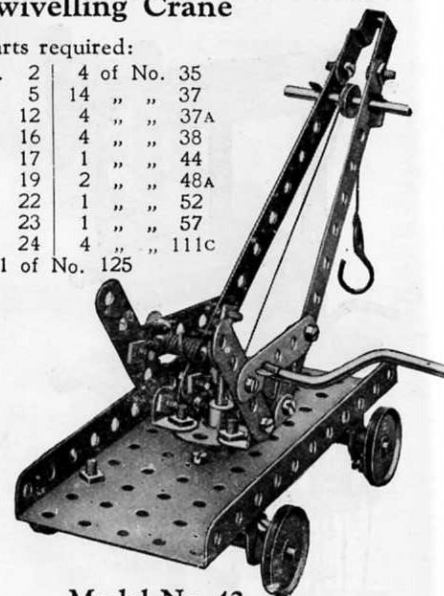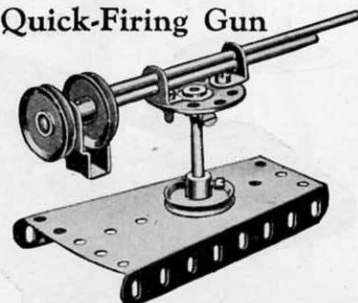Parts required:

2 of No.	2	4 of No.	35
4 " "	5	14 " "	37
4 " "	12	4 " "	37A
2 " "	16	4 " "	38
2 " "	17	1 " "	44
1 " "	19	2 " "	48A
4 " "	22	1 " "	52
1 " "	23	1 " "	57
1 " "	24	4 " "	111C
1 of No. 125			

**Model No. 42 Quick-Firing Gun**

Parts required:

2 of No.	12	1 of No.	24
2 " "	16	4 " "	37
1 " "	17	1 " "	44
2 " "	22	1 " "	54

**Model**

Pa	4 of No.
7 " "	2 " "
2 " "	1 " "
1 " "	4 " "
1 " "	2 " "
2 " "	1 " "
3 " "	1 " "

T  
model  
pulley

Parts required:	4 of No.
3 " "	1 " "
1 " "	2 " "
2 " "	4 " "
1 " "	1 " "
1 " "	2 " "
2 " "	1 " "
2 " "	1 " "
23 " "	1 " "
1 " "	2 " "
1 " "	1 " "
2 " "	1 " "

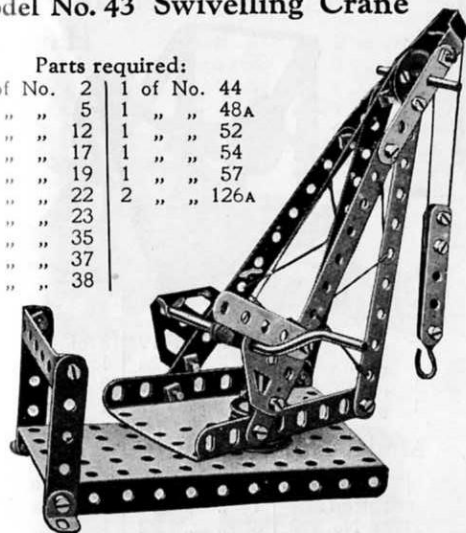
These Models can be made with MECCANO Outfit No. 0, or No. 00 and No. 00A.

11

### Model No. 43 Swivelling Crane


#### Parts required:

4 of No. 2	1 of No. 44
7 " " 5	1 " " 48A
2 " " 12	1 " " 52
2 " " 17	1 " " 54
1 " " 19	1 " " 57
4 " " 22	2 " " 126A
1 " " 23	
2 " " 35	
2 " " 37	
3 " " 38	



The sector plate of the Crane in this model is pivoted to the base with a fast pulley above and below.

### Model No. 44 Hand Loom

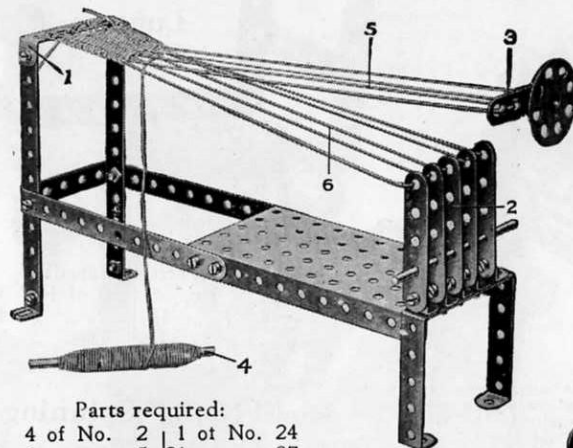

#### Parts required:

4 of No. 2	1 of No. 24
6 " " 5	21 " " 37
7 " " 12	4 " " 48A
2 " " 16	1 " " 52

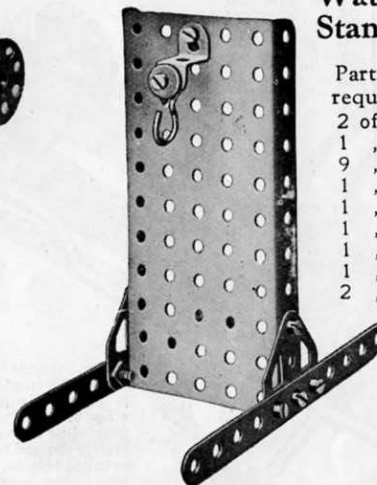
The warp threads are tied at one end to a double angle strip 1, whilst their other ends are secured alternately to the tops of the upright strips 2, and the 2 1/2" strip 3. The "shedding" movement of the warp is obtained by moving the strip 3 up or down each time the shuttle—a 3 1/2" rod 4—is passed between the two layers of warp 5 and 6. Wool or similar material is particularly suited to this apparatus. The strands 6 should be kept very taut, and the weft threads may be closed up with the woven portion by means of an ordinary comb each time the shuttle passes.

### Model No. 45

#### Watch Stand

#### Parts required:


2 of No. 2	23
1 " " 1	23
9 " " 9	37
1 " " 1	37A
1 " " 1	52
1 " " 1	57
1 " " 1	111c
1 " " 1	125
2 " " 2	126A



### Model No. 48 Gong

#### Parts required:

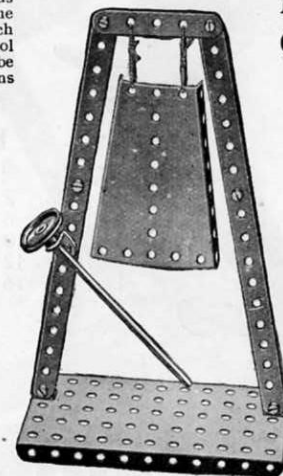4 of No. 2	2
1 " " 1	5
3 " " 3	12
1 " " 1	16
1 " " 1	22
9 " " 9	37
1 " " 1	52
1 " " 1	54




### Model No. 46

#### Sawing Machine

#### Parts required:

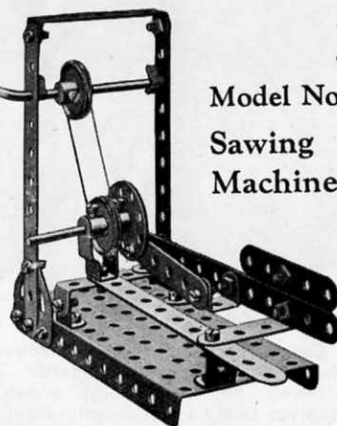
4 of No. 2	2
3 " " 3	5
1 " " 1	10
2 " " 2	11
4 " " 4	12
1 " " 1	17
1 " " 1	19
2 " " 2	22
1 " " 1	24
2 " " 2	35
2 " " 2	37
1 " " 1	44
2 " " 2	48A
1 " " 1	52
2 " " 2	126A



### Model No. 47 Telegraph Key

#### Parts required:

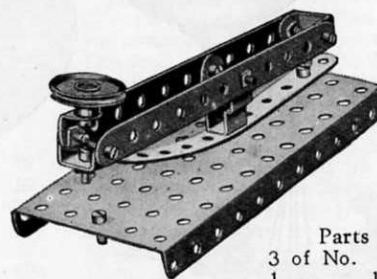3 of No. 2	1 of No. 22
1 " " 10	11 " " 37
2 " " 11	1 " " 44
1 " " 12	1 " " 52






These Models can be made with MECCANO Outfit No. 0, or No. 00 and No. 00A.

### Model No. 49 Racing Motor Car

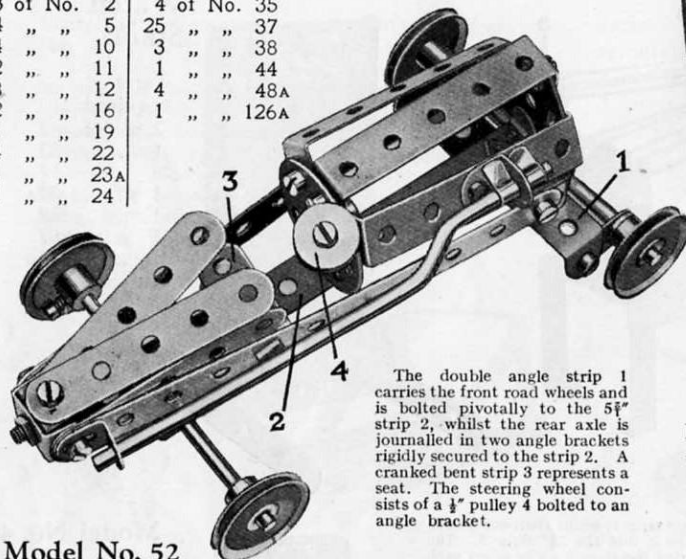Parts required:

3 of No. 2	4 of No. 35
4 " " 5	25 " " 37
4 " " 10	3 " " 38
2 " " 11	1 " " 44
8 " " 12	4 " " 48A
2 " " 16	1 " " 126A
1 " " 19	
4 " " 22	
1 " " 23A	
1 " " 24	




The double angle strip 1 carries the front road wheels and is bolted pivotally to the 5½" strip 2, whilst the rear axle is journaled in two angle brackets rigidly secured to the strip 2. A cranked bent strip 3 represents a seat. The steering wheel consists of a ½" pulley 4 bolted to an angle bracket.

### Model No. 52 Anchor

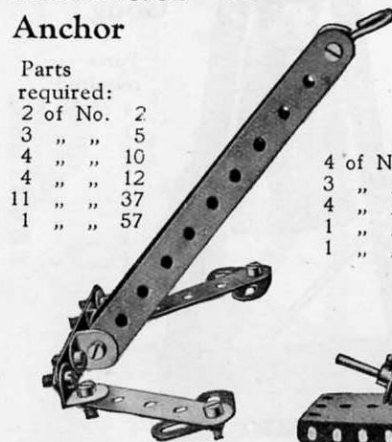Parts required:


2 of No. 2	
3 " " 5	
4 " " 10	
4 " " 12	
11 " " 37	
1 " " 57	




### Model No. 53 Battleship

Parts required:

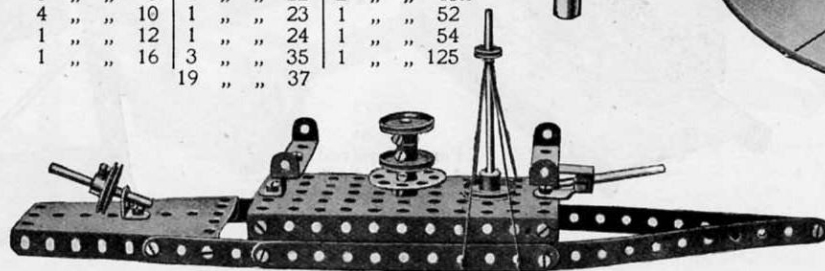4 of No. 2	2 of No. 17	1 of No. 44
3 " " 5	4 " " 22	2 " " 48A
4 " " 10	1 " " 23	1 " " 52
1 " " 12	1 " " 24	1 " " 54
1 " " 16	3 " " 35	1 " " 125
	19 " " 37	



### Model No. 50 Luggage Cart

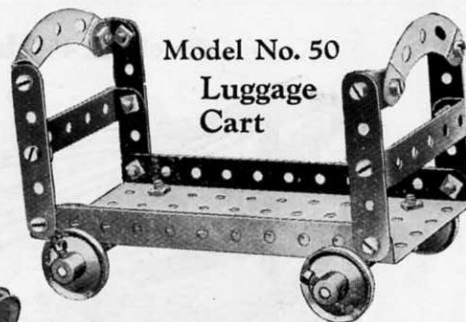


Parts required:

4 of No. 5	20 of No. 37
4 " " 12	2 " " 48A
2 " " 16	1 " " 52
4 " " 22	2 " " 90A


### Model No. 54 Spinning Top

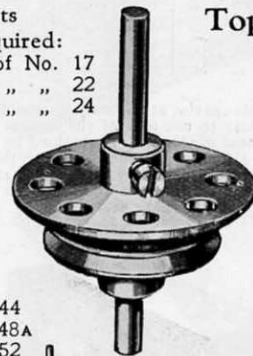Parts required:

1 of No. 17	
1 " " 22	
1 " " 24	



### Model No. 51 Mechanical Hammer

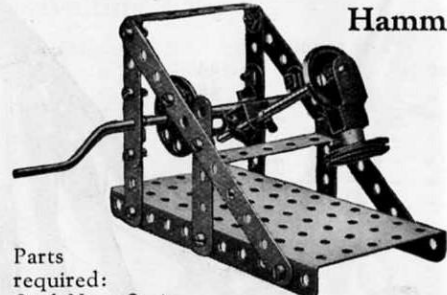


Parts required:

2 of No. 2	1 of No. 19	18 of No. 37
6 " " 5	2 " " 22	1 " " 44
1 " " 11	1 " " 24	3 " " 48A
1 " " 12	4 " " 35	1 " " 52
1 " " 16		

### Model No. 55 Roulette Wheel

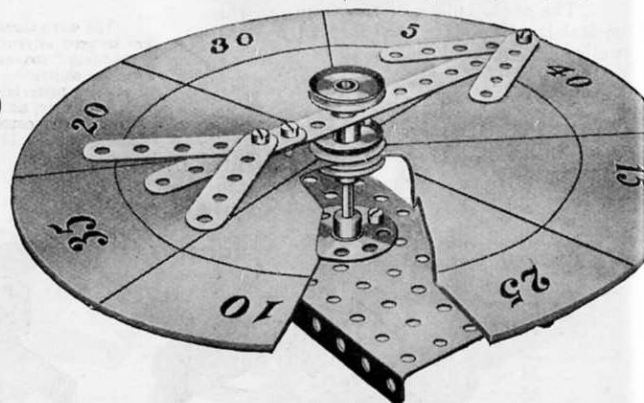
Parts required:

5 of No. 5	1 of No. 24
1 " " 16	5 " " 37
1 of No. 2	3 " " 22
	1 " " 52




Cut out a circular piece of cardboard, and mark as shown to form scoring board. This is clamped between two 1" pulley wheels. The pointer revolves freely on the upright spindle and is held in position by another 1" pulley wheel.

## Model No. 56 Invalid Chair

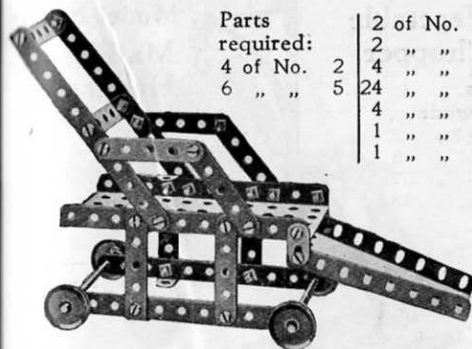


Parts required:		2 of No. 10	
4 of No. 2	2	2	16
6 " " 5	5	4	22
		24	37
		4	48A
		1	52
		1	54

## Model No. 57 Rotating Crane

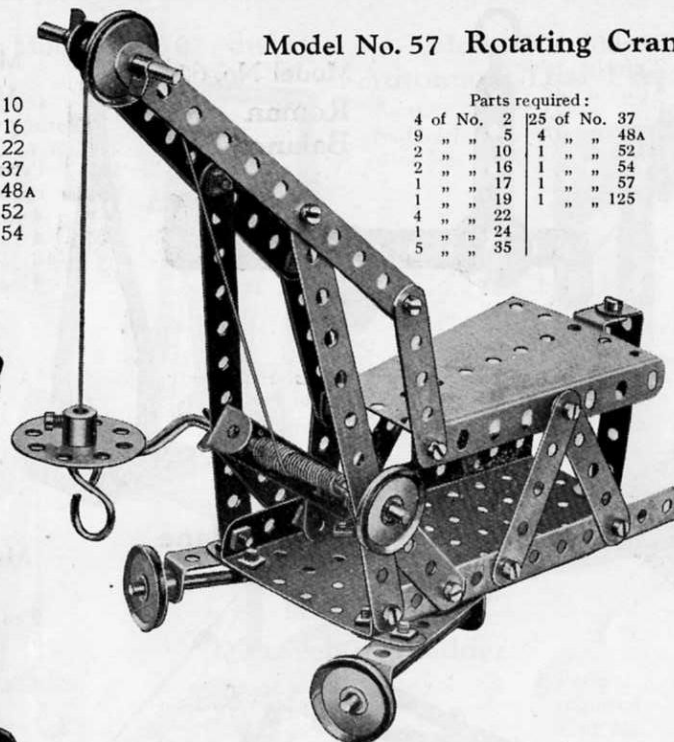


Parts required:		25 of No. 37	
4 of No. 2	5	4	48A
9 " " 10	1	"	52
2 " " 16	1	"	54
1 " " 17	1	"	57
4 " " 22	1	"	125
1 " " 24			
5 " " 35			

## Model No. 58 See-saw

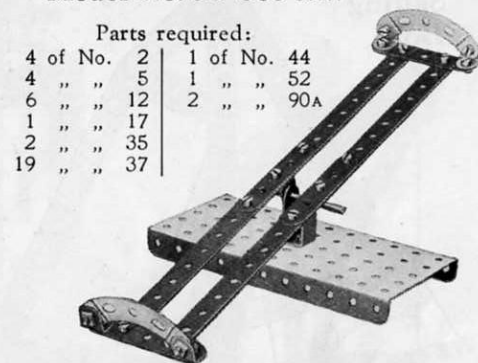

Parts required:		1 of No. 44	
4 of No. 2	5	1	52
4 " " 5	1	"	90A
6 " " 12	2	"	
1 " " 17			
2 " " 35			
19 " " 37			


## Model No. 59 Stamping Machine

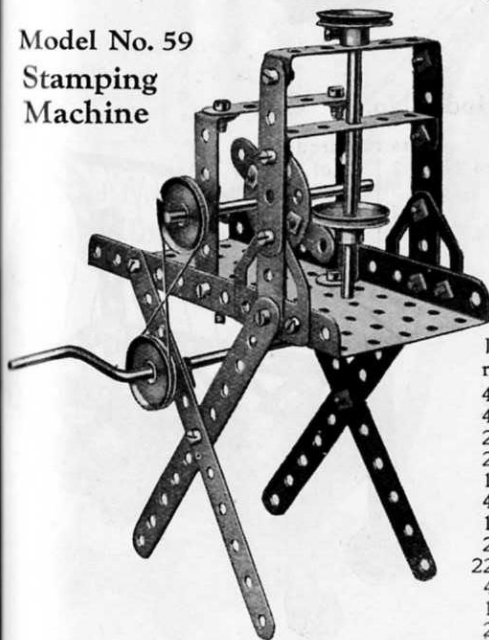

Parts required:		2 of No. 2	
4 of No. 2	5	4	10
4 " " 10	2	"	16
2 " " 16	1	"	19
1 " " 19	4	"	22
4 " " 22	1	"	24
1 " " 24	2	"	35
2 " " 35	22	"	37
22 " " 37	4	"	48A
4 " " 48A	1	"	52
1 " " 52	2	"	126A

The running wheels of this crane are journaled in double angle strips bolted to the base plate and secured at an angle by means of flat brackets. The rear of the base plate is supported on a double bracket. The jib is bolted loosely to the supporting  $5\frac{1}{2}$ " strips and is connected by  $2\frac{1}{2}$ " strips to the sector plate which pivots about its supporting bolts. By moving this sector plate the elevation of the jib may be altered as desired. The movement is controlled by a double angle strip mounted on the crank handle and connected pivotally to the plate by means of a  $2\frac{1}{2}$ " strip. A reversed angle bracket bolted to an upright double angle strip in the rear of the model serves to restrict the movement of the sector plate.

## Model No. 60 Punching Machine

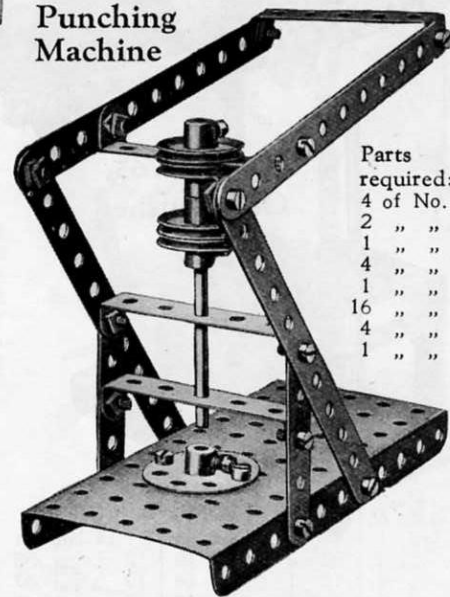


Parts required:		2 of No. 2	
4 of No. 2	5	2	10
2 " " 10	1	"	16
1 " " 16	4	"	22
4 " " 22	1	"	24
1 " " 24	16	"	37
16 " " 37	4	"	48A
4 " " 48A	1	"	52



These Models can be made with MECCANO Outfit No. 0, or No. 00 and No. 00A.

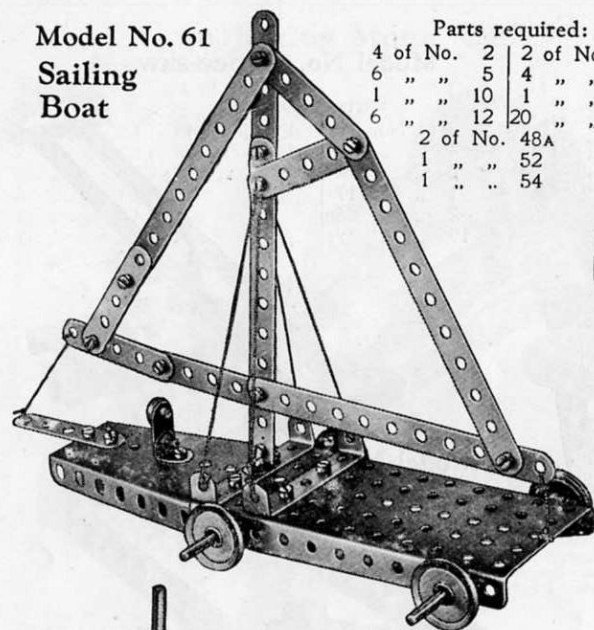
**Model No. 61**  
**Sailing Boat**



Parts required:

4 of No. 2	2 of No. 16
6 " " 5	4 " " 22
1 " " 10	1 " " 23
6 " " 12	20 " " 37
2 of No. 48A	
1 " " 52	
1 " " 54	

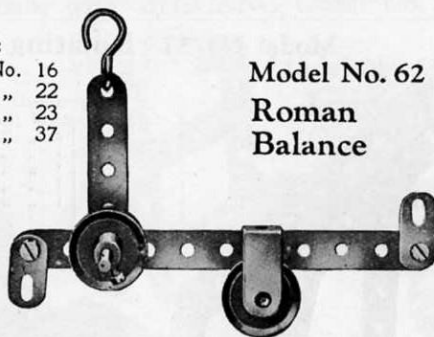**Model No. 62**  
**Roman Balance**




Parts required:

1 of No. 2	3 of No. 22
2 " " 5	2 " " 37
2 " " 10	1 " " 44
1 " " 17	1 " " 57
1 of No. 111c	

**Model No. 63**  
**Vegetable Chopper**

Parts required:

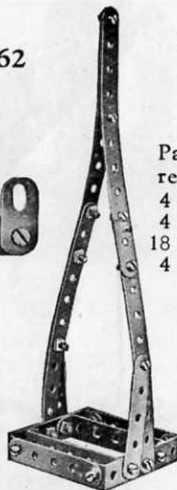
4 of No. 2
4 " " 5
18 " " 37
4 " " 48A




**Model No. 64**  
**Mail-Bag Hanger**

Parts required:

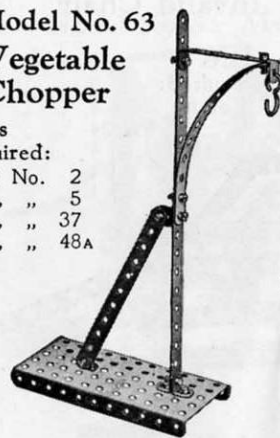4 of No. 2
4 " " 12
10 " " 37
1 " " 48A
1 " " 52
1 " " 57




**Model No. 65**  
**Ore Crusher**

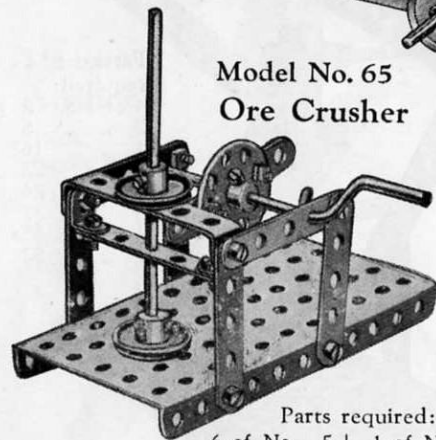

Parts required:

6 of No. 5	1 of No. 24
2 " " 10	2 " " 35
1 " " 16	12 " " 37
1 " " 19	2 " " 48A
2 " " 22	1 " " 52

**Model No. 66 Aeroplane**

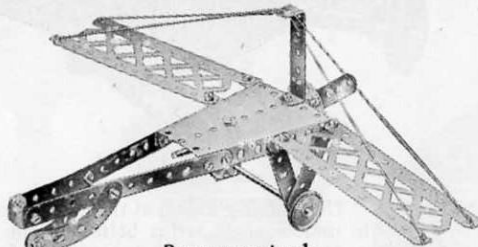


Parts required:

2 of No. 2	2 of No. 16	1 of No. 48A
5 " " 5	2 " " 22	1 " " 54
1 " " 11	1 " " 24	2 " " 90A
6 " " 12	21 " " 37	2 " " 100

**Model No. 67 Cot**

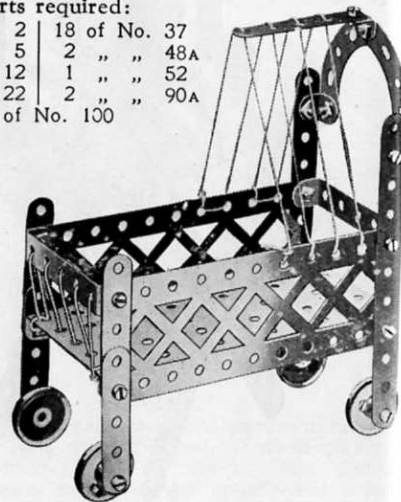Parts required:

2 of No. 2	18 of No. 37
5 " " 5	2 " " 48A
3 " " 12	1 " " 52
4 " " 22	2 " " 90A
2 of No. 100	



### HOW TO CONTINUE

This completes our examples of Models that may be made with MECCANO Outfit No. 0. The next Models are a little more advanced, requiring a number of extra parts to construct them. The necessary parts are all contained in a No. 0A Accessory Outfit, the price of which will be found in the list at the end of the Manual.


These Models can be made with MECCANO Outfit No. 1, or No. 0 and No. 0A.

15

No. 6  
Bag  
er


2  
12  
37  
48A  
52  
57

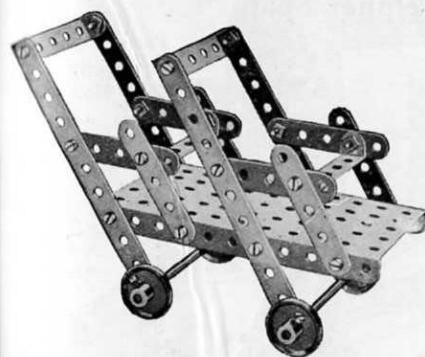Model No. 101  
Tandem Car



Parts required:  
4 of No. 2 20 of No. 37  
8 " " 5 4 " " 48A  
2 " " 16 1 " " 52  
4 " " 22

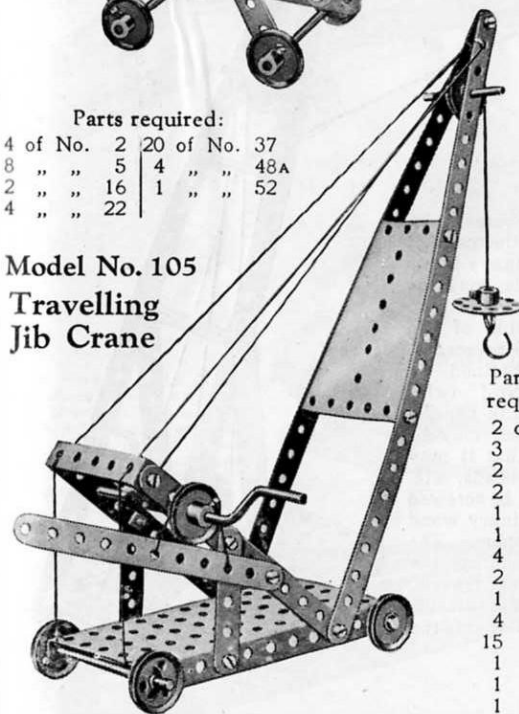Model No. 105  
Travelling  
Jib Crane



Parts required:  
2 of No. 1  
3 " " 2  
2 " " 5  
2 " " 16  
1 " " 17  
1 " " 19  
4 " " 22  
2 " " 22A  
1 " " 24  
4 " " 35  
15 " " 37  
1 " " 48A  
1 " " 52  
1 " " 54  
1 " " 57

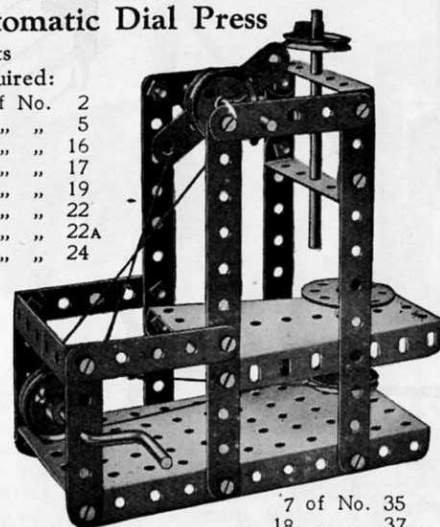
Model No. 102 Swing

Parts required:  
4 of No. 1  
1 " " 2  
6 " " 5  
4 " " 12  
12 " " 37  
3 " " 48A  
1 " " 52




Model No. 103  
Automatic Dial Press

Parts required:  
4 of No. 2  
7 " " 5  
2 " " 16  
1 " " 17  
1 " " 19  
4 " " 22  
2 " " 22A  
1 " " 24




7 of No. 35  
18 " " 37  
3 " " 48A  
1 " " 52  
1 " " 54

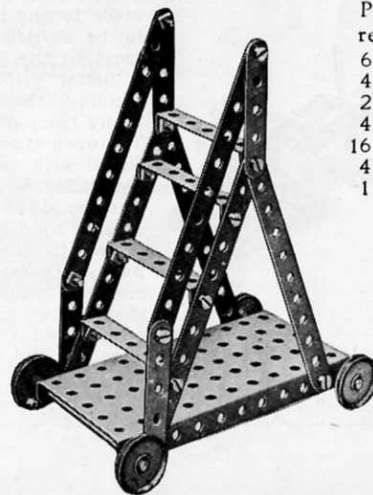Model No. 106  
Travelling Ladder



Parts required:  
6 of No. 2  
4 " " 5  
2 " " 16  
4 " " 22  
16 " " 37  
4 " " 48A  
1 " " 52

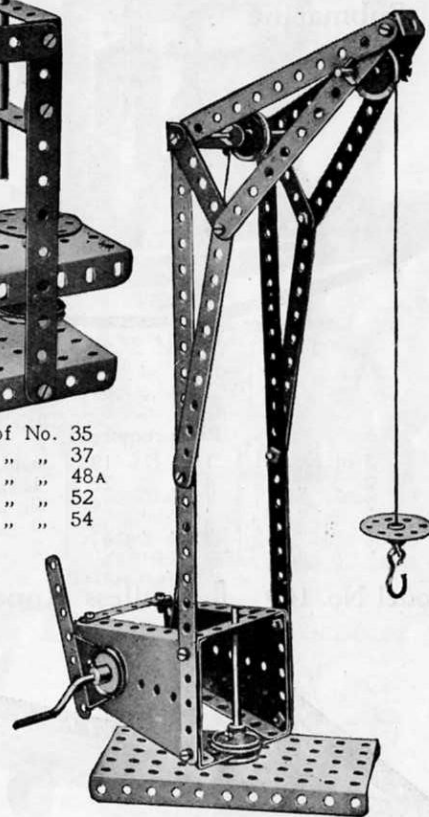Model No. 104  
Swivelling Crane




Parts required:

2 of No. 1	1 of No. 11	2 of No. 22A	3 of No. 48A
6 " " 2	1 " " 16	1 " " 24	1 " " 52
1 " " 3	2 " " 17	4 " " 35	2 " " 54
4 " " 5	1 " " 19	18 " " 37	1 " " 57
	4 " " 22	1 " " 44	



These Models can be made with MECCANO Outfit No. 1, or No. 0 and No. 0A.

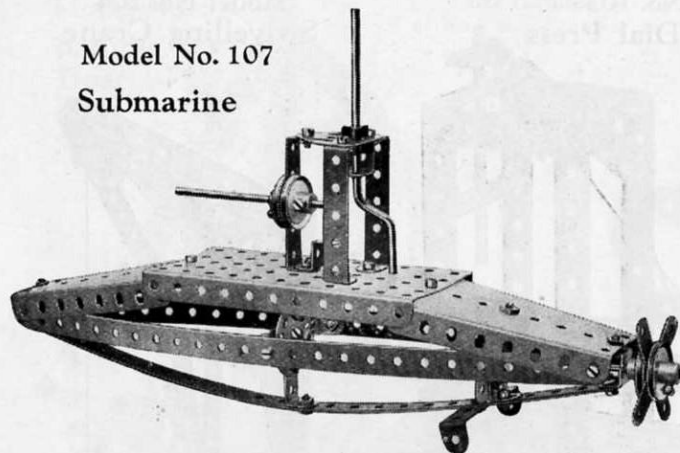
Model No. 107  
Submarine



Parts required:

3 of No. 1	1 of No. 19	6 of No. 48A
2 " " 5	4 " " 22	1 " " 52
2 " " 11	1 " " 24	2 " " 54
2 " " 12	3 " " 35	2 " " 125
2 " " 16	25 " " 37	2 " " 126A

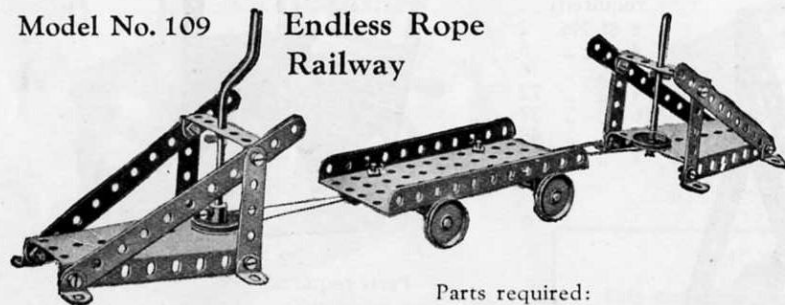
Model No. 109  
Endless Rope  
Railway



Parts required:

4 of No. 2	1 of No. 19	16 of No. 37
4 " " 5	4 " " 22	4 " " 48A
8 " " 12	2 " " 22A	1 " " 52
3 " " 16	4 " " 35	2 " " 54

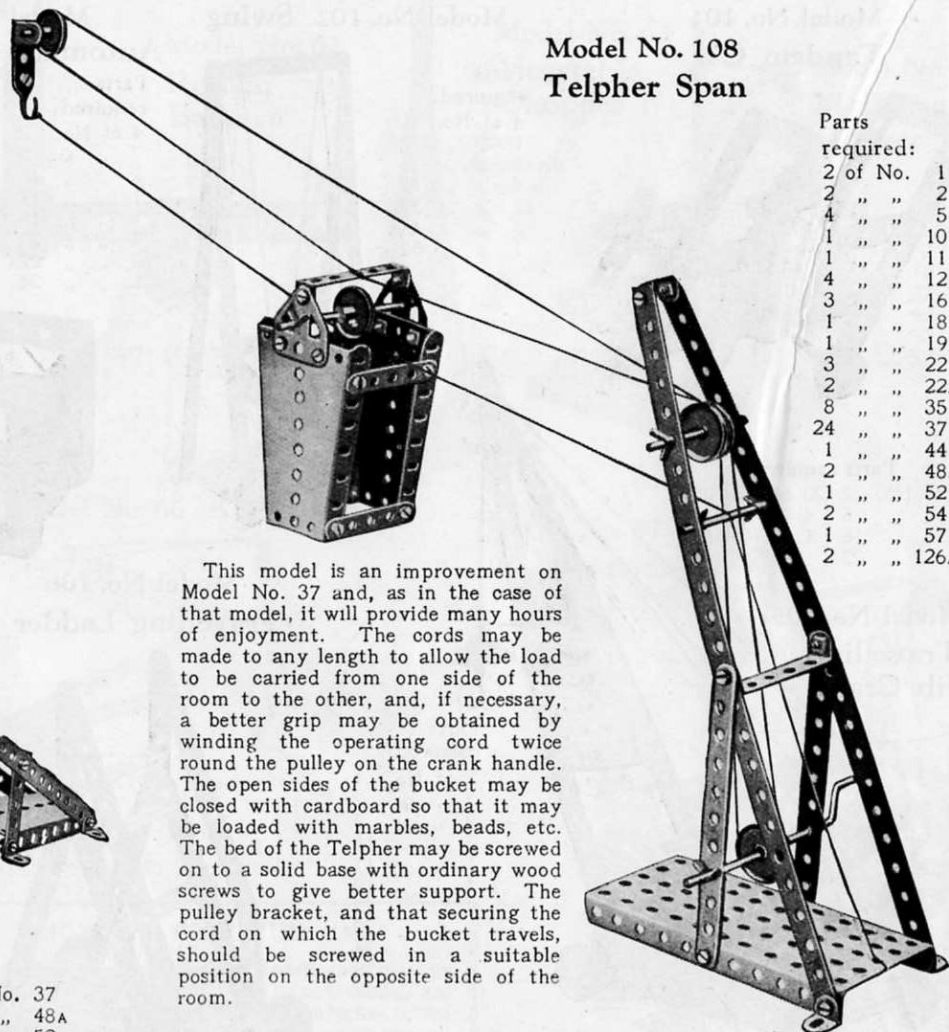Model No. 108  
Telfer Span



Parts required:

2 of No. 1	1
2 " " 2	2
4 " " 5	5
1 " " 10	10
1 " " 11	11
4 " " 12	12
3 " " 16	16
1 " " 18	18
1 " " 19	19
3 " " 22	22
2 " " 22A	22A
8 " " 35	35
24 " " 37	37
1 " " 44	44
2 " " 48A	48A
1 " " 52	52
2 " " 54	54
1 " " 57	57
2 " " 126A	126A


This model is an improvement on Model No. 37 and, as in the case of that model, it will provide many hours of enjoyment. The cords may be made to any length to allow the load to be carried from one side of the room to the other, and, if necessary, a better grip may be obtained by winding the operating cord twice round the pulley on the crank handle. The open sides of the bucket may be closed with cardboard so that it may be loaded with marbles, beads, etc. The bed of the Telfer may be screwed on to a solid base with ordinary wood screws to give better support. The pulley bracket, and that securing the cord on which the bucket travels, should be screwed in a suitable position on the opposite side of the room.

The ver  
Roundab  
in the base  
1" fast pu  
side of  
should be  
pulleys in  
dom of mo

These Models can be made with MECCANO Outfit No. 1, or No. 0 and No. 0A.

17


### Model No. 110 Snow Plough

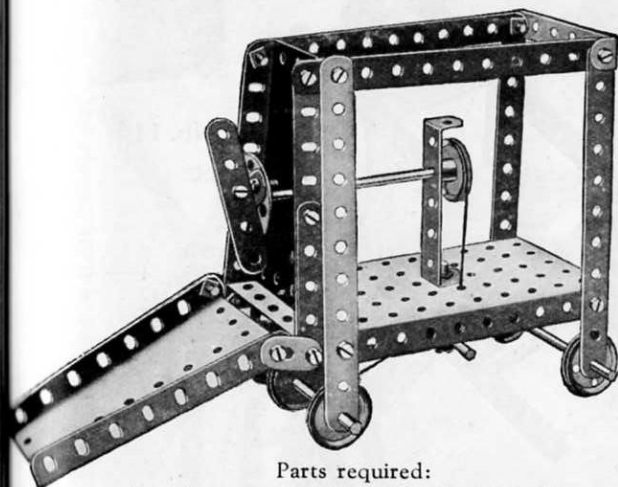

Parts required:


6 of No. 2	1 of No. 17	19 of No. 37
3 " " 5	4 " " 22	1 " " 44
2 " " 10	2 " " 22A	2 " " 48A
1 " " 12	1 " " 24	1 " " 52
3 " " 16	4 " " 35	2 " " 54

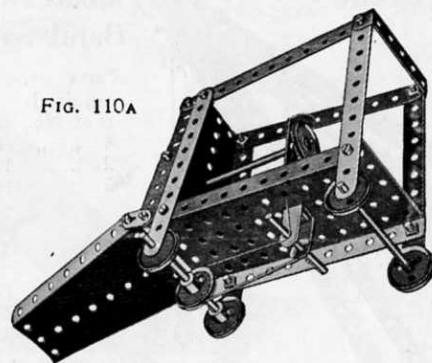Fig. 110A



The construction of the framework of this model presents no difficulty. The sector plate forming the plough is loosely pivoted to the model. The plough shaft is mounted in the front sector plate and the  $2\frac{1}{2}$ " double angle strip. A  $2\frac{1}{2}$ " strip is bolted by angle brackets to a bush wheel on the front of the shaft and forms a dispersing propeller for the snow after it has risen up the inclined sector plate. A continuous cord is passed round a 1" pulley on the propeller shaft and round the short axle shown beneath the model (Fig. 110A) and a 1" pulley on the leading axle. In this way, as the plough is moved along the ground, the propeller is rotated.

### Model No. 111 Dinner Wagon

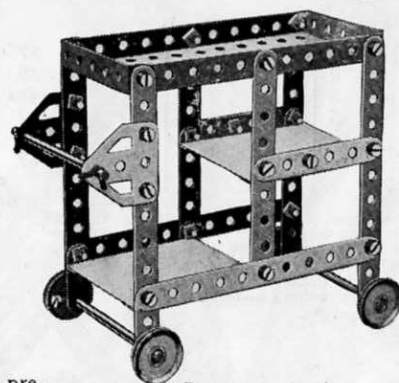


Parts required:

6 of No. 2	2 of No. 35
8 " " 5	22 " " 37
4 " " 12	4 " " 48A
3 " " 16	1 " " 52
4 " " 22	2 " " 126A

The two lower platforms are constructed out of pieces of ordinary cardboard, their outer edges resting on  $2\frac{1}{2}$ " bent strips and their inner edges on angle brackets.

### Model No. 112 Roundabout

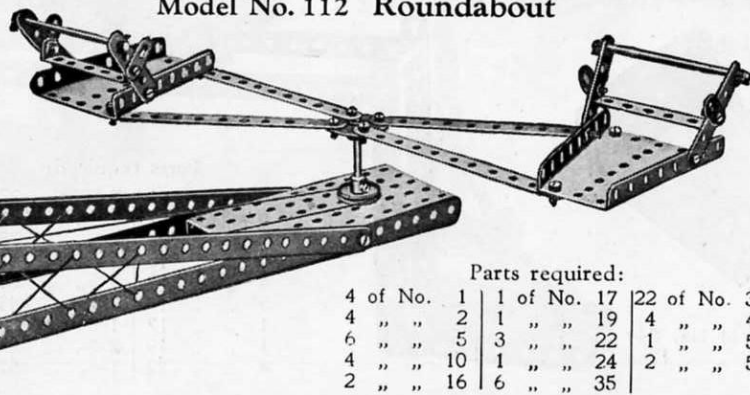The vertical spindle of the Roundabout is secured in place in the base plate by means of a 1" fast pulley bolted on either side of the plate. Washers should be placed beneath these pulleys in order to obtain freedom of movement.




Parts required:

4 of No. 1	1 of No. 17	22 of No. 37
4 " " 2	1 " " 19	4 " " 48A
6 " " 5	3 " " 22	1 " " 52
4 " " 10	1 " " 24	2 " " 54
2 " " 16	6 " " 35	

### Model No. 113 Scooter

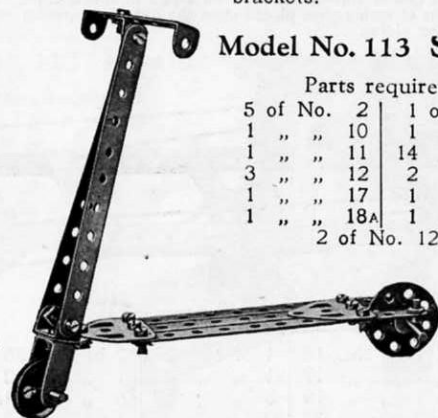Parts required:

5 of No. 2	1 of No. 22
1 " " 10	1 " " 24
1 " " 11	14 " " 37
3 " " 12	2 " " 38
1 " " 17	1 " " 44
1 " " 18A	1 " " 48A
2 of No. 126A	







**Model No. 114 Swivelling Jib Crane****Parts required:**

6 of No.	1	4 of No.	12	20 of No.	37
4 "	2	2 "	17	3 "	38
1 "	3	1 "	19	1 "	48A
2 "	5	3 "	22	1 "	52
1 "	10	1 "	22A	2 "	54
1 "	11	1 "	23	1 "	57
		3 "	35		

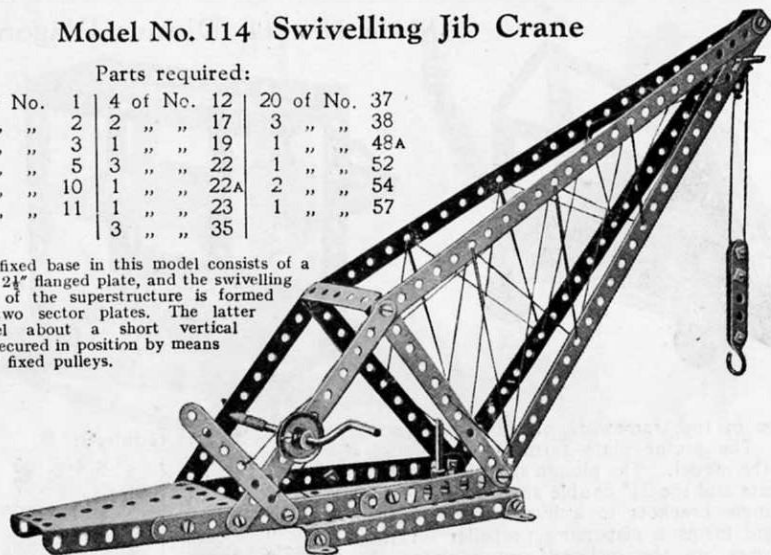The fixed base in this model consists of a  $5\frac{1}{2} \times 2\frac{1}{2}$ " flanged plate, and the swivelling base of the superstructure is formed by two sector plates. The latter swivel about a short vertical rod secured in position by means of 1" fixed pulleys.

**Model No. 117 Giant Foundry Ladle**

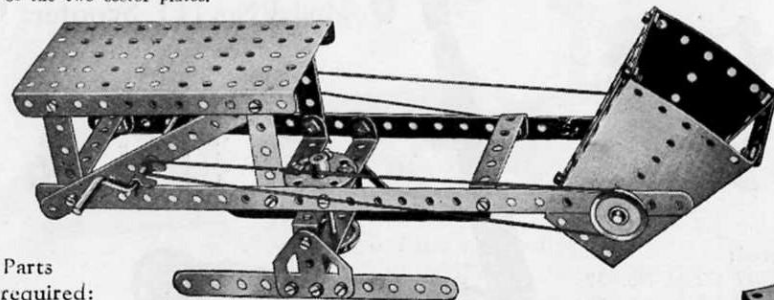This represents a device used in handling molten metal in foundry operations. The metal is poured from the converter into the bucket-like container which consists in our model of two sector plates bolted together at the top by  $2\frac{1}{2}$ " strips and at the bottom by flat brackets. The container swings about a central pivot so that it may be brought into position over the moulds that receive the metal. The bucket may be tipped on rotation of the crank handle on each end of which cords are wound two or three times between a pair of spring clips. The bucket is secured to its axle by means of spring clips placed upon the axle and pressing against either side of each of the two sector plates.


**Parts required:**

2 of No.	1	1 of No.	16	1 of No.	22A	2 of No.	38	2 of No.	54
4 "	2	1 "	17	1 "	24	1 "	40	2 "	126A
6 "	5	1 "	19	8 "	35	6 "	48A		
2 "	10	3 "	22	30 "	37	1 "	52		



**Model No. 115 Band Saw****Parts required:**

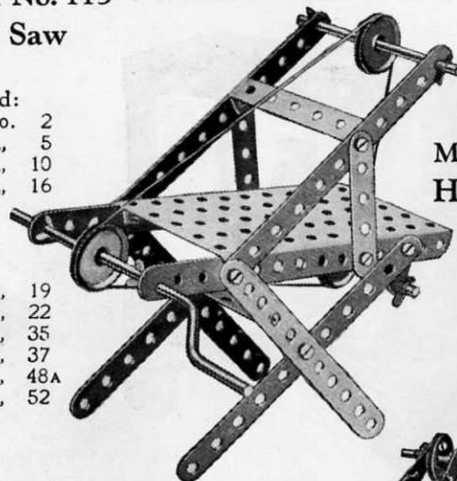6 of No.	2
4 "	5
2 "	10
2 "	16

1 "	19
3 "	22
6 "	35
10 "	37
2 "	48A
1 "	52

**Model No. 116 Hatchet****Parts required:**


3 of No.	1
6 "	12
15 "	37
2 "	54

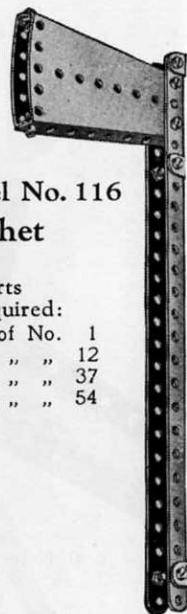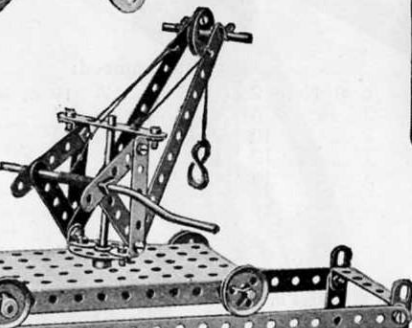**Model No. 118 Overhead Crane****Parts required:**

2 of No.	1	2 of No.	22A
6 "	2	1 "	24
9 "	5	6 "	35
4 "	10	20 "	37
4 "	12	4 "	38
3 "	16	2 "	48A
1 "	17	1 "	52
1 "	19	2 "	54
4 "	22	1 "	57

These Models can be made with MECCANO Outfit No. 1, or No. 0 and No. 0A.

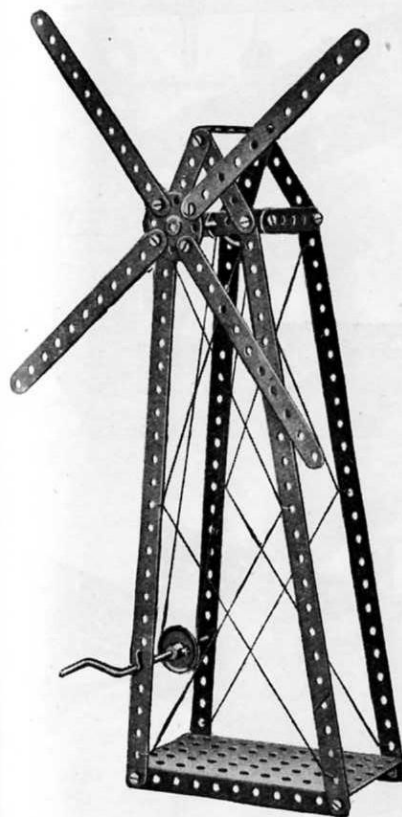
Model No. 119 Windmill



Parts required:

4 of No. 1	2 of No. 22
4 " " 2	1 " " 24
7 " " 5	4 " " 35
2 " " 12	20 " " 37
1 " " 16	3 " " 48A
1 " " 19	1 " " 52

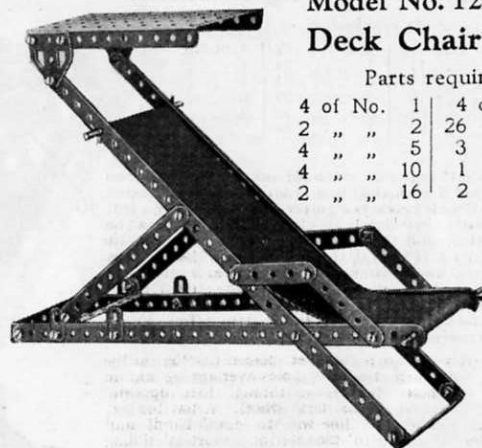Model No. 120  
Deck Chair



Parts required:

4 of No. 1	4 of No. 35
2 " " 2	26 " " 37
4 " " 5	3 " " 48A
4 " " 10	1 " " 52
2 " " 16	2 " " 126A


Model No. 122  
Bed Table

Parts required:

3 of No. 2	2
1 " " 3	3
1 " " 5	5
1 " " 11	11
5 " " 12	12
2 " " 16	16
1 " " 17	17
4 " " 22	22
1 " " 24	24
21 " " 37	37
4 " " 48A	48A
1 " " 52	52
1 " " 126A	126A



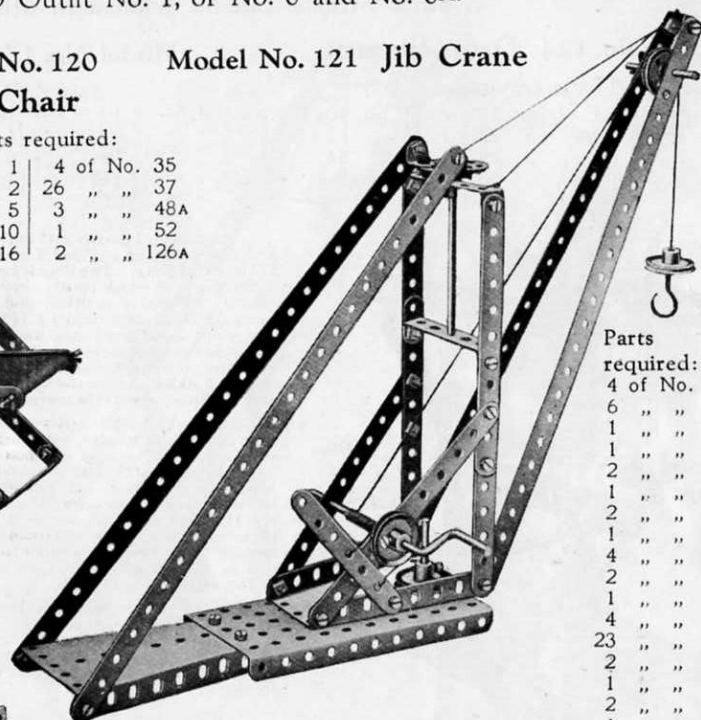Model No. 121 Jib Crane




Parts required:

4 of No. 1	1
6 " " 2	2
1 " " 3	3
1 " " 11	11
2 " " 12	12
1 " " 16	16
2 " " 17	17
1 " " 19	19
4 " " 22	22
2 " " 22A	22A
1 " " 24	24
4 " " 35	35
23 " " 37	37
2 " " 48A	48A
1 " " 52	52
2 " " 54	54
1 " " 57	57

Model No. 123 Invalid Chair

Parts required:



4 of No. 2	13 of No. 37
2 " " 5	1 " " 44
2 " " 16	2 " " 48A
1 " " 18	1 " " 52
2 " " 22	
1 " " 22A	
1 " " 24	
4 " " 35	

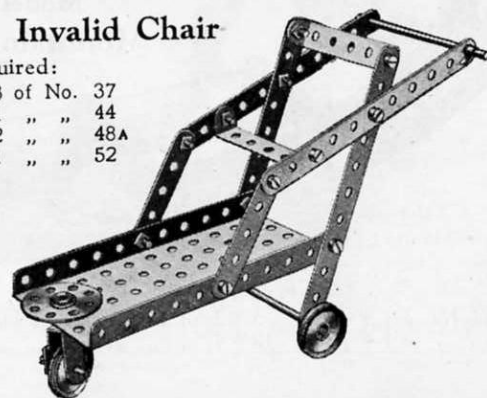

# Model No. 124 Drop Stamp

Parts required:

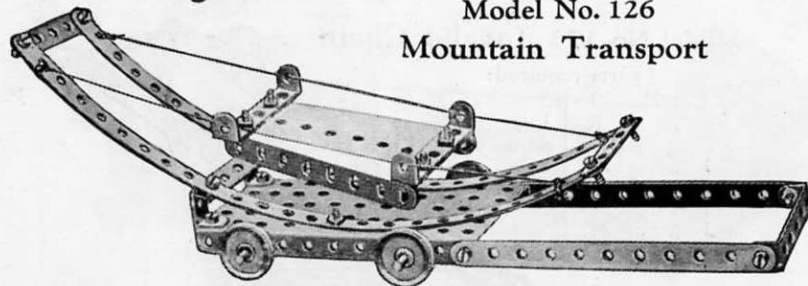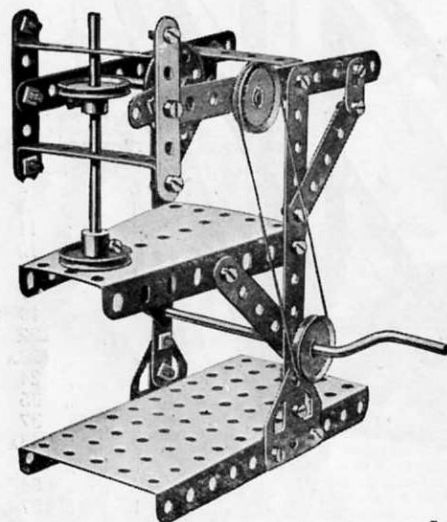4 of No. 2	1 of No. 19	3 of No. 48A
6 " " 5	4 " " 22	1 " " 52
3 " " 10	1 " " 24	1 " " 54
2 " " 16	2 " " 35	2 " " 126A
	27 " " 37	



Parts required:

2 of No. 1	3 of No. 5	2 of No. 16	18 of No. 37	1 of No. 52
2 " " 2	4 " " 12	4 " " 22	2 " " 48A	1 " " 54

# Model No. 125 Sewing Machine

Parts required:

3 of No. 2	1 of No. 16A	2 of No. 22A	4 of No. 48A
6 " " 5	3 " " 17	1 " " 24	1 " " 52
3 " " 10	1 " " 18A	3 " " 35	1 " " 54
2 " " 11	1 " " 19	2 " " 37	2 " " 125
3 " " 12	2 " " 21	3 " " 38	2 " " 126A
1 " " 16	3 " " 22	1 " " 44	

The handle 1 carries a 1" pulley 2, which drives by means of a cord a similar pulley on a 2" rod 3 journaled in a cranked bent strip bolted to the sector plate. Two double brackets 4 are secured together by a bolt 5, the shank of which presses very tightly on the rod 3. This locks the double brackets in position, and they revolve with the rod 3. The outer double bracket carries a 1 1/4" rod 6, the end of which lies between two strips 7, arranged at a short distance apart from each other and bolted to two flat brackets. These are secured to a further strip 8 bolted pivotally to a transverse double angle strip. As the shaft 3 rotates, the rod 6 slides between the strips 7 and so rocks the strip 8 from side to side. This represents the movement of the shuttle.

The bush wheel 9 carries two angle brackets placed together in the form of a double bracket, with their elongated holes overlapping, and in such a position that an imaginary line drawn through their opposite round holes, would cross the centre of the bush wheel. A flat bracket is bolted to the inner angle bracket in a line with the crank handle and forms a lever which engages a 1" pulley 10 mounted on a vertical sliding rod 11. This rod is journaled in a double angle strip bolted between the lower holes of the two flat trunnions and is further supported by two 1/4" reversed angle brackets secured to the angle strip. As the bush wheel rotates, the flat bracket imparts to the rod 11 a movement corresponding to the action of the needle.

The outer angle bracket on the bush wheel strikes once in every revolution the end of a double angle strip 12. This is pivotally mounted by a bolt passed through its second hole from the bush wheel end to the centre hole of the flat trunnion on that side of the model. The resulting movement of the strip 12 represents the apparatus by which the cotton is paid out from the reel to the needle.

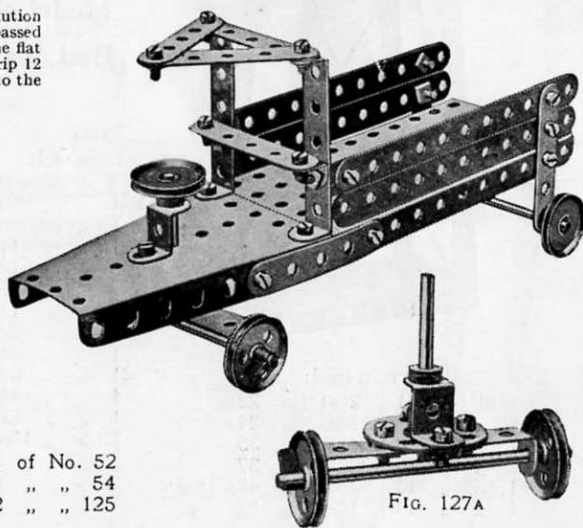
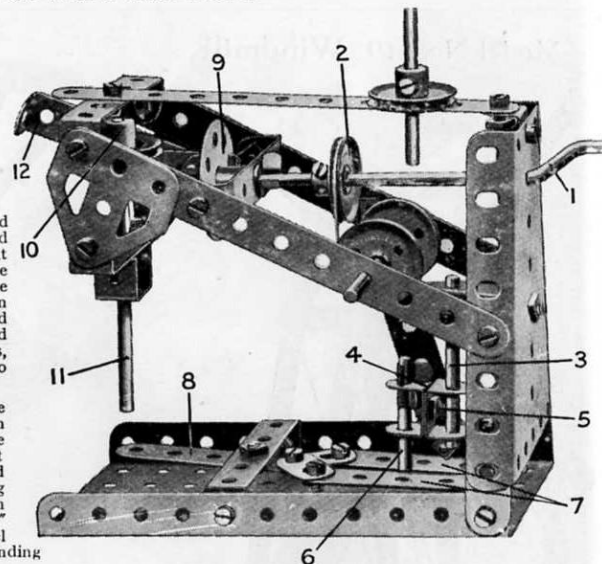


FIG. 127A

# Model No. 127 Motor Lorry

Parts required:

4 of No. 2	
8 " " 5	
4 " " 12	
2 " " 16	
1 " " 17	
3 " " 22	
2 " " 22A	
1 " " 24	
2 " " 35	
25 " " 37	1 of No. 52
3 " " 38	1 " " 54
3 " " 48A	2 " " 125

Model  
Jib

Parts  
require  
2 of N

5 "  
7 "  
1 "  
3 "  
1 "  
1 "  
1 "  
4 "  
2 "  
1 "  
1 "  
6 "  
22 "  
2 "  
1 "  
3 "  
1 "  
1 "  
2 "  
2 "

Model  
Tip V

Parts  
require  
1 of No  
4 "  
5 "  
3 "  
4 "  
2 "  
14 "  
2 "  
1 "  
2 "



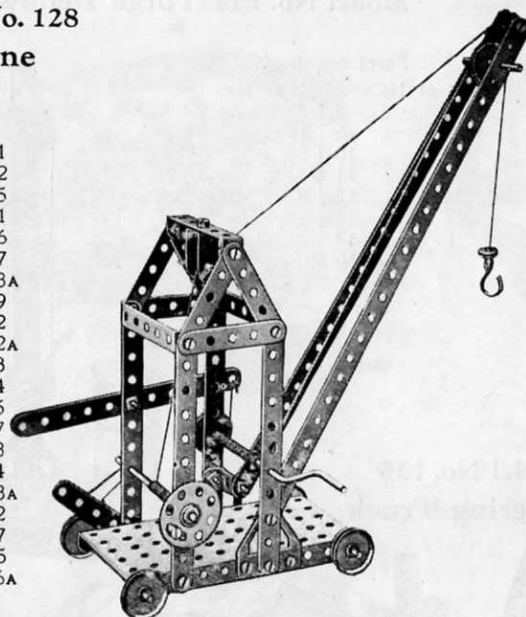
These Models can be made with MECCANO Outfit No. 1, or No. 0 and No. 0A.

### Model No. 128 Jib Crane

#### Parts

#### required:

2	of No.	1
5	" "	2
7	" "	5
1	" "	11
3	" "	16
1	" "	17
1	" "	18A
1	" "	19
4	" "	22
2	" "	22A
1	" "	23
1	" "	24
6	" "	35
22	" "	37
2	" "	38
1	" "	44
3	" "	48A
1	" "	52
1	" "	57
2	" "	125
2	" "	126A




### Model No. 129 Double Action Crane


A feature of this crane is that, by the arrangement of the cords on the crank handle, one load may be raised whilst the other is being lowered.

#### Parts required:

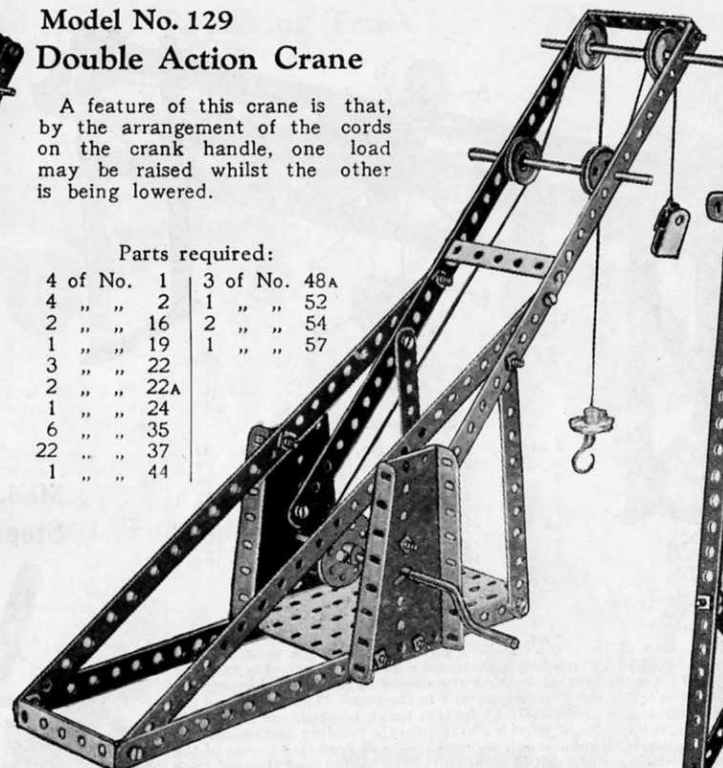4	of No.	1	3	of No.	48A
4	" "	2	1	" "	52
2	" "	16	2	" "	54
1	" "	19	1	" "	57
3	" "	22			
2	" "	22A			
1	" "	24			
6	" "	35			
22	" "	37			
1	" "	44			



### Model No. 130 Fire Alarm

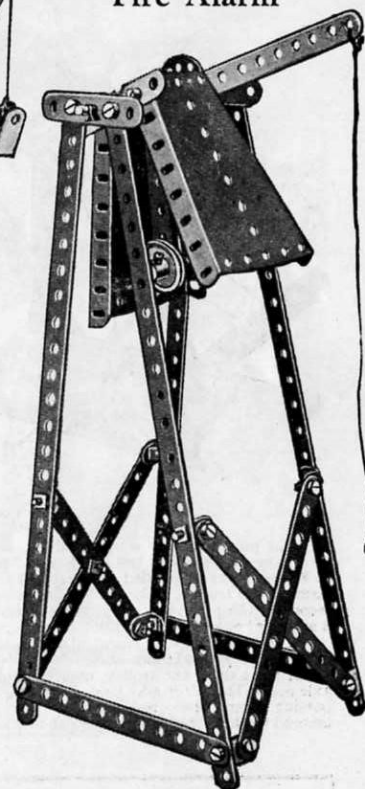


### Model No. 131 Tip Wagon

#### Parts

#### required:

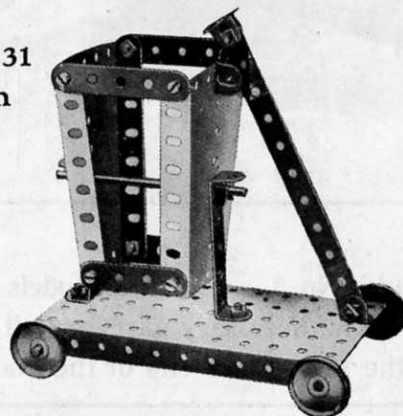1	of No.	2
4	" "	5
5	" "	12
3	" "	16
4	" "	22
2	" "	35
14	" "	37
2	" "	48A
1	" "	52
2	" "	54




### Model No. 132 Rowing Boat

#### Parts

#### required:

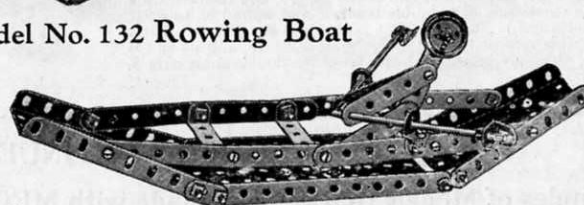4	of No.	2	2	of No.	16	4	of No.	35	3	of No.	48A
5	" "	5	1	" "	18A	24	" "	37	1	" "	52
4	" "	10	2	" "	22A	4	" "	38	2	" "	54
7	" "	12									




#### Parts required:

4	of No.	1	1	of No.	22
7	" "	2	1	" "	24
1	" "	3	4	" "	35
3	" "	5	27	" "	37
8	" "	12	2	" "	54
1	" "	16			

These Models can be made with MECCANO Outfit No. 1, or No. 0 and No. 0A.
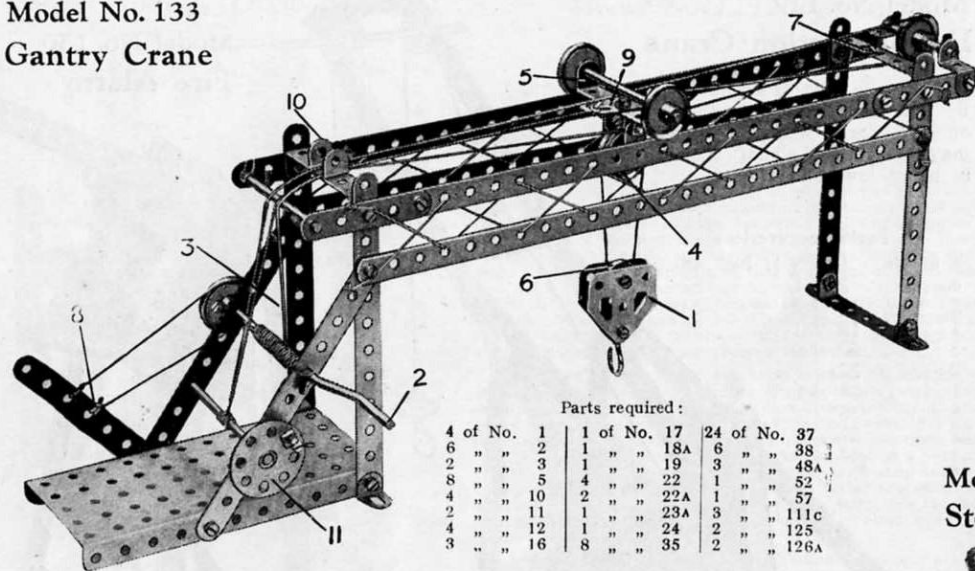
### Model No. 133 Gantry Crane



Parts required:

4 of No. 1	1 of No. 17	24 of No. 37
6 " " 2	1 " " 18A	6 " " 38
2 " " 3	1 " " 19	3 " " 48A
8 " " 5	4 " " 22	1 " " 52
4 " " 10	2 " " 22A	1 " " 57
2 " " 11	1 " " 23A	3 " " 111c
4 " " 12	1 " " 24	2 " " 125
3 " " 16	8 " " 35	2 " " 126A


The pulley-block 1 is operated by means of the crank handle 2, on which a cord 3 is wound. This cord passes over one of the two loose 1" pulleys 4 carried on a short rod which is journalled in the ends of flat brackets suspended by means of a double bracket beneath the double angle strip 5 forming the frame of the trolley. The cord then passes round the 1" pulley wheel 6 in the pulley block and round the second of the pulleys 4, and is finally fixed to the model at 7. A friction brake, consisting of a 3 1/4" strip 8 and cord engaging a 1" pulley on the crank handle, is provided to control the hoisting movement.

The traversing movement of the trolley is effected as follows:—A length of cord tied to one of the two flat brackets 9 is passed round the 1" pulley wheel at the outer end of the gantry, and then led back under the axle of the trolley, over the guide 10 (consisting of a double bracket) and wound on to a 3 1/4" axle rod. The latter may be operated by a hand wheel 11, formed from a bush wheel and 1/2" bolt. After passing several times round the 3 1/4" rod the cord is returned over the double bracket 10, and its end is secured to the second of the two flat brackets 9, which are bolted to the centre of the double angle strip 5.


### Model No. 134 Forge Bellows

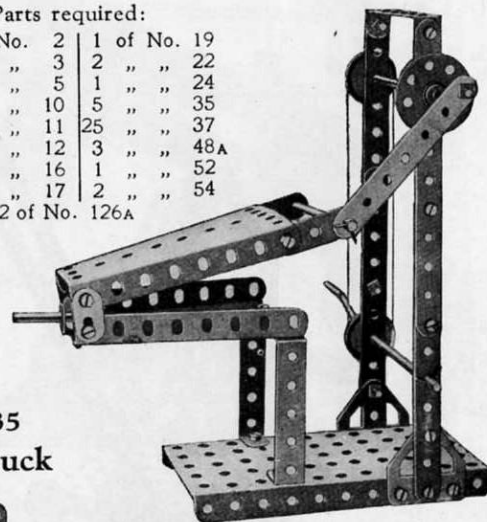Parts required:

4 of No. 2	1 of No. 19
1 " " 3	2 " " 22
2 " " 5	1 " " 24
2 " " 10	5 " " 35
1 " " 11	25 " " 37
2 " " 12	3 " " 48A
2 " " 16	1 " " 52
1 " " 17	2 " " 54
2 of No. 126A	



### Model No. 135 Steering Truck

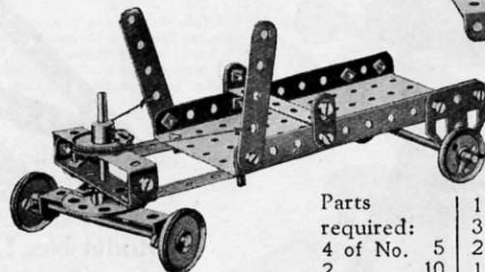

Parts required:	1 of No. 17	18 of No. 37
3 " " 3	2 " " 22	2 " " 38
4 of No. 5	2 " " 22A	4 " " 48A
2 " " 10	1 " " 24	1 " " 52
2 " " 16	2 " " 35	2 " " 126A


## HOW TO CONTINUE

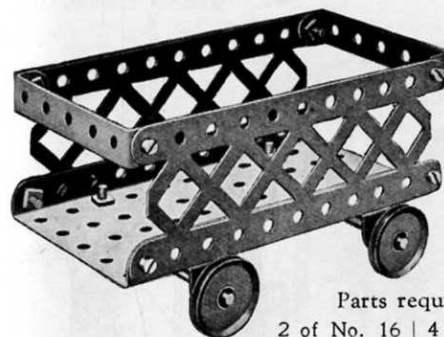This completes our examples of Models that may be made with MECCANO Outfit No. 1. The next Models are a little more advanced, requiring a number of extra parts to construct them. The necessary parts are all contained in a No. 1A Accessory Outfit, the price of which will be found in the List at the end of the Manual.

These Models can be made with MECCANO Outfit No. 2, or No. 1 and No. 1A.

23


Model No. 201 Truck



Parts required:

2 of No. 16	4 of No. 48A
4 " " 22	1 " " 52
12 " " 37	2 " " 100

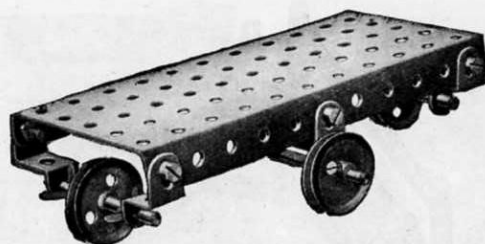
Model No. 202 Revolving Truck



Parts required:

2 of No. 10	2 of No. 22	6 of No. 37
1 " " 16	2 " " 22A	1 " " 52
2 " " 17	4 " " 35	4 " " 125

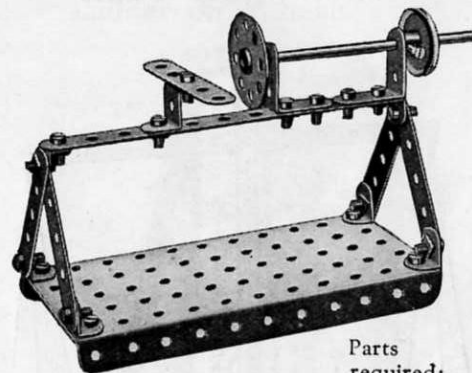
Model No. 203 Lathe



Parts required:

1 of No. 2
5 " " 5
6 " " 12
2 " " 12A
1 " " 16
1 " " 22
1 " " 24
17 " " 37
1 " " 52
1 " " 125

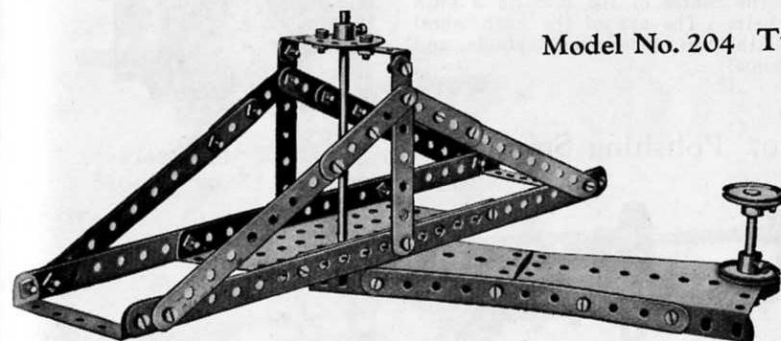
Model No. 204 Turntable Gangway



Parts required:

2 of No. 1	4 of No. 22
6 " " 2	1 " " 24
2 " " 3	36 " " 37
4 " " 5	3 " " 48A
1 " " 15A	1 " " 52
1 " " 17	2 " " 54

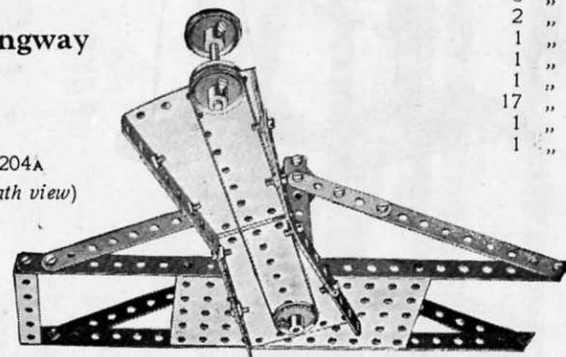
FIG. 204A  
(underneath view)



The side frames of the gangway are made of 12½" strips bolted by means of 2½" bent strips to parallel strips below. The side frames are connected by a perforated flanged plate, to the underside of which is bolted a bush wheel fitted with a rod on which is mounted a 1" pulley (see Fig. 204A). The rod passes through one of the end holes of the sector plate which is connected by diagonal strips to another sector plate. Through the end hole of the latter a rod is threaded carrying two 1" pulleys from one of which an operating cord passes through the pulley mounted on the under side of the flanged plate. In this way the Gangway may be rotated by an operating spindle.



## Model No. 205 Scales

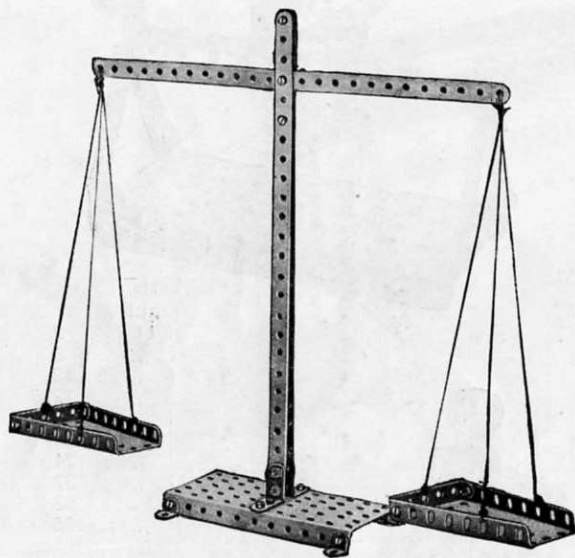


Parts required:

3 of No. 1	4 of No. 38
4 " " 12	2 " " 48A
2 " " 12A	1 " " 52
19 " " 37	2 " " 54

The slot is formed by inserting 2 washers on the bolts above and below the beam. These washers hold the strips composing the standard at the required distance apart to give the beam free play.

## Model No. 206 Joy Wheel

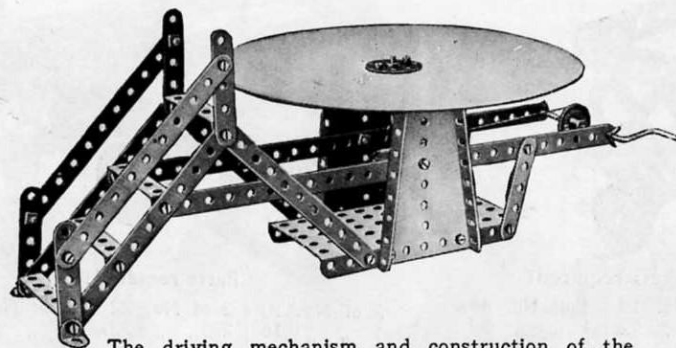

The driving mechanism and construction of the framework of this model are clearly brought out in Fig. 206A. Cut out a circular piece of cardboard, 8" in diameter, and in the centre of the disc fix a bush wheel by nuts and bolts. The eye of the bush wheel is then threaded over the top of a vertical spindle, and secured by its set-screw.

## Parts required:

2 of No. 1	1 of No. 22A
6 " " 2	1 " " 24
6 " " 5	2 " " 35
2 " " 12	28 " " 37
1 " " 15A	5 " " 48A
1 " " 19	1 " " 52
3 " " 22	2 " " 54


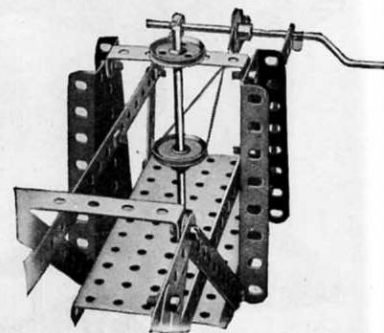


Fig. 206A

## Model No. 207 Polishing Spindle

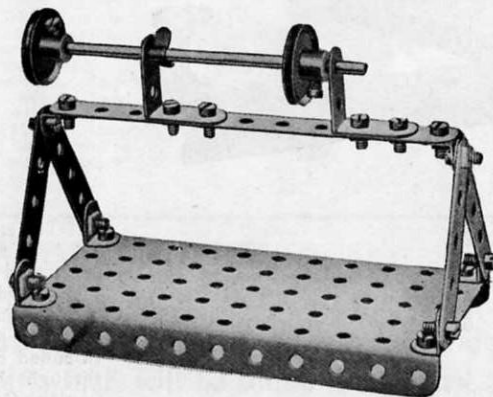

## Parts required:

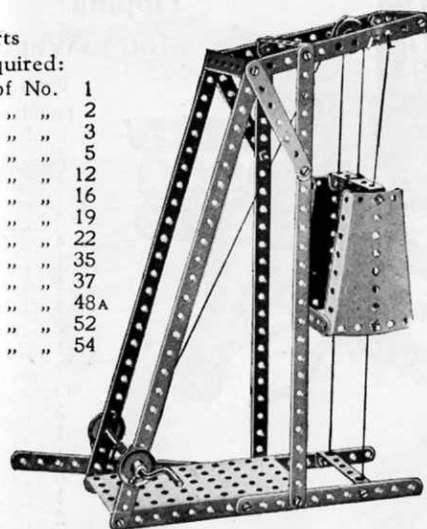
1 of No. 2	1 of No. 15A
4 " " 5	2 " " 22
6 " " 12	1 " " 35
2 " " 12A	16 " " 37
	1 of No. 52

These Models can be made with MECCANO Outfit No. 2, or No. 1 and No. 1A.


### Model No. 208 Pit Head Gear

Parts  
required:

4 of No.	1
5 " "	2
2 " "	3
2 " "	5
2 " "	12
1 " "	16
1 " "	19
3 " "	22
2 " "	35
25 " "	37
5 " "	48A
1 " "	52
2 " "	54




### Model No. 209 Gangway

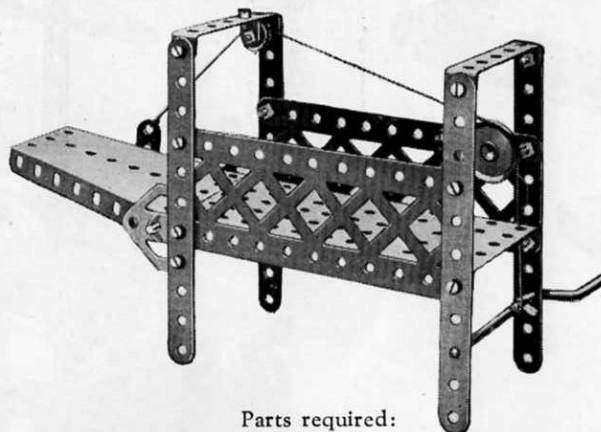

Parts required:

4 of No.	2	1 of No.	22	1 of No.	52
1 " "	10	1 " "	23	1 " "	54
1 " "	12	4 " "	35	2 " "	100
1 " "	16	17 " "	37	2 " "	126A
1 " "	19	2 " "	48A		


### Model No. 211 Motor Truck

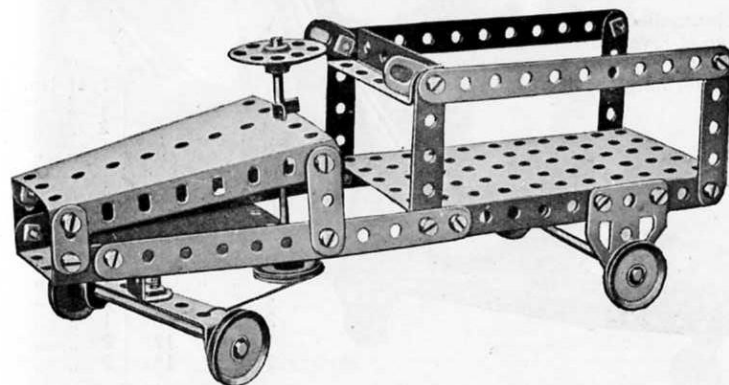

Parts  
required:

4 of No.	2
4 " "	5
2 " "	6A
4 " "	10
1 " "	11
3 " "	16
3 " "	22
2 " "	22A
1 " "	24
3 " "	35
26 " "	37
3 " "	48A
1 " "	52
2 " "	54
2 " "	126A

### Model No. 210 Ladder on Wheels

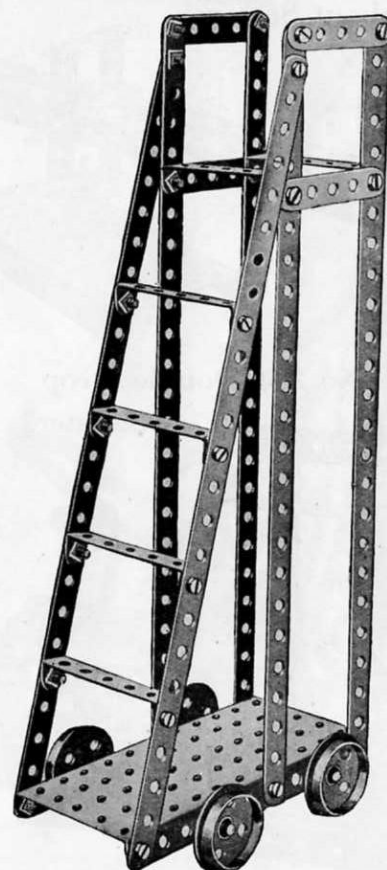


Parts required:

6 of No.	1	24 of No.	37
4 " "	5	6 " "	48A
2 " "	16	1 " "	52
4 " "	20		


Model No. 212

## Roundabout Seesaw

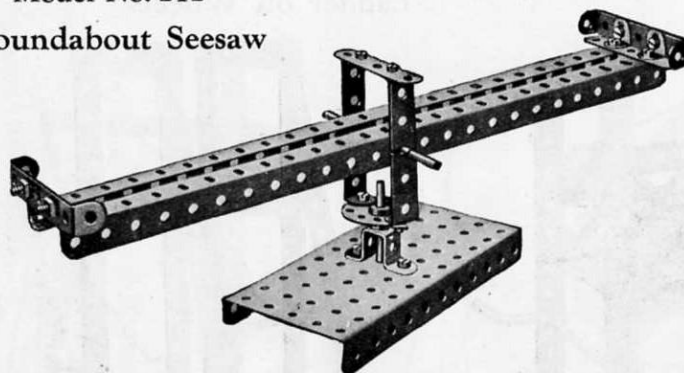

Parts required:	
3 of No.	5
2 " "	8
4 " "	12
1 " "	16
1 " "	17
1 " "	24
3 " "	35
14 " "	37
1 " "	45
4 " "	48A
1 " "	52

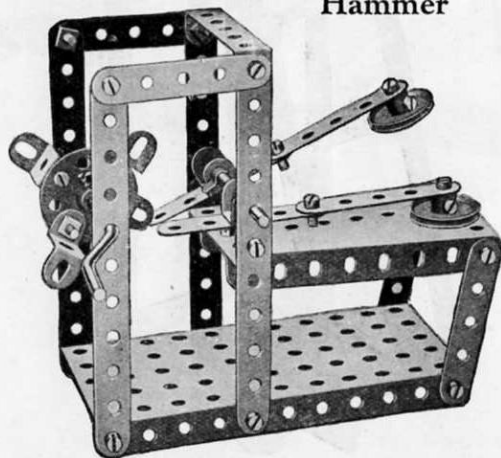
Model No. 214 Double Drop Hammer



Parts required:		1 of No.	16	25 of No.	37
4 of No.	2	1	" "	19	2
8 " "	5	2	" "	22	" "
2 " "	11	1	" "	24	" "
		6	" "	35	48
					52
					54
					125

Model No. 215  
Motor Breakdown Crane

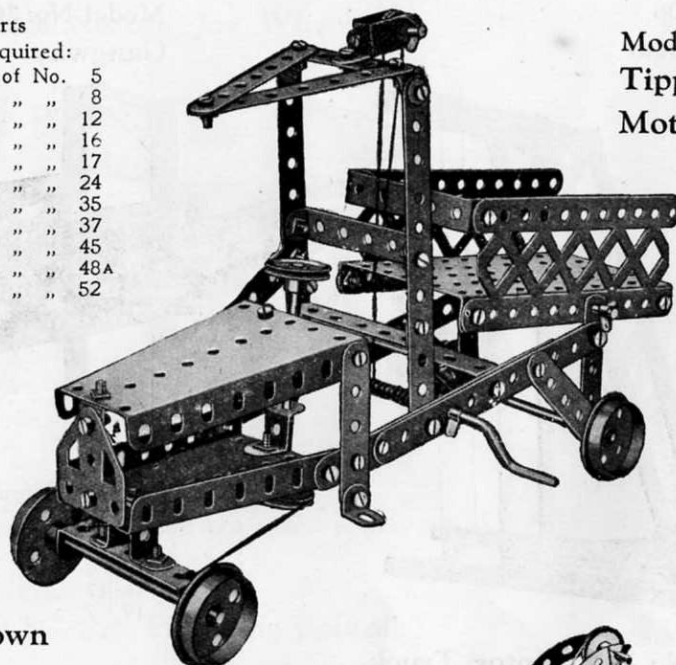
The front axle in this model is journaled in a  $2\frac{1}{2}'' \times \frac{1}{2}''$  double angle strip on which are mounted two  $\frac{1}{2}''$  reversed angle brackets. The latter are connected pivotally to a double bent strip bolted to the underside of the sector plate forming the bonnet of the motor car. Steering is effected by a piece of cord tied to each end of the double angle strip and passed twice round a 1" pulley wheel secured at the foot of the steering column. The Crane swivels about a 2" axle rod secured in a bush wheel which, in turn, is bolted to the chassis.



Model No. 213

## Tipping Motor Wagon

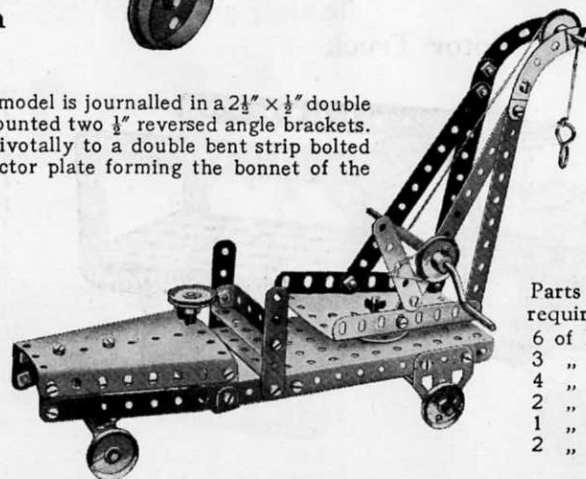Parts required:	
6 of No.	2
2 " "	3
7 " "	5
1 " "	10
4 " "	12
4 " "	16
1 " "	18A
1 " "	19
4 " "	20
2 " "	22
1 " "	23
7 " "	35
43 " "	37
2 " "	38
1 " "	44
1 " "	45
6 " "	48A
1 " "	52
2 " "	54
2 " "	100
2 " "	125
1 " "	126A



Parts required:		1 of No.	19
6 of No.	2	4	" "
3 " "	5	2	" "
4 " "	10	2	" "
2 " "	16	1	" "
1 " "	17	1	" "
2 " "	18A	6	" "
		32	" "
		1	" "
		4	" "
		1	" "
		2	" "
		1	" "
		2	" "
		2	" "
		2	" "



These Models can be made with MECCANO Outfit No. 2, or No. 1 and No. 1A.

### Model No. 216 Monoplane

Parts required:					
10 of No. 1	2	of No. 3	1	of No. 18A	
14 " " 2	8	" " 5	4	" " 22	
	2	" " 11	2	" " 22A	
	8	" " 12	1	" " 24	
	1	" " 15A	4	" " 35	
	2	" " 17	55	" " 37	
			1	" " 45	
			5	" " 48A	


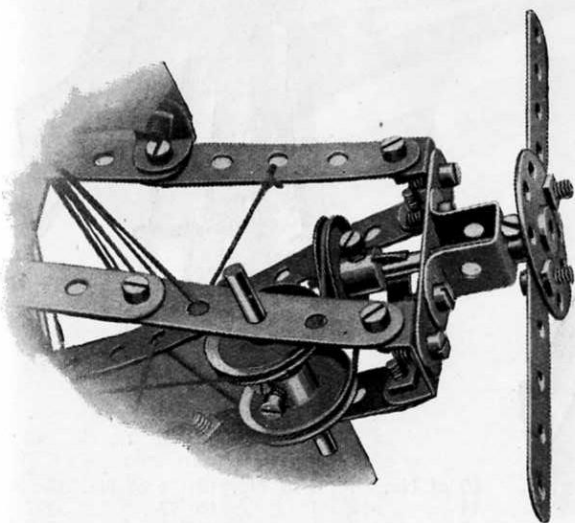
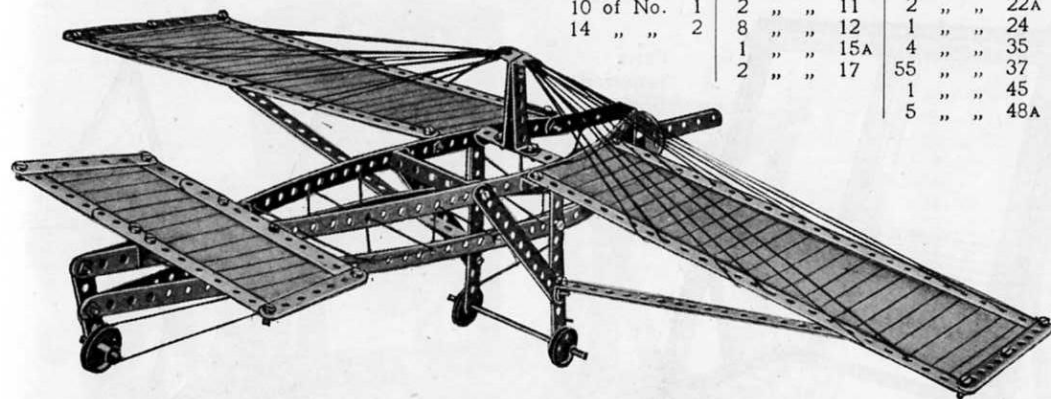


FIG. 216A

### Model No. 217
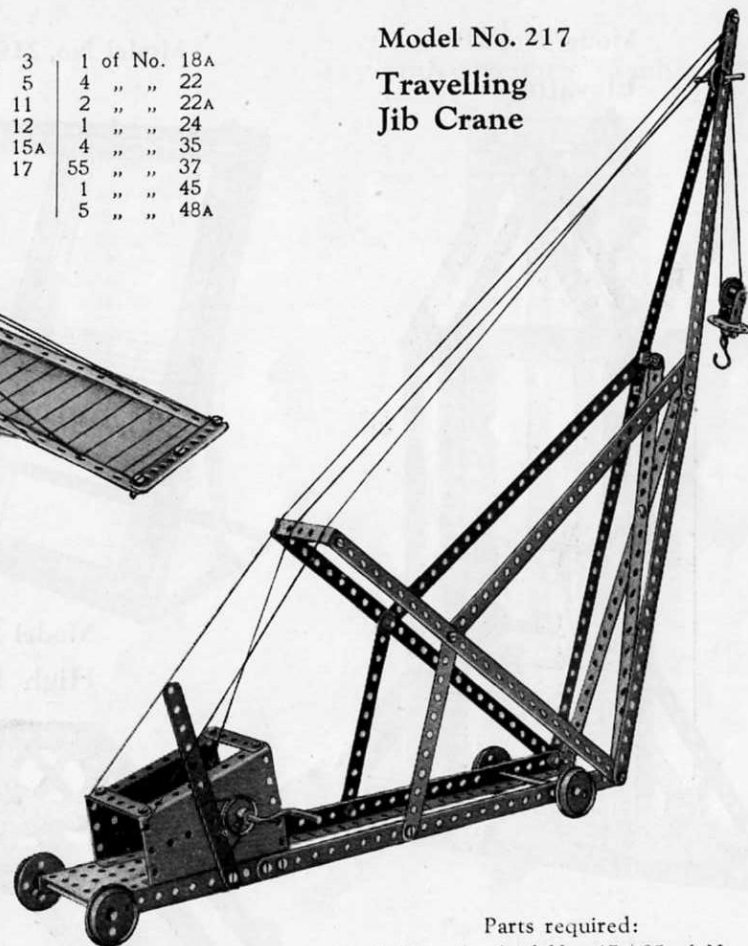
#### Travelling Jib Crane




Parts required:					
10 of No. 1	2	2 of No. 17	35	of No. 37	
3 " " 2	1	" " 19	1	" " 44	
3 " " 5	4	" " 20	1	" " 48A	
2 " " 8	2	" " 22	1	" " 52	
4 " " 12	1	" " 22A	2	" " 54	
2 " " 16	1	" " 24	1	" " 57	
	5	" " 35			

These Models can be made with MECCANO Outfit No. 2, or No. 1 and No. 1A.

Model No. 218

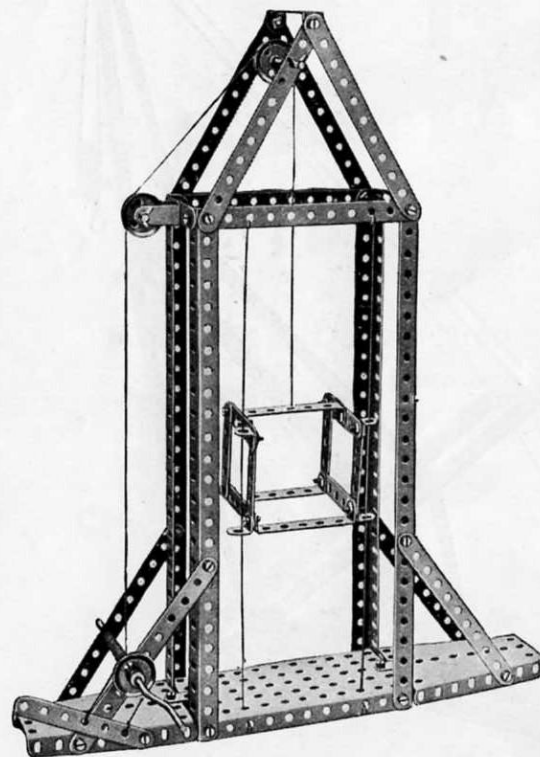
Elevator



Parts required:

10 of No. 2	1 of No. 16	38 of No. 37
1 " " 3	1 " " 18A	1 " " 44
10 " " 5	1 " " 19	4 " " 48A
4 " " 8	1 " " 22	1 " " 52
2 " " 10	2 " " 22A	2 " " 54
4 " " 12	5 " " 35	

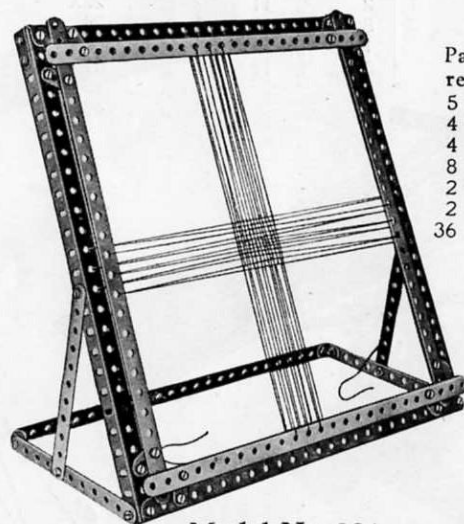
Model No. 219 Mat Frame



Parts  
required:  
5 of No. 1  
4 " " 2  
4 " " 8  
8 " " 10  
2 " " 12A  
2 " " 12  
36 " " 37

Model No. 221

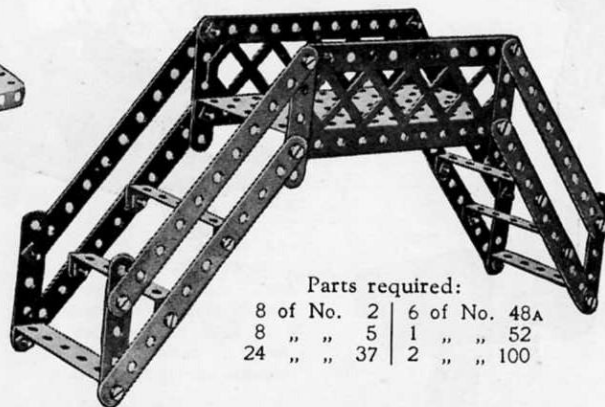High Level Bridge



Parts required:

8 of No. 2	6 of No. 48A
8 " " 5	1 " " 52
24 " " 37	2 " " 100

Model No. 220

Windmill




Parts required:

10 of No. 1	4 of No. 12	4 of No. 35
14 " " 2	1 " " 15	47 " " 37
2 " " 3	1 " " 19	1 " " 45
2 " " 5	2 " " 22	2 " " 54
4 " " 8	1 " " 24	

These Models can be made with MECCANO Outfit No. 2, or No. 1 and No. 1A.

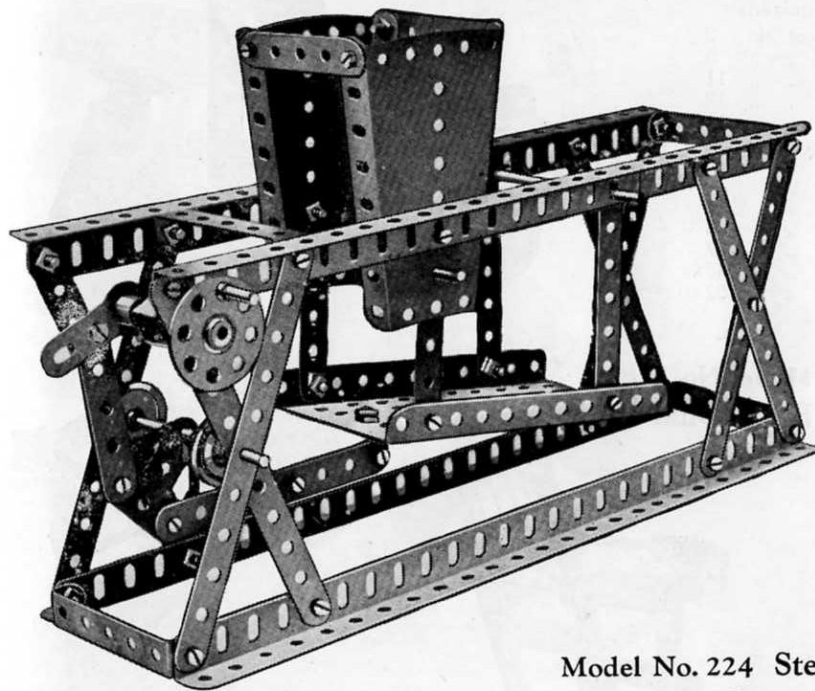
Model No. 222 Coal Sifter



Parts  
required:

8	of No.	2
2	" "	3
7	" "	5
4	" "	8
1	" "	12
3	" "	16
1	" "	17
2	" "	22
1	" "	24
6	" "	35
38	" "	37
1	" "	45
4	" "	48A
1	" "	52
2	" "	54
1	" "	62
1	" "	115
1	" "	126A

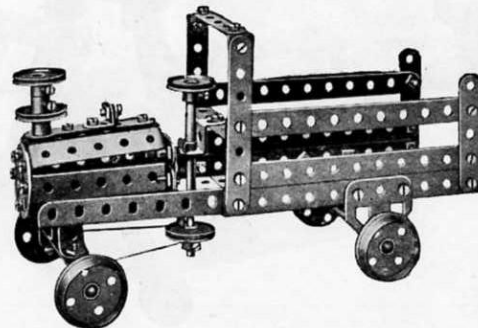
Model No. 224 Steam Lorry



Parts required:

4	of No.	2	1	of No.	24
2	" "	3	2	" "	35
6	" "	5	47	" "	37
3	" "	10	1	" "	45
7	" "	12	6	" "	48A
3	" "	16	1	" "	52
1	" "	17	1	" "	54
4	" "	20	1	" "	62
4	" "	22	2	" "	125
1	" "	23	2	" "	126A

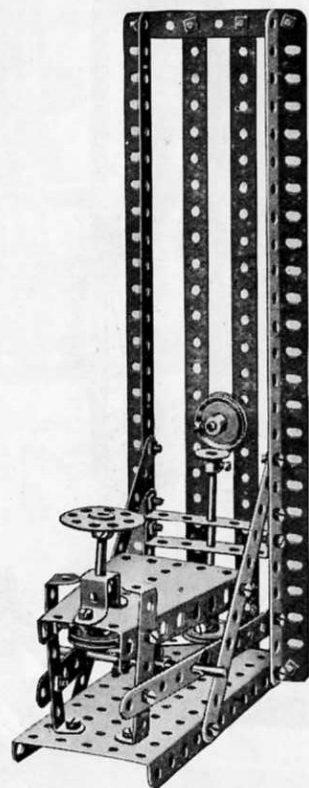Model No. 223  
Try-your-strength Machine




Parts required:

2	of No.	1	1	of No.	17	12	of No.	38
5	" "	2	1	" "	18A	1	" "	45
2	" "	3	4	" "	22	4	" "	48A
2	" "	8	1	" "	24	1	" "	52
1	" "	11	4	" "	35	1	" "	54
2	" "	16	30	" "	37	1	" "	126A



These Models can be made with MECCANO Outfit No. 2, or No. 1 and No. 1A.


### Model No. 225 Candy Puller

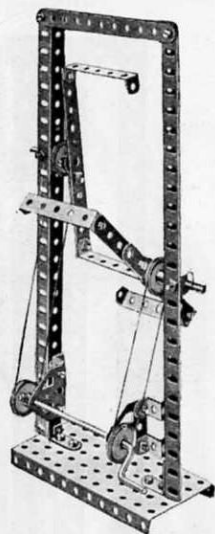

Parts  
required:

3 of No.	2
2 "	8
2 "	12
2 "	12A
2 "	17
1 "	19
4 "	22
2 "	35
26 "	37
10 "	38
4 "	48A
1 "	52
2 "	62
4 "	125
2 "	126A


### Model No. 227 Hay Tedder

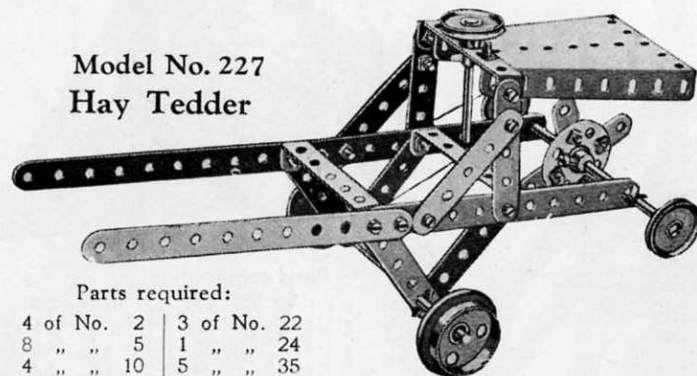

Parts required:

4 of No.	2	3 of No.	22
8 "	5	1 "	24
4 "	10	5 "	35
3 "	16	18 "	37
1 "	17	3 "	48A
2 "	20	1 "	54

### Model No. 226 Carrier Tricycle

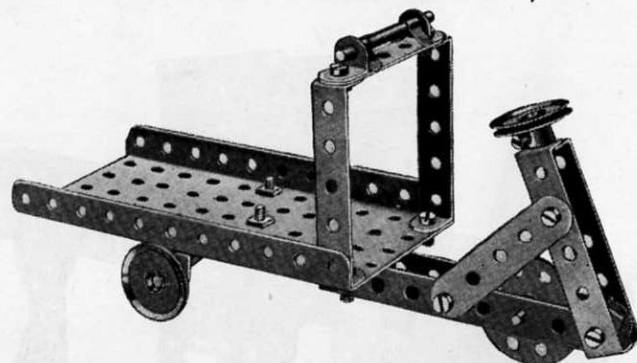

Parts  
required:

2 of No.	2
3 "	5
1 "	11
2 "	12
1 "	16
1 "	17
1 "	18A
3 "	22
1 "	24
2 "	35
15 "	37
5 "	48A
1 "	52

### Model No. 228 Baby Chair

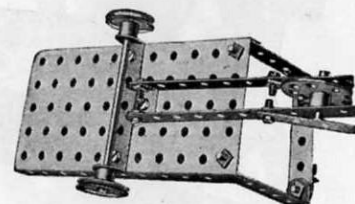
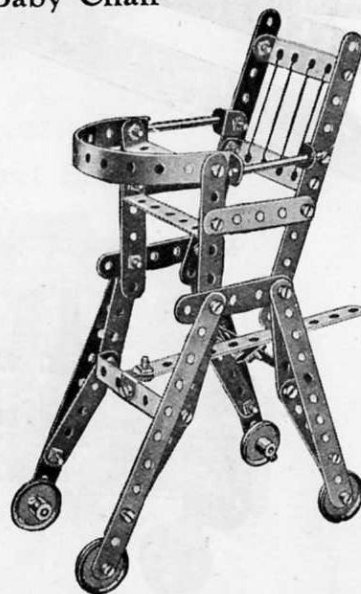


FIG. 226A  
(underneath view)


Parts  
required:

8 of No.	2
2 "	3
12 "	5
6 "	12
2 "	17
4 "	22
31 "	37
6 "	48A


Model  
Anti-  
Gun

5 of No.  
2 "  
2 "  
2 "  
1 "

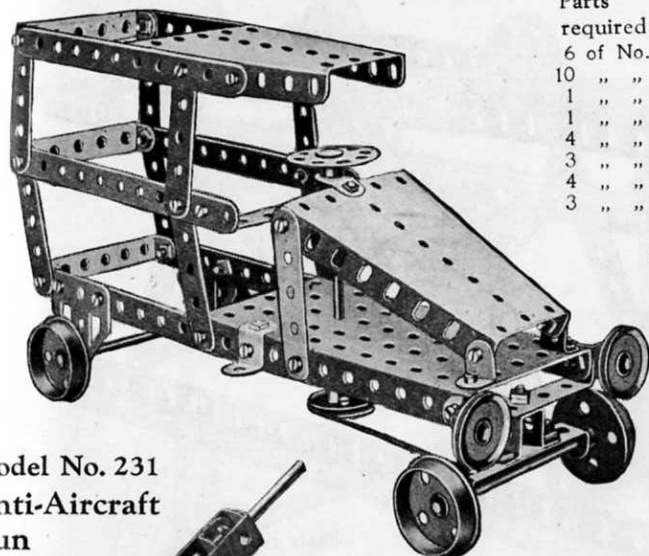
Model No. 229 Motor Van



Parts required:	
6 of No.	2
10 " "	5
1 " "	10
1 " "	11
4 " "	12
3 " "	16
4 " "	20
3 " "	22
1 of No.	24
38 " "	37
1 " "	45
6 " "	48A
1 " "	52
2 " "	54
2 " "	125
2 " "	126A

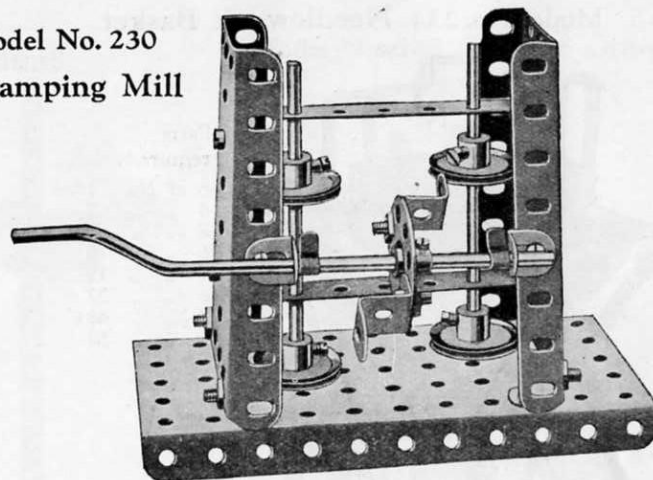
Model No. 230  
Stamping Mill

Parts required:	
2 of No.	3
10 " "	12
2 " "	16
1 " "	19
4 of No.	22
1 " "	24
2 " "	35
14 " "	37
1 of No.	52
2 " "	54
2 " "	125

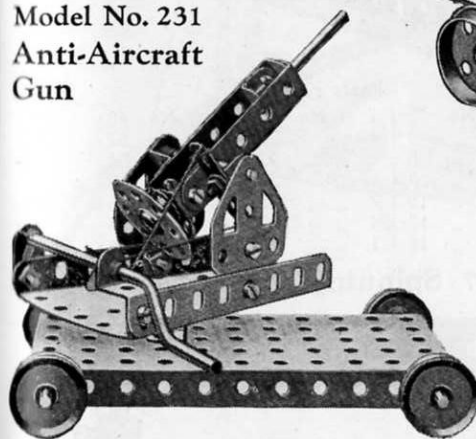Model No. 231  
Anti-Aircraft  
Gun


Parts required:	
5 of No.	10
2 " "	11
2 " "	16
2 " "	17
1 " "	19
4 of No.	22
1 " "	24
4 " "	35
12 " "	37
2 " "	48A
1 of No.	52
1 " "	54
4 " "	125
2 " "	126A

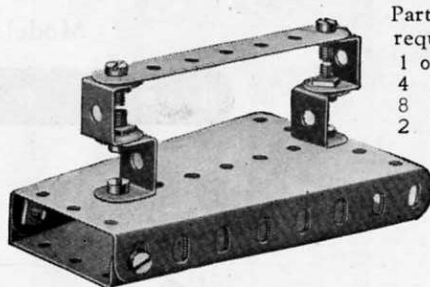Model No. 232 Smoothing Iron



Parts required:	
1 of No.	3
4 " "	11
8 " "	37
2 " "	54

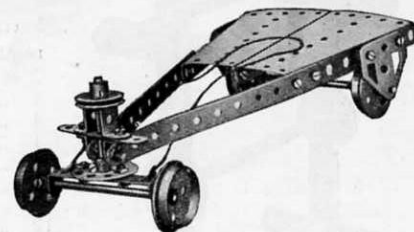Model No. 233 Coaster



Parts required:	
2 of No.	2
1 " "	5
2 " "	12
1 " "	15
1 " "	16
1 of No.	17
4 " "	20
1 " "	22
1 " "	24
16 " "	37
6 of No.	38
1 " "	45
1 " "	48A
2 " "	54
2 " "	126A

These Models can be made with MECCANO Outfit No. 2, or No. 1 and No. 1A.


### Model No. 234 Needlework Basket



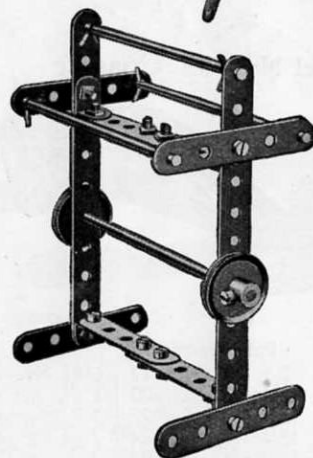Parts  
required:

6 of No.	1
4 " "	2
2 " "	3
6 " "	5
12 " "	12
46 " "	37
3 " "	48A
1 " "	52


### Model No. 236 Towel Rail



Parts  
required:

2 of No.	2
8 " "	5
4 " "	12
1 " "	15
4 " "	16
2 " "	22
6 " "	35
12 " "	37


### Model No. 235 Sifter

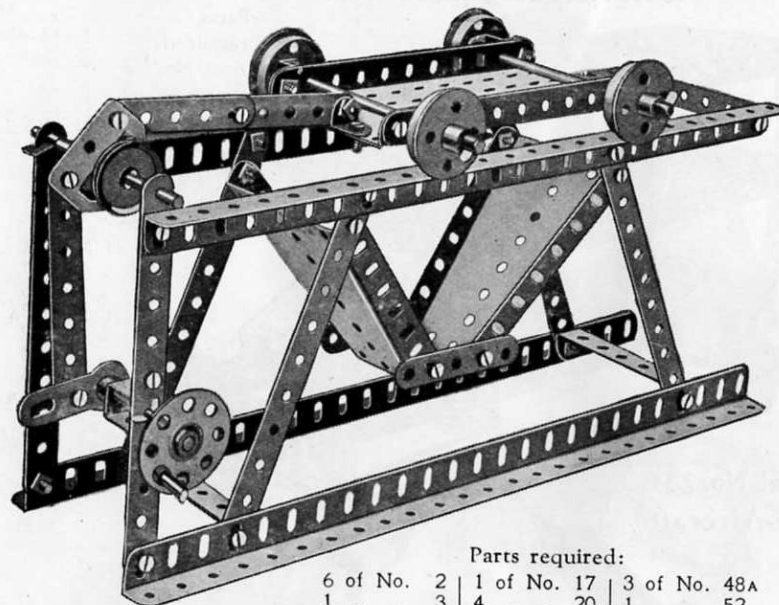

Parts required:

6 of No.	2	1 of No.	17	3 of No.	48A
1 " "	3	4 " "	20	1 " "	52
4 " "	5	2 " "	22	2 " "	54
4 " "	8	1 " "	24	1 " "	62
1 " "	12	7 " "	35	1 " "	115
2 " "	15	34 " "	37	4 " "	125
1 " "	16	1 " "	45	1 " "	126A

### Model No. 237 Spinning Top

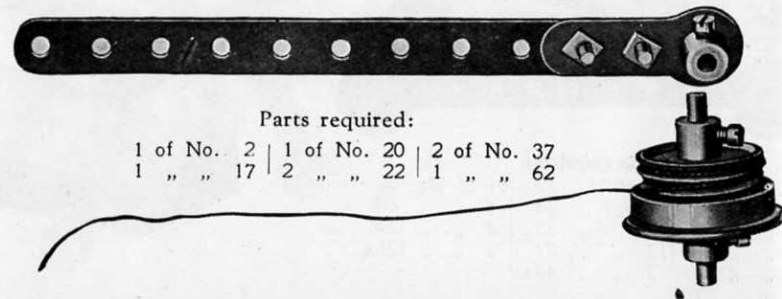


Parts required:

1 of No.	2	1 of No.	20	2 of No.	37
1 " "	17	2 " "	22	1 " "	62




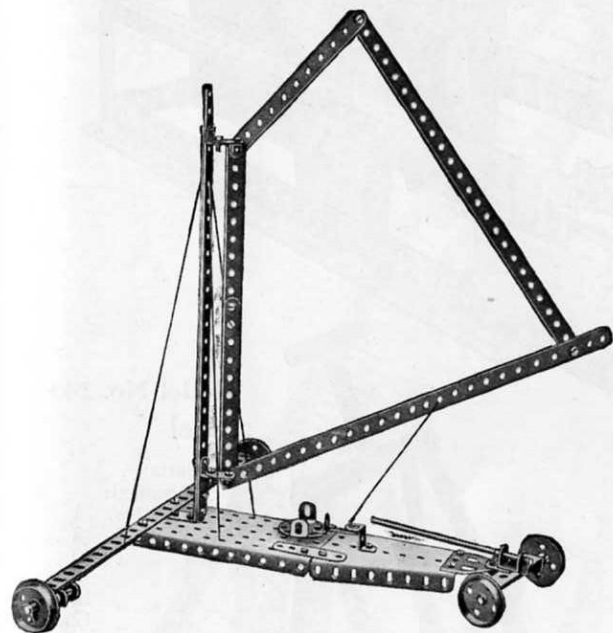Model No. 238 Seashore Aeroplage



Parts required:


4 of No.	1	1 of No.	12A	33 of No.	37
3 " "	2	1 " "	15	1 " "	38
2 " "	5	1 " "	16	1 " "	48A
1 " "	8	2 " "	17	1 " "	52
3 " "	10	4 " "	20	1 " "	54
3 " "	11	1 " "	24	1 " "	125
7 " "	12	6 " "	35	1 " "	126A

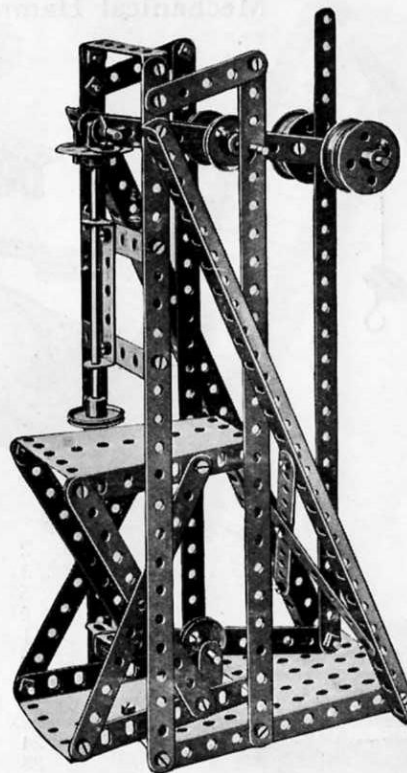Model No. 239  
Embossing Machine

Parts required:

5 of No.	1	2 of No.	16	44 of No.	37
9 " "	2	1 " "	17	1 " "	44
2 " "	5	1 " "	18A	4 " "	48A
2 " "	8	4 " "	20	1 " "	52
2 " "	11	4 " "	22	2 " "	54
4 " "	12	1 " "	24		
1 " "	15	4 " "	35		

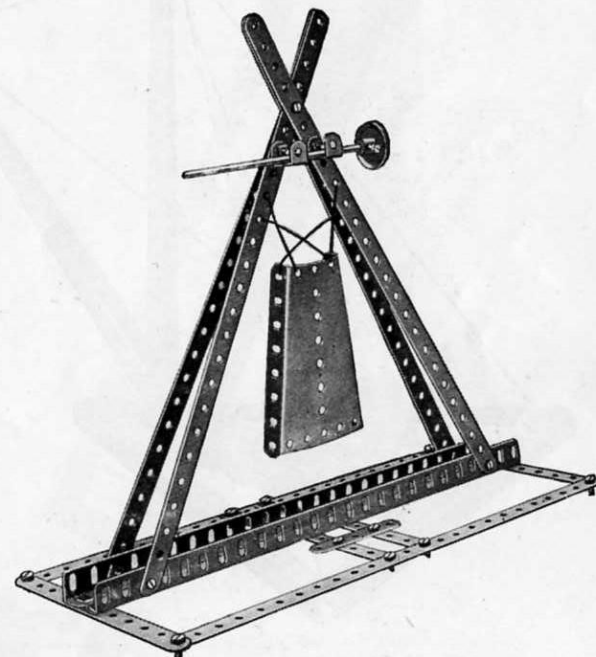Model No. 240 Dinner Gong




Parts required:

6 of No.	1	1 of No.	15
4 " "	2	1 " "	22
2 " "	5	27 " "	37
2 " "	8	1 " "	54
2 " "	11		

These Models can be made with MECCANO Outfit No. 2, or No. 1 and No. 1A.


### Model No. 241 Dwarf Derrick

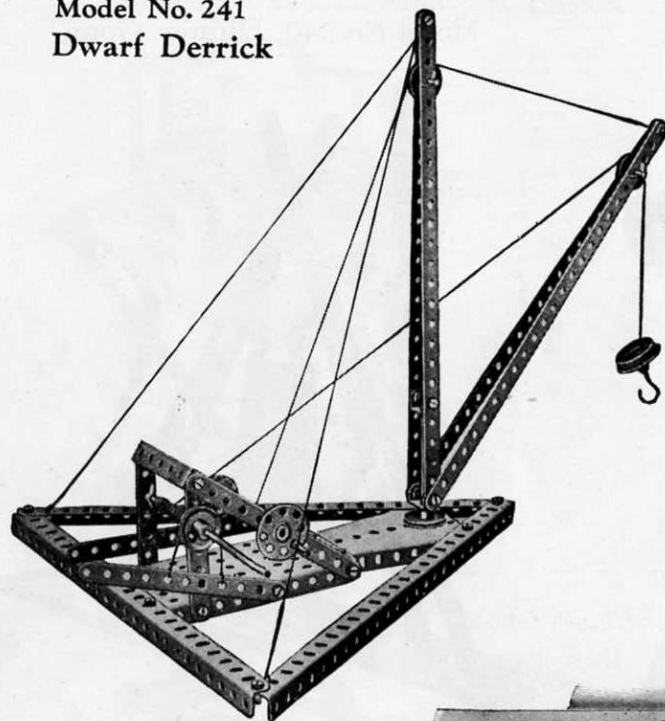

Parts required:

4 of No. 1	2 of No. 22A
4 " " 2	1 " " 24
2 " " 3	6 " " 35
3 " " 8	23 " " 37
2 " " 11	4 " " 38
2 " " 16	1 " " 48A
2 " " 18A	1 " " 52
1 " " 19	1 " " 54
1 " " 20	1 " " 57
4 " " 22	1 " " 115

### Model No. 242 Mechanical Hammer

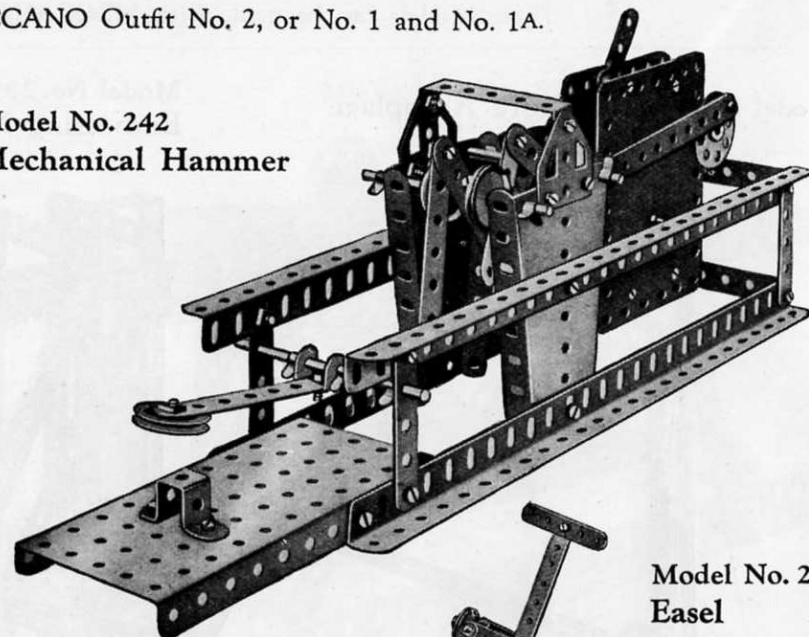

Parts required:

2 of No. 2	
1 " " 3	
6 " " 5	
4 " " 8	
1 " " 11	
1 " " 12	
3 " " 16	
4 " " 22	
1 " " 22A	
1 " " 24	
8 " " 35	
32 " " 37	
1 " " 45	
3 " " 48A	
1 " " 52	
2 " " 54	
2 " " 126A	

Clockwork Motor  
not included in Outfit)


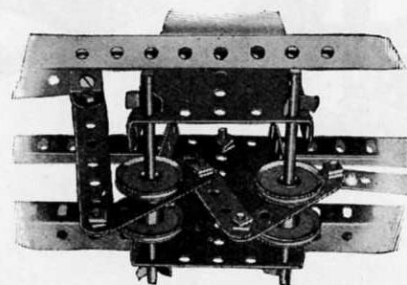


FIG. 242A

### Model No. 243 Easel

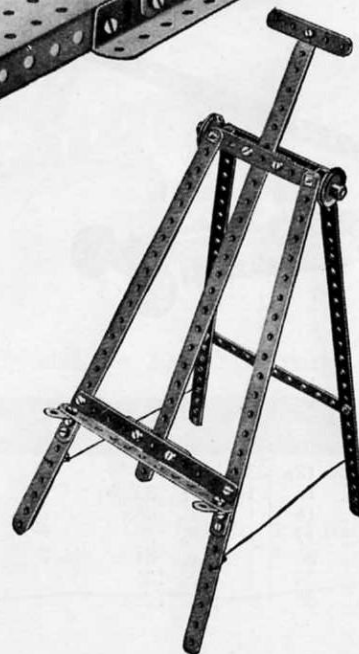Parts required:

5 of No. 1	
3 " " 2	
2 " " 3	
3 " " 5	
4 " " 12	
2 " " 12A	
1 " " 15A	
2 " " 22	
19 " " 37	
4 " " 38	



## Model No. 244 Extending Ladder on Running Carriage

Parts  
required:

2 of No.	1
8 " "	2
1 " "	3
7 " "	5
4 " "	8
5 " "	12
4 " "	16
1 " "	18A
1 " "	19
4 " "	20
4 " "	22
1 " "	22A
1 " "	24
6 " "	35
47 " "	37
2 " "	38
1 " "	44
1 " "	45
7 " "	48A
1 " "	52
2 " "	54
1 " "	115
2 " "	125
2 " "	126A

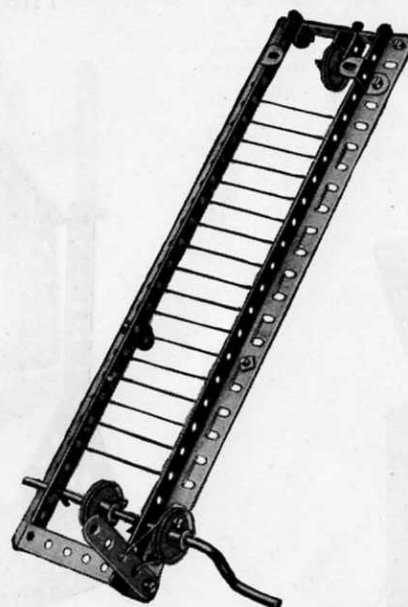
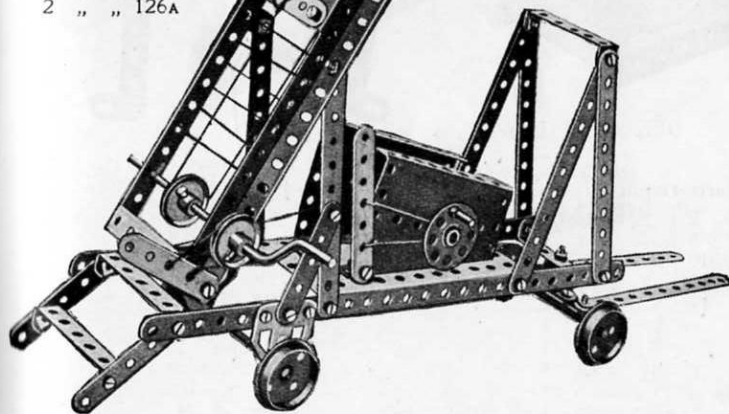


FIG. 244A

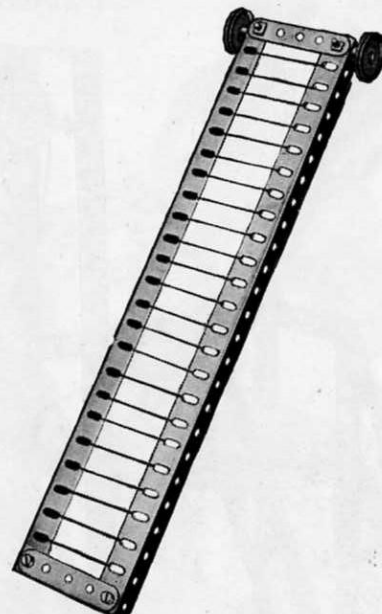



FIG. 244B

The bed of the lower carriage framework is formed by bolting two  $12\frac{1}{2}$ " strips to the sides of a large flanged plate, and two sector plates bolted to the flanged plate by their flanges to form the sides, and a bearing for the spindle carrying the operating cord attached to the bottom of the ladder to raise it from a horizontal position; and the strips form a support for the ladder when in this horizontal position. Angle brackets, Fig. 244A, form pivots for the lower part of the ladder, and are carried from the supports. The upper part of the ladder, Fig. 244, is slideably guided and retained on the lower ladder by reversed brackets. The extension of the ladder is effected by the cranked spindle round a pulley on which (and another pulley at the tip of the framework) the cord is passed, the ends being secured to the lower part of the slideable ladder.




## Model No. 245 Ferry Gangway

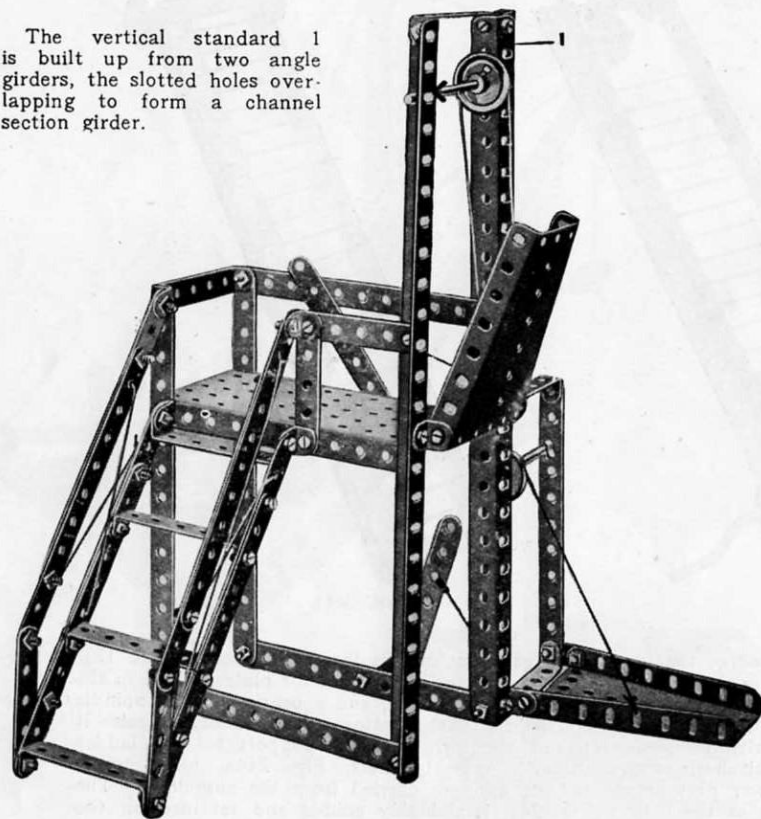The vertical standard 1 is built up from two angle girders, the slotted holes overlapping to form a channel section girder.




Parts required:					
14 of No. 2	6 of No. 12	1 of No. 45			
2 " " 3	2 " " 16	8 " " 48A			
6 " " 5	2 " " 22	1 " " 52			
3 " " 8	2 " " 35	2 " " 54			
2 " " 10	54 " " 37				

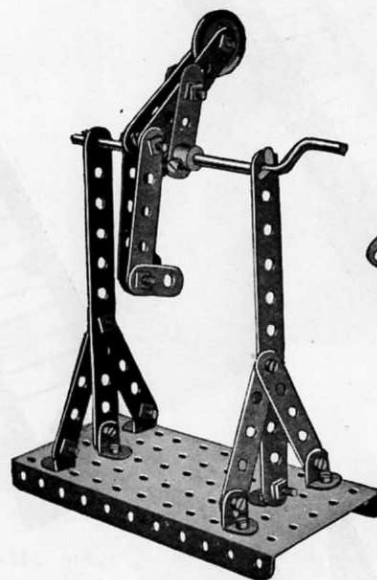Model No. 246  
The Acrobat

## Parts required:

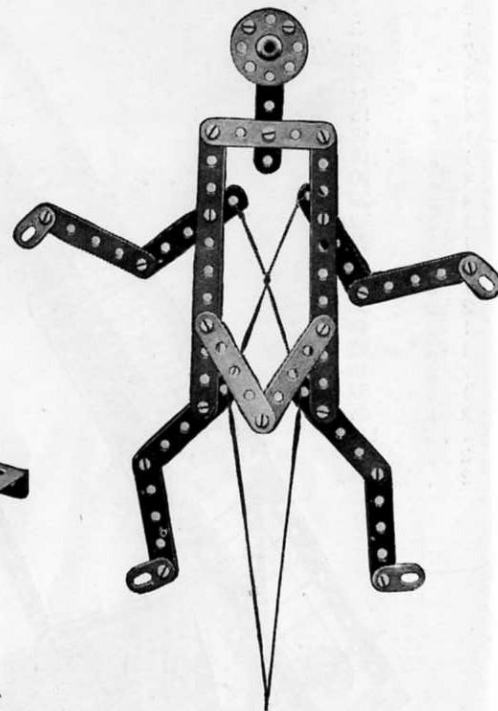2 of No. 2	1 of No. 22A
8 " " 5	2 " " 35
2 " " 10	21 " " 37
6 " " 12	1 " " 52
1 " " 19	2 " " 62


Model No. 247  
Jumping Jack

## Parts

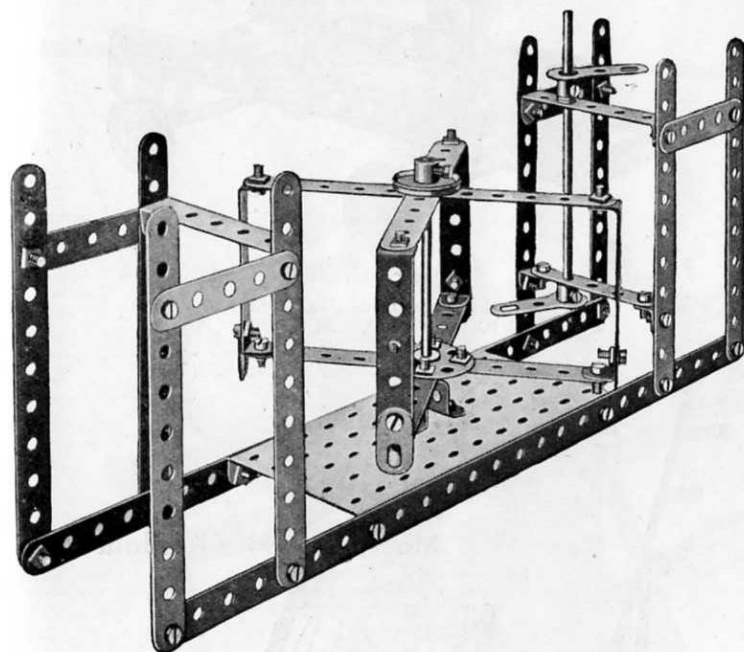required:	
2 of No. 2	
12 " " 5	
4 " " 10	
1 " " 24	
20 " " 37	

These Models can be made with MECCANO Outfit No. 2, or No. 1 and No. 1A.

Model No. 248 Turnstile




Parts required:

2 of No. 1	1 of No. 24
10 " " 2	42 " " 37
9 " " 5	2 " " 38
4 " " 10	1 " " 45
2 " " 12	6 " " 48A
1 " " 15	1 " " 52
1 " " 15A	2 " " 62
2 " " 22	

Model No. 250  
Cutting  
Machine

Parts  
required:

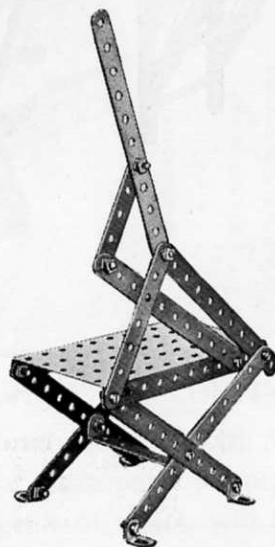7 of No. 2
1 " " 3
1 " " 5
4 " " 12
14 " " 37
1 " " 48A
1 " " 52



Model No. 249  
Chair for Wounded

Parts  
required:

6 of No. 2
2 " " 3
10 " " 5
2 " " 11
2 " " 16
4 " " 22
21 " " 37
2 " " 48A
1 " " 52



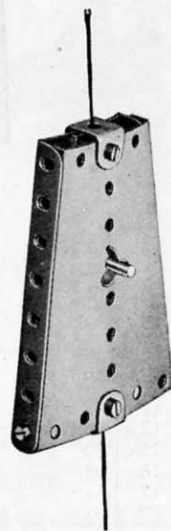
Model No. 251  
Magic Sector Plates

Parts

required:


2 of No. 11
1 " " 17
2 " " 35
6 " " 37
2 " " 54

When the cord is held vertically the magic sector plates will fall or stop at the bidding of the owner. If the cord is held without tension the plates will fall, but the instant the cord is tightened they will stop dead. The cord is wrapped once around the rod which passes through the centre holes of the sector plates.



These Models can be made with MECCANO Outfit No. 2, or No. 1 and No. 1A.

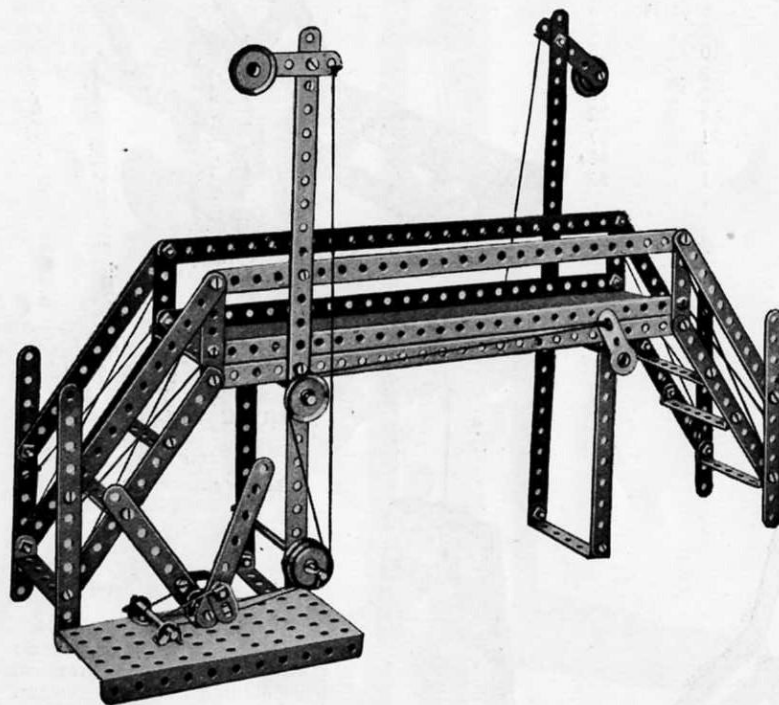
**Model No. 252**  
**Railway Foot Bridge and Signals**



Parts required:

4 of No. 1	1 of No. 11	2 of No. 22A
14 " " 2	2 " " 12	6 " " 35
2 " " 3	1 " " 15A	50 " " 37
8 " " 5	2 " " 16	8 " " 48A
2 " " 8	1 " " 17	1 " " 52
2 " " 10	3 " " 22	1 " " 62


**Model No. 253 Steering Truck**

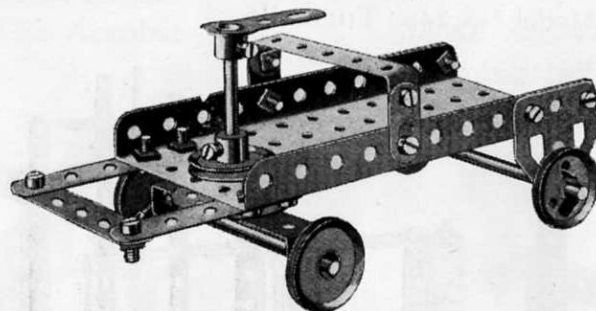

Parts required:

3 of No. 5	2 of No. 22A	2 of No. 48A
2 " " 10	1 " " 24	1 " " 52
2 " " 16	2 " " 35	1 " " 62
1 " " 17	16 " " 37	2 " " 126A
3 " " 22	2 " " 38	

**Model No. 254 Gondola**

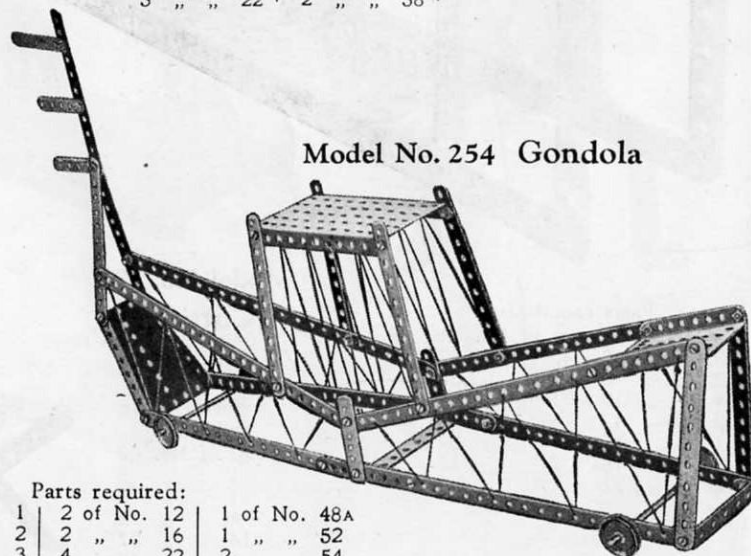


Parts required:

8 of No. 1	2 of No. 12	1 of No. 48A
9 " " 2	2 " " 16	1 " " 52
1 " " 3	4 " " 22	2 " " 54
5 " " 5	29 " " 37	



These Models can be made with MECCANO Outfit No. 2, or No. 1 and No. 1A.


### Model No. 255 Roundabout

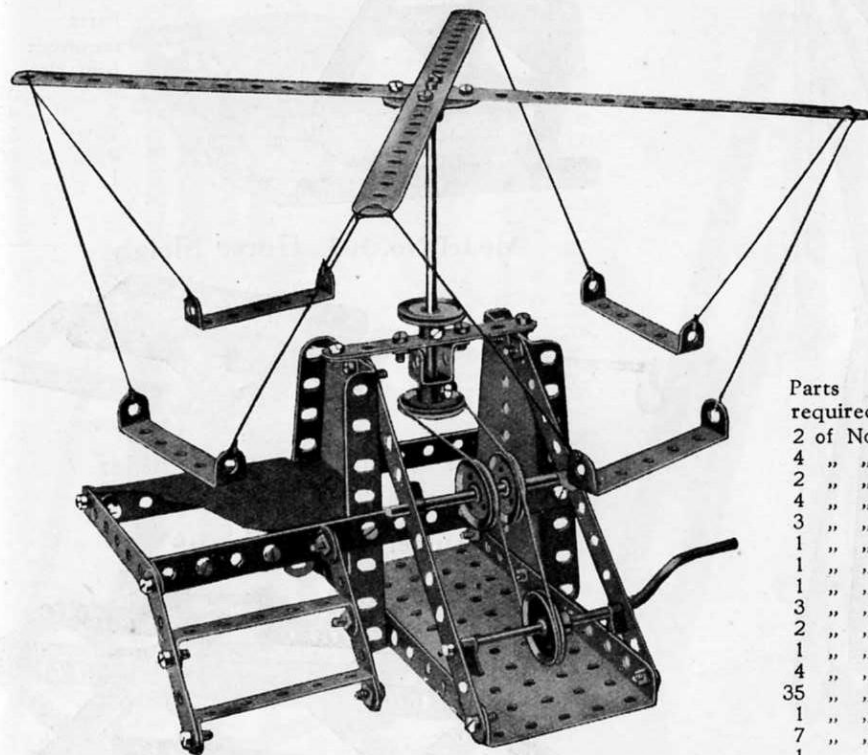

#### Parts required:

2 of No.	1
4 " "	2
2 " "	3
4 " "	5
3 " "	12
1 " "	15
1 " "	16
1 " "	19
3 " "	22
2 " "	22A
1 " "	24
4 " "	35
35 " "	37
1 " "	45
7 " "	48A
1 " "	52
2 " "	54
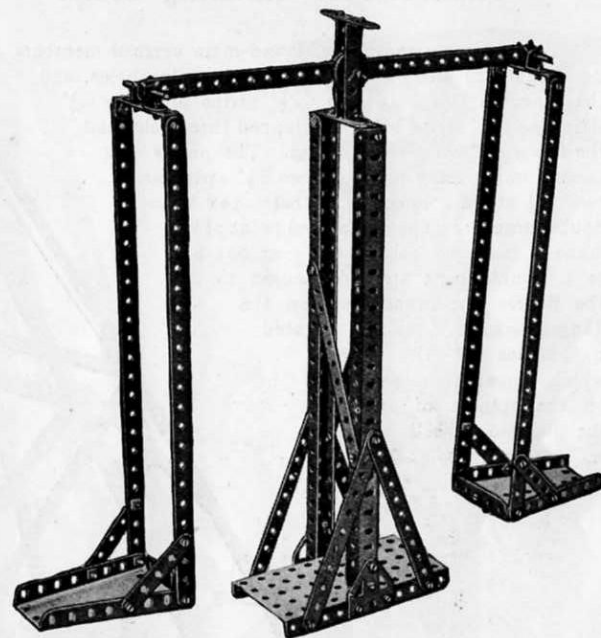
### Model No. 256 Beam Scales



#### Parts required:

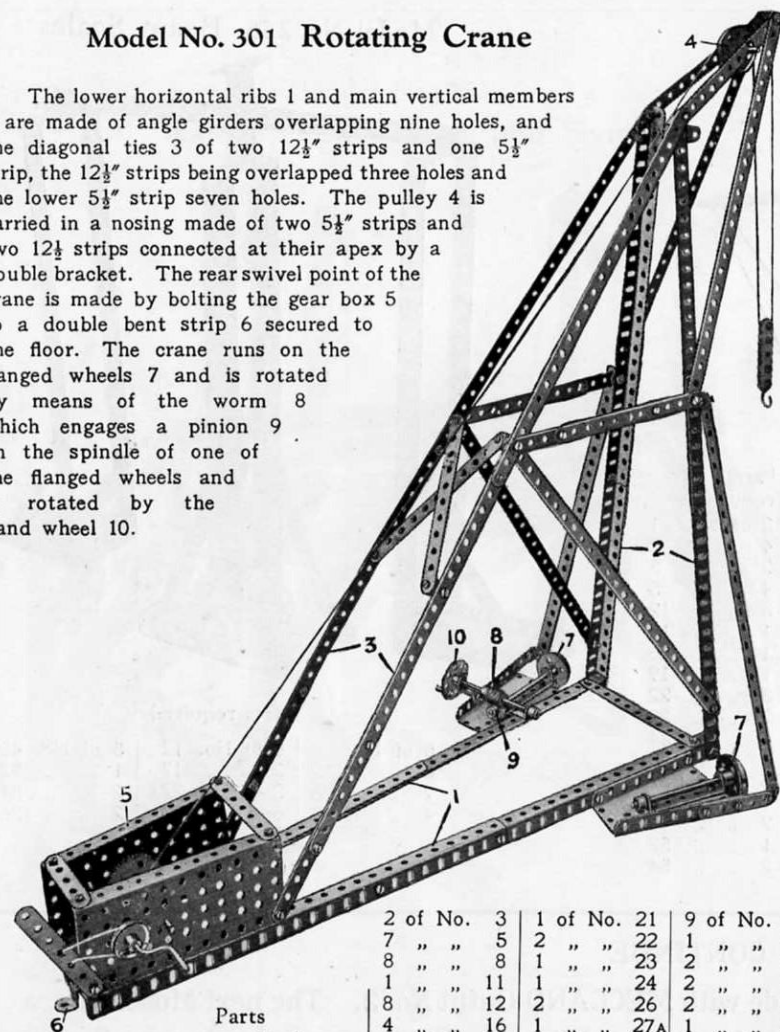
5 of No.	1	6 of No.	12	5 of No.	48A
6 " "	2	2 " "	17	1 " "	52
7 " "	5	2 " "	22A	2 " "	54
4 " "	8	6 " "	35	2 " "	126A
		48 " "	37		

### HOW TO CONTINUE

This completes our examples of Models that may be made with MECCANO Outfit No. 2. The next Models are a little more advanced, requiring a number of extra parts to construct them. The necessary parts are all contained in a No. 2A Accessory Outfit, the price of which will be found in the List at the end of the Manual.


### Model No. 301 Rotating Crane

The lower horizontal ribs 1 and main vertical members 2 are made of angle girders overlapping nine holes, and the diagonal ties 3 of two  $12\frac{1}{2}$ " strips and one  $5\frac{1}{2}$ " strip, the  $12\frac{1}{2}$ " strips being overlapped three holes and the lower  $5\frac{1}{2}$ " strip seven holes. The pulley 4 is carried in a nosing made of two  $5\frac{1}{2}$ " strips and two  $12\frac{1}{2}$ " strips connected at their apex by a double bracket. The rear swivel point of the crane is made by bolting the gear box 5 to a double bent strip 6 secured to the floor. The crane runs on the flanged wheels 7 and is rotated by means of the worm 8 which engages a pinion 9 on the spindle of one of the flanged wheels and is rotated by the hand wheel 10.




Parts required:	10 of No. 1	11 " " 2	2 of No. 3	1 of No. 21	9 of No. 38
			7 " " 5	2 " " 22	1 " " 45
			8 " " 8	1 " " 23	2 " " 48A
			1 " " 11	1 " " 24	2 " " 52
			8 " " 12	2 " " 26	2 " " 54
			4 " " 16	1 " " 27A	1 " " 57
			1 " " 17	1 " " 32	4 " " 59
			1 " " 19	2 " " 35	1 " " 115
			2 " " 20	70 " " 37	2 " " 125

### Model No. 302 Toboggan

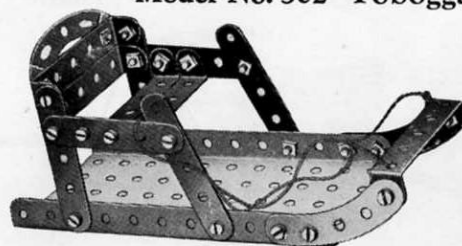

Parts required:	6 of No. 5
20 " " 37	
5 " " 48A	
1 " " 52	
2 " " 90	
1 " " 90A	


### Model No. 303 Horse Sleigh

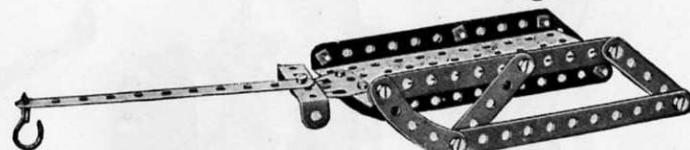

Parts required:

3 of No. 2	13 of No. 37	1 of No. 57
4 " " 5	1 " " 48A	2 " " 90
1 " " 23	1 " " 52	1 " " 126A

### Model No. 304 Lathe

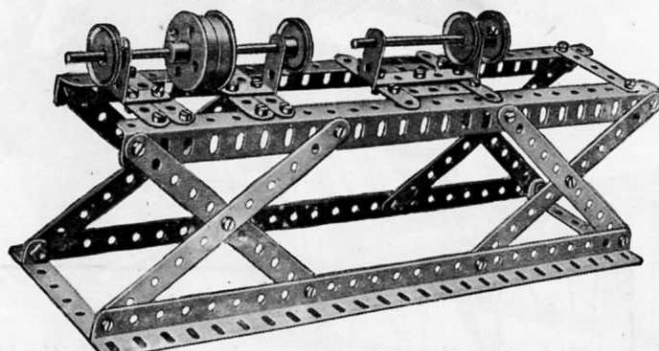

Parts required:	4 of No. 8	2 of No. 20
	2 " " 12A	1 " " 22
8 of No. 2	1 " " 15A	41 " " 37
10 " " 5	1 " " 16	1 " " 46
		2 " " 48A

This Model can be made with MECCANO Outfit No. 3, or No. 2 and No. 2A.

41

### Model No. 305 Tower Wagon

#### Parts

required:

6 of No.	1
2 " "	4
10 " "	5
8 " "	8
2 " "	12
2 " "	15A
4 " "	16
4 " "	20
1 " "	22A
1 " "	24
1 " "	26
1 " "	32
4 " "	35
72 " "	37
8 " "	38
10 " "	48A
2 " "	52
3 " "	59
1 " "	98
2 " "	100
1 " "	115
2 " "	126A

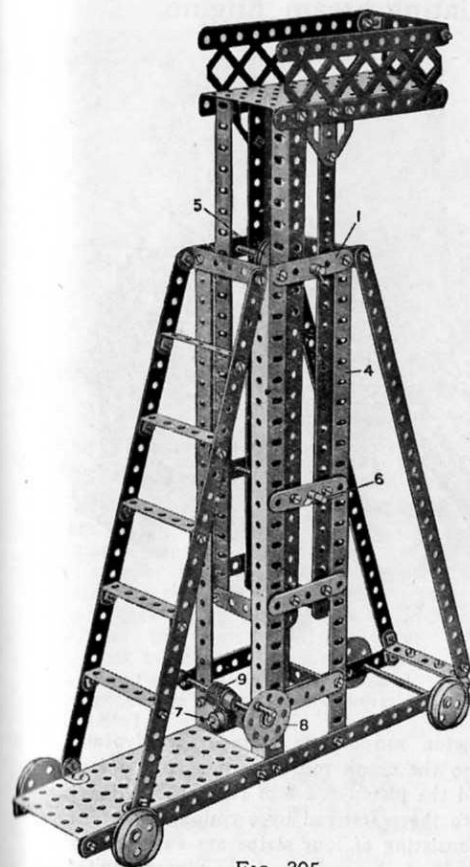


FIG. 305

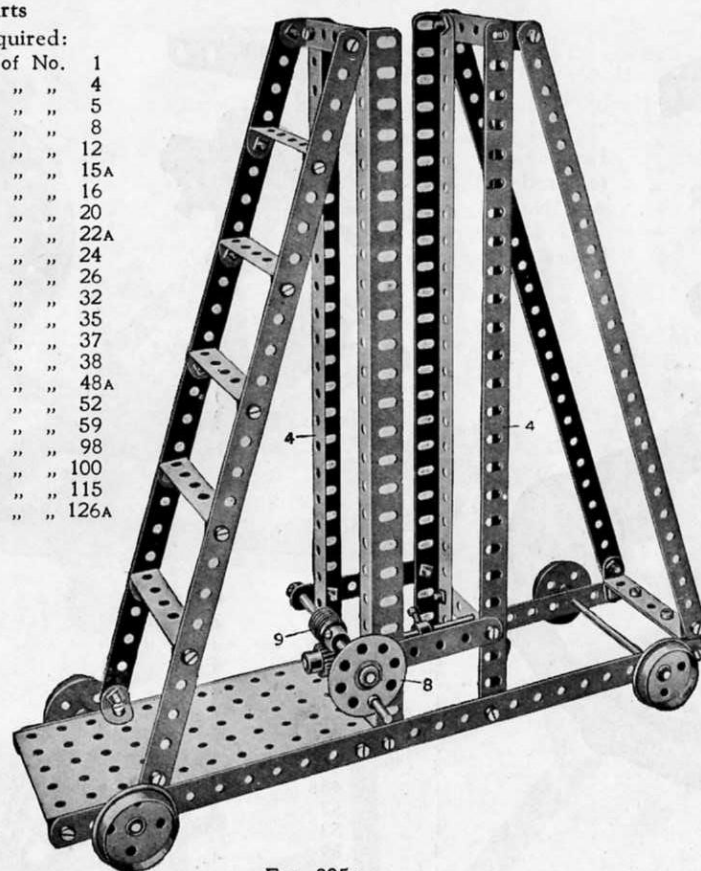


FIG. 305A

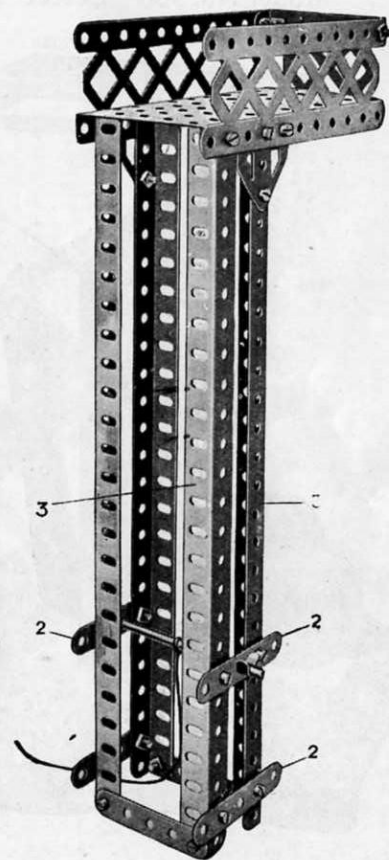



FIG. 305B

Begin the construction of this model by building up the platform, Fig. 305A, the tie strips 1 being left off as shown in order to be able to insert the rising and falling tower, Fig. 305B. The strips are then bolted on. The guide strips 2 are bolted to the girder 3 of the tower with washers beneath the strips. This gives the necessary clearance and enables the strips to rise easily up the faces of the girders 4 of the fixed lower part of the tower. The tower is raised by means of a cord which passes over a pulley 5 and is fastened to a rod 6, the other end of the cord winding on a rod 7 rotated by a hand wheel 8 on the spindle of the worm 9.



These Models can be made with MECCANO Outfit No. 3, or No. 2 and No. 2A.

### Model No. 306 Letter Balance

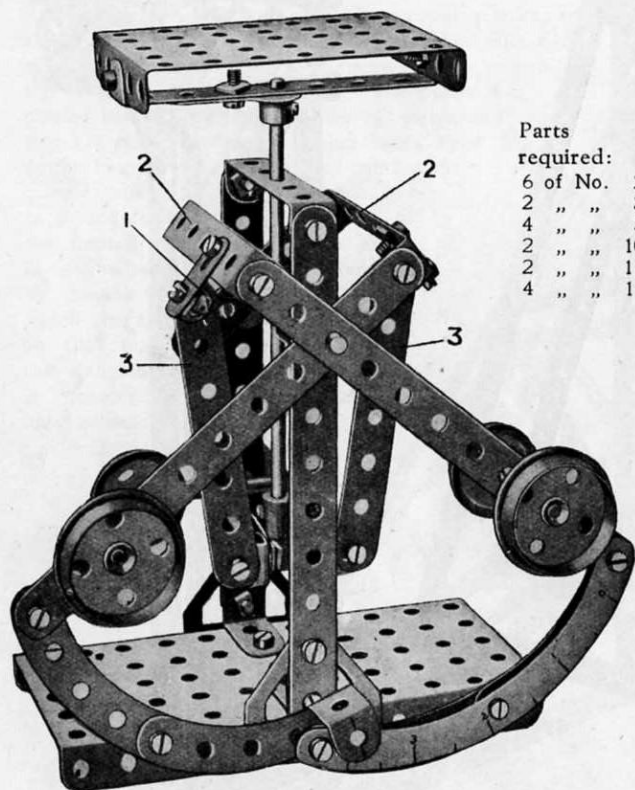

Parts  
required:  
6 of No. 2  
2 " " 3  
4 " " 5  
2 " " 10  
2 " " 11  
4 " " 12

The connection at 1 of the rocking arms 2 to the thrust strips 3 is locknuttled to give a free pivotal action, and similarly the pivotal connections 5 of the strips 3 to the lever strips 4 are locknuttled to give free play.

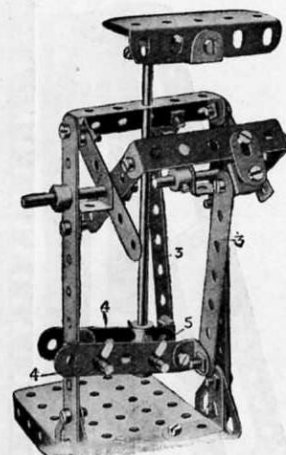



FIG. 306A

2 of No. 12A  
1 " " 15  
2 " " 17  
2 " " 18A  
2 " " 20  
2 " " 22  
4 " " 35  
40 " " 37  
6 " " 38  
3 " " 48A  
1 " " 48B  
1 " " 52  
1 " " 53  
4 " " 59  
1 " " 62  
1 " " 63  
4 " " 90  
2 " " 125A  
2 " " 126

Parts  
required:  
2 of No. 3  
2 " " 5  
4 " " 11  
4 " " 12  
2 " " 15  
2 " " 19  
1 " " 19B  
4 " " 20  
4 " " 22  
3 " " 35  
37 " " 37  
1 " " 46  
8 " " 48A  
2 " " 52  
3 " " 53  
2 " " 59  
1 " " 63  
1 " " 116  
4 " " 125

### Model No. 307
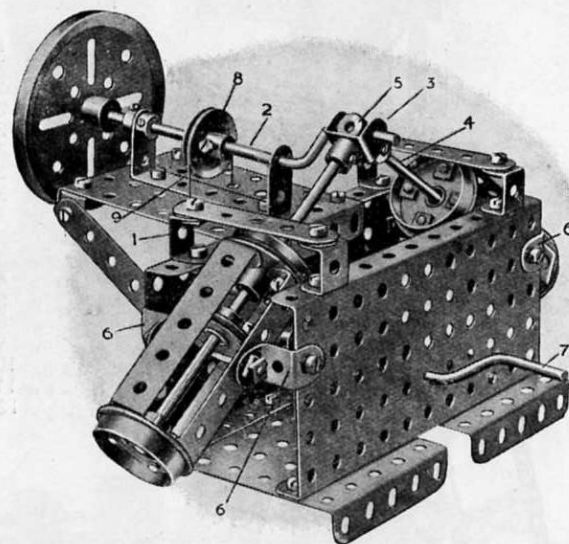
### Oscillating Steam Engine



The piston rod of one cylinder is pivotally connected to the crank rod 2 by means of a fork piece 3, and the piston rod 4 of the other cylinder is pivoted to the crank rod by a coupling 5. The cylinders consisting of four strips are enclosed by flanged wheels at the ends, and are pivoted on  $\frac{1}{2}$ " reversed brackets 6. The model is operated from the handle rod 7, a pulley on the rear end of which is coupled to the pulley 8 by a cord 9.

1 ar  
2 up  
the  
rotat  
gear  
to b  
the  
are p  
5 in  
jour

2 of  
4 "  
8 "

These Models can be made with MECCANO Outfit No. 3, or No. 2 and No. 2A.

43

### Model No. 308 Railway Wagon Swivel Crane

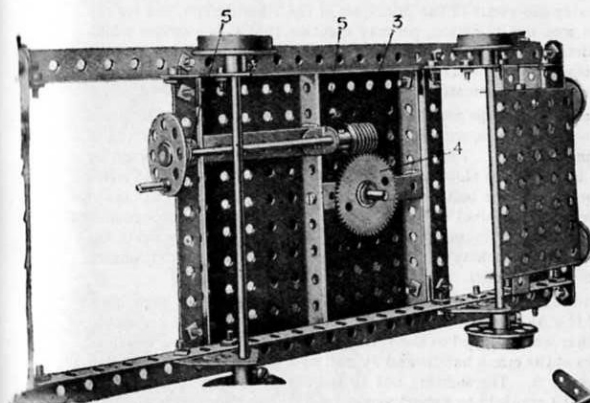




FIG. 308A

The flanges of the sector plates 1 are bolted to the 3" pulley wheel 2 upon which the crane swivels, and the spindle of the pulley wheel is rotated by the worm 3 engaging the gear wheel 4 (Fig. 308A). In order to bring the worm centrally over the teeth of the gear wheel 4, washers are placed beneath the angle brackets 5 in which the spindle of the worm is journaled.

### Model No. 309 Chinese Palanquin

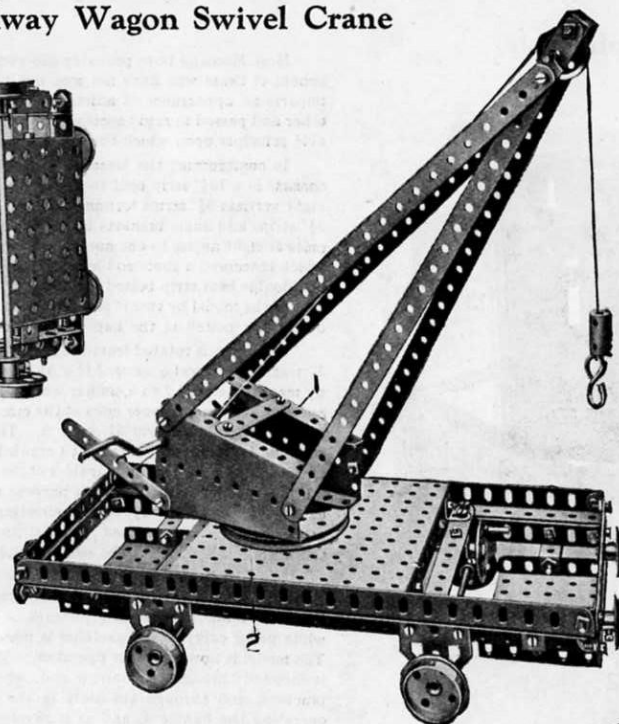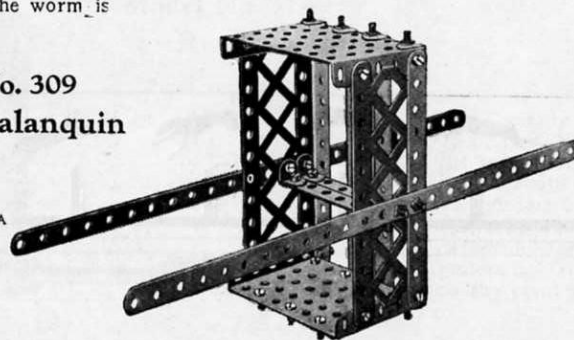Parts required:

2 of No. 1	30 of No. 37
4 " " 2	2 " " 48A
8 " " 12	2 " " 53
2 of No. 100	




Parts required:

4 of No. 1	1 of No. 19	2 of No. 38
6 " " 2	1 " " 19B	2 " " 48A
1 " " 3	4 " " 20	2 " " 52
2 " " 5	4 " " 22	2 " " 53
4 " " 8	1 " " 22A	2 " " 54
1 " " 11	1 " " 24	1 " " 57
14 " " 12	1 " " 27A	3 " " 59
2 " " 15	1 " " 32	1 " " 63
1 " " 15A	3 " " 35	1 " " 115
2 " " 17	70 " " 37	4 " " 125
		4 " " 126A


### Model No. 310 Crossbow

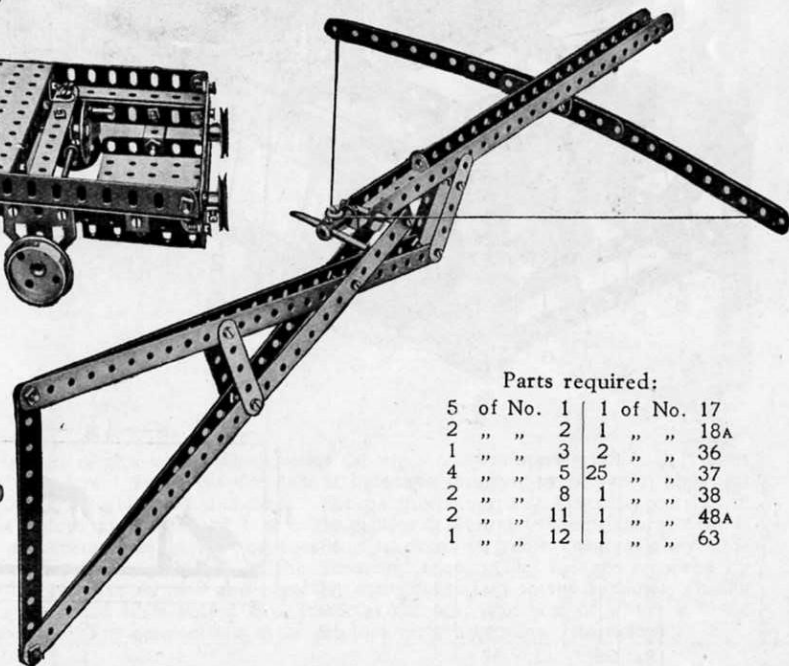Parts required:

5 of No. 1	1 of No. 17
2 " " 2	1 " " 18A
1 " " 3	2 " " 36
4 " " 5	25 " " 37
2 " " 8	1 " " 38
2 " " 11	1 " " 48A
1 " " 12	1 " " 63



## Model No. 311 Kinetograph

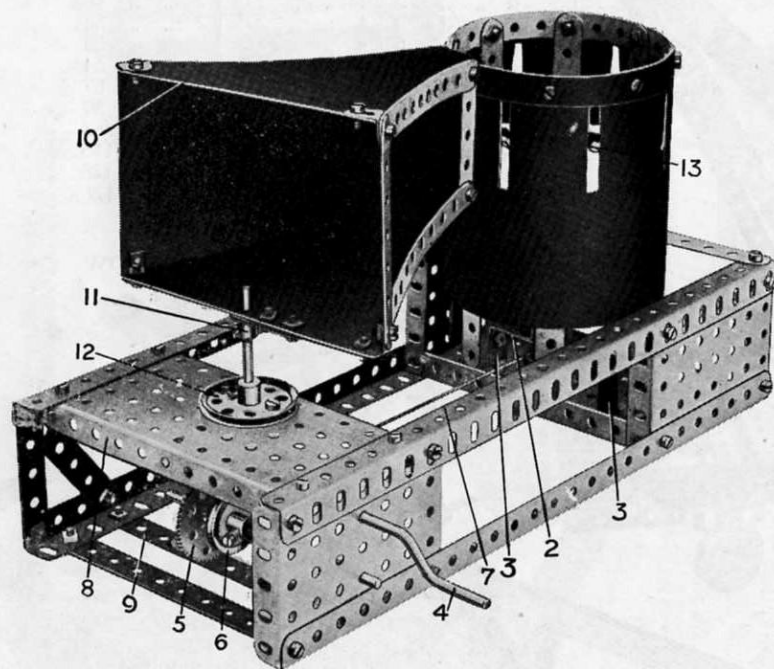

Most Meccano boys probably are aware of the principles of the Kinetograph, but for the benefit of those who have not seen one in action, we may mention that it is a device which imparts an appearance of animation to a series of pictures, each differing slightly from the other and passed in rapid succession before the eyes. In this respect it resembles the remarkable principle upon which the modern cinematograph is based.

In constructing the Meccano model the following details will prove useful:—The drum consists of a  $12\frac{1}{2}$ " strip bent to form a circle, with its ends overlapping one hole, and bolted to eight vertical  $5\frac{1}{2}$ " strips forming the sides. Two pairs of opposite  $5\frac{1}{2}$ " strips are connected by  $3\frac{1}{2}$ " strips and angle brackets bolted in the third holes from their lower ends. The  $3\frac{1}{2}$ " strips cross at right angles to one another and are bolted in the centre to a bush wheel, in the boss of which is secured a short rod forming the pivot of the revolving drum. This rod is journaled in a double bent strip bolted to a  $2\frac{1}{2}$ "  $\times$   $1$ " double angle strip 2. This, in turn, is secured to the base of the model by two  $1$ "  $\times$   $1$ " angle brackets 3. A further bearing for the short rod consists of a crank bolted in the base of the model.

The drum is rotated from the crank handle 4, on which is mounted a  $\frac{1}{4}$ " pinion engaging a 57-teeth gear wheel 5 secured to a  $3\frac{1}{2}$ " rod carrying a pulley wheel 6. The latter is connected by means of a cord 7 to a similar wheel nipped to the vertical spindle of the drum. Bearings are provided for the inner ends of the crank handle and  $3\frac{1}{2}$ " rod by a double angle strip bolted between the plate 8 and  $5\frac{1}{2}$ " strip 9. The sighting box 10 is built up from a framework of strips and is secured by means of a crank 11 to a short vertical rod rigidly mounted in the boss of the  $1\frac{1}{2}$ " pulley 12. The four sides of the framework 10 are covered with some black material; stiff black paper suitable for this purpose may be obtained from any stationers. The drum is enclosed in the same way, but the covering paper should be cut in a strip measuring  $12\frac{1}{2}$ "  $\times$   $4\frac{1}{2}$ " and pierced with slots spaced  $1\frac{1}{4}$ " apart (from centre to centre) so that they fall exactly between the upright  $5\frac{1}{2}$ " strips. The slots should measure  $1\frac{1}{4}$ "  $\times$   $\frac{1}{4}$ ".

The type of drawing suitable for use in this model is shown in Fig. 311a, and the dimensions indicated therein should be followed carefully. No doubt Meccano boys will be able to devise numerous amusing pictures of a similar kind for themselves. The strip of stout white paper carrying the sketches is inserted in the bottom of the drum, as indicated at 13. The model is now ready for operation. Placing the frame 10 over the eyes, the line of vision is directed through the narrow end, where the strips are held apart by means of double brackets, and through the slots in the drum. The latter should be rotated rapidly by operating the handle 4, and as it revolves, the little dog shown in Fig. 311a will be seen jumping over the fence with a most realistic and amusing action.

## Parts required:

1 of No. 1	1 of No. 15A	12 of No. 38
17 " " 2	2 " " 16	1 " " 45
6 " " 3	1 " " 19	1 " " 46
1 " " 4	1 " " 21	1 " " 48A
3 " " 5	2 " " 22	2 " " 52
4 " " 8	1 " " 24	3 " " 53
2 " " 11	1 " " 26	4 " " 59
12 " " 12	1 " " 27A	2 " " 62
2 " " 12A	28 " " 37	


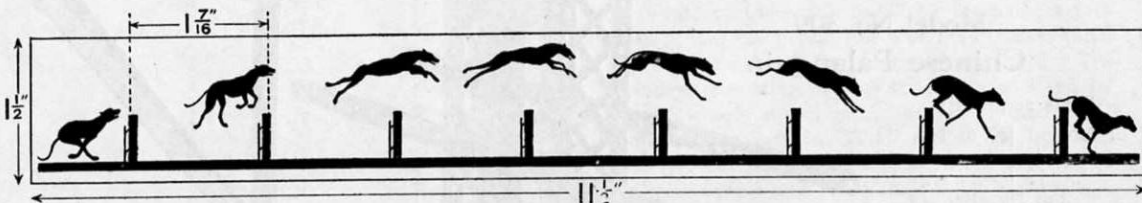


FIG. 311A

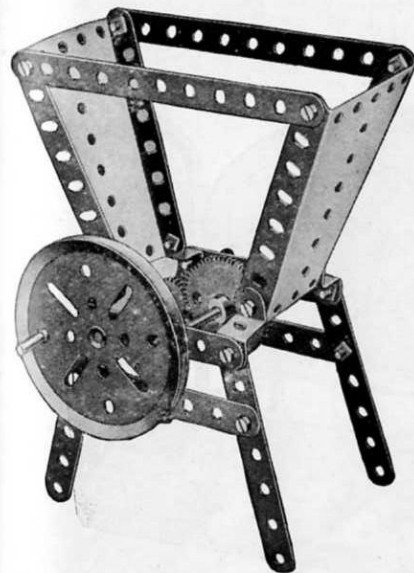


These Models can be made with MECCANO Outfit No. 3, or No. 2 and No. 2A.

### Model No. 312 Coffee Grinder



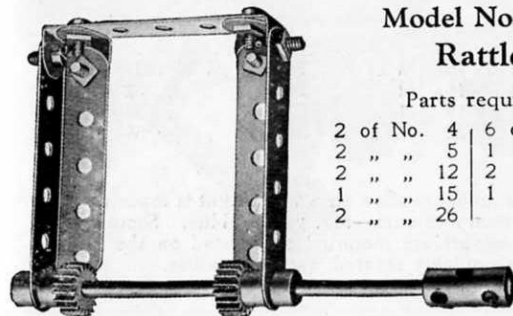Parts required:	
2 of No.	2
6 " "	3
2 " "	4
2 " "	16
1 " "	19B
1 " "	26
1 " "	27A
16 " "	37
2 " "	54
3 " "	59
1 " "	115
4 " "	125


### Model No. 314 Rattle



Parts required:	
2 of No.	4
2 " "	5
2 " "	12
1 " "	15
2 " "	26
6 of No.	37
1 " "	48A
2 " "	59
1 " "	63

### Model No. 313 Demonstration Scales

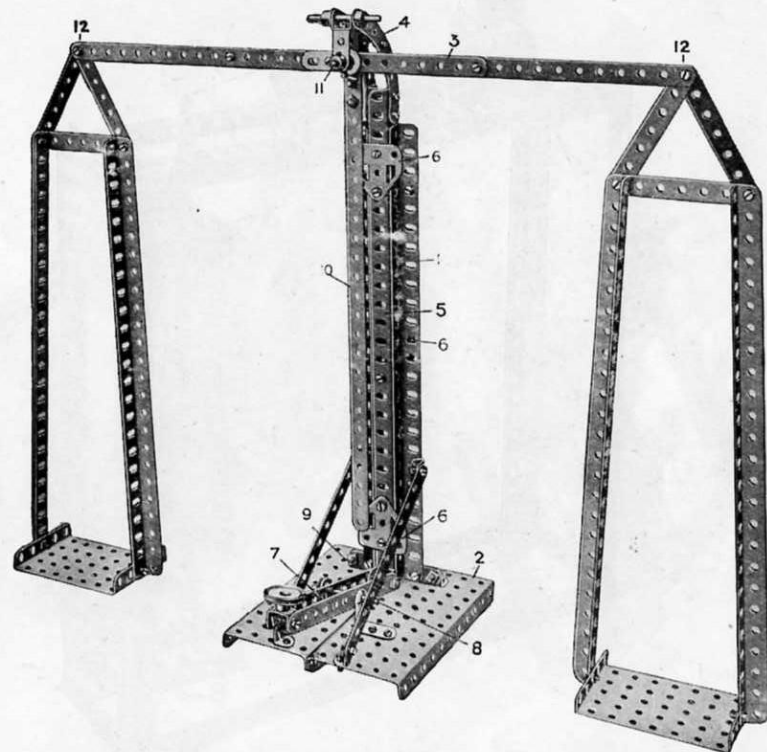
Parts required:	
3 of No.	1
4 " "	2
6 " "	3
1 " "	4
2 " "	5
8 " "	8
4 " "	11
6 " "	12
2 " "	12A
2 " "	17
1 " "	18A
1 " "	22
2 " "	35
58 " "	37
1 " "	44
2 " "	52
2 " "	53
2 " "	59
2 " "	62
4 " "	90
1 " "	125
3 " "	126A



The only feature of this model which needs description is the standard, which is built up of two angle girders 1 bolted to the base 2 by angle brackets and spaced apart at the top by a  $2\frac{1}{2}$ " strip obliquely disposed. The balance lever 3 is pivotally carried in curved strips 4 bolted to the top of two angle girders 5 sliding between the girders 1. The girders 5 are themselves bolted together and in order to guide them as they slide vertically flat trunnions 6 are bolted at the front and rear. The balance is raised by depressing the lever 8 pivoted at 9 and pivotally connected at 11 to the vertically sliding girders 5. The indicator 10 is bolted to a crank at the rear, the boss of which is fitted on the pivot rod 11. The connections at 12 are lock-nutted to allow free action.

These Models can be made with MECCANO Outfit No. 3, or No. 2 and No. 2A.

### Model No. 315 Drop the Nigger

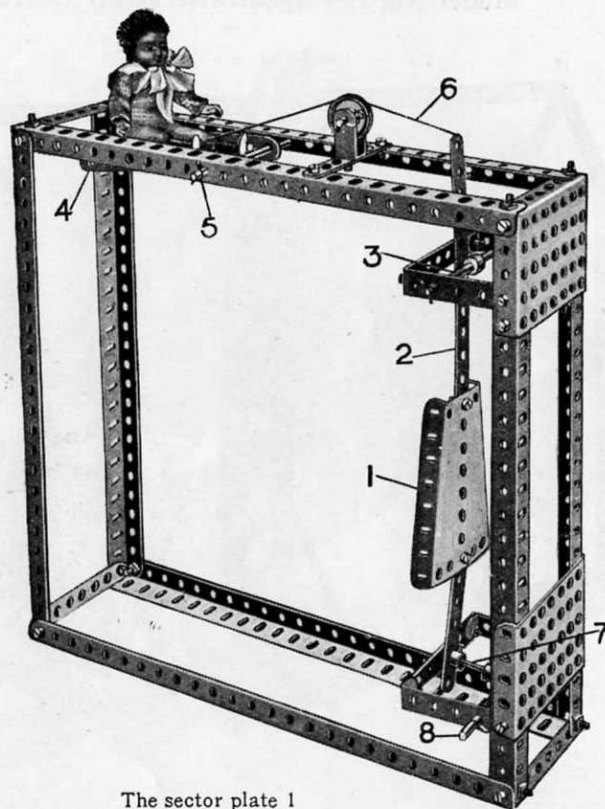


#### Parts required:

1 of No.	1
6 " "	3
8 " "	8
1 " "	12
3 " "	15A
1 " "	17
1 " "	22
6 " "	35
33 " "	37
1 " "	44
4 " "	48A
2 " "	53
2 " "	54
3 " "	59
1 " "	63

The sector plate 1 is a target, which, when hit, allows the nigger to be dropped. The plate 1 is carried on the strip 2 pivoted at 3, and the weight of the nigger supported on another sector plate 4 pivoted at 5 by means of the cord 6 keeps the lower end of the strip 2 hard against a short rod 7 pivoted at 8. When the target is hit and knocked back the rod 7 is released and falls about its pivot, allowing the sector plate 4 with the nigger to drop.
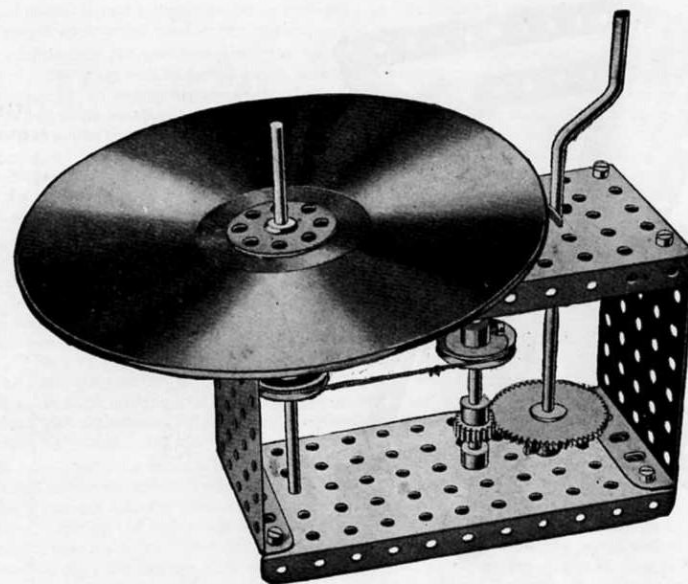
### Model No. 316 Newton's Disc



#### Parts required:

1 of No. 15	1 of No. 24	8 of No. 37
1 " " 15A	1 " " 26	2 " " 52
1 " " 19	1 " " 27A	2 " " 53
2 " " 22	2 " " 35	4 " " 59

This is a model to show that white light is made up of the three primary colours—red, yellow, blue. Sectors of these three colours are mounted or painted on the disc, which, if then quickly rotated, shows as white.

This Model can be made with MECCANO Outfit No. 3, or No. 2 and No. 2A.

### Model No. 317 Railway Breakdown Crane

#### Parts required:

2 of No. 1	1 of No. 23	1 of No. 54
4 " " 2	1 " " 24	1 " " 57
4 " " 11	1 " " 26	2 " " 59
1 " " 12	1 " " 32	1 " " 63
3 " " 15A	4 " " 35	1 " " 115
1 " " 16	36 " " 37	4 " " 126A
2 " " 17	5 " " 38	1 " " 147A
1 " " 19	2 " " 48A	1 " " 147B
1 " " 19B	2 " " 48B	1 " " 148
4 " " 20	2 " " 52	
1 " " 22A	3 " " 53	

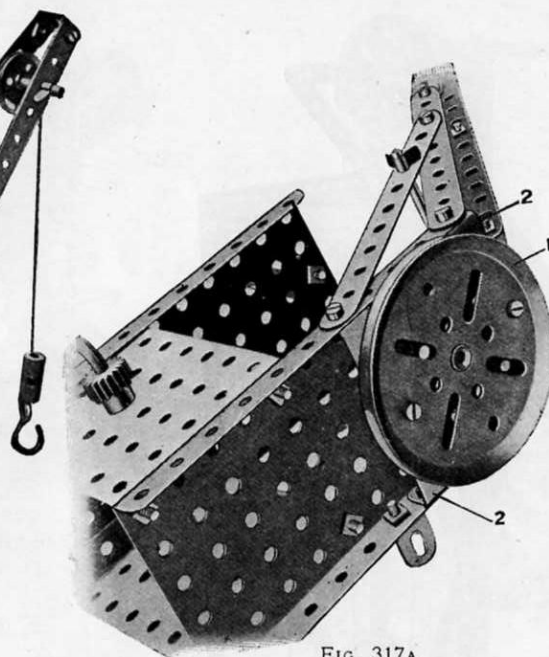
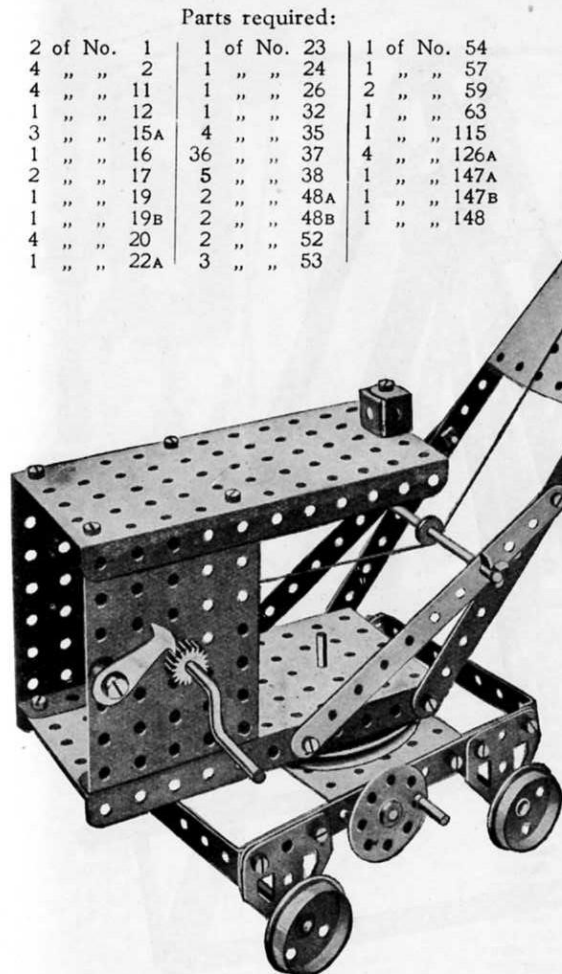


FIG. 317A

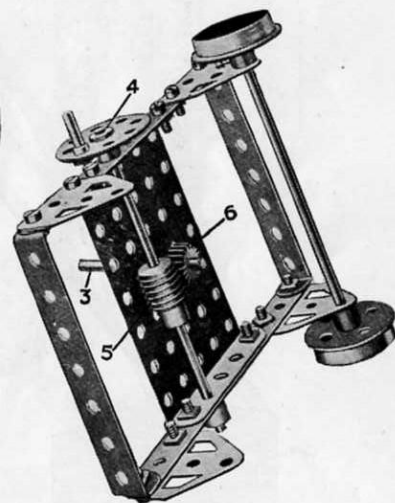


FIG. 317B


The swivelling action is obtained by bolting a 3" pulley 1 to double angle strips 2 on the jib frame. The boss of this wheel fits over the rod 3 and is secured to the rod. The hand wheel 4 rotates the worm 5, engaging the pinion 6 to swivel the jib.



## Model No. 318 Pit Head Gear
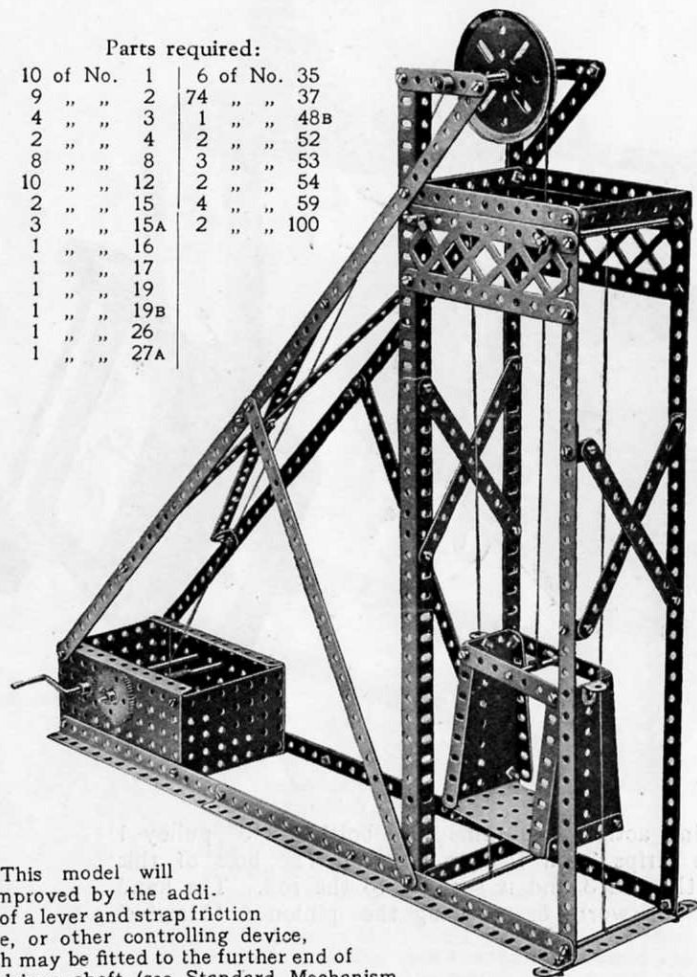
## Parts required:

10 of No.	1	6 of No.	35
9 "	2	74 "	37
4 "	3	1 "	48B
2 "	4	2 "	52
8 "	8	3 "	53
10 "	12	2 "	54
2 "	15	4 "	59
3 "	15A	2 "	100
1 "	16		
1 "	17		
1 "	19		
1 "	19B		
1 "	26		
1 "	27A		




This model will be improved by the addition of a lever and strap friction brake, or other controlling device, which may be fitted to the further end of the driven shaft (see Standard Mechanism No. 81).

## Model No. 319 Swing

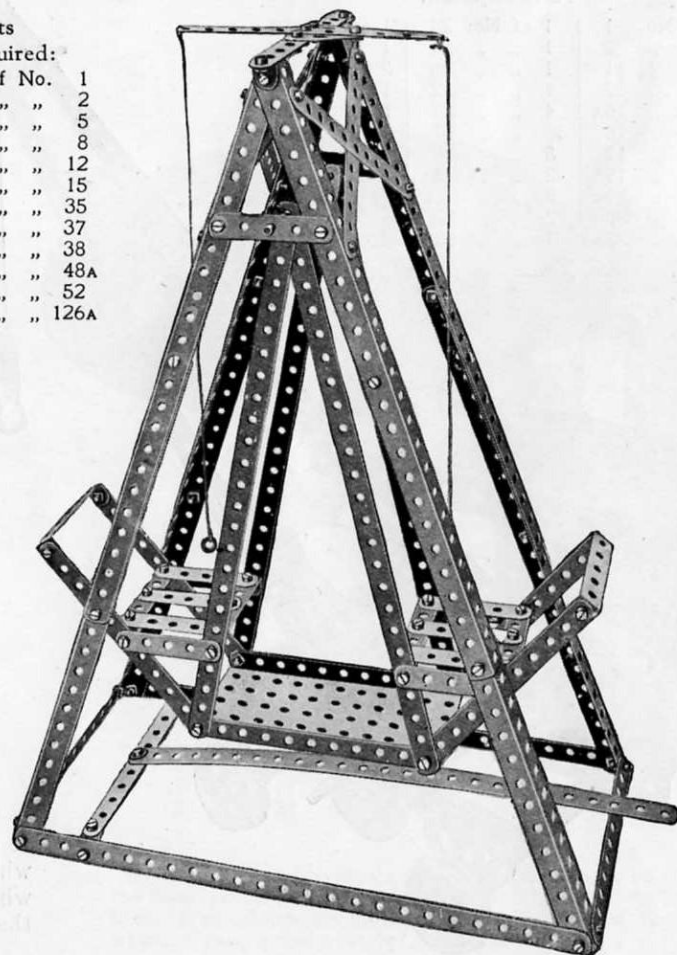
## Parts required:

7 of No.	1
13 "	2
12 "	5
8 "	8
4 "	12
1 "	15
6 "	35
69 "	37
4 "	38
6 "	48A
1 "	52
1 "	126A



2 of No.  
2 " "  
2 " "  
2 " "  
1 " "  
2 " "  
2 " "  
1 " "

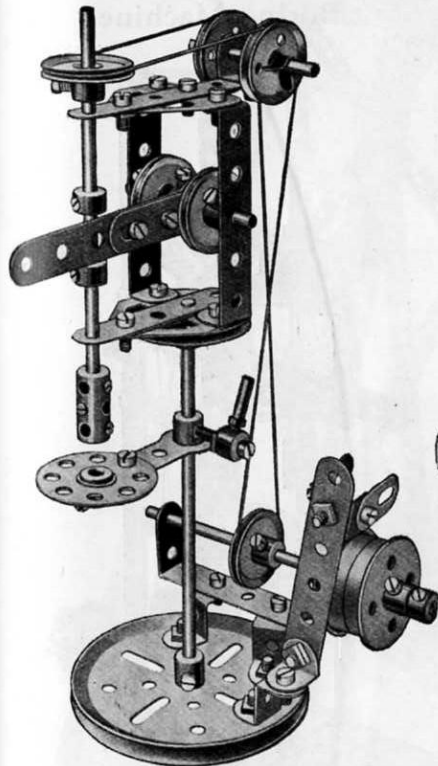
Model No. 320  
Drilling Machine



Parts required:

2 of No. 4	2 of No. 20	2 of No. 48A
2 " " 5	1 " " 21	5 " " 59
2 " " 10	4 " " 22	2 " " 62
2 " " 11	2 " " 22A	1 " " 63
1 " " 12	1 " " 24	1 " " 111
1 " " 15	2 " " 35	1 " " 115
2 " " 15A	21 " " 37	3 " " 125
2 " " 17	1 " " 44	2 " " 126A
1 " " 19B	1 " " 46	

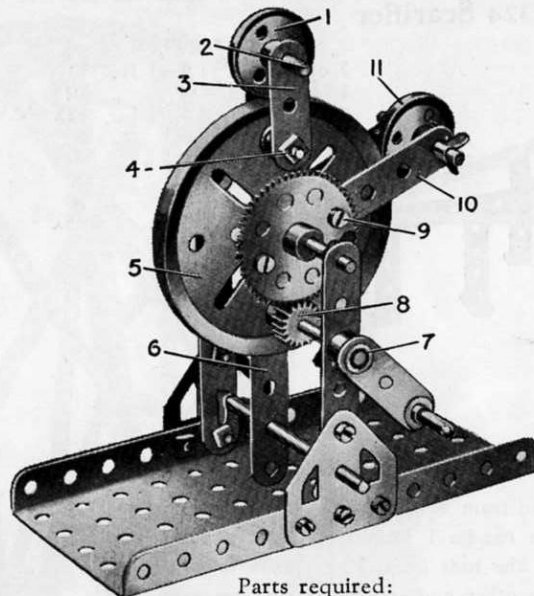Model No. 321 Strip-Bending Machine




Parts required:

1 of No. 2	2 of No. 18B	10 of No. 38
2 " " 3	1 " " 19B	1 " " 52
1 " " 4	2 " " 22A	4 " " 59
1 " " 5	1 " " 26	1 " " 62
1 " " 6A	1 " " 27A	1 " " 111
2 " " 16	6 " " 35	1 " " 115
1 " " 17	10 " " 37	2 " " 126A

This model represents a device for bending bars or rods of metal to circular form, and may be put to practical purpose in shaping strips of tin or similar material. A loose pulley 1 is spaced by a collar and washers in the centre of the short rod 2 journaled in a  $1\frac{1}{2}$ " strip 3. The latter is secured to the end of a  $\frac{1}{2}$ " bolt 4 and spaced away from the 3" pulley 5 by means of a number of washers. The opposite end of the rod is supported by a  $5\frac{1}{2}$ " strip 6. The handle 7 is secured to a  $3\frac{1}{2}$ " rod carrying a  $\frac{1}{2}$ " pinion 8. This engages with a 57-teeth gear wheel 9 mounted on another  $3\frac{1}{2}$ " rod which is free to revolve in the boss of the wheel 5. The gear wheel 9 carries a 3" strip 10 forming one of the bearings for a short rod carrying a second 1" loose pulley 11. The latter is also spaced by means of a collar and washers so that it lies immediately above the groove of the pulley wheel 5. The material to be shaped is passed between the two loose pulleys at the top of the wheel 5, and on rotation of the handle 7 the arm 10 is caused to move downward, so forcing the object to the same curvature as the circumference of the wheel.

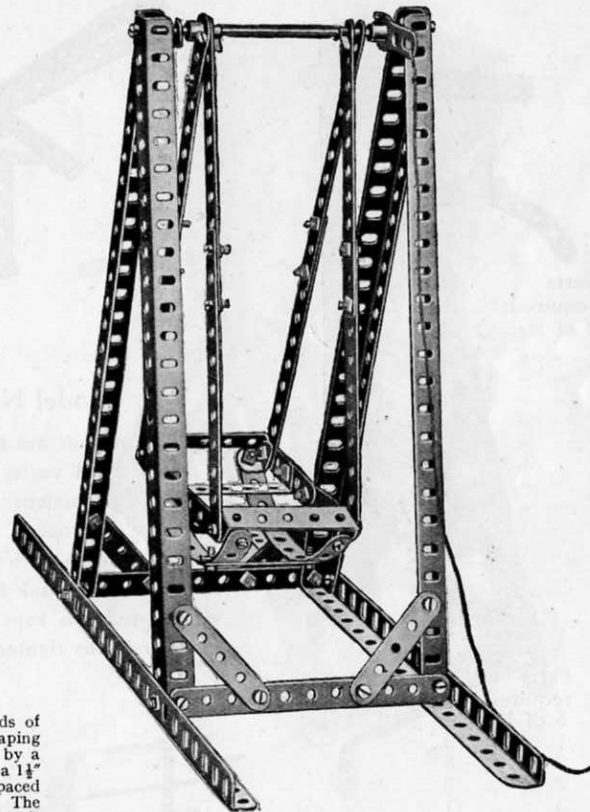Model No. 322 Swing




Parts required:

12 of No. 2	1 of No. 15
9 " " 5	2 " " 35
6 " " 8	43 " " 37
2 " " 11	4 " " 48A
4 " " 12	2 " " 62

These Models can be made with MECCANO Outfit No. 3, or No. 2 and No. 2A.

### Model No. 323 Railway Gauge

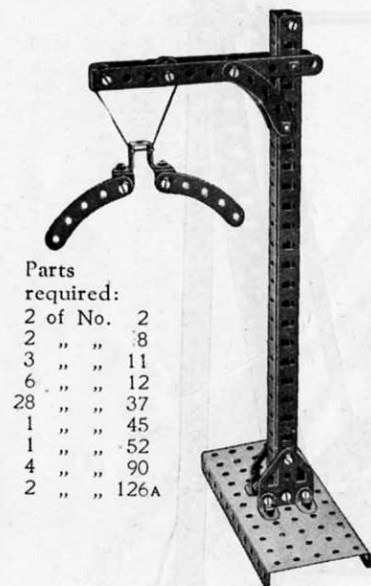

Parts


required:

2 of No.	2
2 " "	8
3 " "	11
6 " "	12
28 " "	37
1 " "	45
1 " "	52
4 " "	90
2 " "	126A

Parts  
required:

6 of No.	2
1 " "	3
2 " "	5
2 " "	8
3 " "	11
12 " "	12
2 " "	15
3 " "	15A
2 " "	19
4 " "	20
1 " "	24
2 " "	26
1 " "	27A
3 " "	35
50 of No.	37
1 " "	45
2 " "	48A
2 " "	52
3 " "	53
4 " "	59
2 " "	62
4 " "	126A

### Model No. 324 Scarifier

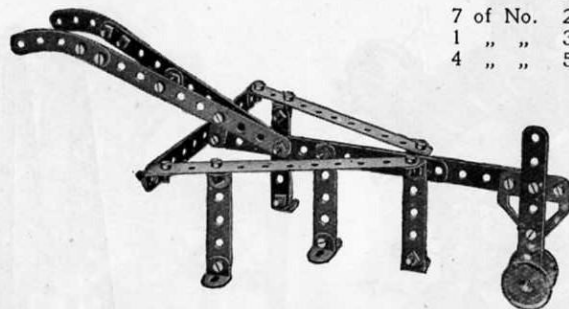


Parts required:


7 of No.	2	1 of No.	10
1 " "	3	14 " "	12
4 " "	5	1 " "	18A
		2 " "	22
		31 " "	37
		2 " "	38
		2 " "	90
		1 " "	126A

### Model No. 326 Wire Rope Maker

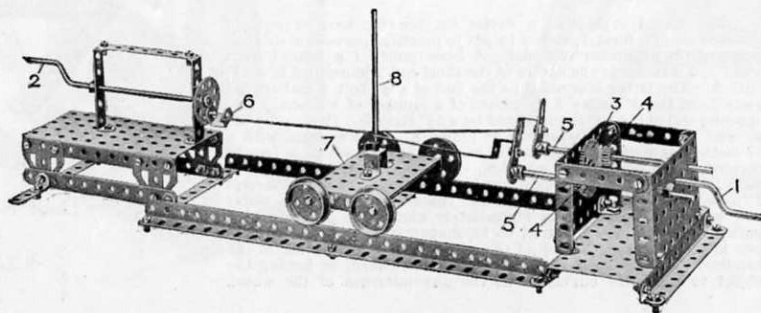The strands are twisted from both ends by the handles 1 and 2 of the fixed parts. The handle 1 rotates through a large gear wheel 3 two pinions 4 on the rods 5 carrying cranks to which the strands are attached. The other ends of the strands are connected to a double bracket 6 on a bush wheel which is rotated in the opposite direction by a crank handle 2. The carriage 7 runs on rails and the vertical rod 8 is kept just at the formation of the twisted rope and so controls the tightness of the twist.



### Model No. 325 Boring Machine

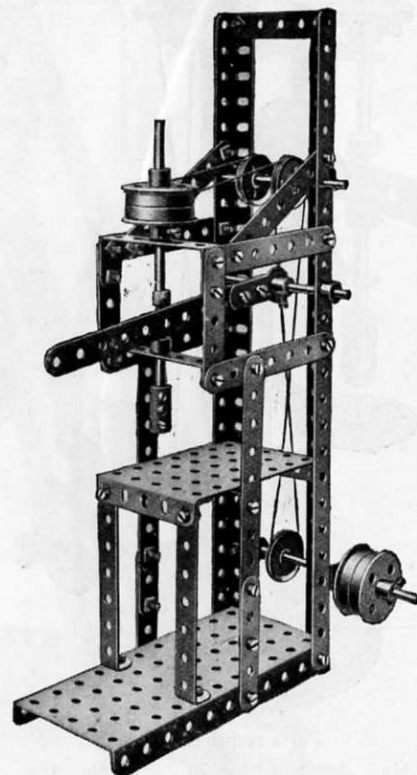


Parts required

3 of No.	2	4 of No.	20	2 of No.	48B
6 " "	3	1 " "	22	1 " "	52
5 " "	5	2 " "	22A	1 " "	53
2 " "	8	3 " "	35	4 " "	59
2 " "	11	38 " "	37	1 " "	62
2 " "	15	1 " "	46	1 " "	63
2 " "	16	2 " "	48A		



These Models can be made with MECCANO Outfit No. 3, or No. 2 and No. 2A.

### Model No. 327 Lawn Swing

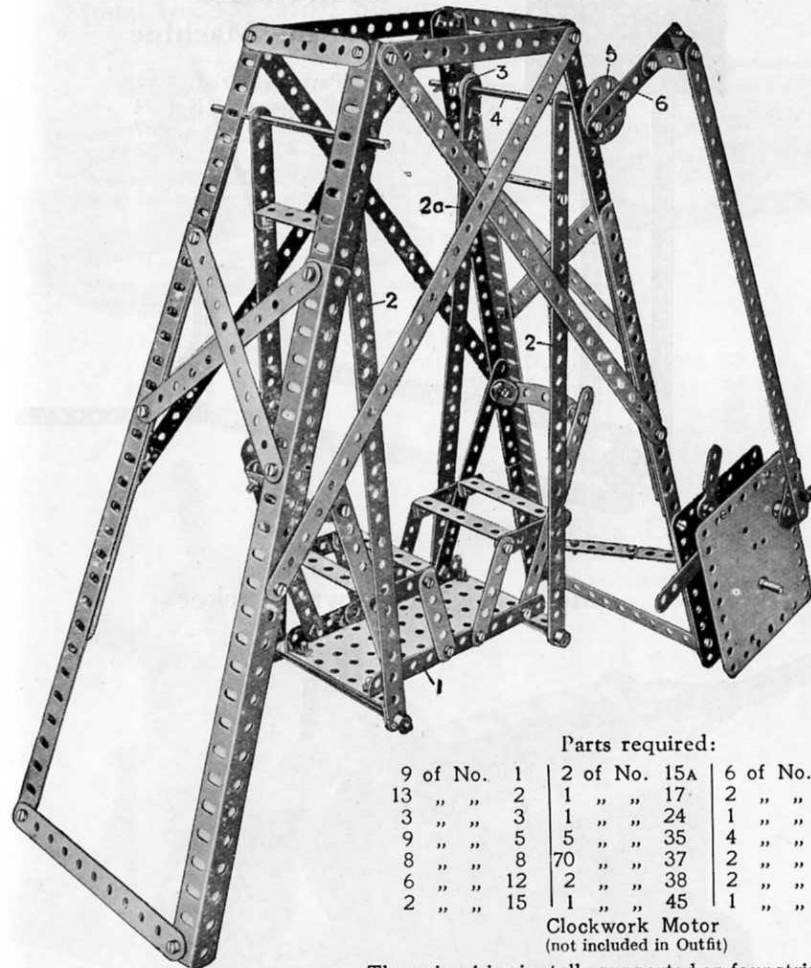


#### Parts required:

9 of No. 1	2 of No. 15A	6 of No. 48A
13 " " 2	1 " " 17	2 " " 48B
3 " " 3	1 " " 24	1 " " 52
9 " " 5	5 " " 35	4 " " 59
8 " " 8	70 " " 37	2 " " 62
6 " " 12	2 " " 38	2 " " 90
2 " " 15	1 " " 45	1 " " 115

Clockwork Motor  
(not included in Outfit)

The swing 1 is pivotally supported on four strips 2, the far strip 2a is connected at the top to a crank 3 which is bolted to a rod 4 and at the front end of this rod is a wheel 5 to which is bolted a strip 6 to the motor spindle.
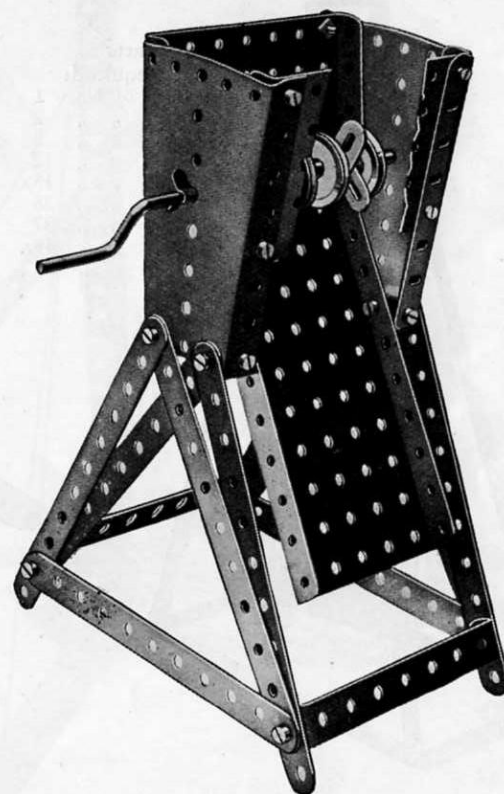
### Model No. 328 Oilcake Chopper




#### Parts required:

10 of No. 2	2 of No. 35
4 " " 10	20 " " 37
2 " " 12	2 " " 48B
1 " " 19	1 " " 52
4 " " 22	2 " " 53
2 of No. 54	

These Models can be made with MECCANO Outfit No. 3, or No. 2 and No. 2A.
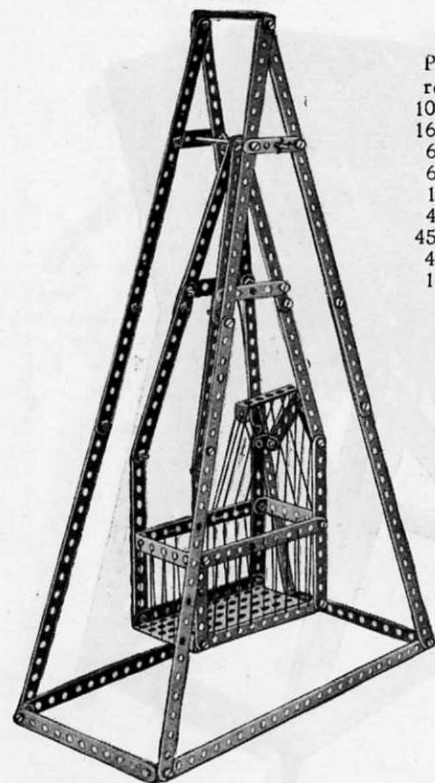
### Model No. 329 Swinging Cot



Parts required:


10 of No.	1
16 " "	2
6 " "	5
6 " "	12
1 " "	15A
4 " "	35
45 " "	37
4 " "	48A
1 " "	52

### Model No. 330 Drafting Machine



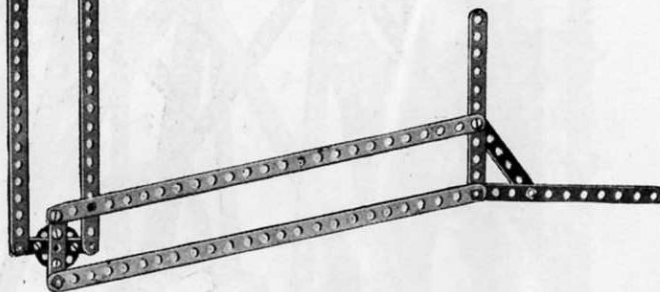Parts required:

4 of No.	1	1 of No.	24
3 " "	2	15 " "	37
1 " "	4	1 " "	52
2 " "	5		




### Model No. 331 Lawn Marker




Parts required:

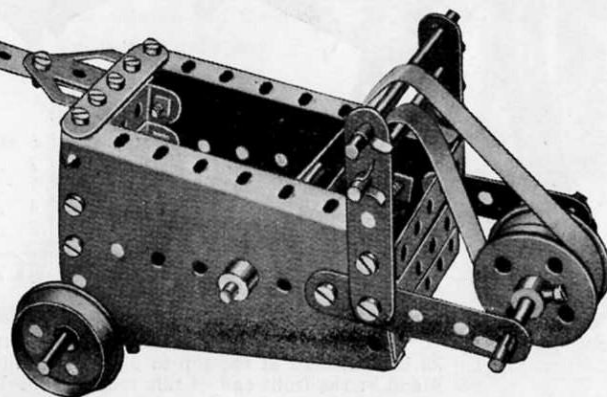1 of No.	2
6 " "	5
1 " "	15A
4 " "	16
4 " "	20
6 " "	35
21 " "	37
4 " "	48A
1 " "	53
2 " "	54
2 " "	59
1 " "	126A



These Models can be made with MECCANO Outfit No. 3, or No. 2 and No. 2A.

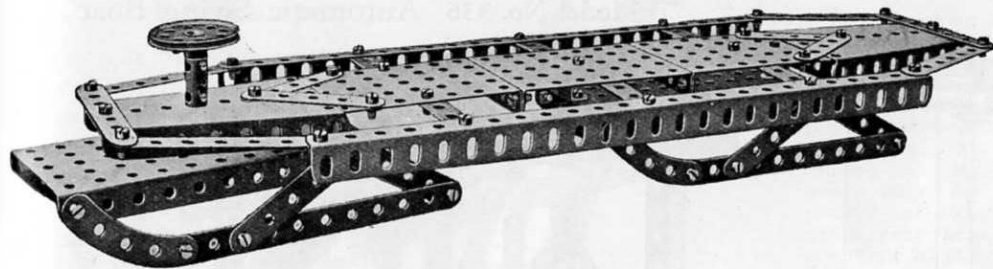
Model No. 332 Bob Sleigh



Parts required:

7 of No. 2	2 of No. 11	55 of No. 37	3 of No. 53
6 " " 3	1 " " 17	2 " " 38	2 " " 54
12 " " 5	1 " " 21	1 " " 45	1 " " 63
2 " " 8	1 " " 24	2 " " 52	4 " " 90

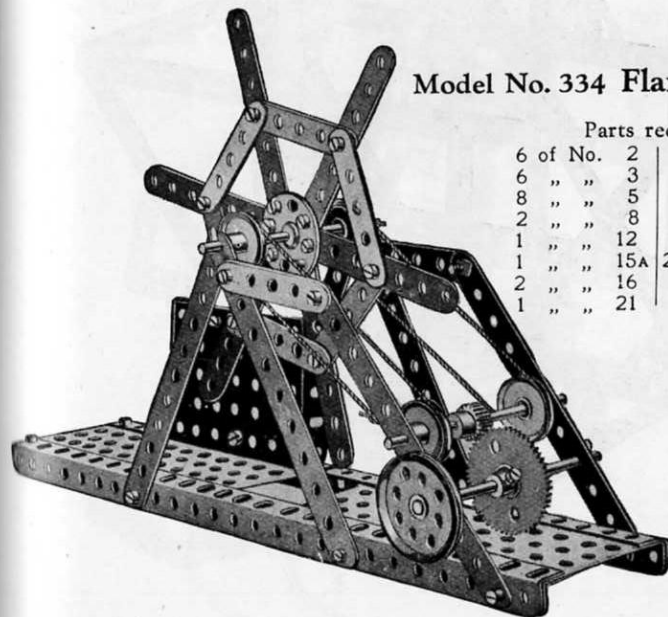
Model No. 334 Flax Cleaner



Parts required:

6 of No. 2	4 of No. 22
6 " " 3	1 " " 24
8 " " 5	1 " " 26
2 " " 8	1 " " 27A
1 " " 12	4 " " 35
1 " " 15A	26 " " 37
2 " " 16	2 " " 52
1 " " 21	1 " " 53

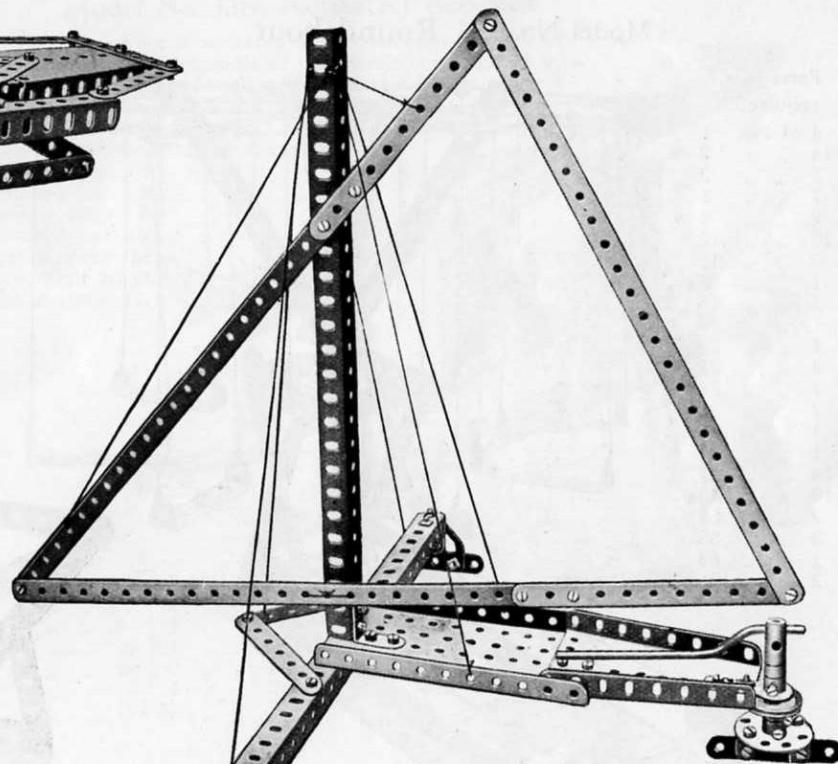Model No. 333 Ice Boat



Parts required:

3 of No. 1	1 of No. 22
2 " " 2	1 " " 24
2 " " 3	36 " " 37
3 " " 5	1 " " 52
2 " " 8	1 " " 54
2 " " 12	1 " " 59
3 " " 12A	1 " " 62
1 " " 17	1 " " 63
1 " " 19	2 " " 126A




These Models can be made with MECCANO Outfit No. 3, or No. 2 and No. 2A.

### Model No. 335 Roundabout

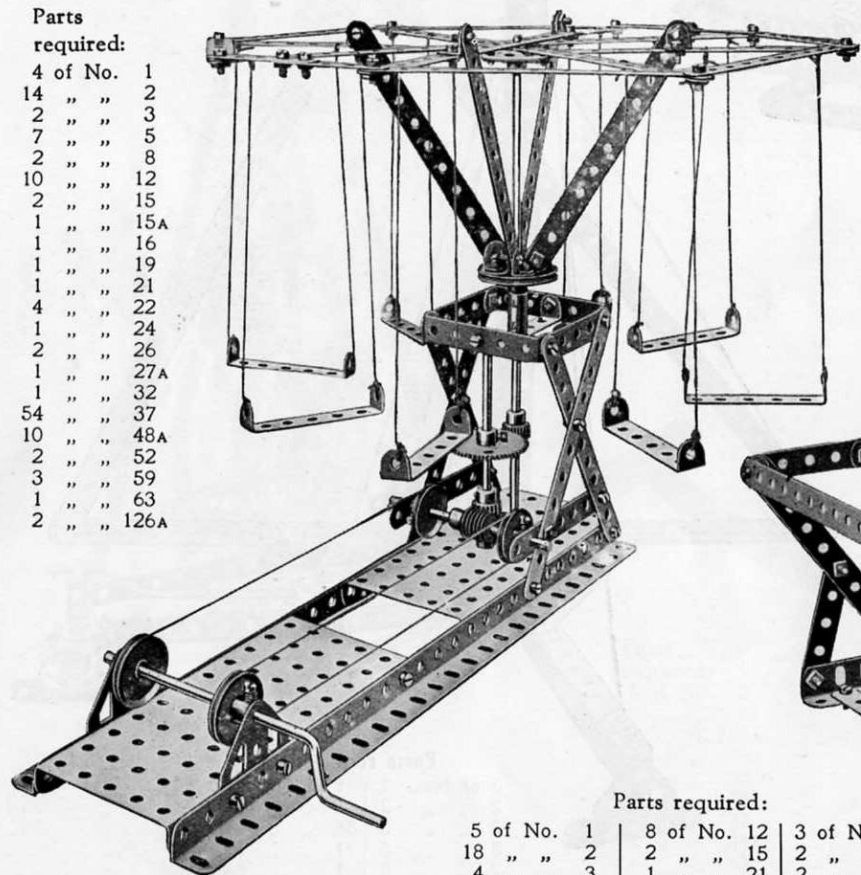Parts  
required:

4	of No.	1
14	" "	2
2	" "	3
7	" "	5
2	" "	8
10	" "	12
2	" "	15
1	" "	15A
1	" "	16
1	" "	19
1	" "	21
4	" "	22
1	" "	24
2	" "	26
1	" "	27A
1	" "	32
54	" "	37
10	" "	48A
2	" "	52
3	" "	59
1	" "	63
2	" "	126A




Parts required:

5 of No.	1	8 of No.	12	3 of No.	38
18 "	"	2 "	"	2 "	"
4 "	"	1 "	"	2 "	"
9 "	"	1 "	"	1 "	"
8 "	"	84 "	"	2 "	"
					126A

Clockwork Motor  
(not included in Outfit)


### Model No. 336 Automatic Swing Boat

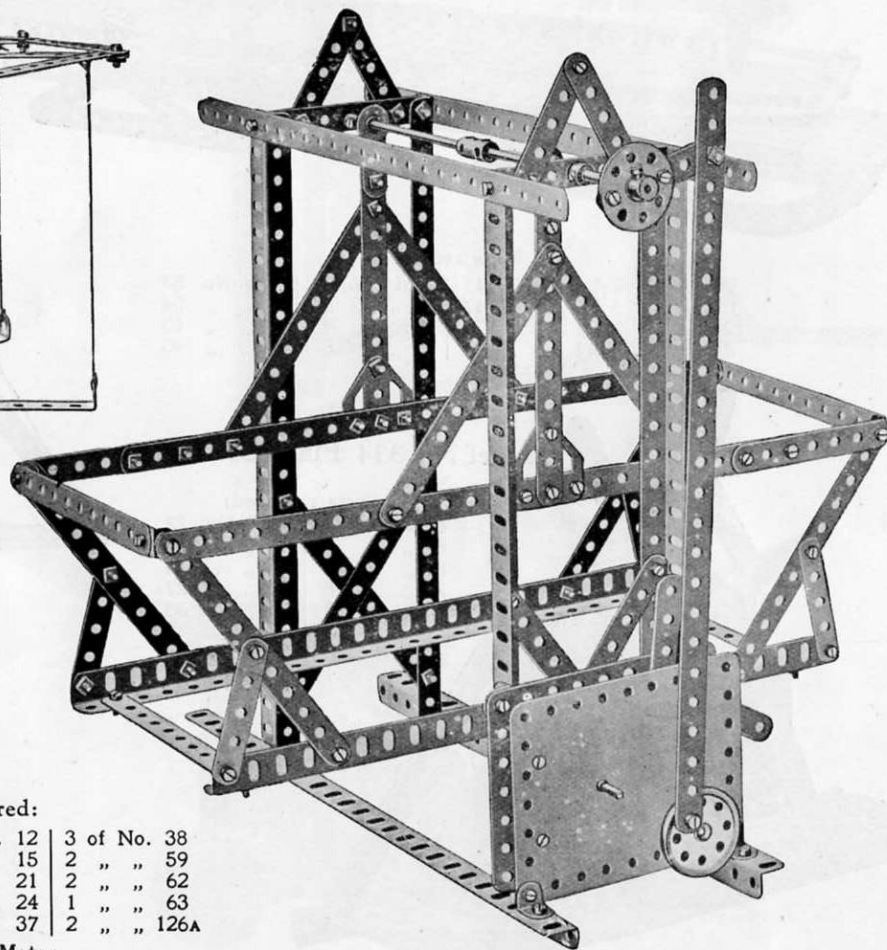

## Model No. 337

## Fire Escape

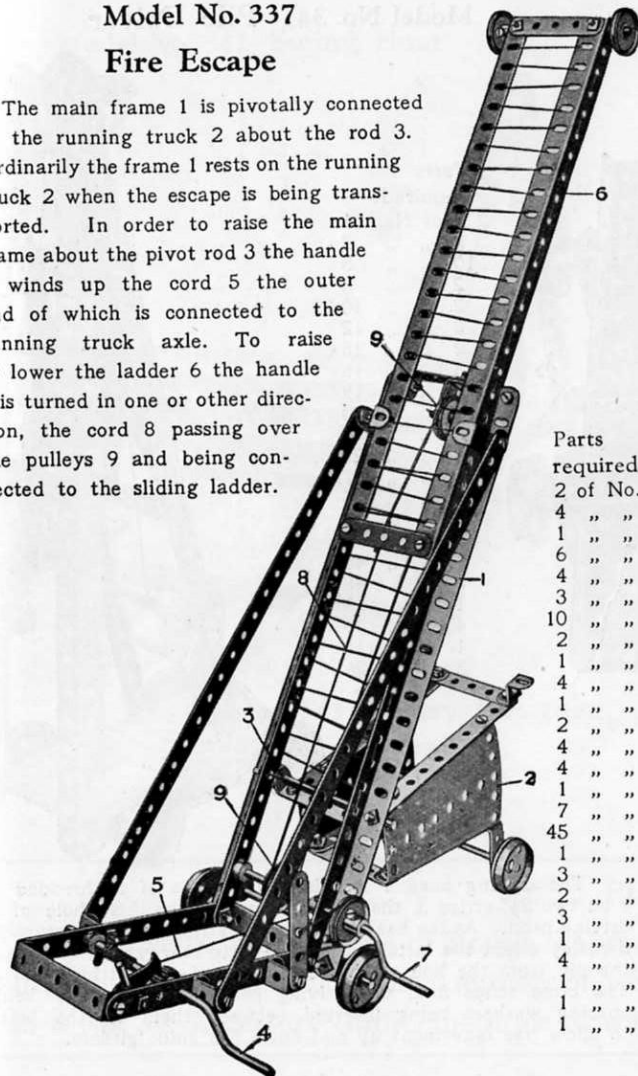The main frame 1 is pivotally connected to the running truck 2 about the rod 3. Ordinarily the frame 1 rests on the running truck 2 when the escape is being transported. In order to raise the main frame about the pivot rod 3 the handle 4 winds up the cord 5 the outer end of which is connected to the running truck axle. To raise or lower the ladder 6 the handle 7 is turned in one or other direction, the cord 8 passing over the pulleys 9 and being connected to the sliding ladder.




## Parts

## required:

2 of No.	1
4 " "	2
1 " "	3
6 " "	5
4 " "	8
3 " "	11
10 " "	12
2 " "	12A
1 " "	15A
4 " "	16
1 " "	18A
2 " "	19
4 " "	20
4 " "	22
1 " "	22A
7 " "	35
45 " "	37
1 " "	44
3 " "	48A
2 " "	54
3 " "	59
1 " "	115
4 " "	125
1 " "	147A
1 " "	147B
1 " "	148

## Model No. 338 Actuated See-Saw

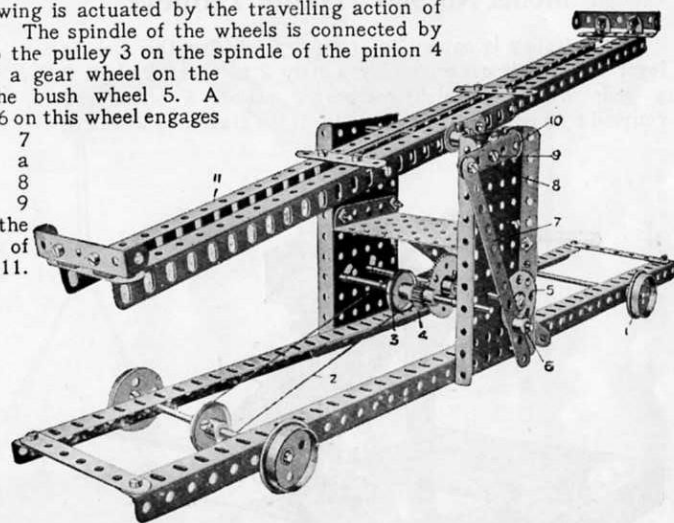The see-sawing is actuated by the travelling action of the wheels 1. The spindle of the wheels is connected by the cord 2 to the pulley 3 on the spindle of the pinion 4 which drives a gear wheel on the spindle of the bush wheel 5. A threaded pin 6 on this wheel engages the strip 7 coupled to a lever strip 8 pivoted at 9 which rocks the pivot rod 10 of the see-saw 11.



## Parts

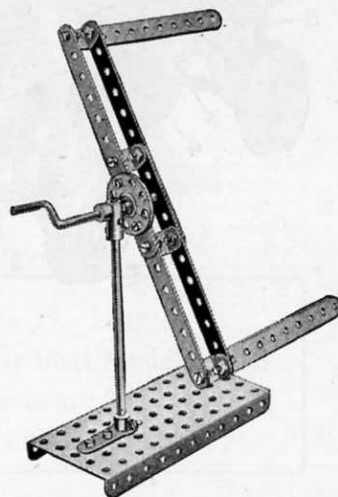
## required:

3 of No.	2	4 of No.	20	2 of No.	48
2 " "	3	2 " "	22	2 " "	52
5 " "	5	1 " "	24	1 " "	53
8 " "	8	1 " "	26	3 " "	59
4 " "	12	1 " "	27A	2 " "	62
2 " "	15	4 " "	35	1 " "	115
3 " "	15A	36 " "	37		

## Model No. 339 Lace Jennier


## Parts required:

8 of No.	2	14 of No.	37
4 " "	11	1 " "	52
1 " "	15	1 " "	59
1 " "	19	1 " "	62
1 " "	24	1 " "	63



### Model No. 340 Hand Trolley

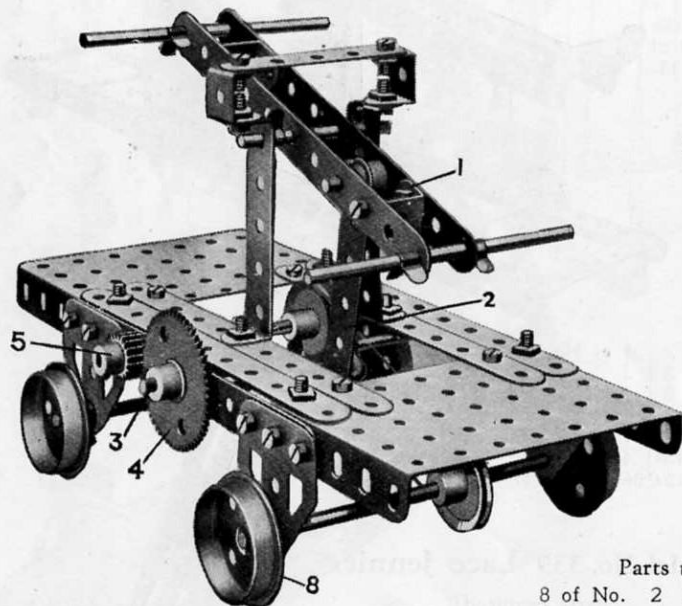The trolley is caused to travel by working the rocking lever 1 which is connected by a strip 2 to a crank shaft 3 a gear wheel 4 which meshes a pinion 5 on a rod coupled by a cord 6 to an axle rod 7 of the travelling wheels 8.



#### Parts required:

8 of No.	2	2 of No.	22
1 " "	4	1 " "	26
1 " "	5	1 " "	27A
4 " "	11	6 " "	35
3 " "	15A	30 " "	37
2 " "	16	2 " "	48A
1 " "	17	2 " "	53
1 " "	18A	4 " "	59
4 " "	20	4 " "	126A
1 of No. 134			

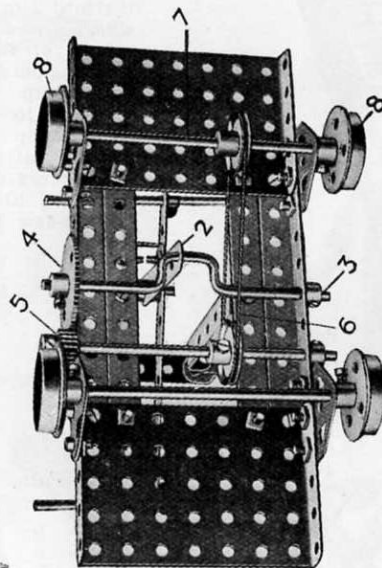



FIG. 340A

### Model No. 341 Pile Driver
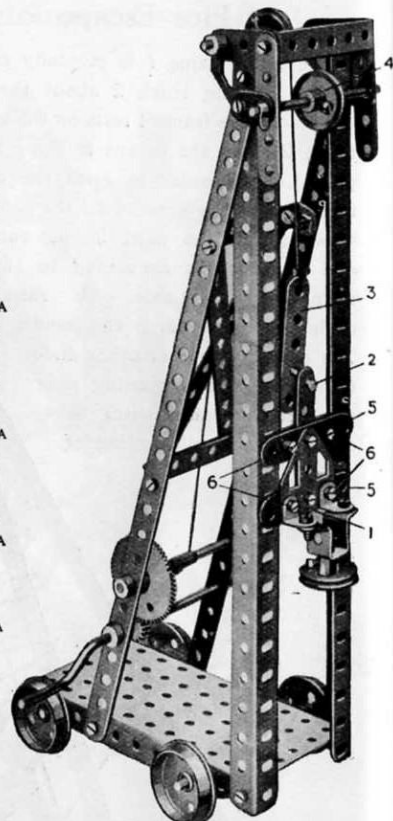
#### Parts

#### required:

2 of No.	1
2 " "	2
10 " "	5
2 " "	8
2 " "	10
2 " "	12
2 " "	15A
3 " "	16
1 " "	19
4 " "	20
3 " "	22
1 " "	26
1 " "	27A
2 " "	35
26 " "	37
4 " "	38
1 " "	45
3 " "	48A
1 " "	52
4 " "	59
1 " "	115
3 " "	126A



The driving head 1 is raised by means of a threaded pin 2 on two  $2\frac{1}{2}$ " strips 3, the pin engaging in the first hole of the driving head. As the head is raised, the strip 3 makes contact with a pulley 4 and the latter pushes the strip rearwardly, disengaging the pin from the hole on the driving head, permitting it to fall. The cross strips 5 of the driving head are duplicated behind, spacing washers being inserted between them on the bolts 6 to allow free movement up and down the guide girders.


These Models can be made with MECCANO Outfit No. 3, or No. 2 and No. 2A.

57

### Model No. 342 Swing Boat

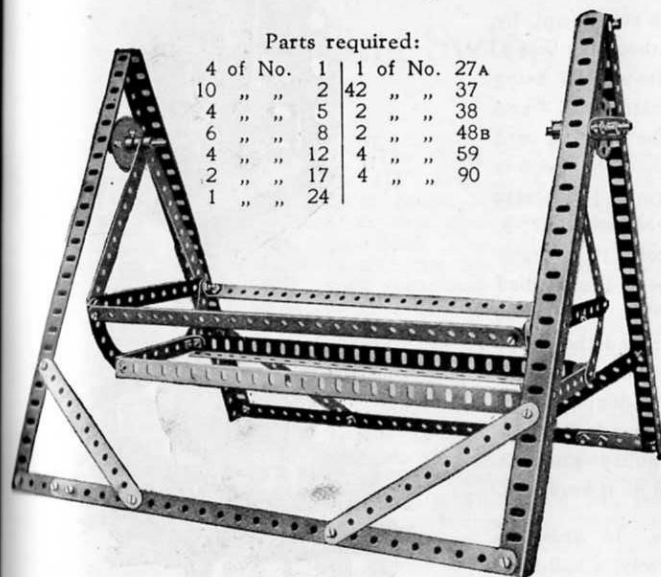Parts required:


4 of No.	1	1 of No.	27A
10 "	2	42 "	37
4 "	5	2 "	38
6 "	8	2 "	48B
4 "	12	4 "	59
2 "	17	4 "	90
1 "	24		



### Model No. 343 Pastry Designer

Parts required:

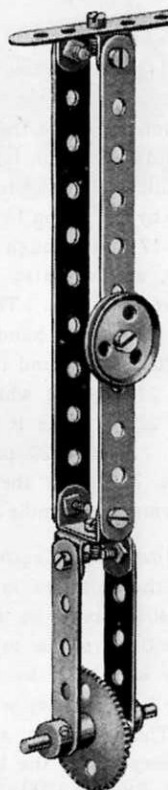
2 of No.	2	1 of No.	17	9 of No.	37
3 "	5	1 "	22A	2 "	59
3 "	11	1 "	27A		



### Model No. 344 Scales

Parts required:

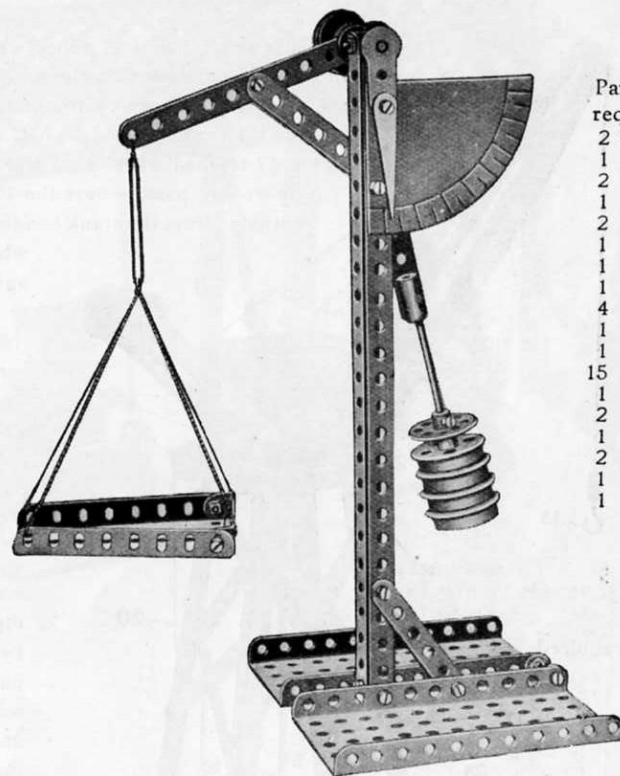2 of No.	2
1 "	3
2 "	4
1 "	5
2 "	8
1 "	11
1 "	15
1 "	17
4 "	20
1 "	22
1 "	24
15 "	37
1 "	48A
2 "	52
1 "	54
2 "	62
1 "	63
1 "	90




### HOW TO CONTINUE

This completes our examples of Models that may be made with MECCANO Outfit No. 3. The next Models are a little more advanced, requiring a number of extra parts to construct them. The necessary parts are all contained in a No. 3A Accessory Outfit, the price of which will be found in the List at the end of the Manual.



This Model can be made with MECCANO Outfit No. 4, or No. 3 and No. 3A.
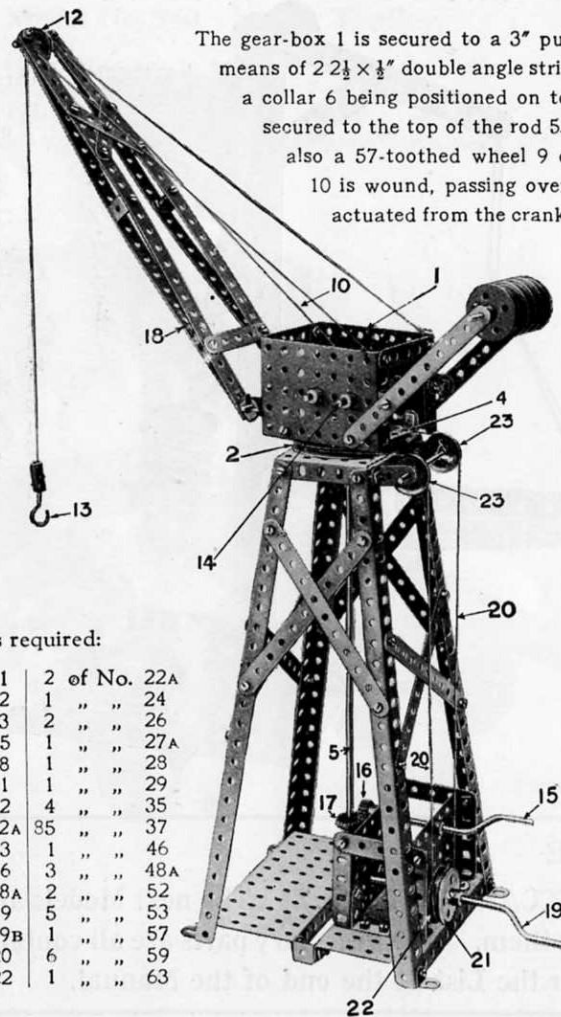
## Model No. 401 Elevated Jib Crane



### Parts required:

4 of No.	1	2 of No.	22A
10 "	2	1 "	24
1 "	3	2 "	26
8 "	5	1 "	27A
4 "	8	1 "	28
4 "	11	1 "	29
14 "	12	4 "	35
3 "	12A	85 "	37
1 "	13	1 "	46
5 "	16	3 "	48A
1 "	18A	2 "	52
2 "	19	5 "	53
1 "	19B	1 "	57
6 "	20	6 "	59
1 "	22	1 "	63

The gear-box 1 is secured to a 3" pulley wheel 2 (the boss 3 of which stands up), by means of 2  $2\frac{1}{2} \times \frac{1}{2}$ " double angle strips 4. The  $1\frac{1}{2}$ " rod 5 passes up through the boss 3, a collar 6 being positioned on top of the boss within, the contrate wheel 7 being secured to the top of the rod 5. A  $\frac{1}{2}$ " pinion 8 engages the contrate wheel 7 and also a 57-toothed wheel 9 on the rod 14 on which latter the hoisting cord 10 is wound, passing over the 1" pulley 12 to the hook 13. The rod 5 is actuated from the crank handle 15 by the pinion 16 engaging a  $\frac{3}{4}$ " contrate

wheel 17 and through the gear wheels 7, 8, and 9, and operates the cord 10 to raise or lower the load. The jib 18 is swivelled from the crank handle 19, a continuous cord 20 being wound twice round the flange wheel 21, against which is butted a bush wheel 22 to make it into a double flange pulley. A cord 20 passes round 1" guide pulleys 23 round the 3" pulley wheel 2. By turning the handle 19 the jib is swivelled.

*Alternative Construction.* In order to make the jib swivel more freely, a ball-race, Fig. 401B, may be fitted. This is made by bolting to the top of the frame a 3" pulley wheel 24 by bolts 25 which also secure in the pulley wheel 24 a wheel flange 26. This provides a circular groove for the reception of the ball bearings 27. The pulley wheel 2 which is bolted to the gear-box 1 is then placed over the rod 5 and rests on the ball bearings 27 to form a race.

(N.B.—The wheel flange and the balls for the bearing are not provided in this Outfit but can be bought separately. See parts list page).

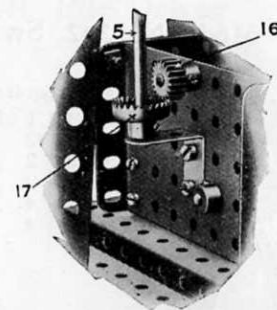


FIG. 401A

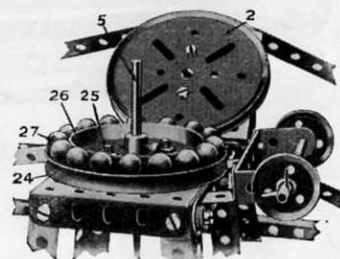


FIG. 401B

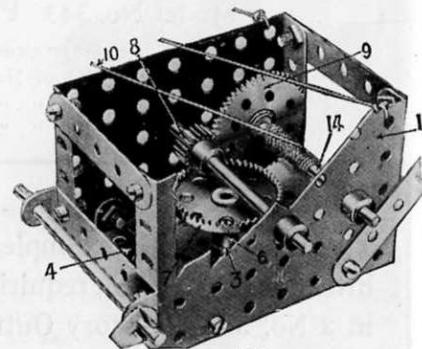


FIG. 401C

These Models can be made with MECCANO Outfit No. 4, or No. 3 and No. 3A.

59

### Model No. 402

## Alternating Swing


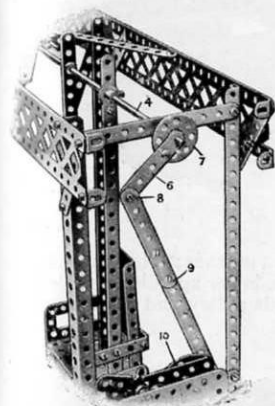


FIG. 402A

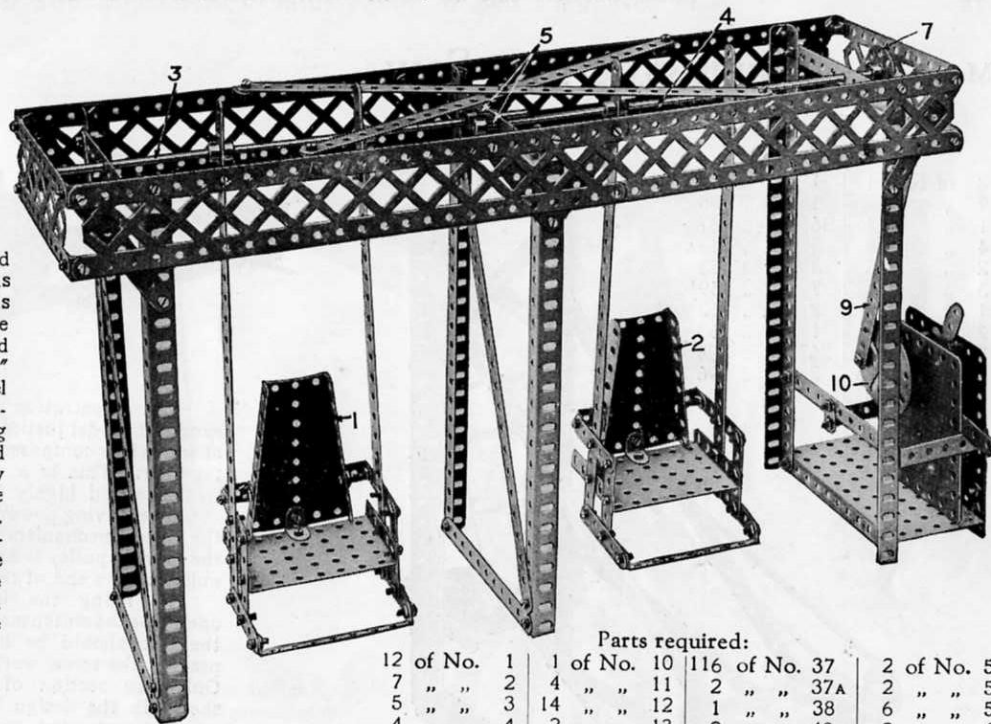The chairs 1, 2, are pivoted on  $11\frac{1}{2}$ " rods 3, 4, these rods being geared together by pinions 5, so that they turn in opposite directions. The rod 4 is turned to and fro by means of a  $2\frac{1}{2}$ " strip 6 connected to a bush wheel 7. The strip 6 is pivotally connected at 8 to a link 9 consisting of  $5\frac{1}{2}$ " and  $3\frac{1}{2}$ " strips overlapped three holes. This link is loosely bolted to a face plate 10 on the driven spindle 11 of the motor. As the spindle 11 rotates continuously in one direction, the swings are rocked in opposite directions. The model will run for five or ten minutes from one winding.




#### Parts required:

12 of No. 1	1 of No. 10	116 of No. 37	2 of No. 53
7 " " 2	4 " " 11	2 " " 37A	2 " " 54
5 " " 3	14 " " 12	1 " " 38	6 " " 59
4 " " 4	2 " " 13	2 " " 48A	2 " " 62
15 " " 5	1 " " 24	2 " " 48B	4 " " 99
6 " " 8	2 " " 26	1 " " 52	2 " " 100
1 of No. 109			

Clockwork Motor (not included in Outfit)
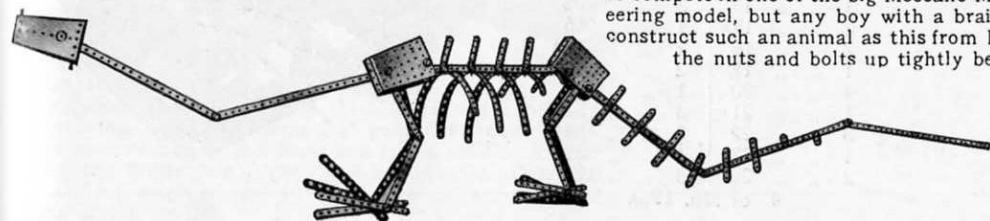
### Model No. 403 Diplodocus



This representation of a prehistoric animal is a most extraordinary effort sent in by a young French boy to compete in one of the big Meccano Model Building Competitions. We could scarcely class it as an engineering model, but any boy with a brain clever enough and an imagination lively enough to conceive and construct such an animal as this from Meccano parts deserved a good prize, so we awarded him one. Screw the nuts and bolts up tightly because the Diplodocus looks most dejected when he droops.


#### Parts required:

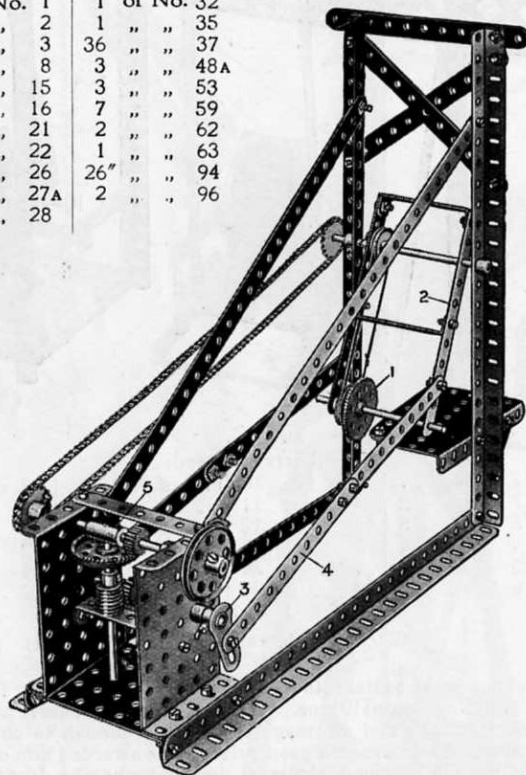1 of No. 1	1 of No. 8	40 of No. 37
7 " " 2	4 " " 10	4 " " 53
4 " " 3	1 " " 16	2 " " 54
8 " " 5	4 " " 17	8 " " 59
	2 " " 22	

## Model No. 404 Swinging Hot Saw


### Parts required:

2 of No. 1	1 of No. 32
9 " " 2	1 " " 35
1 " " 3	36 " " 37
4 " " 8	3 " " 48A
2 " " 15	3 " " 53
3 " " 16	7 " " 59
1 " " 21	2 " " 62
2 " " 22	1 " " 63
2 " " 26	26 " " 94
1 " " 27A	2 " " 96
1 " " 28	



The rotary driving motion in this model is caused to impart a to and fro movement to the swinging frame 2 carrying the circular saw 1 by means of the crank 3 and connecting strips 4. The coupling 5 is loose on the sprocket wheel spindle and forms a bearing for the spindle of the worm.

## Model No. 405 Cable Railway

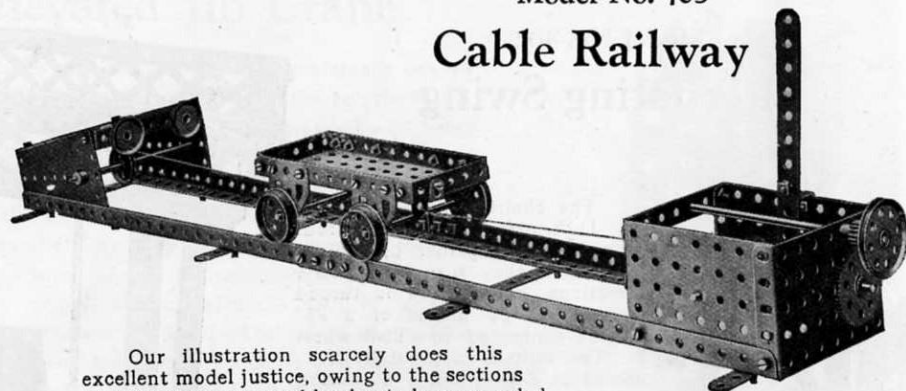

Our illustration scarcely does this excellent model justice, owing to the sections of which it is composed having to be so crowded together. This is a very fine model, both instructive and highly interesting.

The driving power is received at the outer  $1\frac{1}{2}$ " pulley, and is transmitted through the clutch mechanism and the pinion and gear wheels to the lower spindle on which the driving pulley is fixed, the driving rope passing round this pulley and the second pulley at the end of the rails, all as shown in the drawing.

In fixing the lever for operating the clutch mechanism, the nuts should be locked to prevent the screw working out. Only one section of rails is shown in the design but they may be extended as desired.

### Parts required:

5 of No. 2	1 of No. 27A
3 " " 3	2 " " 29
2 " " 5	2 " " 35
4 " " 8	51 " " 37
1 " " 15	3 " " 38
2 " " 15A	1 " " 46
2 " " 16	2 " " 48A
1 " " 17	2 " " 48C
4 " " 20	1 " " 52
1 " " 21	3 " " 53
3 " " 22	2 " " 54
1 " " 22A	6 " " 59
2 " " 26	3 " " 125
4 of No. 126A	

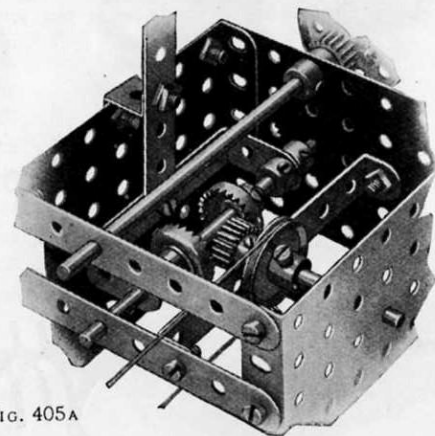


FIG. 405A

These Models can be made with MECCANO Outfit No. 4, or No. 3 and No. 3A.


61

## Model No. 406 Warehouse
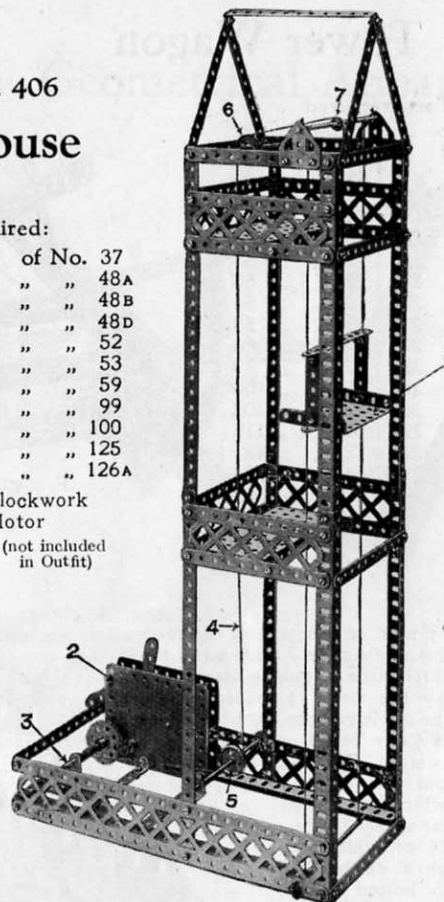
### Parts required:


4 of No.	1	96 of No.	37
14 " "	2	2 " "	48A
2 " "	4	1 " "	48B
6 " "	8	2 " "	48D
4 " "	11	2 " "	52
14 " "	12	1 " "	53
1 " "	12A	2 " "	59
3 " "	14	2 " "	99
1 " "	15	6 " "	100
1 " "	16	2 " "	125
2 " "	22A	2 " "	126A
1 " "	23		
1 " "	26		
1 " "	27A		
10 " "	35		

Clockwork  
Motor  
(not included  
in Outfit)



The cage 1 is raised or lowered to the several floors from the motor 2 driving a rod 3 from which passes the hoisting cord 4 round a 1" pulley 5 and another 6 at the top, and thence over a  $\frac{1}{2}$ " pulley 7 to the cage 1. The construction of the floors and frame should be clear from the illustration. The rod 3 is supported at one end in a 1" x 1" angle bracket bolted to two  $2\frac{1}{2}$ " strips in the base of the model.

## Model No. 407 Girder Crane

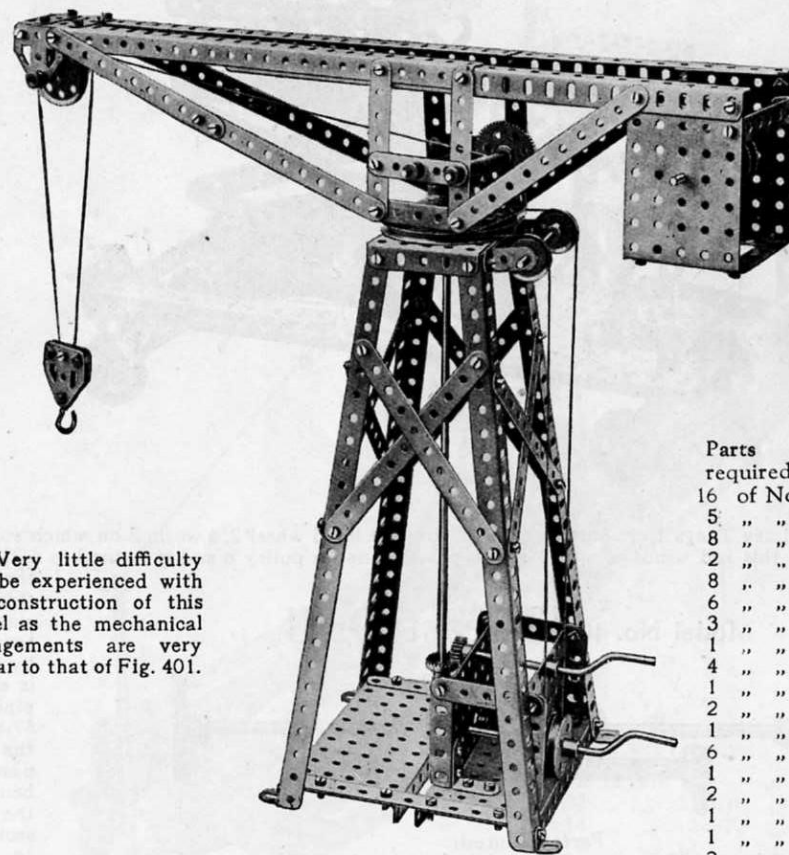

Very little difficulty will be experienced with the construction of this model as the mechanical arrangements are very similar to that of Fig. 401.

### Parts required

16 of No.	2
5 " "	3
8 " "	5
2 " "	6A
8 " "	8
6 " "	12
3 " "	12A
1 " "	13
4 " "	16
1 " "	17
2 " "	19
1 " "	19B
6 " "	20
1 " "	21
2 " "	22
1 " "	23
1 " "	24
2 " "	26
1 " "	27A

1 of No.	28	10 of No.	38	2 of No.	52	9 of No.	59
1 " "	29	1 " "	46	5 " "	53	1 " "	115
92 " "	37	3 " "	48A	1 " "	57	4 " "	126A



These Models can be made with MECCANO Outfit No. 4, or No. 3 and No. 3A.

## Model No. 408 Tower Wagon

### Parts required:

16 of No. 2	78 of No. 37
2 " " 4	22 " " 37A
4 " " 5	24 " " 38
2 " " 8	1 " " 45
2 " " 15	4 " " 48A
5 " " 15A	6 " " 48B
1 " " 16	1 " " 52
2 " " 17	2 " " 53
4 " " 20	2 " " 54
1 " " 21	3 " " 59
3 " " 22	2 " " 62
1 " " 22A	2 " " 77
1 " " 24	2 " " 100
2 " " 26	2 " " 103
1 " " 27A	1 " " 115
1 " " 32	2 " " 125
2 " " 35	4 " " 126A


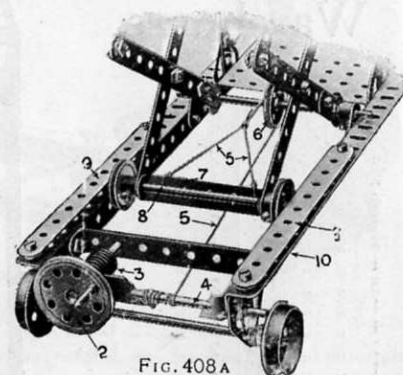


FIG. 408A

The Lazy Tongs 1 are extended by turning the hand wheel 2, a worm 3 on which engages a  $\frac{1}{2}$ " pinion not shown, on the rod 4. On this rod winds a cord 5 which passes round a pulley 6 and is secured to a  $2\frac{1}{2} \times \frac{1}{2}$ " double angle strip 7 on the rod 8, the ends of which slide in guides on either side formed by the strips 9 spaced by washers and the angle girders 10 of the carriage. The Lazy Tongs collapse by their own weight. The steering is effected from the rod 11, a pinion 12 on which engages a

## Model No. 409 Breast Drill

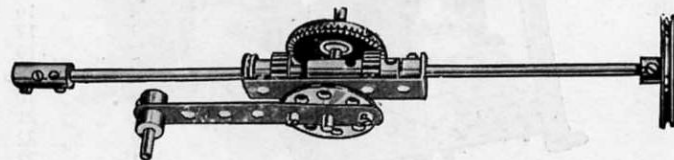

### Parts required:

1 of No. 3	1 of No. 21	2 of No. 37
2 " " 15	1 " " 23	1 " " 48A
2 " " 17	1 " " 24	3 " " 59
1 " " 18A	2 " " 26	2 " " 63
	1 " " 28	

57-toothed gear wheel 13, the 2" rod 14 of which passes through a double bent strip 15 bolted to the under-side of the sector plate 16. The rod 14 is secured to the bush wheel 17 which carries the double angle strip  $3\frac{1}{2} \times \frac{1}{2}$  18.


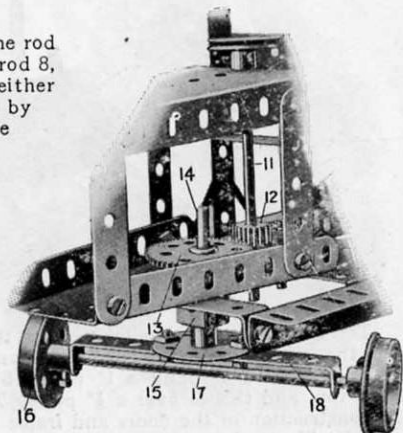


FIG. 409B

## Model No. 410 Geometrical Apparatus

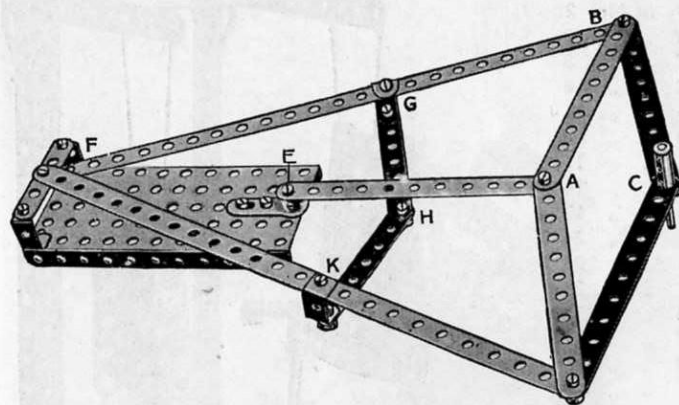

This most ingenious model for transforming a circular movement into a rectilinear movement was designed by M. Pierre-Th. Dufour, who used it in his Thesis (presented to the Faculty of Science in Paris) to obtain his degree of Doctor of the University of Paris. He required an instrument which would transform a circular movement into a movement rigorously rectilinear and he states in his published work that he was able to do this "with the aid of Meccano parts, which permit of making experiments so easily in mechanisms of the most varied types."


The point F is fixed, and is situated at a distance from the fixed point E, equal to AE, the two arms FB and FD being together equal to the four sides of the lozenge ABCD. The trajectory of the point C is then at right angles to EF. It will be found that whilst the point C is moving in a straight line at right angles to EF, the point A is describing a circle round the fixed point E.

Every Meccano Boy should make up this very interesting model and experiment with it.

### Parts required:

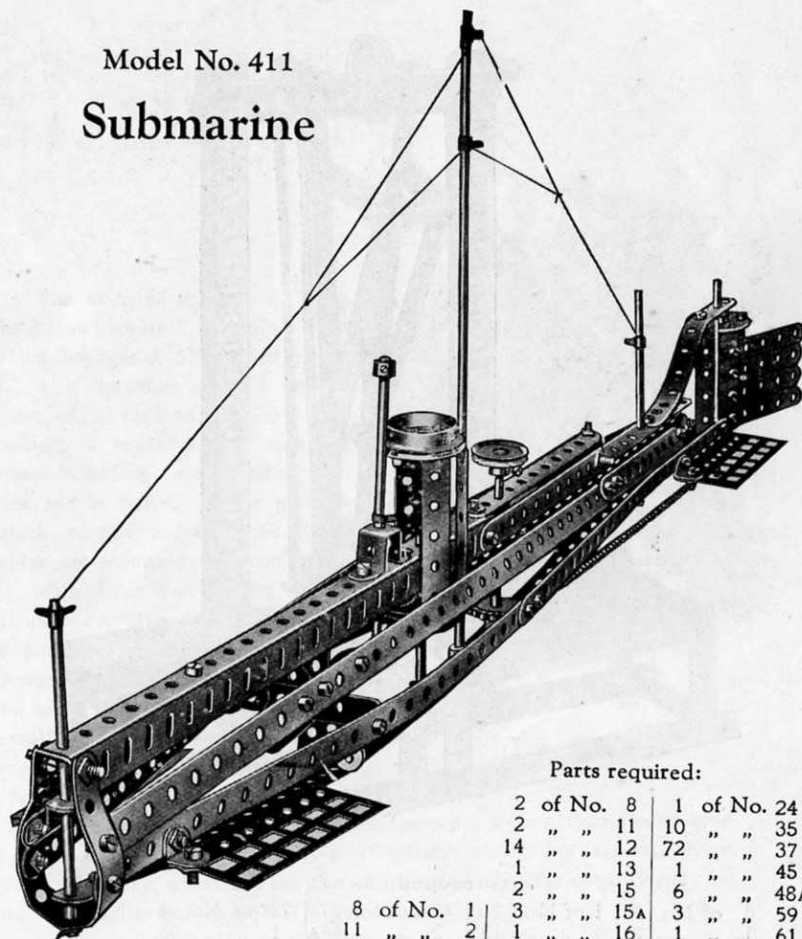2	of No.	1
5	" "	2
2	" "	3
1	" "	5
4	" "	11
1	" "	17
16	" "	37
1	" "	52
7	" "	59
1	" "	62
1	" "	63

## Model No. 411 Submarine




### Parts required:

2	of No.	8	1	of No.	24
2	" "	11	10	" "	35
14	" "	12	72	" "	37
1	" "	13	1	" "	45
2	" "	15	6	" "	48A
3	" "	15A	3	" "	59
1	" "	16	1	" "	61
2	" "	20	26"	" "	94
8	" "	22	2	" "	96

These Models can be made with MECCANO Outfit No. 4, or No. 3 and No. 3A.
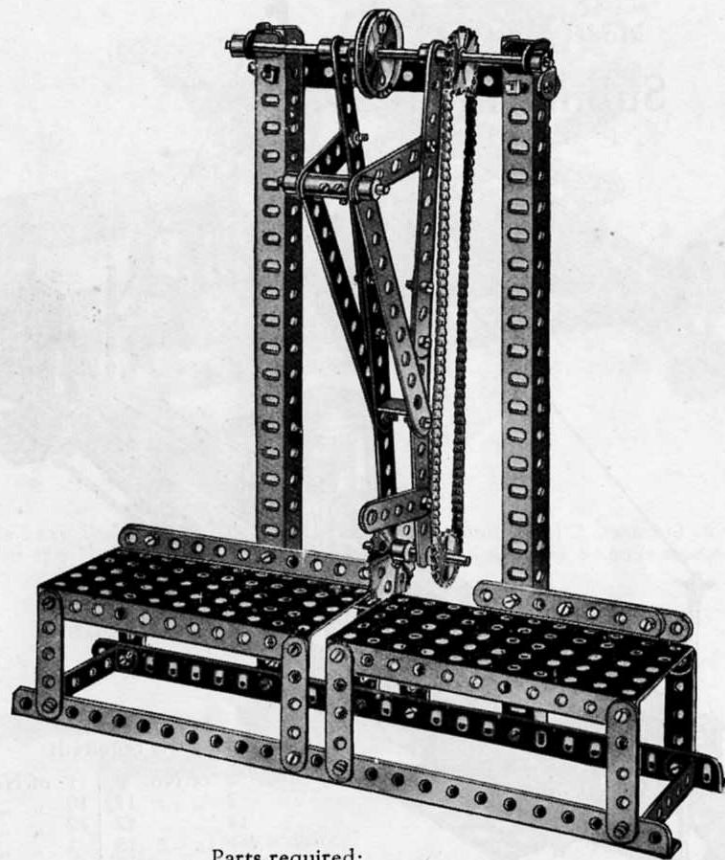
## Model No. 412 Swing Saw



### Parts required:

8	of No. 2	1	of No. 11	45	of No. 37	22 <sup>a</sup>	of No. 94	
1	" "	3	4	" "	12	2	" "	95
12	" "	5	1	" "	14	2	" "	52
6	" "	8	2	" "	17	8	" "	59
1	" "	10	1	" "	21	1	" "	63

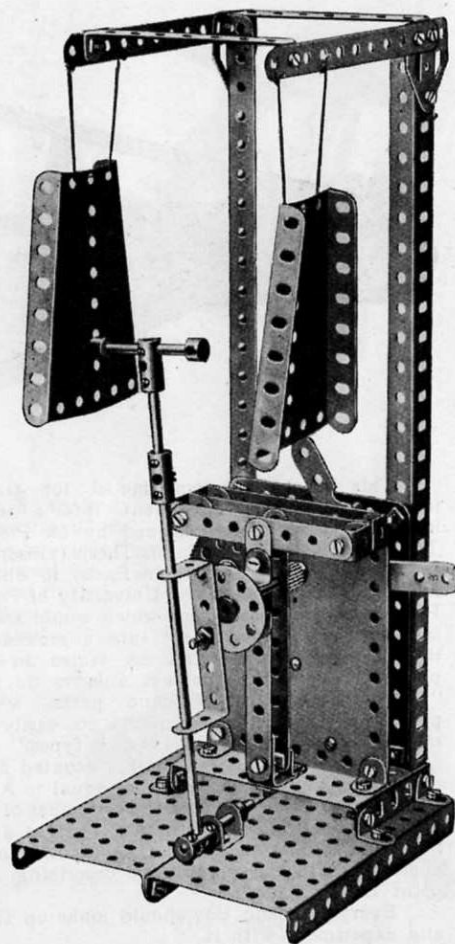
## Model No. 413 Automatic Gong

### Parts required:

2	of No. 2	
2	" "	2A
2	" "	3
2	" "	8
5	" "	11
9	" "	12
1	" "	12A
1	" "	14
5	" "	17
1	" "	24
1	" "	26
1	" "	27A
43	" "	37
2	" "	37A
2	" "	38
1	" "	45
1	" "	46
2	" "	48B
2	" "	52
1	" "	53
2	" "	54
3	" "	59
3	" "	63
1	" "	111
2	" "	126A

Clockwork  
Motor

(not included in  
Outfit)




These Models can be made with MECCANO Outfit No. 4, or No. 3 and No. 3A

65

## Model No. 414 Wire Rope-making Machine
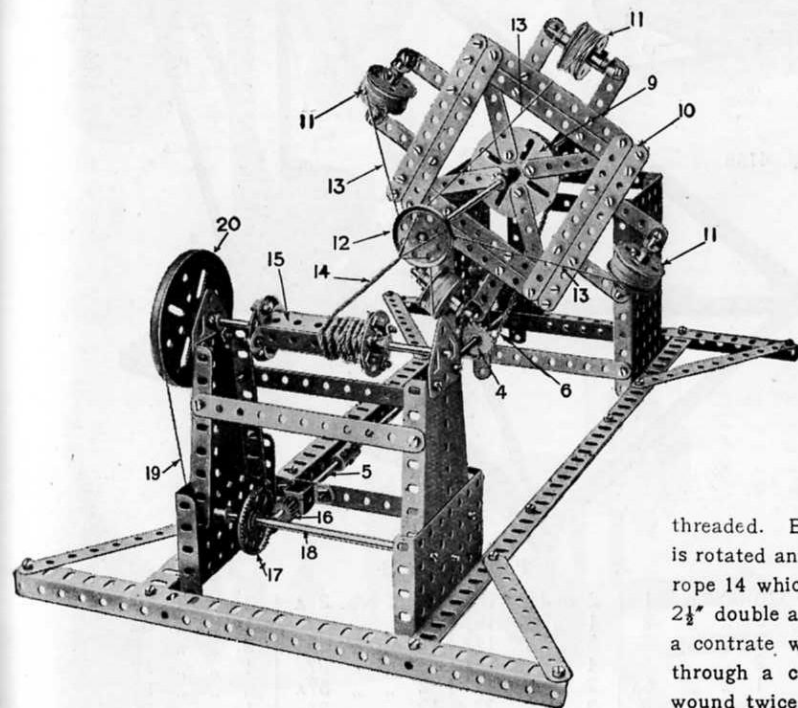
### Parts required:

21 of No. 2	1 of No. 13	4 of No. 17	1 of No. 22	104 of No. 37	2 of No. 53	1 of No. 95
4 " " 3	2 " " 14	1 " " 19	2 " " 24	16 " " 38	2 " " 54	1 " " 96
8 " " 5	1 " " 15	1 " " 19B	2 " " 26	1 " " 45	4 " " 59	1 " " 109
6 " " 8	1 " " 15A	8 " " 20	1 " " 27A	4 " " 48A	2 " " 63	4 " " 126A
8 " " 12	1 " " 16	1 " " 21	1 " " 28	2 " " 52	16 " " 94	



The machine is operated from the crank handle 1, a pinion 2 on which engages a 57-toothed wheel 3. A 1" sprocket wheel 4 on the rod 5 of the toothed wheel 3 drives through a chain 6 a 2" sprocket wheel 7, bolted on the rod 8. To this rod is bolted a face plate 9 which carries a framework 10 in which are mounted the wire spools 11, made from two flanged pulley wheels. At the front of the rod 5 is bolted a 1 1/2" pulley wheel 12, through alternate holes in which the wires 13 from the spools 11 are threaded. By operating the handle 1 the frame 10 is rotated and the wires stranded to form a twisted rope 14 which is taken up on a drum formed of 4 2 1/2" double angle strips 15. This drum is rotated from the rod 5 by a pinion 16 engaging a contrate wheel 17 on the rod 18 of which a 1" pulley wheel, not shown, drives through a cord 19 a 3" pulley wheel 20, on the drum spindle. The cord 19 may be wound twice round the smaller pulley wheel to get a better grip.

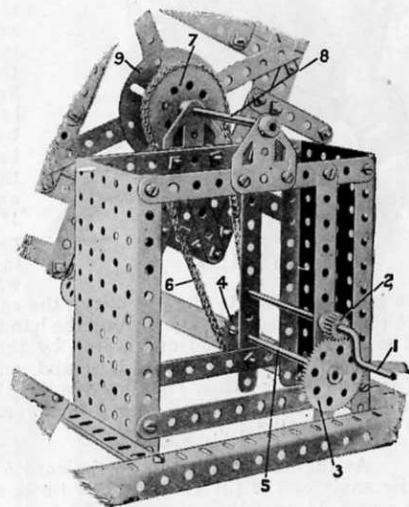


FIG. 414A



## Model No. 415

## Swivelling and Luffing Jib Crane

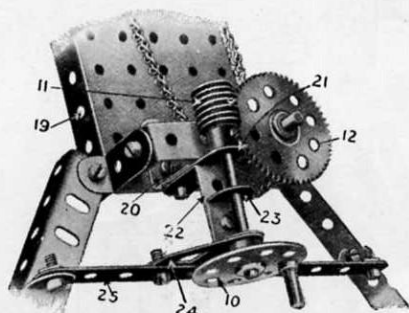


FIG. 415A

In this model three separate actions are provided, for raising the load, raising the jib, and swivelling the jib. The load is raised by means of a crank handle 1 on which the cord 2 is wound and passes over the 1" pulley 3, thence round the 1/2" pulley in the block 4 (spacing washers being used

to give clearance to the 1/2" pulley), the end of the cord 2 being made fast to the top of the jib. By turning the handle 1 the load is raised or lowered. The jib itself is raised or lowered by the operation of the crank handle 5 on the rod of which a cord is wound, and passes over one of two pulleys 7 to and round another 1" pulley 8 in the jib, whence it returns to and passes round the other pulley 7, being finally made fast to the double bracket 9 bolted to the jib.

As the handle 5 is turned the cord 6 is wound round the pulleys and the angle of the jib varied. The jib is swivelled by the hand-wheel 10, a worm 11 on which engages a 57-toothed wheel 12 on the rod of which a 1" sprocket wheel 13 is mounted. A sprocket chain 14 passes round this wheel 13 and round a 2" sprocket wheel 15 secured to the standard 16 of the crane. The bearing for the rod of the worm 11 is made by bolting a 1" angle bracket 20 to the rectangular plate 19, and to the angle bracket 20 is secured a 1 1/2" strip 21 and a 1" bracket 22. To the bracket 22 is bolted a double bracket 23. A flat trunnion 24 is bolted to the 5 1/2" strip 25 which forms with the bracket 23 the front bearing for the rod. The standard is built up of 2 12 1/2" girders 16 which are connected at the base by a 1 1/2" double angle strip 17 which is bolted to the 2" sprocket wheel 15. The 1" rod 18 is secured in the bush of the sprocket wheel 15 and fitted with a collar below the rectangular plate 19, Fig. 415B.


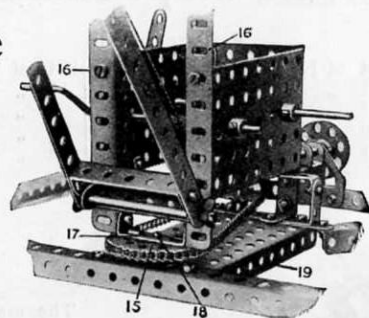


FIG. 415B

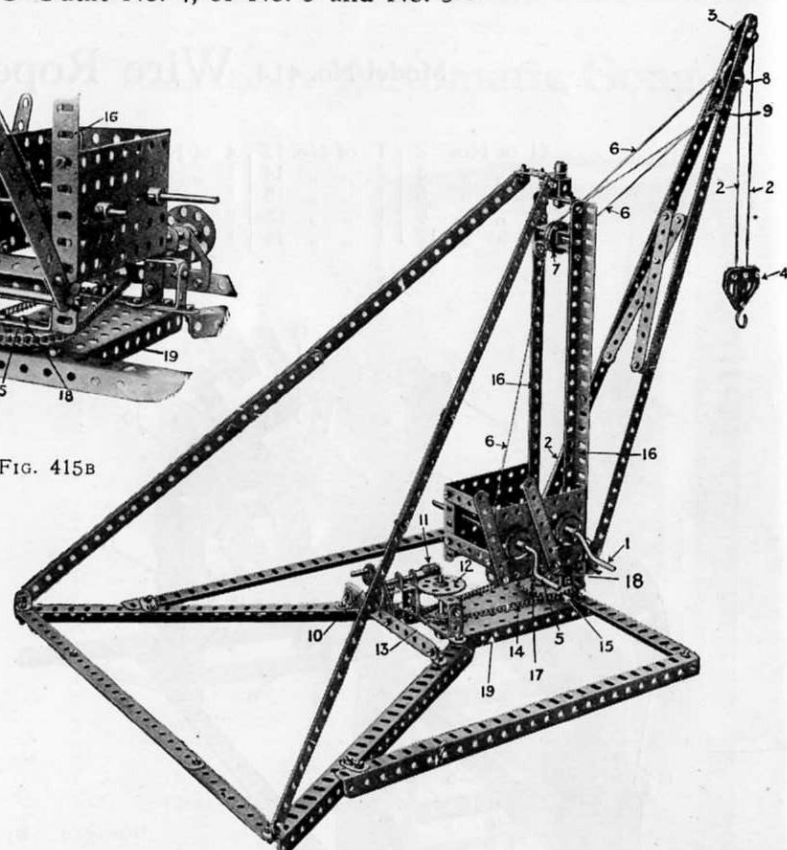


## Parts required:

10 of No. 1	2 of No. 12A	1 of No. 27A	3 of No. 48A
3 " " 2	1 " " 16	1 " " 32	1 " " 52
3 " " 3	3 " " 17	2 " " 35	2 " " 53
2 " " 5	4 " " 18A	80 " " 37	1 " " 57
1 " " 6A	2 " " 19	2 " " 37A	8 " " 59
7 " " 8	3 " " 22	13 " " 38	1 " " 95
2 " " 10	3 " " 22A	3 " " 45	1 " " 96
2 " " 11	1 " " 23	1 " " 46	1 " " 115
10 " " 12	1 " " 24	2 " " 48	4 " " 126A

These Models can be made with MECCANO Outfit No. 4, or No. 3 and No. 3A.
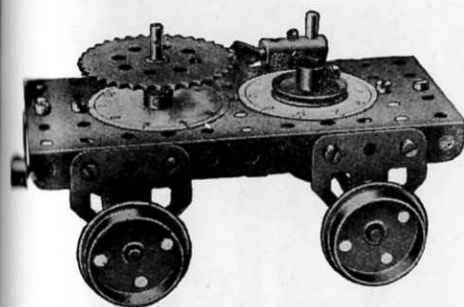
## Model No. 416 Distance Indicator



Parts required:

1 of No. 4	1 of No. 37A
4 " " 10	3 " " 38
2 " " 12	1 " " 52
1 " " 15	3 " " 59
2 " " 16	2 " " 62
2 " " 17	1 " " 63
4 " " 20	1 " " 65
2 " " 26	1 " " 95
1 " " 28	1 " " 96
1 " " 32	4 " " 126A
16 " " 37	



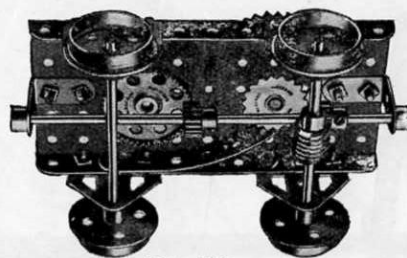


FIG. 416A

## Model No. 417 Band Saw

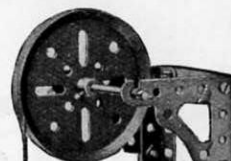

## Model No. 418

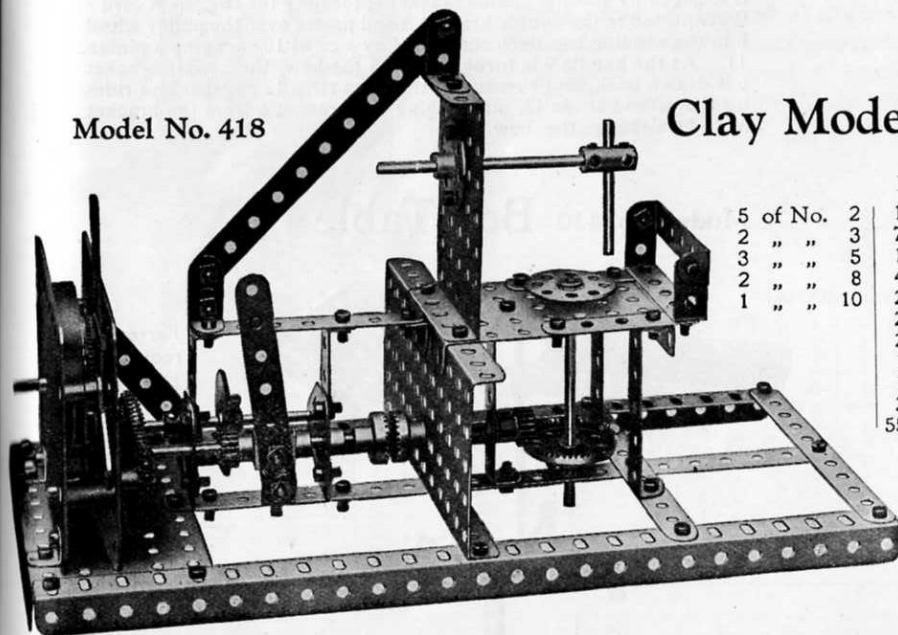


## Clay Modelling Machine

Parts required:

5 of No. 2	1 of No. 11	2 of No. 37A
2 " " 3	7 " " 12	2 " " 38
3 " " 5	1 " " 12A	1 " " 46
2 " " 8	4 " " 16	6 " " 48A
1 " " 10	2 " " 17	2 " " 52
	2 " " 24	2 " " 53
	2 " " 26	4 " " 59
	1 " " 27A	1 " " 63
	1 " " 28	6 " " 94
	2 " " 29	2 " " 96
	55 " " 37	2 " " 126A

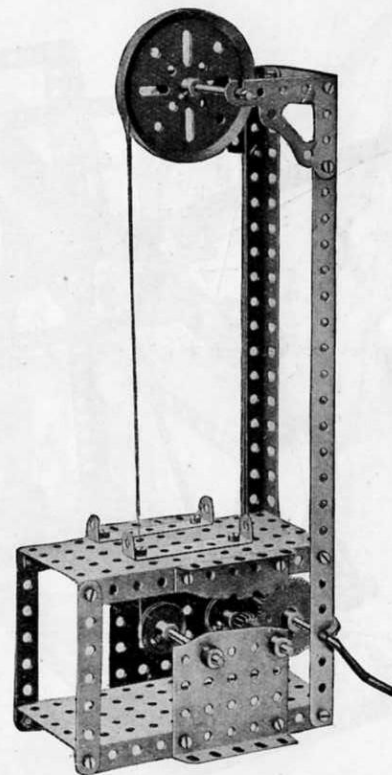Clockwork Motor  
(not included in Outfit)




Parts required:

2 of No. 3	2 of No. 22	2 of No. 52
1 " " 5	1 " " 26	2 " " 53
2 " " 8	1 " " 27A	4 " " 59
3 " " 16	4 " " 35	2 " " 108
1 " " 19	26 " " 37	
1 " " 19B	2 " " 48A	

These Models can be made with MECCANO Outfit No. 4, or No. 3 and No. 3A.

## Model No. 419 Mechanical Cross Bow

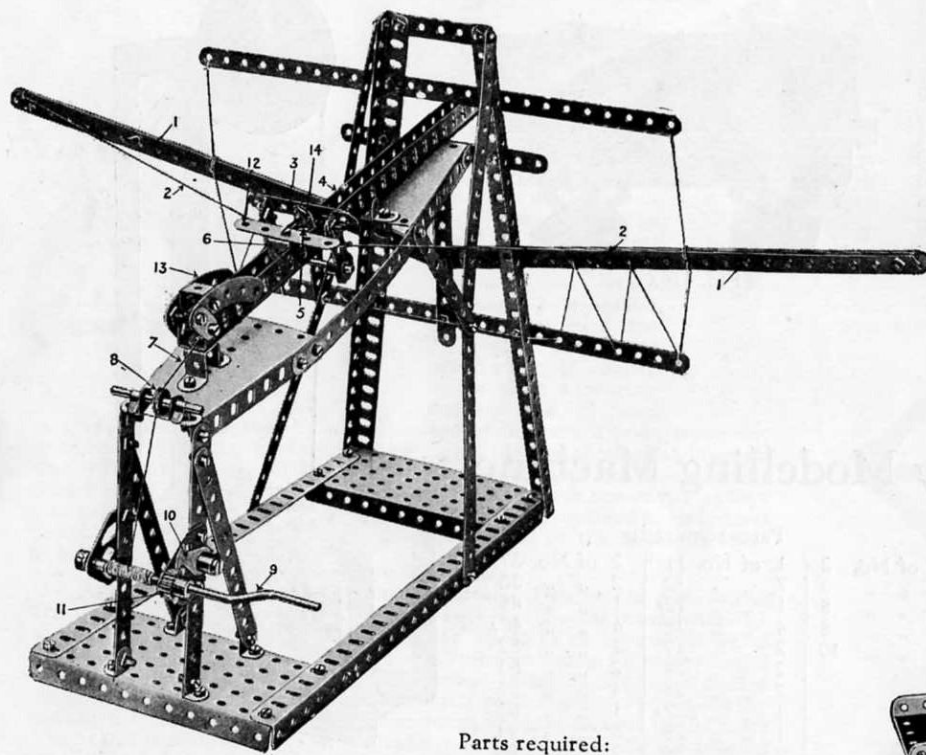

		Parts required:			
10 of No. 1		12 of No. 12	2 of No. 54		
8	" "	2 " "	1 " "	59	
2	" "	1 " "	2 " "	62	
3	" "	3 " "	2 " "	90	
6	" "	73 " "	1 " "	111	
3	" "	1 " "	2 " "	126A	
3	" "	1 " "	1 " "	147A	
3	" "	1 " "	1 " "	147B	
3	" "	2 " "	1 " "	148	


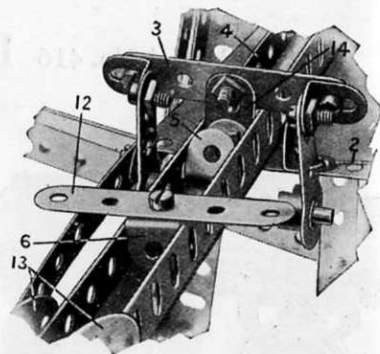


FIG. 419A

The only part of this model that requires description is the release of the bow. This is obtained by the following mechanism: the bow is made of three 12 $\frac{1}{2}$ " strips 1, on each side, from the outer ends of which the cords 2 of the bow are connected to a frame 3, sliding on the angle girders 4. To this frame is bolted a double bracket 5 and a flat bracket 14, and this is engaged by another double bracket 6, forming the trigger. A cord 7 is connected to the double bracket 6 and passes over the pulley wheel 8 to the winding handle 9, controlled by a pawl 10 engaging a pinion 11. As the handle 9 is turned to bend the bow, the double bracket 6 is drawn back, and eventually the cross strip 12 engages and rides up the curved strips 13, disengaging the bracket 6 from the bracket 5 and releasing the bow.

## Model No. 420 Bed Table

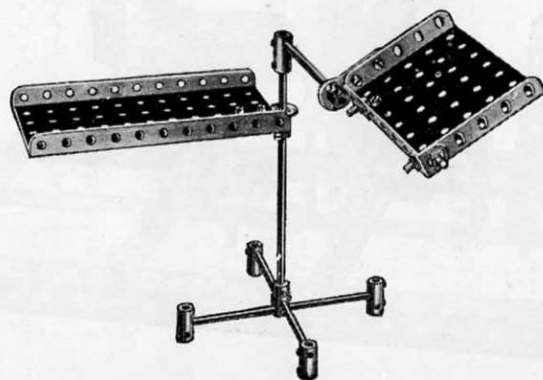


Parts required:			
1	of	No.	3
1	"	"	12
1	"	"	14
2	"	"	15A
1	"	"	16
8	"	"	37
1	"	"	52
1	"	"	53
2	"	"	62
6	"	"	63

2 of 1  
4 "  
3 "  
1 "  
2 "  
2 "  
1 "


Model No. 421

## Treadle Hammer

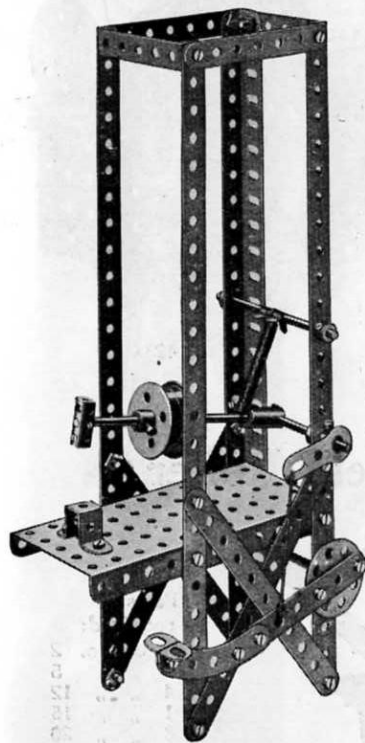

The arms 1 carrying the boats 2 are secured to the 3" pulley 3. This is connected to the rod 4 which carries a gear wheel 5 driven by a pinion 6 on a rod 7. At the foot of this rod is a contrate wheel 8 driven by a pinion on the end of another rod 9. The latter carries a sprocket wheel 10 which is operated through a chain gear from the motor. As the arms 1 rotate about the rod 4 the boats 2 fly out centrifugally.

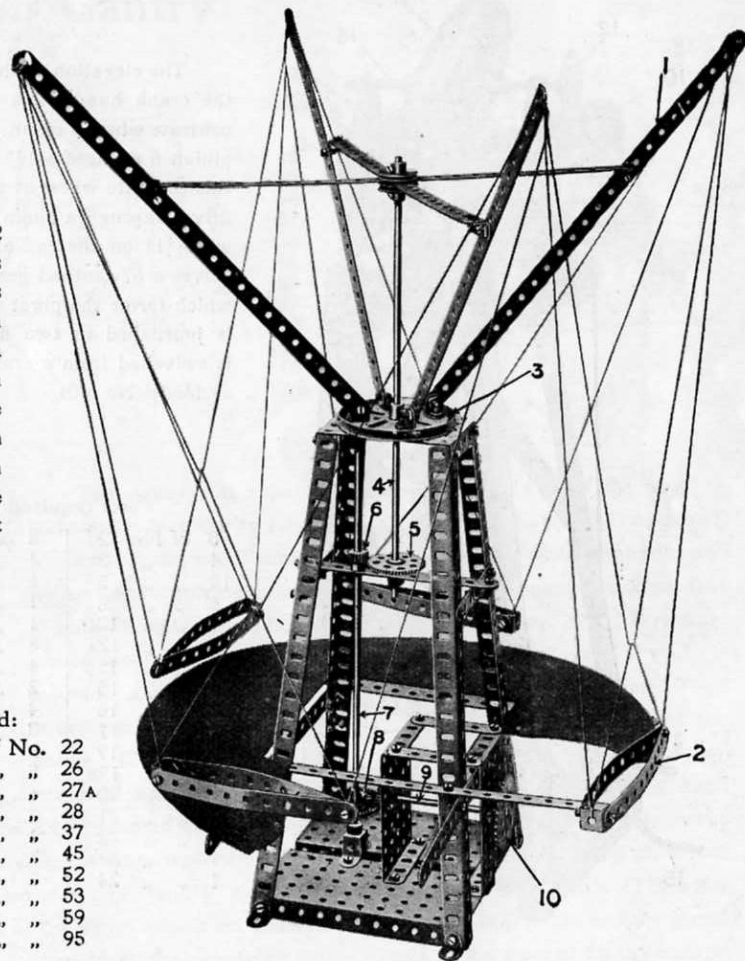Model No. 422 Flying Machine



## Parts required:

10 of No. 1	2 of No. 22
9 " " 2	2 " " 26
2 " " 3	1 " " 27A
2 " " 5	1 " " 28
4 " " 8	66 " " 37
4 " " 11	1 " " 45
22 " " 12	2 " " 52
2 " " 13	3 " " 53
1 " " 16	2 " " 59
1 " " 19B	1 " " 95

## Parts required:

2 of No. 1	3 of No. 16	1 of No. 45
4 " " 2	2 " " 20	1 " " 48A
3 " " 3	1 " " 24	1 " " 52
1 " " 5	2 " " 35	5 " " 59
2 " " 8	23 " " 37	1 " " 62
2 " " 12	2 " " 38	2 " " 63
1 " " 15A	1 " " 43	1 " " 90



## Model No. 423 Searchlight Tower

The elevation of the searchlight 1 is obtained through the crank handle 2 a pinion 3 on which engages a  $\frac{1}{2}$ " contrate wheel 4 on an  $11\frac{1}{2}$ " rod 5 at the top of which a  $\frac{1}{2}$ " pinion 6 engages a  $1\frac{1}{2}$ " contrate wheel 7. On the rod of this contrate wheel at the rear end a 1" sprocket wheel 8 drives through a chain 9 another sprocket wheel 10. A worm 11 on the rod of the latter sprocket engages and drives a 57-toothed gear wheel 12, bolted to a 5" rod 13 which forms the pivot of the searchlight 1. The rod 13 is journalled in two flat brackets 14. The searchlight is swivelled from a crank handle 15 in the same manner as Model No. 401.


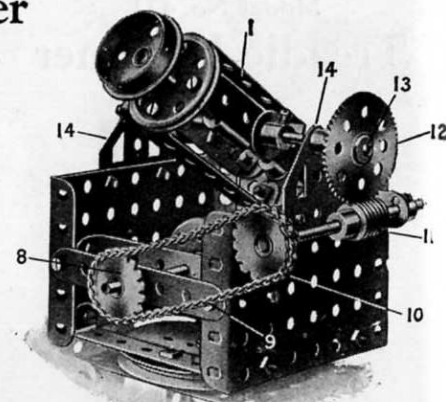
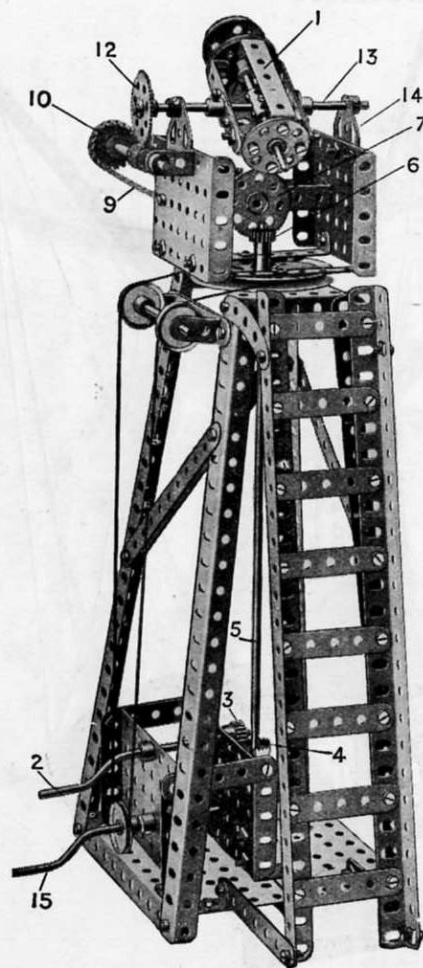


FIG. 423A

### Parts required:

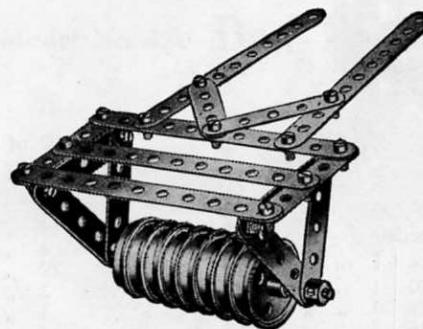3 of No. 2	2 of No. 26
4 " " 3	1 " " 27A
10 " " 5	1 " " 28
6 " " 8	1 " " 29
4 " " 12	1 " " 32
3 " " 12A	88 " " 37
1 " " 13	4 " " 38
1 " " 15	2 " " 46
2 " " 16	4 " " 48A
3 " " 17	3 " " 48B
2 " " 19	2 " " 52
1 " " 19B	5 " " 53
1 " " 20	6 " " 59
1 " " 21	2 " " 62
3 " " 22	1 " " 63
1 " " 22A	2 " " 90
1 " " 24	2 " " 126A


## Model No. 424 Field Roller



### Parts required:

5 of No. 2	2
10 " " 5	5
4 " " 12	12
1 " " 15	15
8 " " 20	20
15 " " 37	37
4 " " 59	59
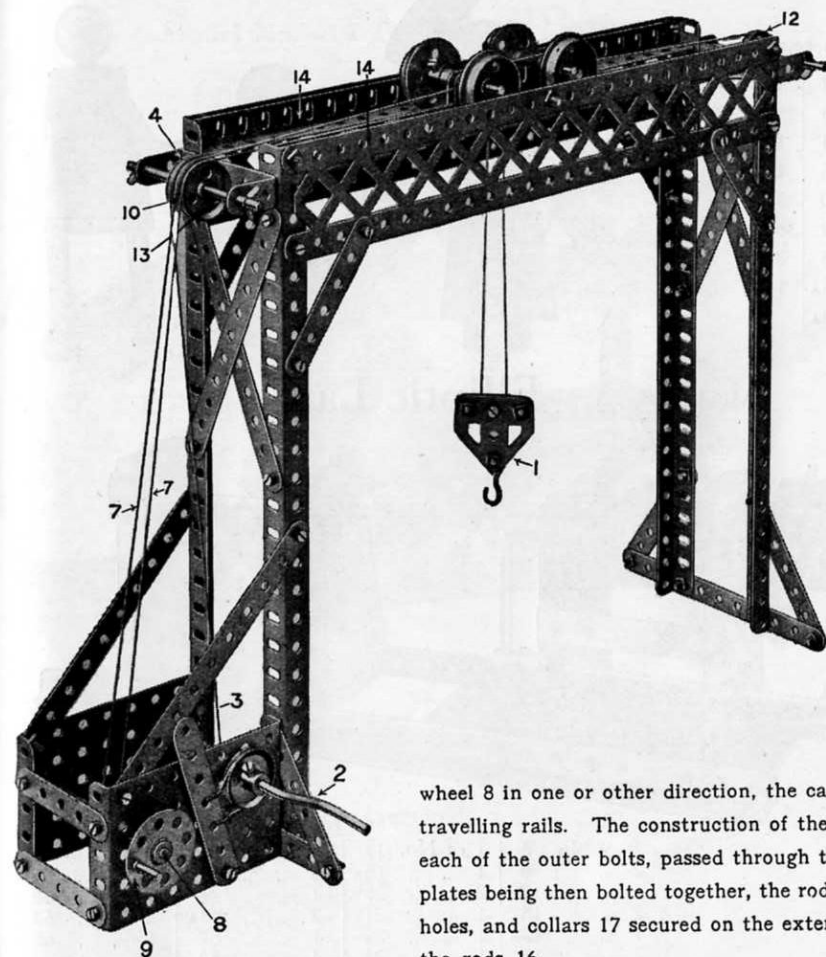
## Model No. 425 Gantry



## Parts required:

2 of No.	1	1 of No.	24
8 "	2	6 "	35
6 "	3	59 "	37
6 "	4	1 "	37A
2 "	5	12 "	38
6 "	8	2 "	46
3 "	16	2 "	53
2 "	17	1 "	57
1 "	19	4 "	59
4 "	20	2 "	103F
3 "	22	1 "	115
2 "	22A	2 "	126A
3 "	23		


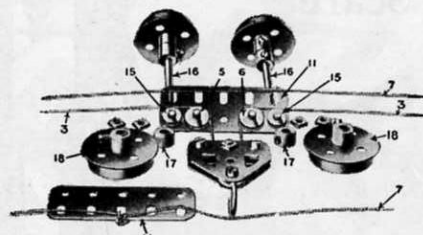


FIG. 425A

The pulley 1 is capable of being hoisted to raise the load, or traversed. In order to raise the load the crank handle 2 is operated, which winds the cord 3 passing over the rear pulley wheel 4 round the  $\frac{1}{2}$ " pulley 5 and a corresponding pulley in the block, thence round another  $\frac{1}{2}$ " pulley 6 and is made fast at the end of the gantry. For traversing, a continuous cord 7 is wound several turns on the  $3\frac{1}{2}$ " rod 8 to which is secured a hand wheel 9. The cord passes over the pulley wheel 10 and is secured to one of the side plates 11, and continues round the pulley 12 returning to and passing over the nearest pulley wheel 13 back to the rod 8. Consequently by turning the hand

wheel 8 in one or other direction, the carriage is traversed to and fro along the top angle girders 14, which form the travelling rails. The construction of the travelling carriage is shown in Fig. 425A, three washers 15 being placed on each of the outer bolts, passed through the two plates 11; and  $\frac{1}{2}$ " pulley wheels 5, 6, on the inner bolts. The outer plates being then bolted together, the rods 16 of the flange wheels are passed through both plates in the end elongated holes, and collars 17 secured on the exterior. After which the remaining flange wheels 18 are secured on the ends of the rods 16.

# Model No. 426 Windmill Scare

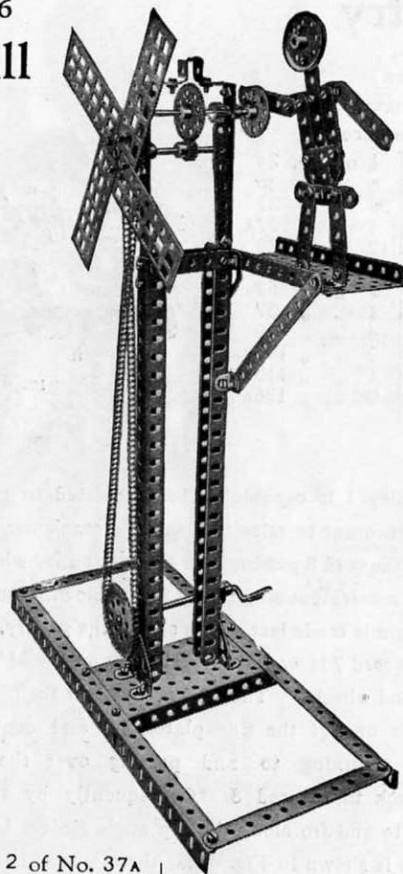


## Parts required:


5 of No. 2	2	
1 " " 3		
11 " " 5		
6 " " 8		
8 " " 12		
2 " " 12A		
2 " " 16		
1 " " 19	2 of No. 37A	
1 " " 21	3 " " 38	1 of No. 95
2 " " 24	1 " " 45	1 " " 96
2 " " 26	2 " " 52	1 " " 115
1 " " 27A	4 " " 59	2 " " 125
61 " " 37	4 " " 61	4 " " 126A
	20 " " 94	

## Parts required:

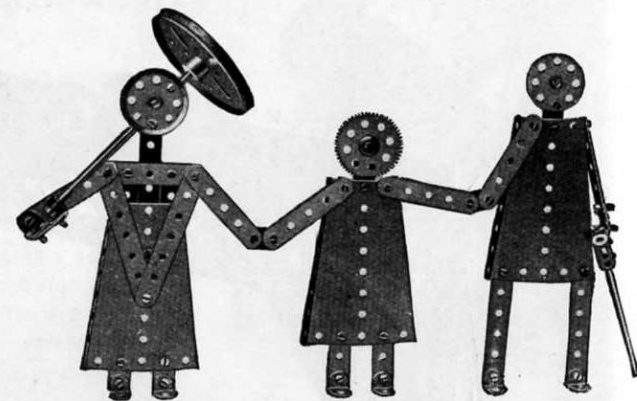1 of No. 2	1 of No. 19B
2 " " 3	1 " " 21
2 " " 4	1 " " 24
12 " " 5	1 " " 27A
7 " " 10	3 " " 35
9 " " 12	36 " " 37
1 " " 15	3 " " 54
1 " " 15A	1 " " 63
1 " " 18A	



# Model No. 428 Elliptic Lathe

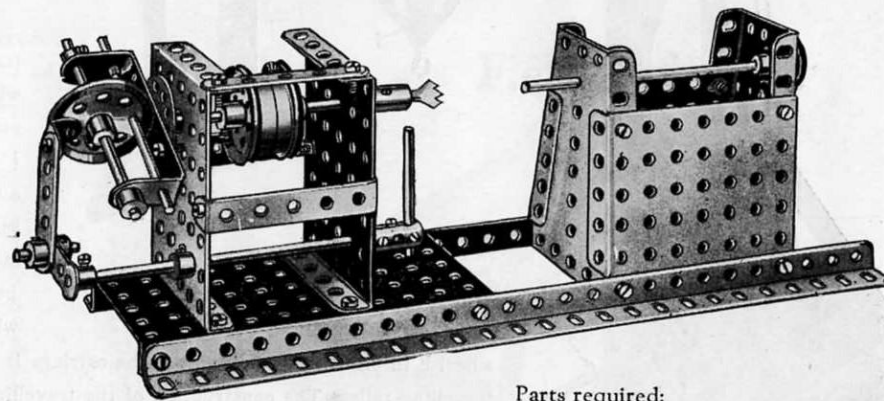


## Parts required:

2 of No. 5	1 of No. 17	2 of No. 35	2 of No. 54
2 " " 8	1 " " 18A	26 " " 37	8 " " 59
1 " " 12	2 " " 20	1 " " 46	1 " " 62
2 " " 15	1 " " 21	2 " " 48A	2 " " 63
1 " " 15A	1 " " 22	1 " " 52	1 " " 65
2 " " 16	1 " " 24	4 " " 53	

These Models can be made with MECCANO Outfit No. 4, or No. 3 and No. 3A.

73

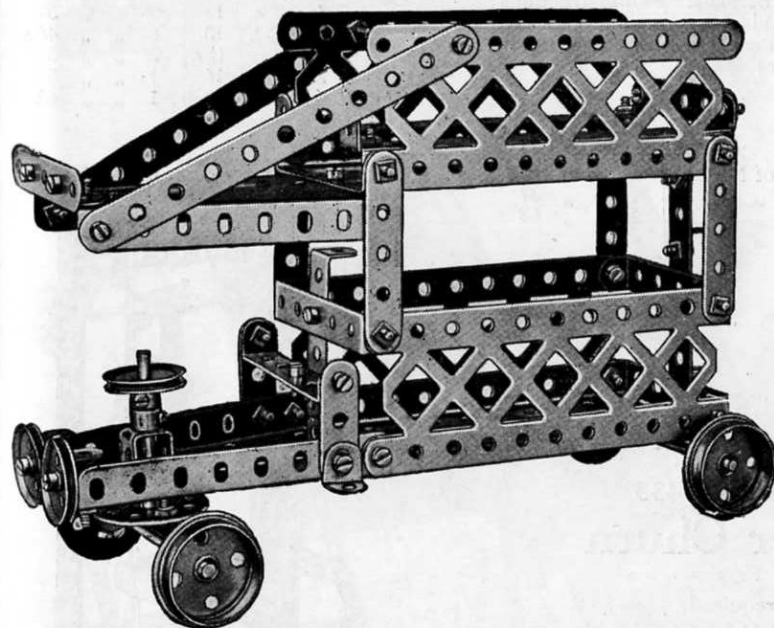
Model No. 429 Motor 'Bus



Parts required:

2 of No. 2	12 of No. 12	2 of No. 22A	2 of No. 52
1 " " 3	2 " " 16	1 " " 24	1 " " 54
6 " " 5	1 " " 17	48 " " 37	1 " " 59
2 " " 6A	4 " " 20	1 " " 45	4 " " 100
3 " " 11	1 " " 22	7 " " 48A	

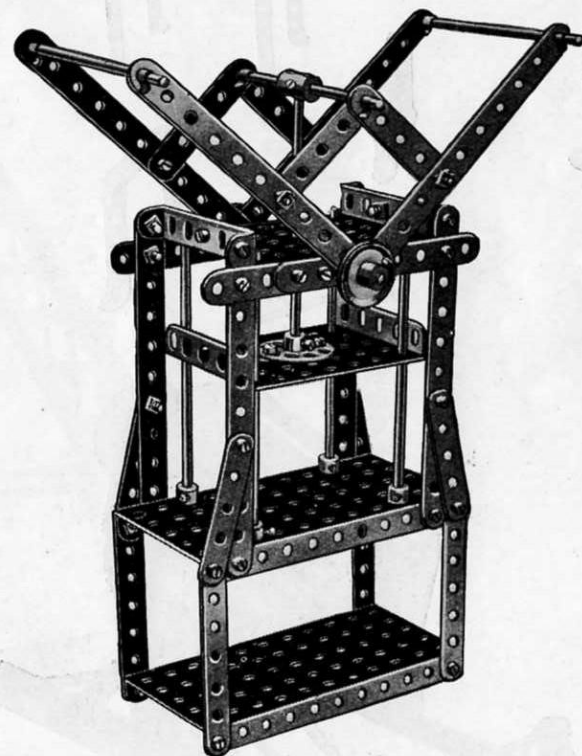Model No. 430 Bale Press




Parts required:

10 of No. 2	1 of No. 15A	44 of No. 37	2 of No. 52
4 " " 3	2 " " 17	14 " " 37A	2 " " 53
8 " " 5	1 " " 24	2 " " 38	4 " " 59
4 " " 15	8 " " 35	2 " " 48A	1 " " 63
2 of No. 111			



These Models can be made with MECCANO Outfit No. 4, or No. 3 and No. 3A.


### Model No. 431 Table Croquet

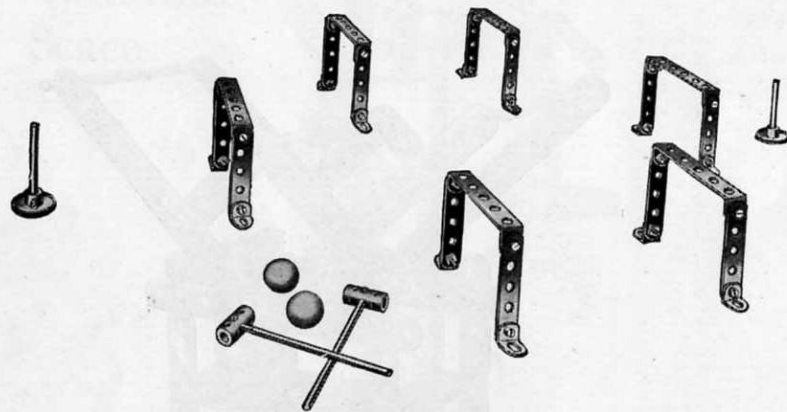

A most diverting game. Coloured marbles may be used for the balls. Full instructions for playing croquet may be obtained from any sports or games dealer.

#### Parts required:

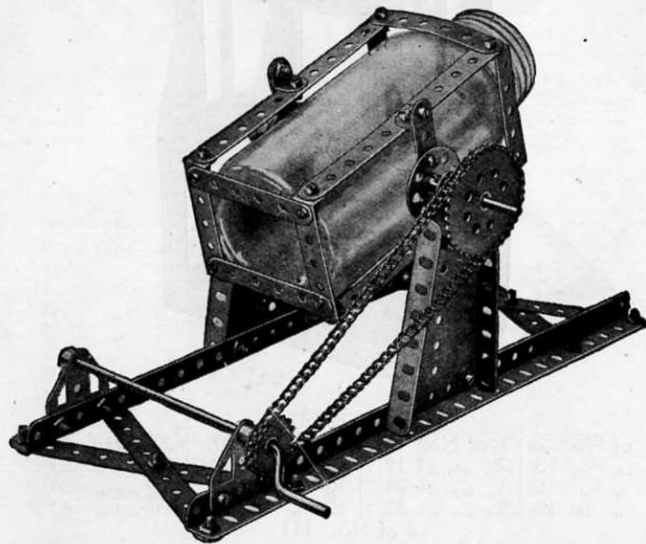12 of No.	5	2 of No.	22
12 "	12	24 "	37
2 "	16	2 "	63
2 "	17		



### Model No. 433 Butter Churn

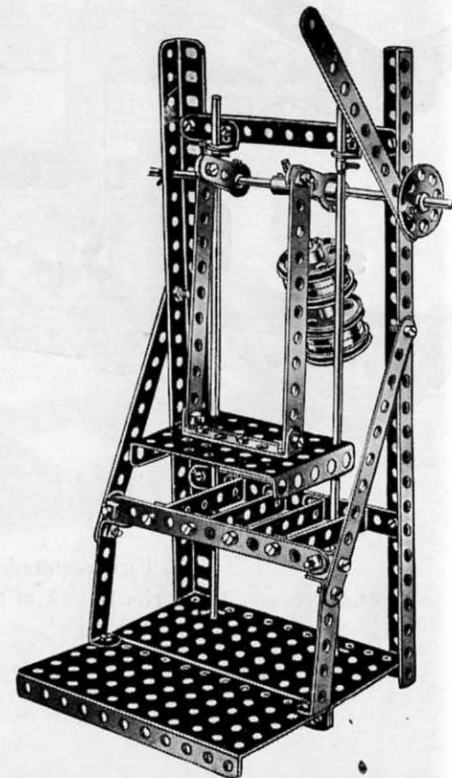
#### Parts required:

8 of No.	2	1 of No.	19	2 of No.	62
2 "	3	2 "	24	16 "	94
4 "	4	42 "	37	1 "	95
2 "	8	4 "	48A	1 "	96
4 "	12	2 "	54	2 "	126A
2 "	17	3 "	59		

### Model No. 432 Potato Chopper

#### Parts required:

8 of No.	2	1 of No.	24
2 "	8	5 "	35
4 "	12	38 "	37
2 "	13	6 "	48A
1 "	15A	2 "	52
2 "	16	1 "	53
4 "	20	1 "	63




Th  
links.  
by mea  
by a pi  
that th

This Model can be made with MECCANO Outfit No. 4, or No. 3 and No. 3A.

75

## Model No. 434 Cake Walk

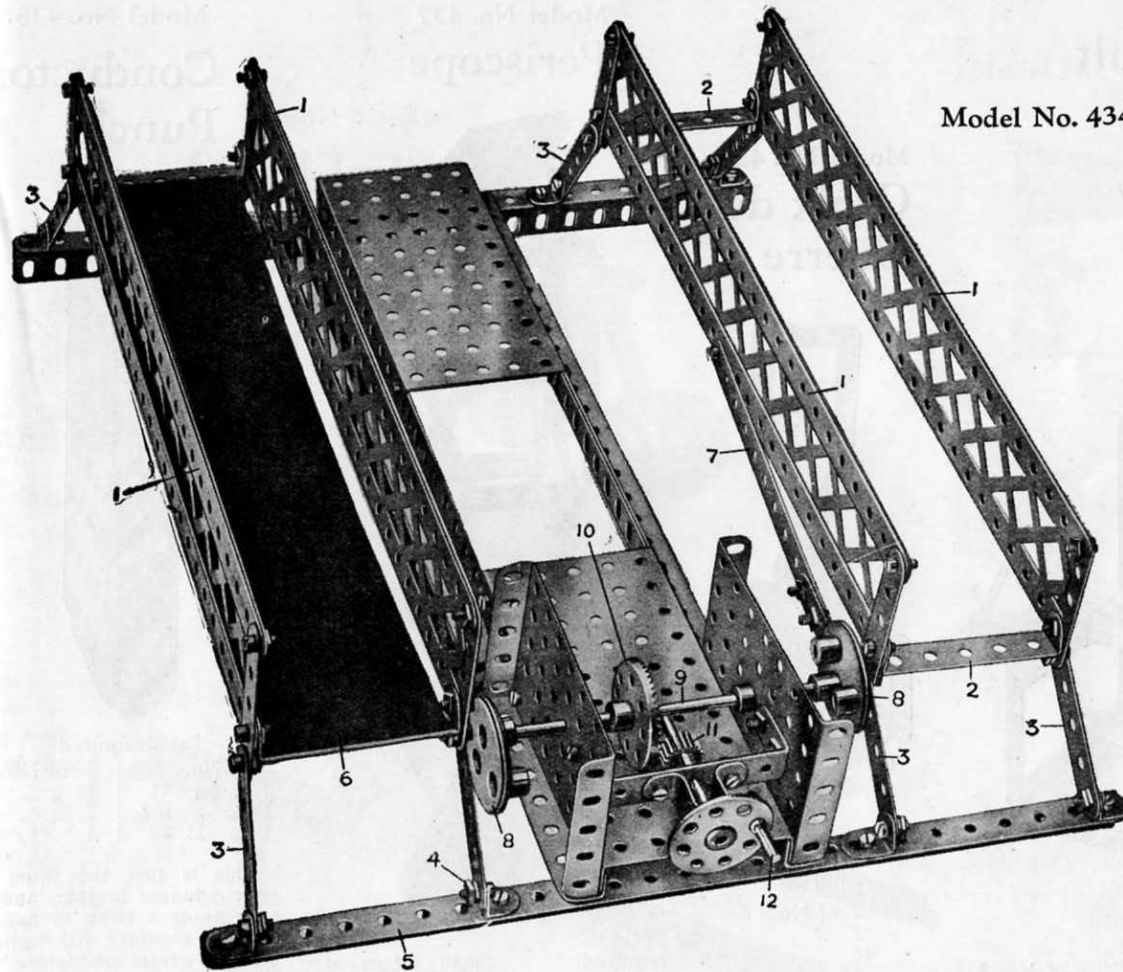

### Parts

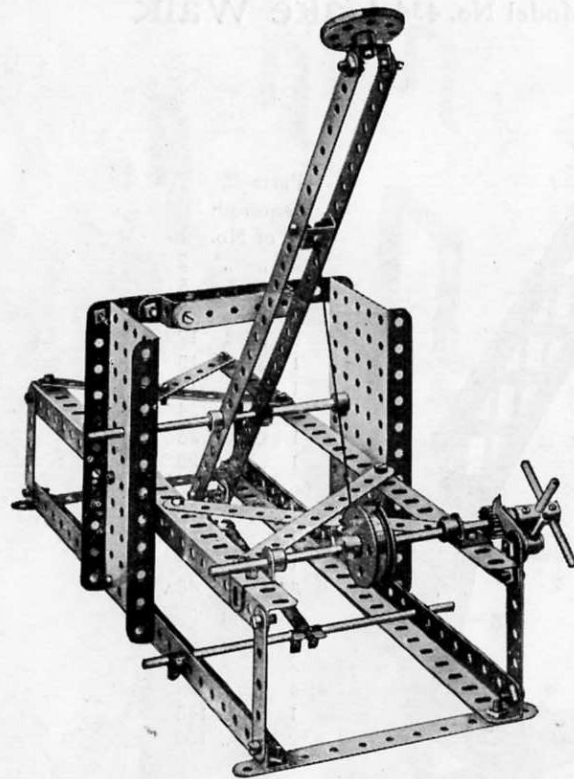
#### required:

8	of No.	1
2	" "	2
16	" "	5
6	" "	8
8	" "	12
1	" "	15
1	" "	17
1	" "	24
1	" "	26
1	" "	28
66	" "	37
1	" "	38
1	" "	45
1	" "	46
4	" "	48A
2	" "	52
2	" "	53
2	" "	59
4	" "	99
1	" "	115
2	" "	130

The rocking platforms are built up of braced girders 1 connected by the end strips 2 and pivotally bolted and lock-nutted to the strips 3 forming rocking links. These latter are bolted and lock-nutted at 4 to the angle girders 5. Strips 6 of cardboard are secured to the end strips 2. The platforms are rocked by means of strips 7 one of which is connected to each rocking platform and to eccentrics 8 fixed on the rod 9 on which is secured a contrate wheel 10 driven by a pinion 11 from the handle 12. As the handle 12 is turned the platforms are rocked to and fro on the strips 3. The eccentrics 8 should be so arranged that the platforms rock in opposite directions.

These Models can be made with MECCANO Outfit No. 4, or No. 3 and No. 3A.


## Model No. 435 Catapult



Parts required:

2 of No. 1	3 of No. 14	44 of No. 37	1 of No. 115
7 " " 2	2 " " 17	1 " " 43	4 " " 125
1 " " 4	1 " " 20	2 " " 52	1 " " 147A
6 " " 5	1 " " 24	1 " " 57	1 " " 147B
4 " " 8	1 " " 28	6 " " 59	1 " " 148
3 " " 11	4 " " 35	1 " " 63	


## Model No. 436 Croix de Guerre

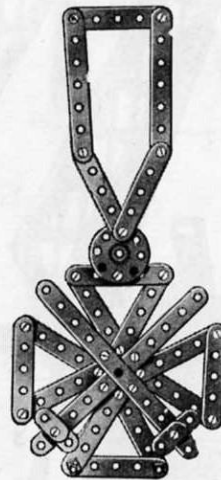

Parts required:

2 of No. 2
2 " " 3
15 " " 5
4 " " 10
2 " " 24
24 " " 37

## Model No. 437 Periscope

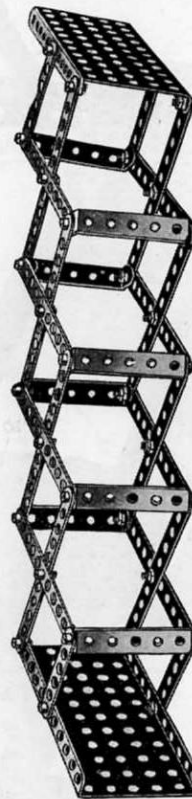


Parts required:

16 of No. 2
4 " " 4
32 " " 37
8 " " 48A
2 " " 52

Small pieces of looking glass should be inserted in the top and bottom plates.

## Model No. 438 Conductor's Punch

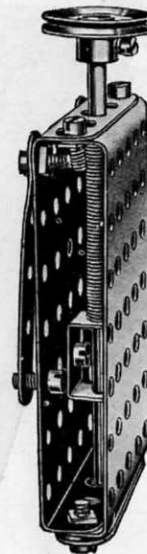

Parts required:

3 of No. 5	9 of No. 37
1 " " 11	1 " " 43
1 " " 15A	2 " " 53
1 " " 22	1 " " 59

This is just the thing for your younger brother, and he only needs a strap to hang it over his shoulder with to make him into a tram conductor. Note the  $2\frac{1}{2}$ " strip at the bottom, spaced a little away from the body of the punch to allow the ticket to pass in to be punched.

Parts  
requi  
2 of  
2 "  
4 "  
2 "  
4 "  
1 "  
2 "  
2 "  
2 "  
5 "  
1 "  
2 "  
1 "  
1 "

8  
or's

## Model No. 439 Speed Indicator


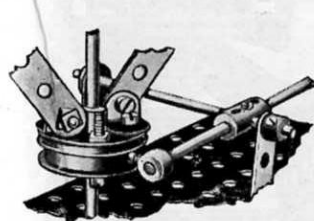


FIG. 439A


Parts  
required:

2	of No.	3
2	" "	4
4	" "	5
2	" "	8
4	" "	12
1	" "	13A
2	" "	16
2	" "	17
2	" "	18A
5	" "	20
1	" "	21
2	" "	24
1	" "	26
1	" "	29

32	of No.	37	1	of No.	52
2	" "	38	2	" "	53
1	" "	45	5	" "	59
3	" "	48A	1	" "	63

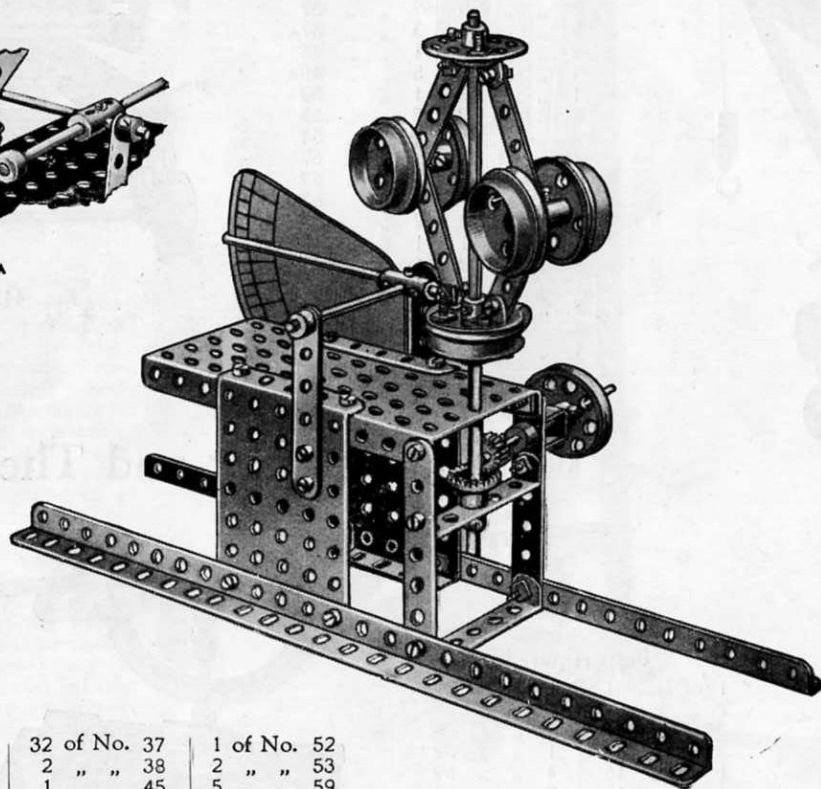

## Model No. 440 Weather Vane

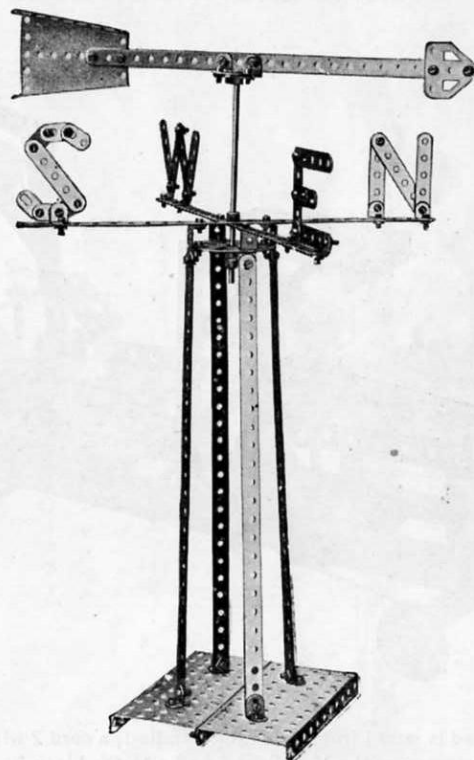


Parts required:

7	of No.	1	1	of No.	14	1	of No.	54
11	" "	5	1	" "	24	2	" "	59
8	" "	10	54	" "	37	1	" "	109
4	" "	11	2	" "	38	1	" "	126A
17	" "	12	2	" "	52			



These Models can be made with MECCANO Outfit No. 4, or No. 3 and No. 3A.

## Model No. 441 Travelling Swivel Crane

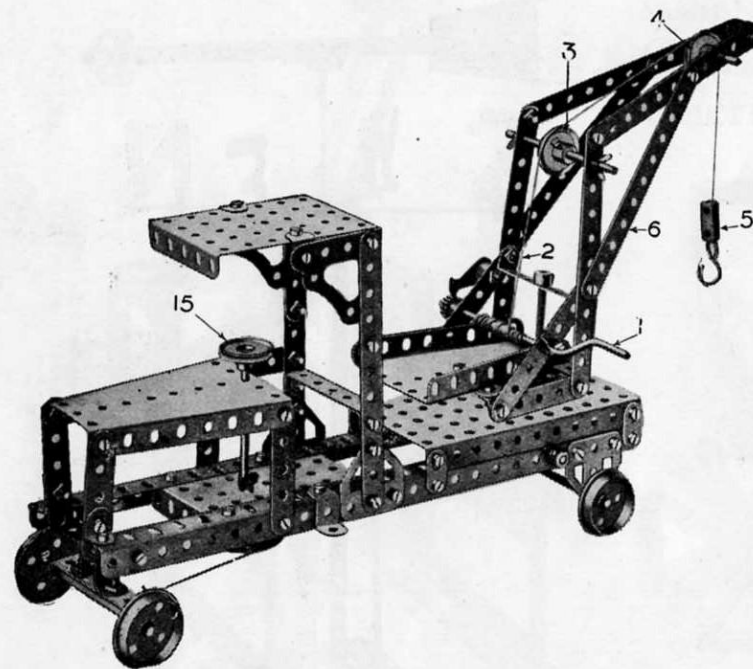

### Parts required:

8 of No.	2	6 of No.	35
2 "	3	69 "	37
9 "	5	3 "	37A
2 "	8	1 "	45
4 "	10	5 "	48A
1 "	11	1 "	52
8 "	12	2 "	53
2 "	15A	2 "	54
4 "	16	1 "	57
1 "	17	3 "	59
1 "	19	1 "	63
4 "	20	2 "	108
1 "	21	1 "	115
4 "	22	1 "	125
1 "	24	4 "	126A
2 "	26	1 "	147A
1 "	27A	1 "	147B
1 "	32	1 "	148


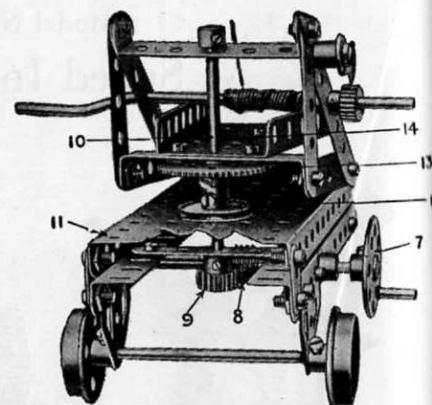


FIG. 441A

## Model No. 442 Sextant and Theodolite

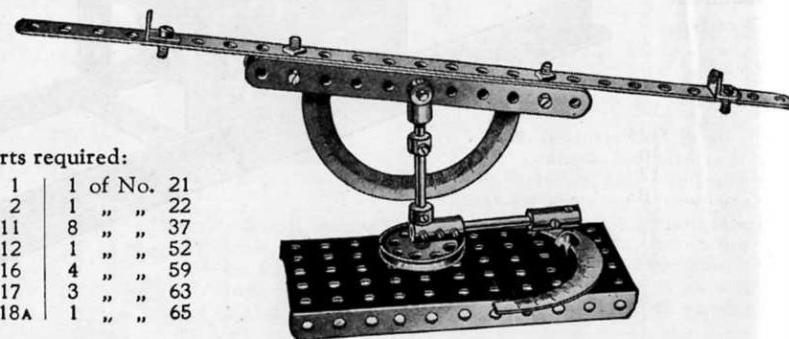

### Parts required:

1 of No.	1	1 of No.	21
2 "	2	1 "	22
2 "	11	8 "	37
2 "	12	1 "	52
1 "	16	4 "	59
1 "	17	3 "	63
2 "	18A	1 "	65

The load is raised from the crank handle 1, a cord 2 winding on which passes over the 1" pulleys 3 and 4 to the block 5. The jib 6 is swivelled from the hand-wheel 7 on the rod of which is a worm 8 engaging a pinion 9 bolted to a vertical rod 10, to which is secured beneath the platform 11 a 1" pulley wheel 12 and a 57-toothed wheel 13 which carries the swivel platform 14. The steering of the crane is effected from the 1" pulley wheel 15 in the same way as Model No. 230.

2 of  
5 "  
2 "  
1 "  
4 "  
3 "  
2 "  
1 "  
2 "  
2 "  
1 "

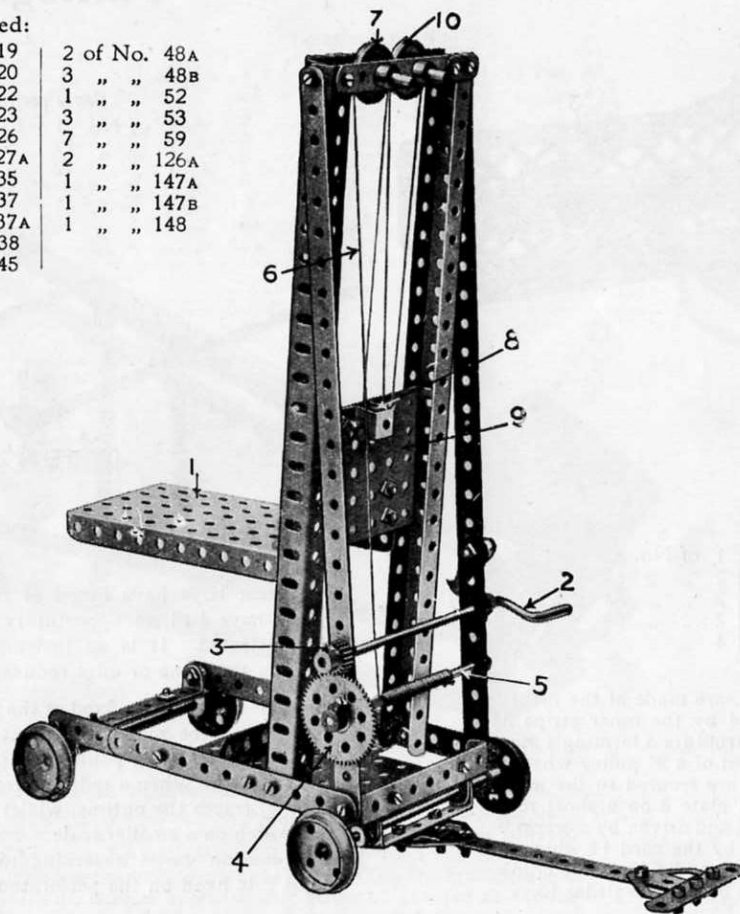
The  
consi  
tangu  
opera  
a pin  
gages  
4 on  
woun  
over  
of th  
1/2 p  
doub  
the  
anoth  
fast  
recta  
conn  
9 by  
and  
thus  
verti  
by  
doub

## Model No. 443 Bale-lifter

## Parts required:

2 of No.	1	1 of No.	19	2 of No.	48A
5	2	4	20	3	48B
2	3	2	22	1	52
1	5	1	23	3	53
4	8	1	26	7	59
3	10	1	27A	2	126A
2	12A	2	35	1	147A
1	15	46	37	1	147B
2	15A	1	37A	1	148
2	17	19	38		
1	18A	1	45		


The bale platform 1, consisting of a large rectangular plate, is raised by operating a crank handle 2, a pinion 3 on which engages a 57-toothed wheel 4 on a rod 5, upon which is wound a cord 6, passing over a pulley 7, in the head of the framework, round a  $\frac{1}{2}$ " pulley 8, pivoted in a double bent strip bolted to the plate 9, up over another pulley 10, and made fast to the plate 9. The rectangular plate 1 is connected to the plate 9 by 1" angle brackets, and the plates 1 and 9 thus slide together in the vertical framework formed by 12 $\frac{1}{2}$ " angle girders doubled.




## Model No. 444 Three-arm Signal

## Parts required:

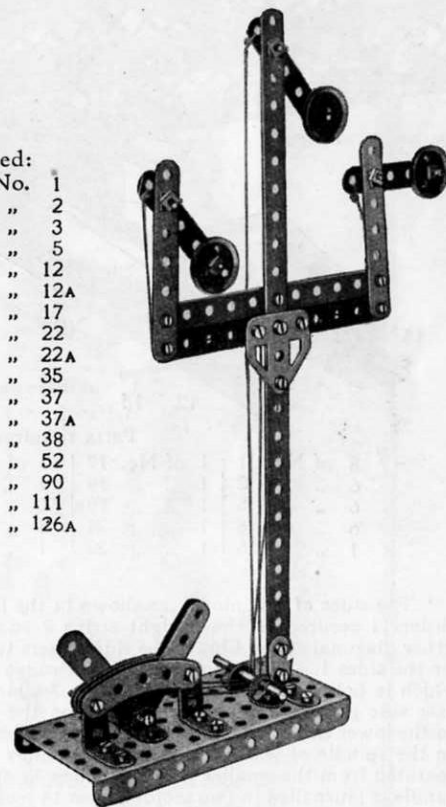1 of No.	1
3	2
2	3
6	5
4	12
3	12A
1	17
1	22
2	22A
2	35
27	37
5	37A
11	38
1	52
4	90
3	111
1	126A



## Model No. 445 Swing Bridge

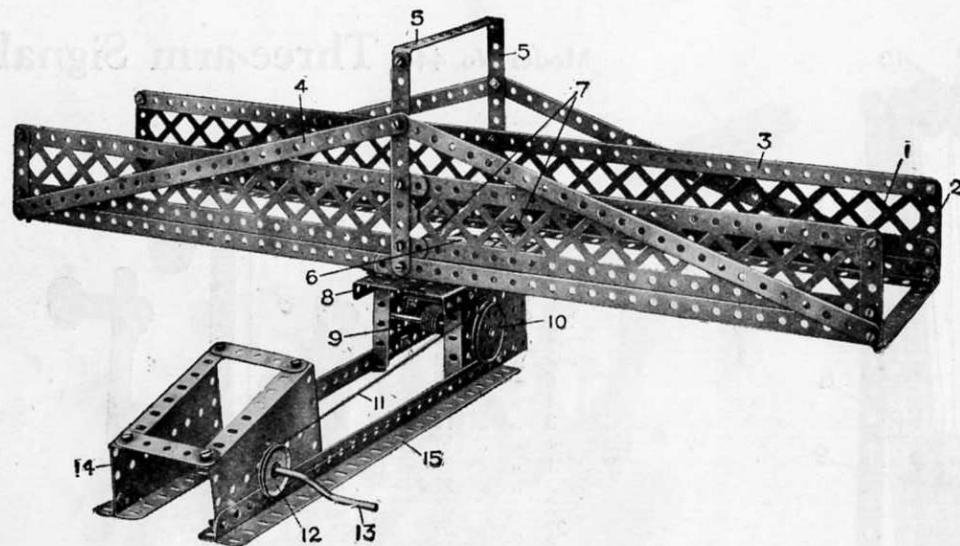

### Parts required:

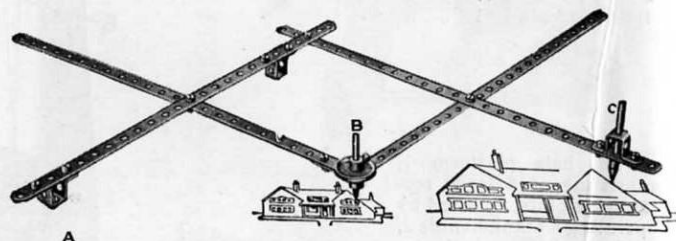
8 of No. 1	1 of No. 17	1 of No. 27A	1 of No. 52
6 " " 2	1 " " 19	1 " " 32	2 " " 53
6 " " 5	1 " " 19B	50 " " 37	2 " " 54
6 " " 8	1 " " 21	1 " " 48A	2 " " 59
1 " " 16	1 " " 22	1 " " 48D	4 " " 99

The sides of this model, as shown in the illustration, are made of the braced girders 1 secured to the upright strips 2 and reinforced by the inner strips 3. Other diagonal strips 4 brace the side girders to the top structure 5 forming a stay for the sides 1. The swing base of the bridge is composed of a 3" pulley wheel 6 which is bolted to two cross 5½" strips 7 which in turn are secured to the main base side girders. The bridge swings on the perforated plate 8 on a short rod, on the lower end of which is secured a gear wheel engaged and driven by a worm 9 on the spindle of which is the grooved pulley 10 driven by the cord 11 which is operated from the smaller grooved pulley 12 on the crank handle 13. The crank handle is journaled in two sector plates 14 secured to the base angle girder 15.

## Model No. 446 Pantograph

Parts required:

4 of No. 1	10 of No. 37
2 " " 17	3 " " 45
1 " " 22	2 " " 62




Most boys have heard of the Pantograph but not many have had an opportunity of seeing its principles demonstrated. It is an instrument for copying plans, etc., on the same or on a reduced or enlarged scale.

The apparatus is fixed at the point A. If an enlarged sketch is to be made, the point B is traced round the outlines, the writing point C reproducing the sketch on a larger scale. When a reduced drawing is to be made, the point C traces the outline, whilst the point B reproduces the sketch on a smaller scale. The degree of enlargement or reduction varies according to the position in which point C is fixed on the perforated arm.

Model No. 447

## Inclined Delivery Chute

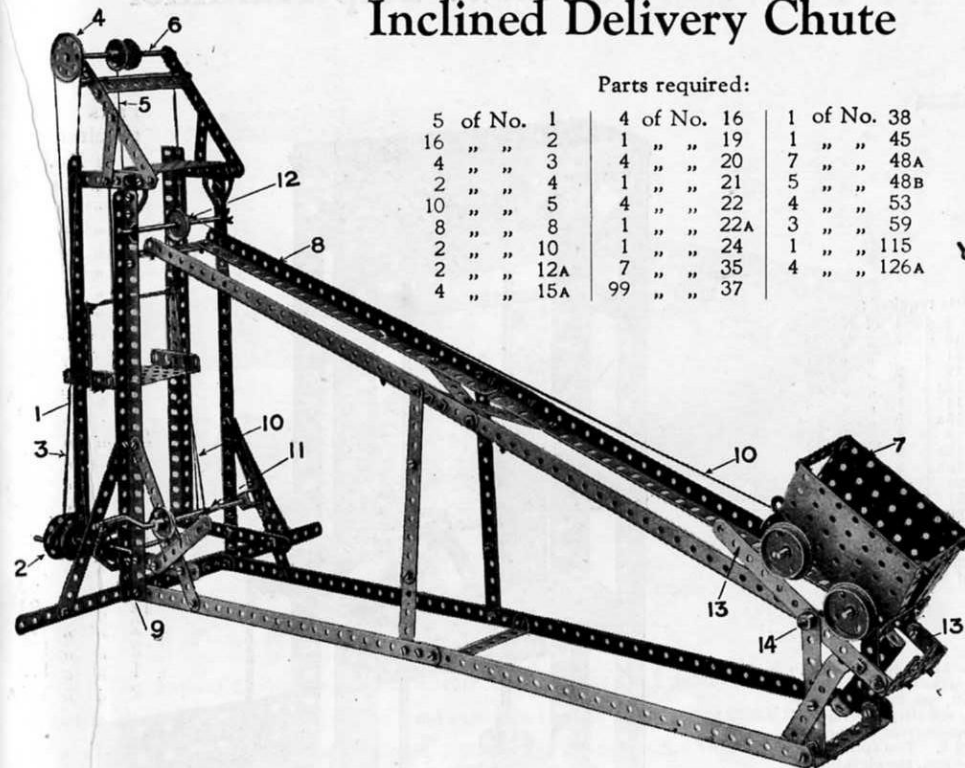


## Parts required:

5 of No. 1	4 of No. 16	1 of No. 38
16 " " 2	1 " " 19	1 " " 45
4 " " 3	4 " " 20	7 " " 48A
2 " " 4	1 " " 21	5 " " 48B
10 " " 5	4 " " 22	4 " " 53
8 " " 8	1 " " 22A	3 " " 59
2 " " 10	1 " " 24	1 " " 115
2 " " 12A	7 " " 35	4 " " 126A
4 " " 15A	99 " " 37	

Model No. 448
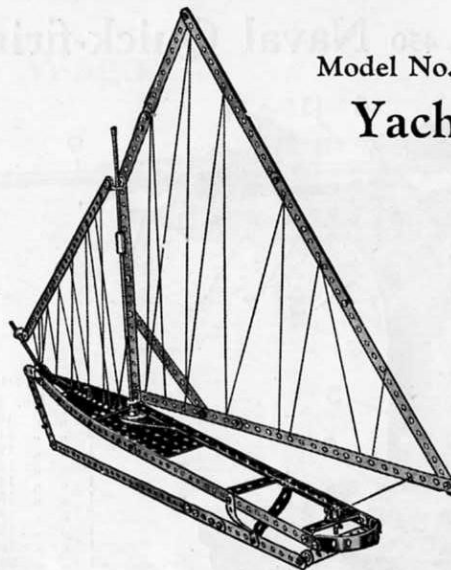
## Yacht



## Parts required:

9 of No. 1	2 of No. 18A
7 " " 2	1 " " 22
4 " " 3	51 " " 37
2 " " 4	1 " " 44
2 " " 5	2 " " 48A
1 " " 10	1 " " 52
5 " " 12	1 " " 54
1 " " 13A	1 " " 63
2 " " 15	

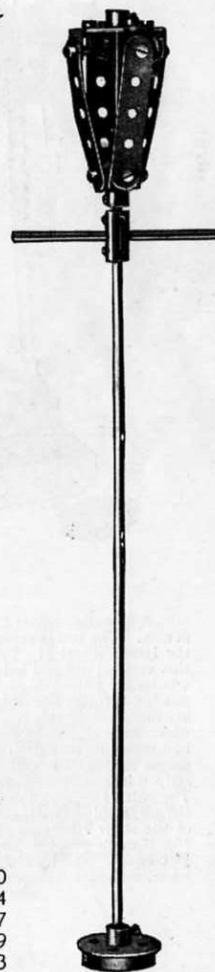
Model No. 449

## Street Lamp

## Parts required:


4 of No. 5	1 of No. 20
2 " " 11	1 " " 24
4 " " 12	12 " " 37
1 " " 13	1 " " 59
2 " " 16	1 " " 63

The cage 1 is raised from the hand-wheel 2 by means of an endless cord 3 which passes over the upper  $1\frac{1}{2}$ " pulley 4. A cord 5 winding on rod 6 between two 1" fast pulleys raises or lowers the cage. The truck 7 is raised or lowered along the inclined rails 8 by a crank handle 9, a cord 10 being wound on the rod 11, passing over a pulley 12, and connected to the truck 7. When the truck reaches the end of the inclined rails 10 it rests upon two  $5\frac{1}{2}$ " strips 13 pivoted at 14, the weight of the truck depressing these pivoted strips and tipping the load.





## Model No. 450 Naval Quick-firing Gun

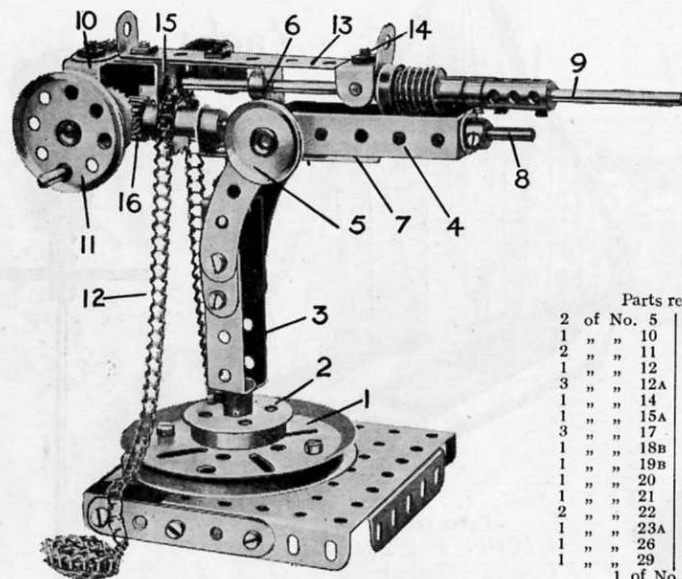


## Parts required:

2 of No. 5	1 of No. 32
1 of No. 10	2 of No. 35
2 of No. 11	24 of No. 37
2 of No. 12	24 of No. 38
3 of No. 12A	1 of No. 45
1 of No. 14	1 of No. 46
1 of No. 15A	5 of No. 48A
3 of No. 17	2 of No. 48B
1 of No. 18B	2 of No. 53
1 of No. 19B	8 of No. 59
1 of No. 20	1 of No. 63
1 of No. 21	4 of No. 90
2 of No. 22	1 of No. 94
1 of No. 23A	1 of No. 96A
1 of No. 26	2 of No. 111A
1 of No. 29	1 of No. 115
1 of No. 125	

A 3" pulley wheel 1 provides a bearing for the vertical  $4\frac{1}{2}$ " rod forming the axis about which the gun pivots. The rod is secured to the base by a flanged wheel 2 and a 1" pulley wheel attached to it beneath the larger wheel 1. Two double angle strips 3, spaced apart by a double bracket, are mounted upon this vertical rod and held in place by a collar secured to its upper end. Two  $2\frac{1}{2}$ " curved strips overlapped 4 holes are bolted to each of the double angle strips 3, and their upper holes form bearings for a short rod passing through the ends of further double angle strips 4 and carrying a hand wheel 5. Two spring clips are mounted on this rod inside the strips 4 to secure it to the pivoting portion of the gun, the elevation of which may be altered on turning the wheel 5. The strips 4 are bolted to the end of a double angle strip 6, and the same bolt secures an angle bracket which in turn is bolted to the double angle strip 7. The rod 8 passes through the end holes of the strips 4 and 7 and is held in place by two collars. On the top of the strip 6 is bolted a  $3\frac{1}{2}$ " double angle strip 13, the upturned ends of which form the sighting apertures. The bolt 14 secures a double bracket and an angle bracket, the latter together with one of the holes in the strip 6 forming bearings for the barrel 9. A 1" angle bracket 15, bolted beneath the strip 6, and the end of the strip 7 provide bearings for the short rod carrying a  $\frac{3}{4}$ " sprocket wheel and  $\frac{1}{2}$ " pinion 16. Two  $1" \times 1"$  angle brackets 10 form bearings for a 2" rod carrying the hand wheel 11. This rod is fitted with a  $\frac{3}{4}$ " contrate wheel which engages with the pinion 16. On rotation of the wheel 11, the small sprocket wheel actuates the sprocket chain 12 which represents the cartridge belt.

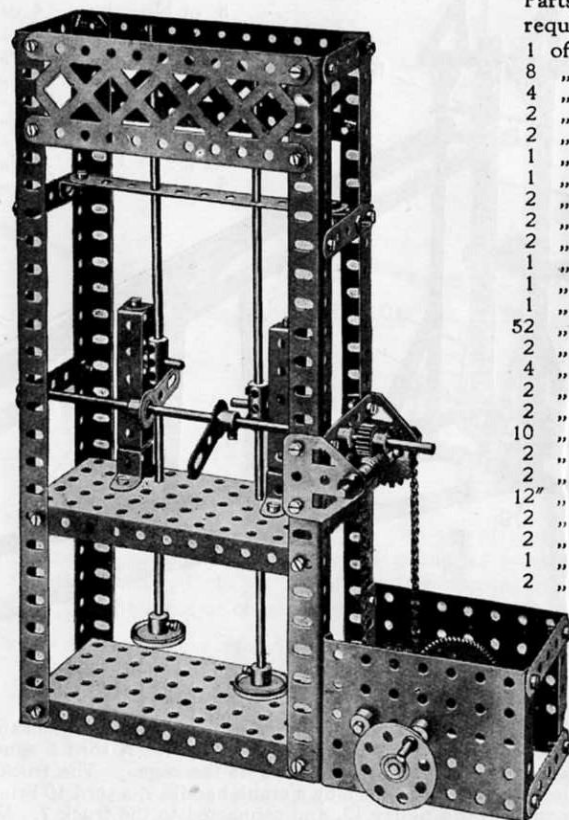
## Model No. 451 Trip Hammer



## Parts required:

1 of No.	2
8 of No.	5
4 of No.	8
2 of No.	12
2 of No.	13
1 of No.	13A
1 of No.	15A
2 of No.	16
2 of No.	18A
2 of No.	22
1 of No.	24
1 of No.	27A
1 of No.	32
52 of No.	37
2 of No.	45
4 of No.	48A
2 of No.	52
2 of No.	53
10 of No.	59
2 of No.	62
2 of No.	63
12 of No.	94
2 of No.	96
2 of No.	100
1 of No.	115
2 of No.	126A
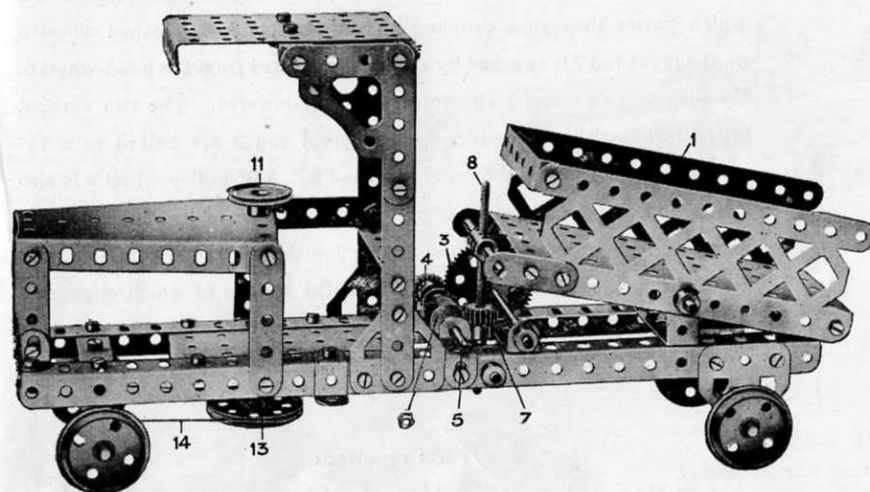
## Model No. 452 Tip Wagon



The tipping of the wagon 1 is effected by the handle 2 secured on a 57-toothed wheel 3 which engages a  $\frac{1}{2}$ " pinion 4 mounted on the rod 5. On the same rod is secured a worm 6 which engages a  $\frac{1}{2}$ " pinion 7 secured to the upright threaded rod 8. The threaded rod 8 revolves freely in the coupling 9, being retained in position by the collar 10. As the handle 2 is operated, the wagon 1 is tipped or restored to its original position. The steering is effected by a 1" pulley wheel 11 on a rod 12, at the lower end of which is secured a  $1\frac{1}{2}$ " pulley wheel 13, a cord 14, wound twice round this pulley wheel, being connected to a double angle strip 15 in which the steering axle 16 is journaled.

Parts  
required:

	2	of No.	2
6	"	"	5
2	"	"	6A
2	"	"	8
4	"	"	12
1	"	"	15A
5	"	"	16
4	"	"	18A
4	"	"	20
1	"	"	21
1	"	"	22
1	"	"	24
2	"	"	26
1	"	"	27A
1	"	"	32
57	"	"	37
4	"	"	38
1	"	"	46
6	"	"	48A
1	"	"	52
2	"	"	53
1	"	"	54
10	"	"	59
3	"	"	63
1	"	"	80A
2	"	"	100
2	"	"	108
1	"	"	115
4	"	"	125
4	"	"	126A

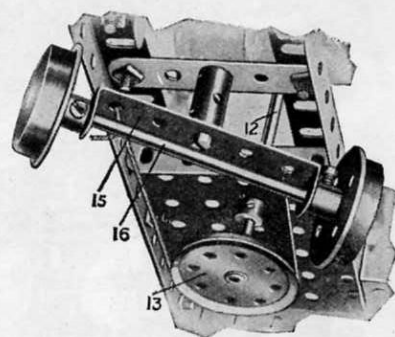


FIG. 452A


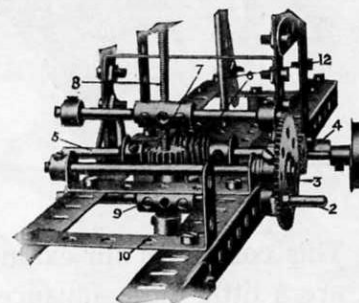


FIG. 452B

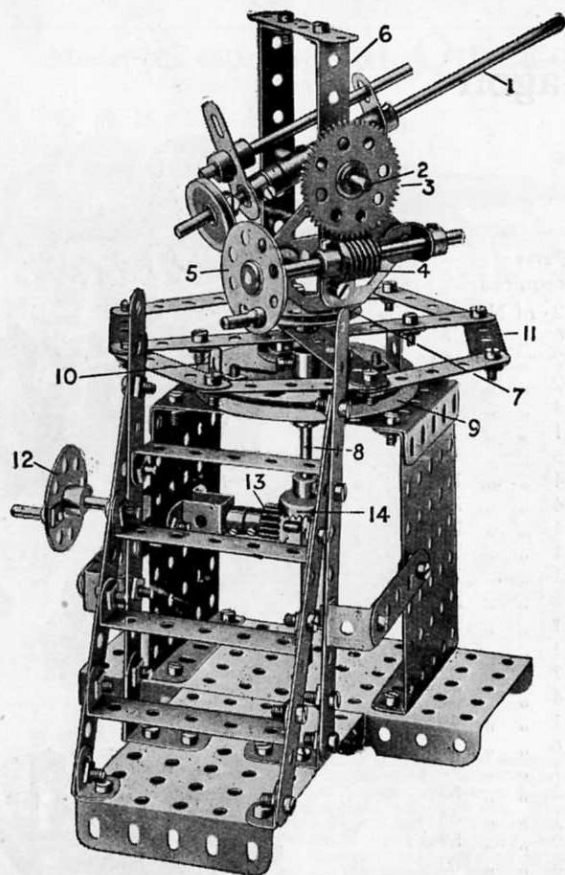This Model can be made with MECCANO Outfit No. 4, or No. 3 and No. 3A.



## Model No. 453 Anti-Aircraft Gun

The gun represented by the rod 1 is pivoted upon a transverse rod 2 which passes through a coupling on the rod 1. A 57-toothed wheel 3 on the pivot rod 2 is engaged by a worm 4 operated from the hand-wheel 5. By turning this wheel 5 the gun is lifted or lowered. The two vertical strips forming the framework for the pivot rod 2 are bolted to a 1½" pulley 7 which is secured on a vertical rod 8. A 3" pulley wheel 9 is also bolted to a rod 8 and from the pulley wheel is carried by reversed angle brackets 10 a framework 11. The rod 8 with the framework is rotated from the hand-wheel 12, a pinion 13 on the spindle of which engages a ½" contrate wheel 14 on the rod 8. By turning the wheel 12 the gun is swivelled round.

Parts required:

6 of No. 2	4 of No. 16	1 of No. 29	4 of No. 53
11 " " 5	1 " " 17	1 " " 32	8 " " 59
" " " 10	1 " " 19 <sup>B</sup>	64 " " 37	1 " " 62
2 " " 11	1 " " 21	12 " " 38	2 " " 63
4 " " 12	2 " " 22	2 " " 45	2 " " 115
2 " " 12 <sup>A</sup>	2 " " 24	4 " " 48 <sup>A</sup>	4 " " 125
1 " " 15	1 " " 26	2 " " 48 <sup>B</sup>	2 " " 126 <sup>A</sup>
1 " " 15 <sup>A</sup>	1 " " 27 <sup>A</sup>	1 " " 52	

## HOW TO CONTINUE

**This completes our examples of the Models that may be made with MECCANO Outfit No. 4. The next Models are a little more advanced, requiring a number of extra parts to construct them. The necessary parts are all contained in a No. 4A Accessory Outfit, the price of which will be found in the List at the end of the Manual.**

This Model can be made with MECCANO Outfit No. 5, or No. 4 and No. 4A.

85

## Model No. 501 Beam Scales

Parts required:

7 of No. 1	7 of No. 20
10 " " 2	2 " " 22
8 " " 3	88 " " 37
2 " " 4	2 " " 44
10 " " 5	1 " " 46
10 " " 8	5 " " 48A
2 " " 10	1 " " 50
9 " " 12	2 " " 52
2 " " 14	2 " " 53
2 " " 15	2 " " 54
4 " " 15A	2 " " 57
2 " " 16	8 " " 59


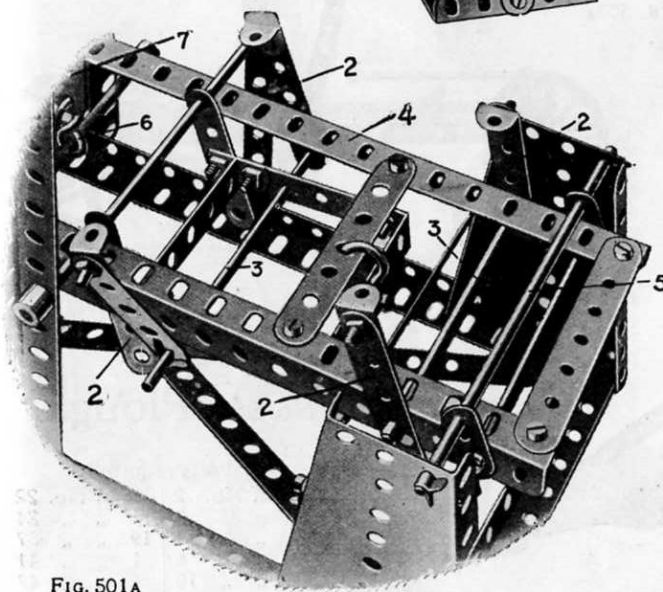


Fig. 501A

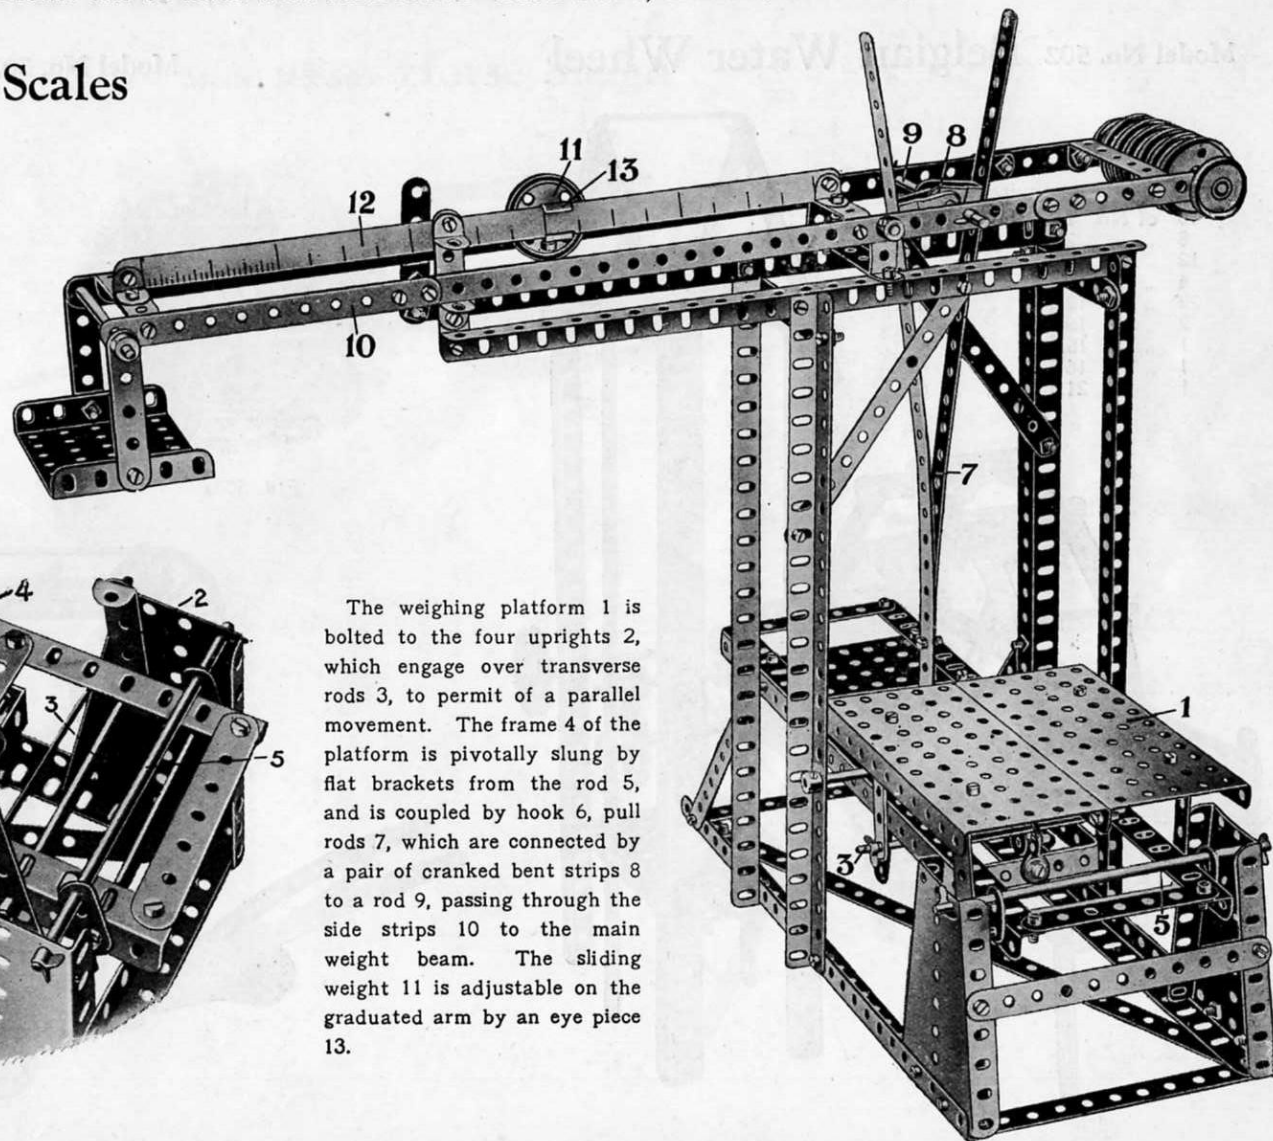

The weighing platform 1 is bolted to the four uprights 2, which engage over transverse rods 3, to permit of a parallel movement. The frame 4 of the platform is pivotally slung by flat brackets from the rod 5, and is coupled by hook 6, pull rods 7, which are connected by a pair of cranked bent strips 8 to a rod 9, passing through the side strips 10 to the main weight beam. The sliding weight 11 is adjustable on the graduated arm by an eye piece 13.




These Models can be made with MECCANO Outfit No. 5, or No. 4 and No. 4A.

## Model No. 502 Belgian Water Wheel

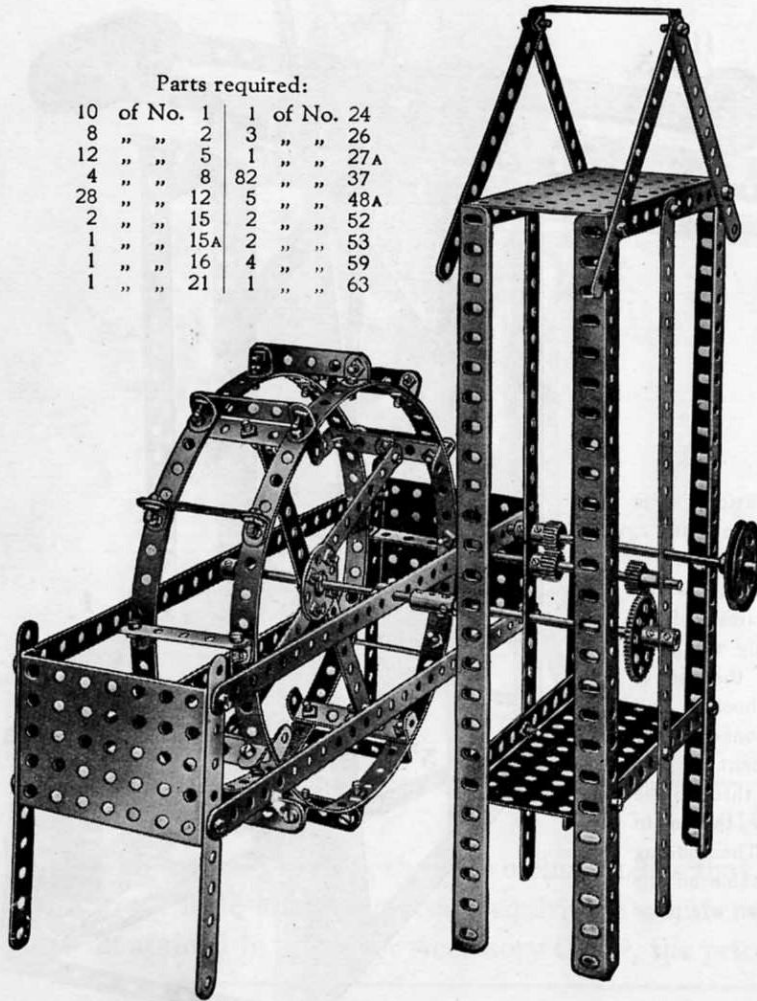Parts required:

10 of No.	1	1 of No.	24
8	" "	3	" "
12	" "	5	" "
4	" "	8	" "
28	" "	12	" "
2	" "	15	" "
1	" "	15A	" "
1	" "	16	" "
1	" "	21	" "
		1	" "
		2	" "
		3	" "
		5	" "
		8	" "
		12	" "
		15	" "
		15A	" "
		16	" "
		21	" "
		24	" "
		26	" "
		27A	" "
		37	" "
		48A	" "
		52	" "
		53	" "
		59	" "
		63	" "



## Model No. 503 Hand Car

Parts required:

4 of No.	2	1 of No.	26
2	" "	6A	" "
2	" "	8	" "
1	" "	9D	" "
4	" "	11	" "
2	" "	14	" "
1	" "	15A	" "
1	" "	16	" "
1	" "	17	" "
4	" "	19A	" "
2	" "	24	" "
		1	" "
		32	" "
		4	" "
		2	" "
		1	" "
		7	" "
		2	" "
		1	" "
		2	" "
		126A	" "


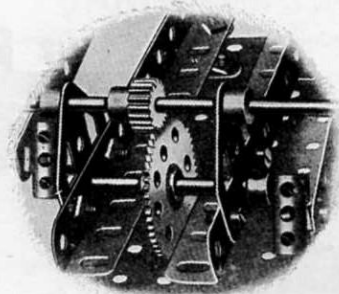



Fig. 503A

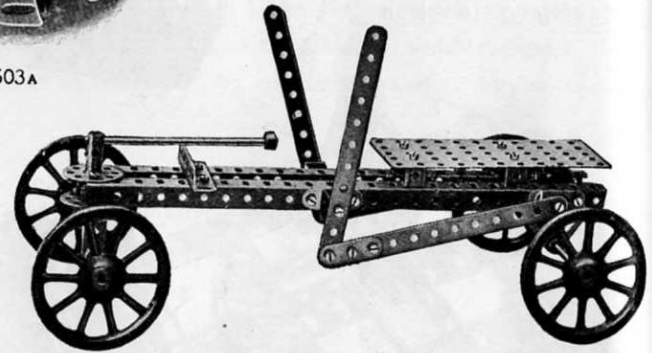

## Model No. 504 Plough

Parts required:

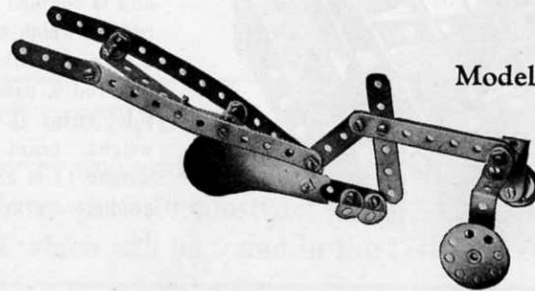
2 of No.	2	1 of No.	22
4	" "	3	" "
1	" "	4	" "
3	" "	6	" "
1	" "	10	" "
8	" "	12	" "
		1	" "
		19	" "
		1	" "
		1	" "
		47	" "



These Models can be made with MECCANO Outfit No. 5, or No. 4 and No. 4A.

87


## Model No. 505 Horse Sleigh

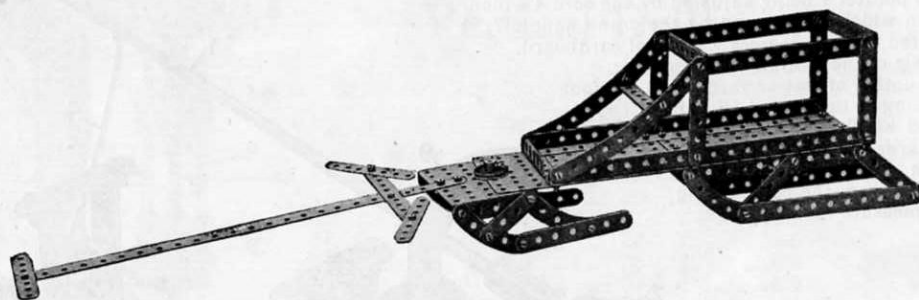

### Parts required:

1 of No. 1	2 of No. 22
5 " " 2	50 " " 37
5 " " 3	3 " " 48B
4 " " 4	1 " " 52
4 " " 5	2 " " 52A
2 " " 6	1 " " 53
2 " " 8A	2 " " 89
1 " " 9D	6 " " 90
1 " " 18A	
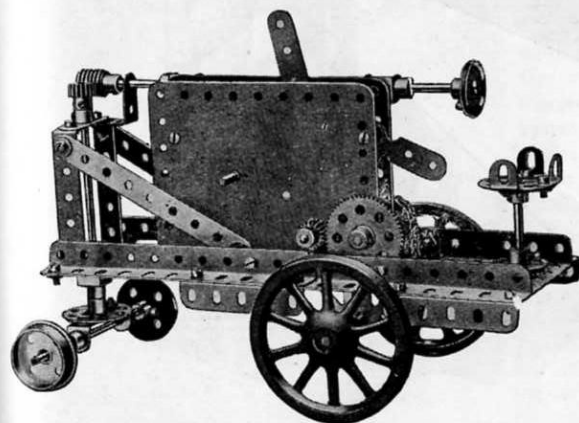
## Model No. 506 Farm Tractor




### Parts required:

2 of No. 2A	1 of No. 27A
1 " " 3	1 " " 32
1 " " 6A	38 " " 37
4 " " 9	6 " " 38
2 " " 11	1 " " 45
7 " " 12	1 " " 48
1 " " 12A	2 " " 48A
1 " " 13A	2 " " 53
1 " " 15	9 " " 59
1 " " 15A	6 " " 94
2 " " 17	2 " " 96
2 " " 19A	2 " " 126A
2 " " 20	
2 " " 22	
2 " " 24	
2 " " 26	

Clockwork  
Motor  
(not included  
in Outfit)
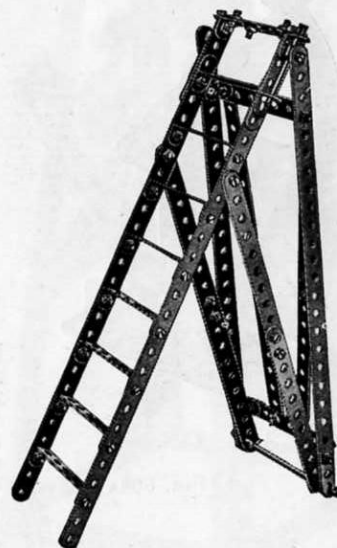
## Model No. 507 Step Ladder



### Parts required:

4 of No. 1	1
8 " " 2	2
2 " " 3	3
3 " " 5	5
2 " " 10	10
8 " " 12	12
1 " " 16	16
2 " " 17	17
10 " " 35	35
44 " " 37	37
9 " " 48A	48A
2 " " 59	59

This Model can be made with MECCANO Outfit No. 5, or No. 4 and No. 4A.

## Model No. 508 Sighting Apparatus

This model is for determining the heights of buildings, towers, etc. The pointer  $11\frac{1}{2}$ " rod 1 is pivoted on the 2" rod 2 and controlled by a spring 3, the pointer 1 being adjusted by the cord 4 which passes round a guide pulley 5 and on to the axle 6 upon which it is wound by the crank handle 7 which operates the gear wheel and pinion 8. A graduated scale of degrees 9 made of cardboard, or a protractor, is mounted in order to read off the angle of inclination of the pointer.

In finding the height of a building, measure out a number of feet or yards from the foot of the building, and set this out to some scale corresponding to the line  $ab$  (Fig. B). Then standing at the point  $a$  furthest from the building, and keeping the angle girders 10 horizontal, move the pointer 1 until it is directed towards the top of the building. Then read off the angle on the scale 9, and draw a line  $ac$ , making the angle  $bac$  equal to the angle read off. Then draw a vertical line  $bc$  from the point  $b$ , and with the same scale used for setting off the distance  $ab$  measure the height  $bc$ , which will be the height of the building.

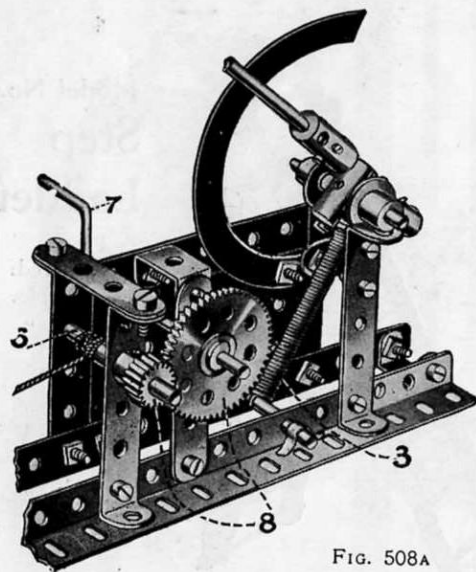


FIG. 508A

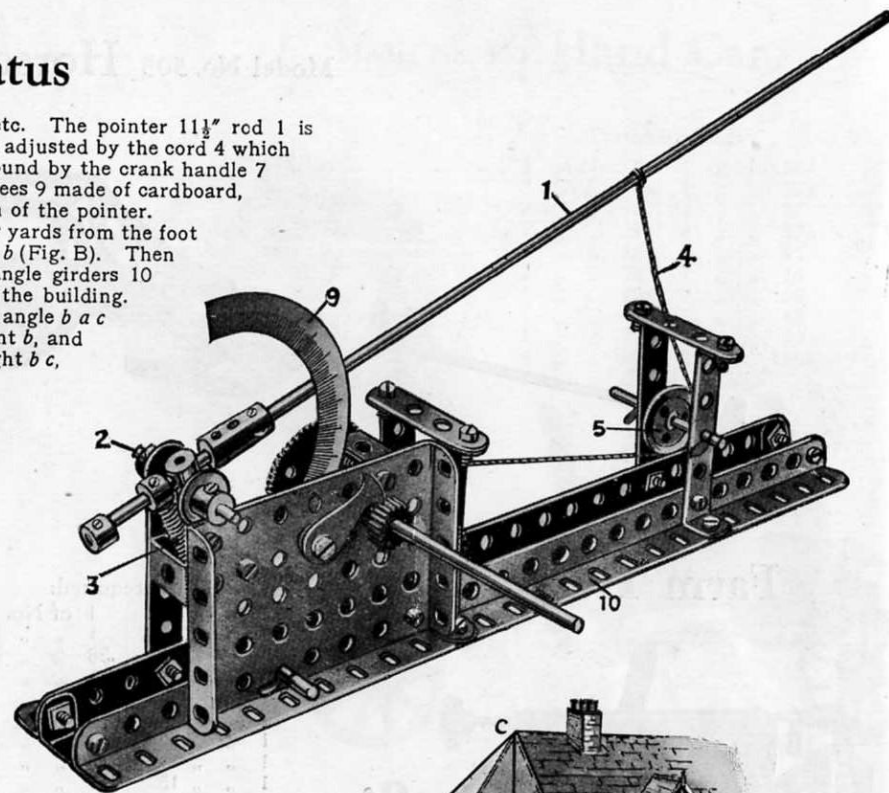


FIG. 508B


### Parts required:

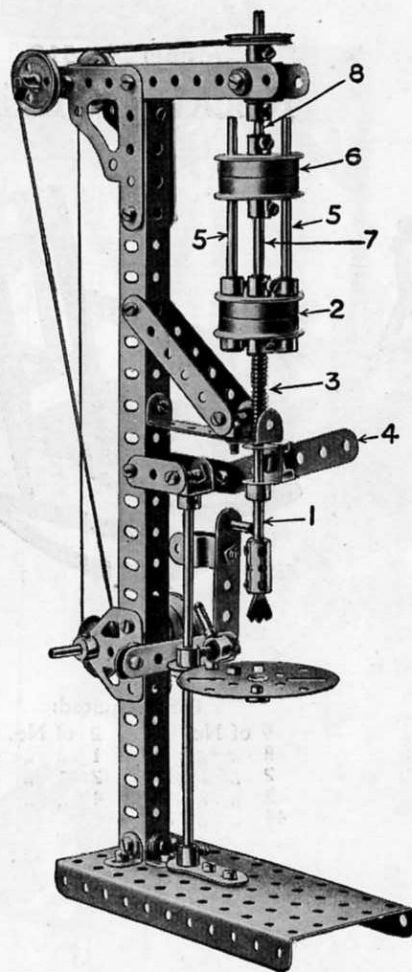1 of No. 5	24 of No. 37
2 " " 6	1 " " 43
2 " " 8	5 " " 48A
4 " " 11	1 " " 53
1 " " 13	3 " " 59
4 " " 17	2 " " 62
1 " " 19	2 " " 63
1 " " 22	1 " " 147A
1 " " 26	1 " " 147B
1 " " 27A	1 " " 148
2 " " 35	

These Models can be made with MECCANO Outfit No. 5, or No. 4 and No. 4A.

## Model No. 510 Fret Saw

### Model No. 509 Vertical Drill




#### Parts required:

2	of No. 2	4	of No. 16	1	of No. 48A
3	" "	1	" "	1	" "
2	" "	5	" "	10	" "
1	" "	6	" "	2	" "
1	" "	6A	" "	2	" "
2	" "	8	" "	35	" "
5	" "	11	" "	39	" "
6	" "	12	" "	6	" "
1	" "	14	" "	1	" "
1	" "	15A	" "	1	" "
				44	" "

The drill rod 1 is connected to the boss of the lower pair of flanged wheels 2 which are reversed, a spring 3 round the rod raising the drill after it has been depressed by the handle strip 4. Bolted in the wheels 2 are two outer rods 5 which slide in the upper flanged wheels 6. The central rod 7 is bolted in the upper wheels and slides in the centre bosses of the lower wheels 2. The upper wheels 6 are bolted to the driving spindle 8 and consequently the drill is driven by the rods 5 when the drill is depressed by the handle 4 against the spring.

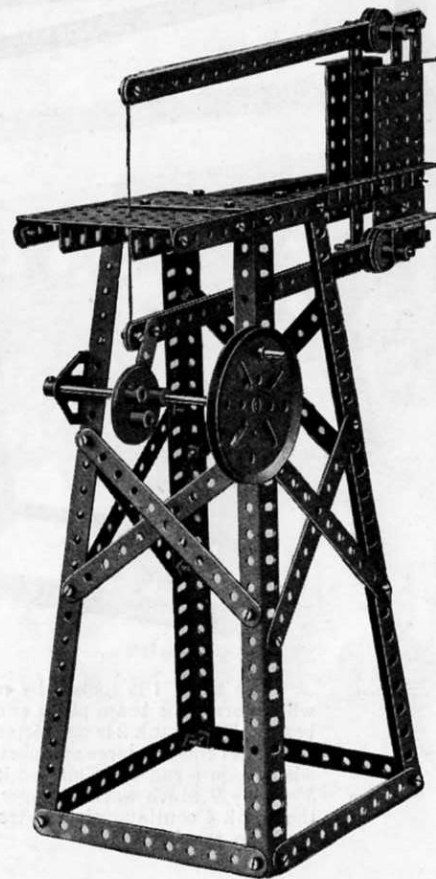See also "Meccano Standard Mechanisms," under Locking Device (S.M. 137) and Variable Drive (Section XIII).




#### Parts required:

4	of No. 1
17	" "
6	" "
1	" "
2	" "
1	" "
4	" "
53	" "
4	" "
5	" "
1	" "
2	" "
1	" "


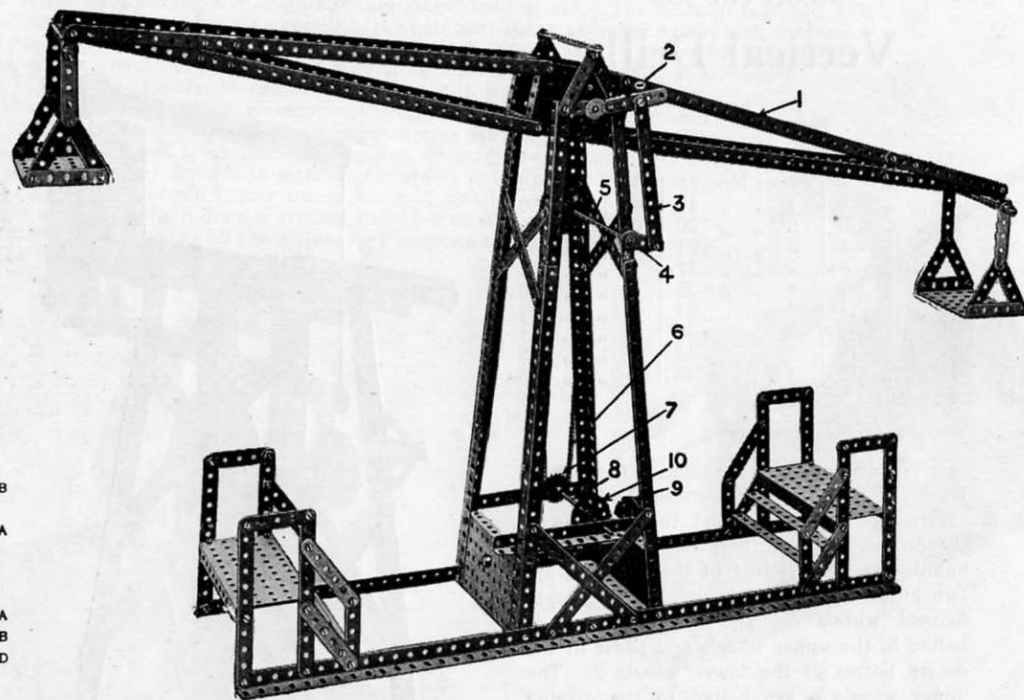
## Model No. 511 Giant Auto Swing



### Parts required:

8 of No.	1
26 " "	2
2 " "	3
8 " "	4
31 " "	5
12 " "	8
1 " "	9
18 " "	12
2 " "	14
4 " "	15
1 " "	19 <sup>B</sup>
1 " "	24
1 " "	27 <sup>A</sup>
1 " "	32
165 " "	37
2 " "	38
2 " "	48 <sup>A</sup>
2 " "	48 <sup>B</sup>
4 " "	48 <sup>D</sup>
4 " "	52
4 " "	53
9 " "	59
2 " "	62
28 " "	94
1 " "	95
1 " "	96
1 " "	147 <sup>B</sup>

The beam 1 is rocked by means of a crank 2 secured on the end of a rod which forms the beam pivot and which is bolted in a bush wheel secured to the beam. This crank 2 is connected by a strip 3 to another crank 4 on a rod 5. On the end of this is a large sprocket wheel driven by a chain 6 from a small sprocket wheel 7 on a rod 8. This rod is driven by means of a worm on the rod of the 3" pulley 9 which worm engages and drives the gear wheel 10 on the rod 8. As the crank 4 continuously rotates the link 3 causes the upper crank 2 to oscillate and also the beam 1.

## Model No. 512 Rocking Chair

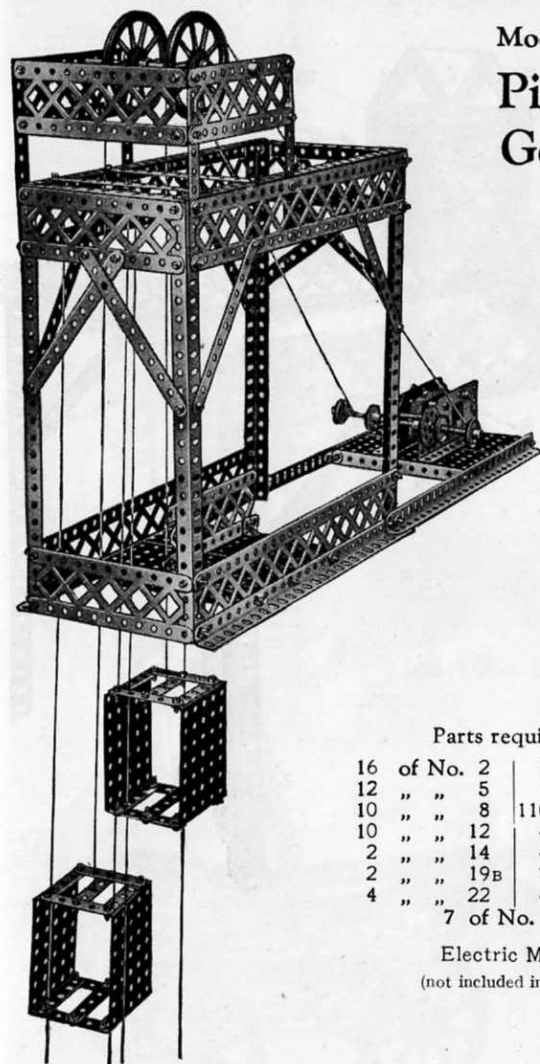


### Parts required:

9 of No.	2	2 of No.	48 <sup>A</sup>
8 " "	5	1 " "	48 <sup>B</sup>
2 " "	10	2 " "	53
3 " "	12	4 " "	89
44 " "	37		

Model No. 513

# Pit Head Gear




## Parts required:

16	of No. 2	1	of No. 26
12	" " 5	1	" " 27A
10	" " 8	110	" " 37
10	" " 12	4	" " 52
2	" " 14	4	" " 53
2	" " 19B	7	" " 59
4	" " 22	4	" " 99
7 of No. 100			

Electric Motor  
(not included in Outfit)

Model No. 514
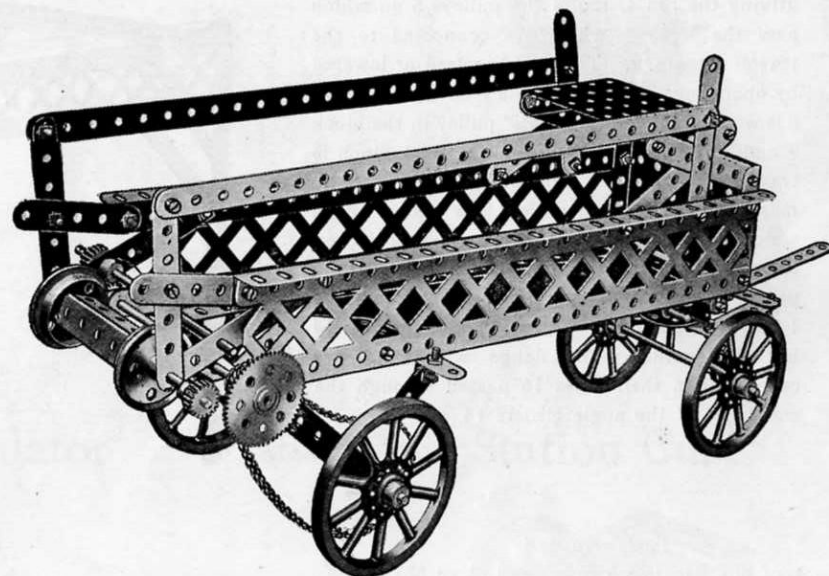
# Manure Distributing Cart



## Parts required:

2	of No. 1	3	of No. 15	3	of No. 26	2	of No. 53
3	" " 2	2	" " 15A	1	" " 27A	8	" " 59
10	" " 3	2	" " 17	4	" " 35	1'	" " 94
9	" " 5	4	" " 19A	57	" " 37	1	" " 95
4	" " 8	2	" " 20	1	" " 46	1	" " 96
6	" " 12	1	" " 24	4	" " 48A	2	" " 99
1	" " 14						

## Model No. 515 Travelling Gantry Crane

The travelling gantry 1 is traversed along the rails by a hand wheel 2, a sprocket chain 3 driving the rod 4, round the pulleys 5 on which pass the cords 6 which are connected to the travelling gantry. The load is raised or lowered by operating the crank handle 7 on which a cord 8 is wound, passing round a  $\frac{1}{2}$ " pulley in the block 9 and being secured to a rod 10. The winch is traversed along the rails of the gantry 1 by means of the crank handle 11, a pinion 12 on which engages a 57-toothed gear wheel 13, on the axle of the travelling wheels. The travelling gantry is built up of the rails of the angle girders 1 bolted at each end to two  $5\frac{1}{2}$ " angle girders 14 butted together. The flange wheels 15 are carried upon their axles 16 passed through the end holes of the angle girders 14.

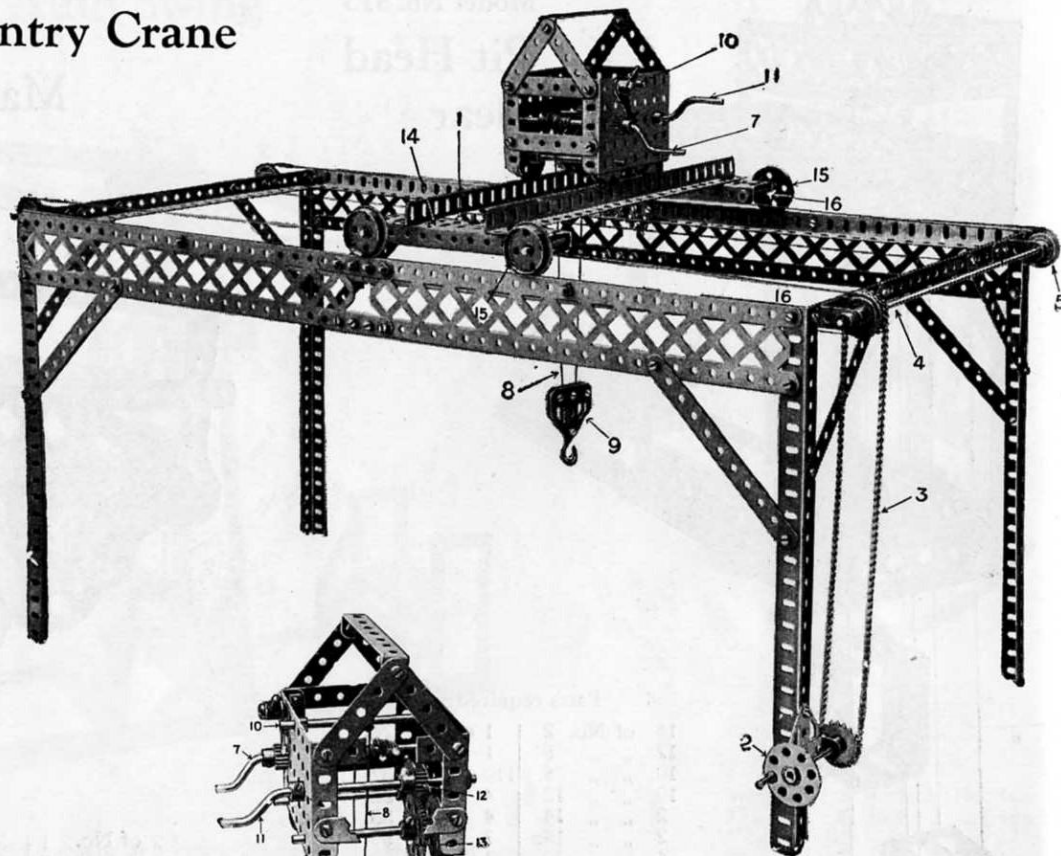



FIG. 515A

### Parts required:

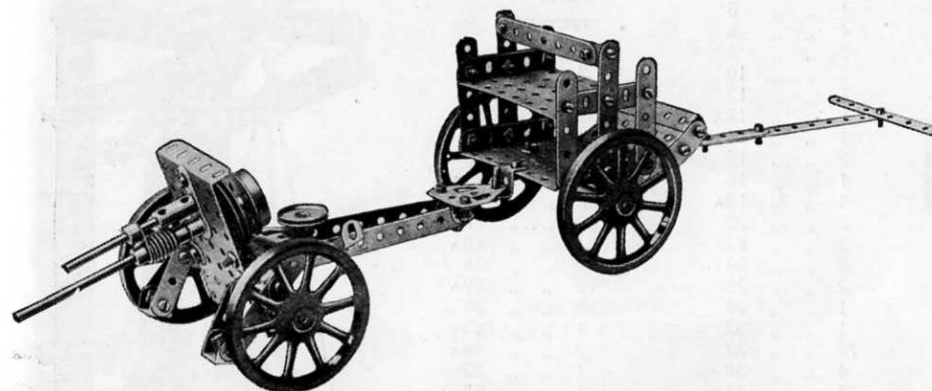4 of No. 1	8 of No. 20	1 of No. 57
8 " " 2	4 " " 22	8 " " 59
4 " " 4	1 " " 23	24 " " 94
10 " " 5	1 " " 24	2 " " 96
12 " " 8	1 " " 26	4 " " 99
4 " " 9	1 " " 27A	4 " " 100
2 " " 11	2 " " 35	2 " " 115
4 " " 12A	96 " " 37	3 " " 126A
2 " " 13	6 " " 38	1 " " 147A
3 " " 16	1 " " 48	1 " " 147B
5 " " 17	1 " " 48B	1 " " 148
2 " " 19	2 " " 53	

These Models can be made with MECCANO Outfit No. 5, or No. 4 and No. 4A.

## Model No. 516 Field Gun and Carriage



Parts required:

4	of No. 2	1	of No. 22
2	" " 3	1	" " 24
2	" " 4	1	" " 32
6	" " 5	62	" " 37
2	" " 6A	2	" " 38
3	" " 10	3	" " 48A
3	" " 11	2	" " 48B
14	" " 12	2	" " 53
2	" " 15	3	" " 59
1	" " 15A	1	" " 62
1	" " 16	1	" " 63
1	" " 18A	2	" " 90
4	" " 19A	1	" " 115
1	" " 20	2	" " 125
1	" " 21	2	" " 126A


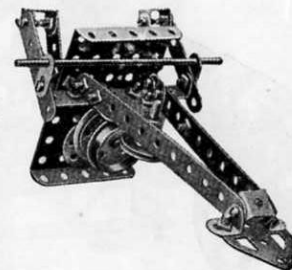


FIG. 516A


## Model No. 517 Perambulator

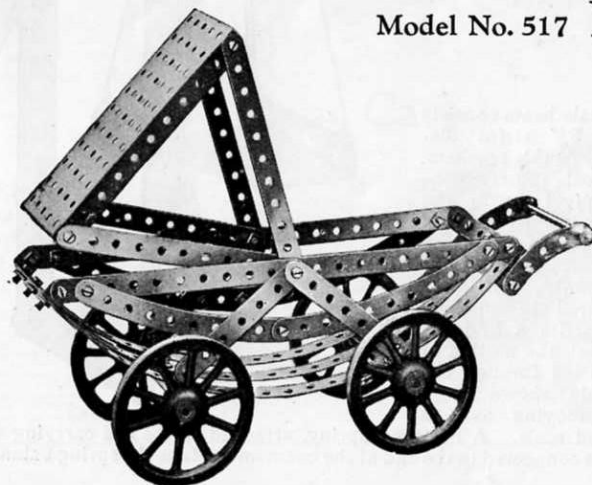

Parts required:

3	of No. 1	37	of No. 37
8	" " 2	5	" " 48A
4	" " 3	1	" " 52
6	" " 12	2	" " 59
3	" " 16	4	" " 89
4	" " 19A	2	" " 90

## Model No. 518 Station Cart

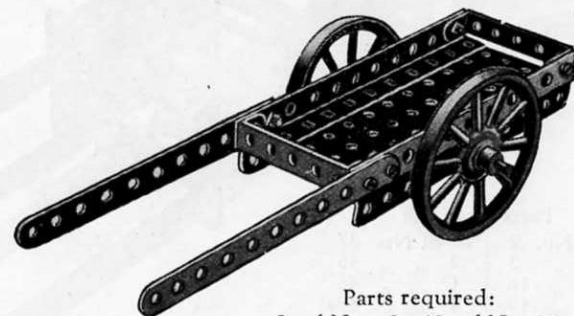


Parts required:

2	of No. 2	10	of No. 37
2	" " 9	2	" " 48A
1	" " 15A	1	" " 52
2	" " 19A		




These Models can be made with MECCANO Outfit No. 5, or No. 4 and No. 4A

## Model No. 519 Motor Car

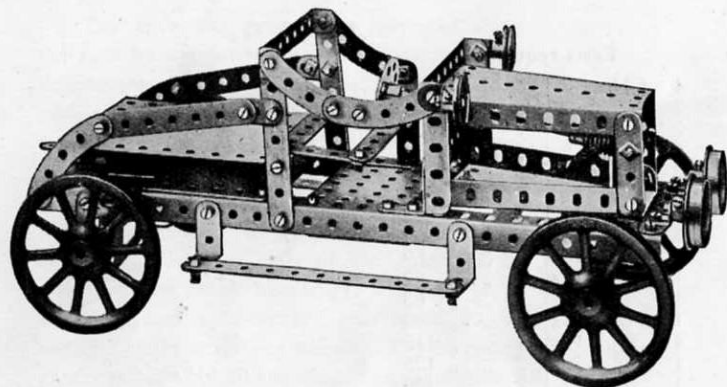

## Model No. 520 Spooling Machine

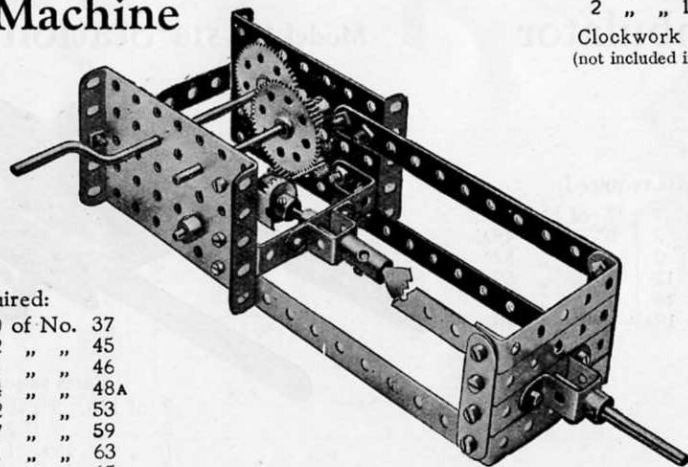

### Parts required:

4	of No. 2	20	of No. 37
1	" " 3	2	" " 45
3	" " 16	1	" " 46
1	" " 17	4	" " 48A
1	" " 19	2	" " 53
2	" " 26	7	" " 59
2	" " 27A	1	" " 63
1	" " 29	1	" " 65

### Parts required:

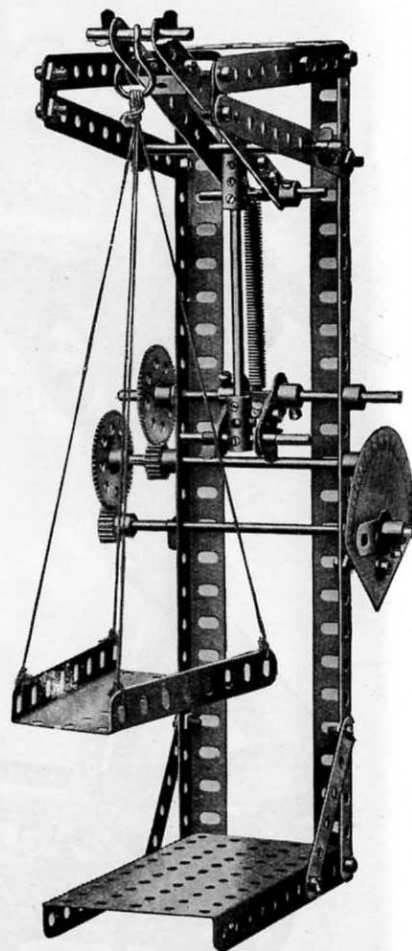
2	of No. 2
8	" " 3
1	" " 5
4	" " 6
2	" " 8
2	" " 10
8	" " 12
6	" " 12A
1	" " 14
2	" " 15
1	" " 16
4	" " 19A
2	" " 20
2	" " 22
2	" " 24
2	" " 26
1	" " 28
1	" " 32
75	" " 37
4	" " 38
3	" " 48B
2	" " 53
2	" " 54
7	" " 59
2	" " 89
2	" " 126A

Clockwork Motor  
(not included in Outfit)

## Model No. 521 Spring Scales

### Parts required:

6	of No. 2
2	" " 4
2	" " 8
2	" " 10
3	" " 11
2	" " 15
1	" " 15A
2	" " 16
2	" " 17
1	" " 18A
2	" " 26
2	" " 27A
23	" " 37
1	" " 43
2	" " 48A
1	" " 52
1	" " 54
1	" " 57
2	" " 59
2	" " 62
2	" " 63
1	" " 111




The scale beam consists of two 5½" strips distanced by double brackets. A vertical rod is connected pivotally to the beam by means of a ¼" bolt, and to a short rod passed through the ends of two cranks. The latter are secured to an axle which carries a 57-teeth gear wheel, the motion of which is led through the gear train shown to a pointer moving over a graduated scale. A Meccano spring, attached to the rod carrying the cranks, is connected to the end of the beam and acts as the spring balance.

Parts  
require  
2 of N  
1 "  
2 "  
14 "  
4 "  
1 "  
2 "  
2 "

These Models can be made with MECCANO Outfit No. 5, or No. 4 and No. 4A

95

## Model No. 522 Timber Carriage

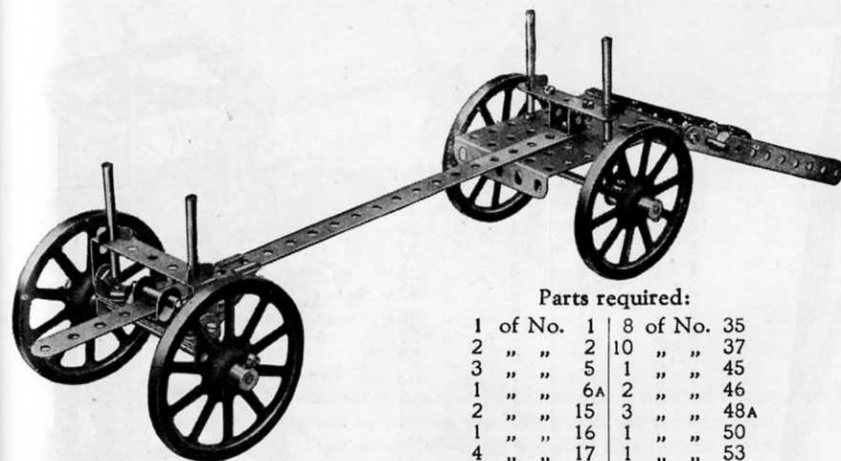


Parts required:

1 of No. 1	8 of No. 35
2 " " 2	10 " " 37
3 " " 5	1 " " 45
1 " " 6A	2 " " 46
2 " " 15	3 " " 48A
1 " " 16	1 " " 50
4 " " 17	1 " " 53
1 " " 18A	4 " " 59
4 " " 19A	1 " " 111


## Model No. 524 Cart

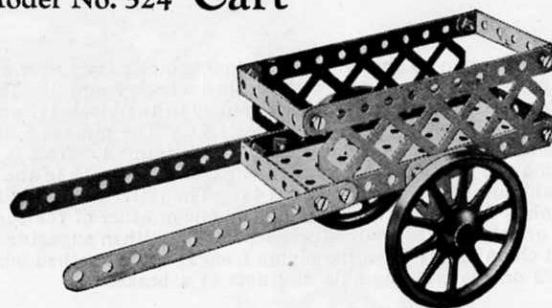Parts required:

2 of No. 2	
1 " " 16	
2 " " 19A	
14 " " 37	
4 " " 48A	
1 " " 52	
2 " " 100	
2 " " 126A	




## Model No. 523 Coster's Barrow

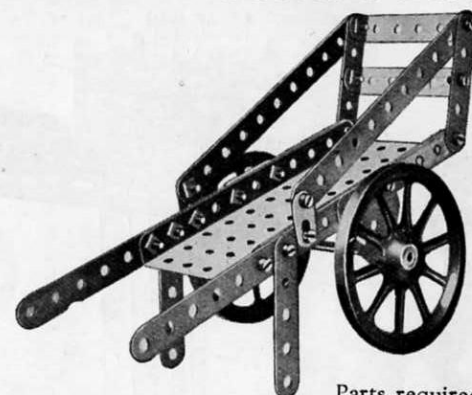

Parts required:

4 of No. 2	18 of No. 37
4 " " 5	2 " " 48A
2 " " 10	1 " " 52
1 " " 16	2 " " 126A
2 " " 19A	

## Model No. 525 Bullock Cart

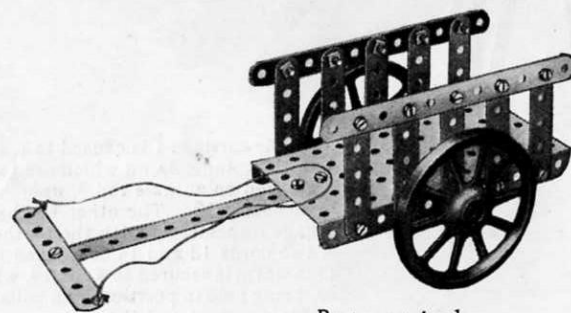


Parts required:

3 of No. 2	2 of No. 19A
1 " " 3	21 " " 37
10 " " 5	1 " " 52
1 " " 16	

This Model can be made with MECCANO Outfit No. 5, or No. 4 and No. 4A.

## Model No. 526 Travelling Crane

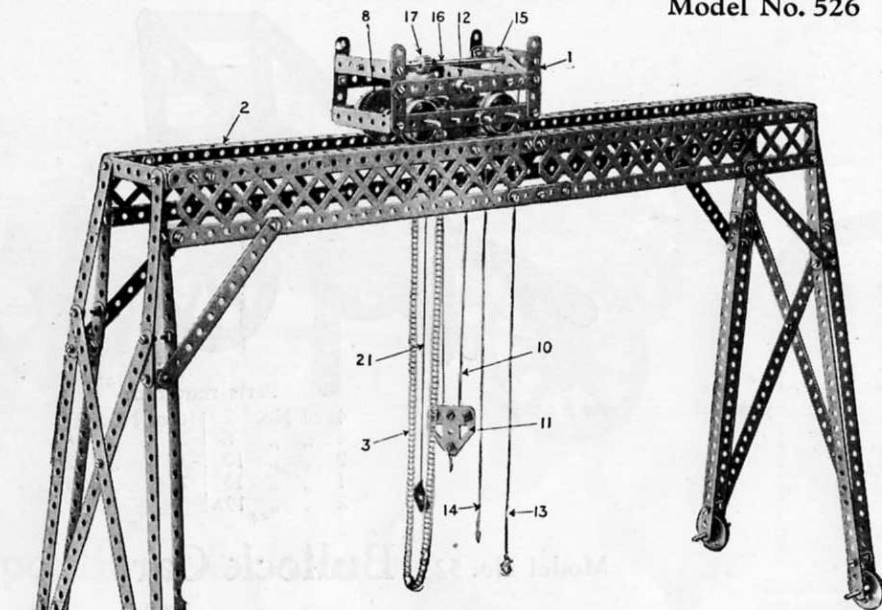

### Parts required:

16 of No. 1	2 of No. 27A
16 " " 2	1 " " 32
6 " " 5	86 " " 37
4 " " 8	8 " " 38
2 " " 9	2 " " 47A
8 " " 11	5 " " 48A
4 " " 12	1 " " 57
1 " " 14	6 " " 59
1 " " 15A	1 " " 62
4 " " 16	1 " " 63
4 " " 17	30" " " 94
8 " " 20	1 " " 96
1 " " 22	4 " " 99
1 " " 23	2 " " 126A
3 " " 26	1 " " 128

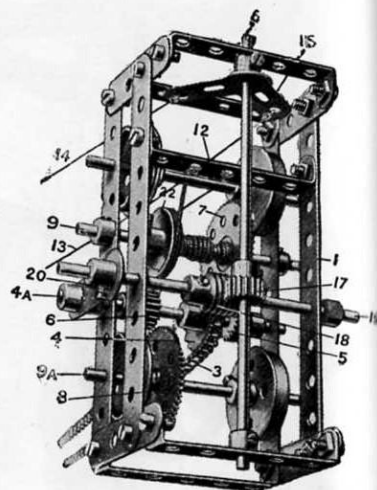


FIG. 526A

The carriage 1 is caused to travel on the rails 2 in either direction by the sprocket chain 3, which passes over a 1" sprocket wheel 4 on the spindle 4A on which are two pinions 5 and 6 for engagement respectively with toothed wheels 7 and 8. The toothed wheel 7 is secured on an axle rod 9, upon which is coiled the winding cord 10 passing round a  $\frac{1}{2}$ " pulley in the block 11, and being made fast to the strip 12. The other toothed wheel 8 is secured on the axle of the travelling wheels 9A. The pinions 5 and 6 are caused to engage respectively with the toothed wheels 7 and 8 by sliding the pinion axle 4A in the carriage frame 1. This is effected by means of two cords 13 and 14 connected to a boss bell crank 15 on a rod 16, a pinion 17 which engages a worm 18 in the manner of a rack. This worm is secured to a rod 19, which is connected by a crank piece 20 to the pinion rod 4A. The latter revolving freely in the crank 20, being held in position by a collar on each side of the crank. Consequently, by pulling on one or other of the cords 13, 14, the bell crank is racked and the pinions caused to engage with one or other of the toothed wheels 7 or 8. When engaging the toothed wheel 7 the load may be raised or lowered by pulling the sprocket chain 3, but when the pinion 6 engages the toothed wheel 8, the carriage travels on the rails. The cord 21 passes round a pulley 22 on the winding axle and acts as a brake.


These Models can be made with MECCANO Outfit No. 5, or No. 4 and No. 4A.

97

## Model No. 527 Motor Plough

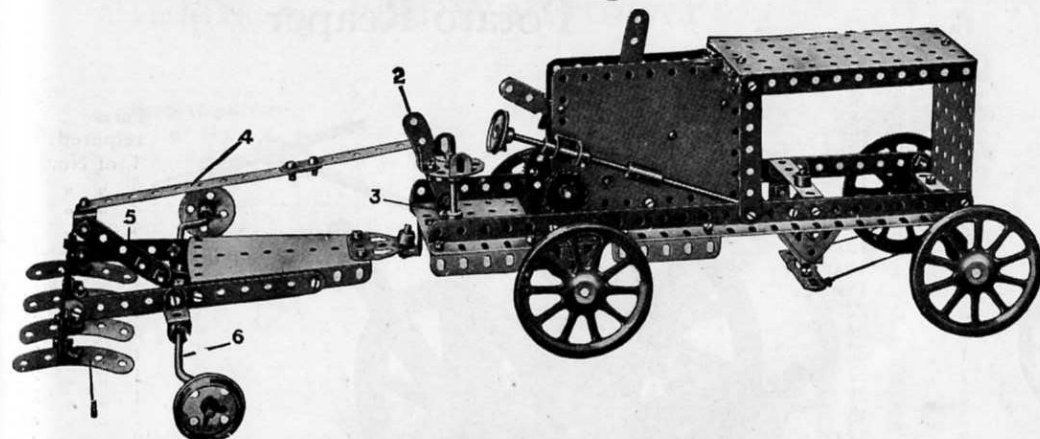Parts required:

5 of No.	2	2 of No.	26	1 of No.	54
3 " "	3	1 " "	27A	9 " "	59
3 " "	5	1 " "	29	1 " "	62
2 " "	8	4 " "	35	2 " "	63
2 " "	10	24 " "	37	4 " "	90
1 " "	11	6 " "	38	6 " "	94
19 " "	12	1 " "	45	2 " "	96
3 " "	15A	1 " "	46	1 " "	115
1 " "	16	4 " "	48A	3 " "	125
3 " "	17	1 " "	52	5 " "	126A
2 " "	19	3 " "	53	Clockwork Motor	
4 " "	19A			(not included in Outfit)	
2 " "	20				
3 " "	22				
1 " "	24				



The ploughshares 1 are raised or lowered by the handle 2 pivoted to an angle bracket on the far side of the seat pillar, and connected by strips 4 to a crank 5 secured on the bent axle 6 of the wheels formed by crank handles. The plough is driven by a Meccano Clockwork Motor.

## Model No. 528 Motor Car

Parts required:

3 of No.	2	2 of No.	45
4 " "	3	2 " "	48
5 " "	5	2 " "	48B
2 " "	8	3 " "	53
2 " "	10	1 " "	54
11 " "	12	3 " "	59
2 " "	15A	1 " "	62
1 " "	16	4 " "	90
1 " "	17	12 " "	94
4 " "	19A	1 " "	95
2 " "	24	2 " "	96
63 " "	37	1 " "	108
2 " "	38	1 " "	125

3 of No. 126A

Clockwork Motor  
(not included in Outfit)



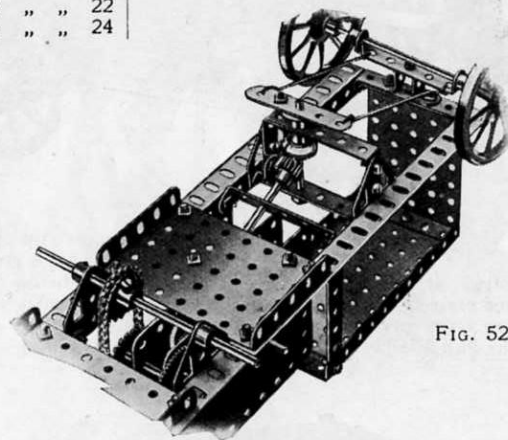


FIG. 527A

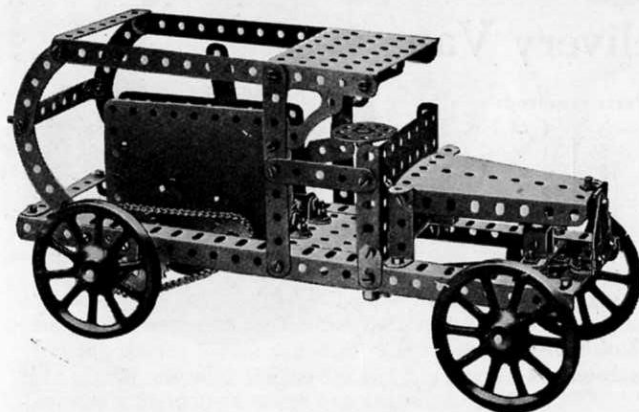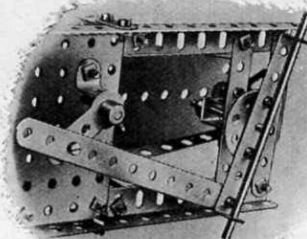
FIG. 528A





These Models can be made with MECCANO Outfit No. 5, or No. 4 and No. 4A.

## Model No. 529 Armoured Motor Car

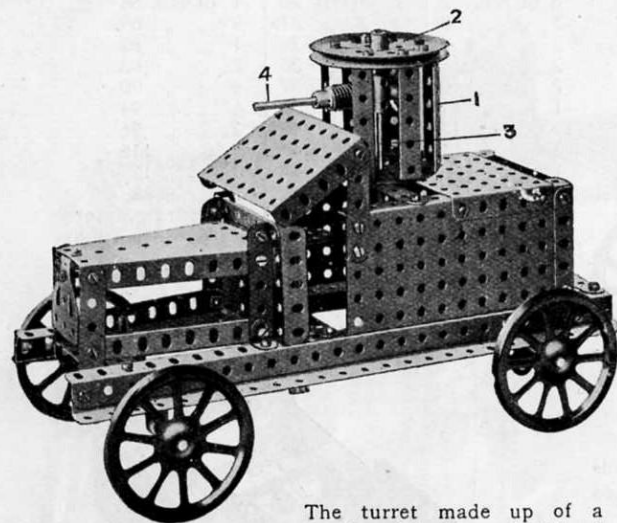


The turret made up of a number of double angle strips 1 bolted at the top to a 3" pulley 2 and below to a face plate is bolted on a rod 3 passing up the centre which forms the pivot of the turret so that it may freely turn. The gun 4 is bolted in a coupling on this pivot rod.

### Parts required:

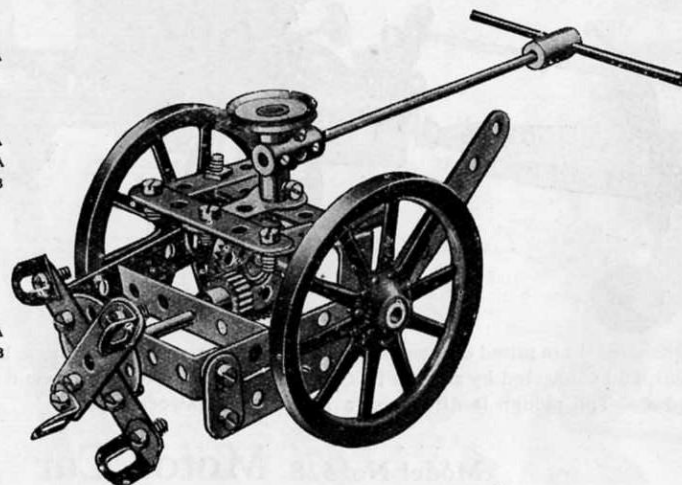5	of No.	3
6	" "	5
4	" "	8
5	" "	12
1	" "	12A
2	" "	14
1	" "	15
2	" "	16
2	" "	18A
4	" "	19A
1	" "	19B
2	" "	22
2	" "	24
1	" "	32
77	" "	37
2	" "	38
2	" "	45
7	" "	48A
1	" "	48B
2	" "	52
4	" "	53
2	" "	54
8	" "	59
1	" "	63
1	" "	109
3	" "	126A

## Model No. 530


## Potato Reaper



### Parts required:

1	of No.	3
8	" "	5
2	" "	10
4	" "	12
1	" "	15
2	" "	16
1	" "	17
1	" "	18A
2	" "	19B
1	" "	22
1	" "	24
1	" "	26
1	" "	28
19	" "	37
1	" "	46
2	" "	48A
1	" "	59
1	" "	62
2	" "	63
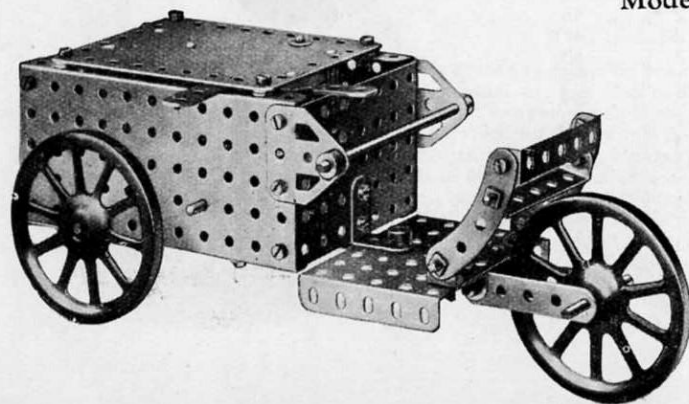
## Model No. 531 Delivery Van



### Parts required:

1	of No.	3	1	of No.	28
3	" "	5	31	" "	37
4	" "	12	9	" "	38
1	" "	12A	2	" "	48A
1	" "	15	2	" "	52
2	" "	15A	3	" "	53
1	" "	17	7	" "	59
1	" "	18A	2	" "	90
3	" "	19A	2	" "	94
1	" "	26	2	" "	96

2 of No. 126A

Clockwork Motor  
(not included in Outfit)

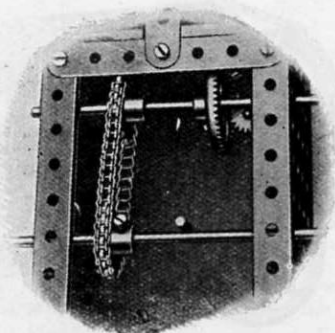


FIG. 531A


These Models can be made with MECCANO Outfit No. 5, or No. 4 and No. 4A.

99

## Model No. 532 Fire Watertower

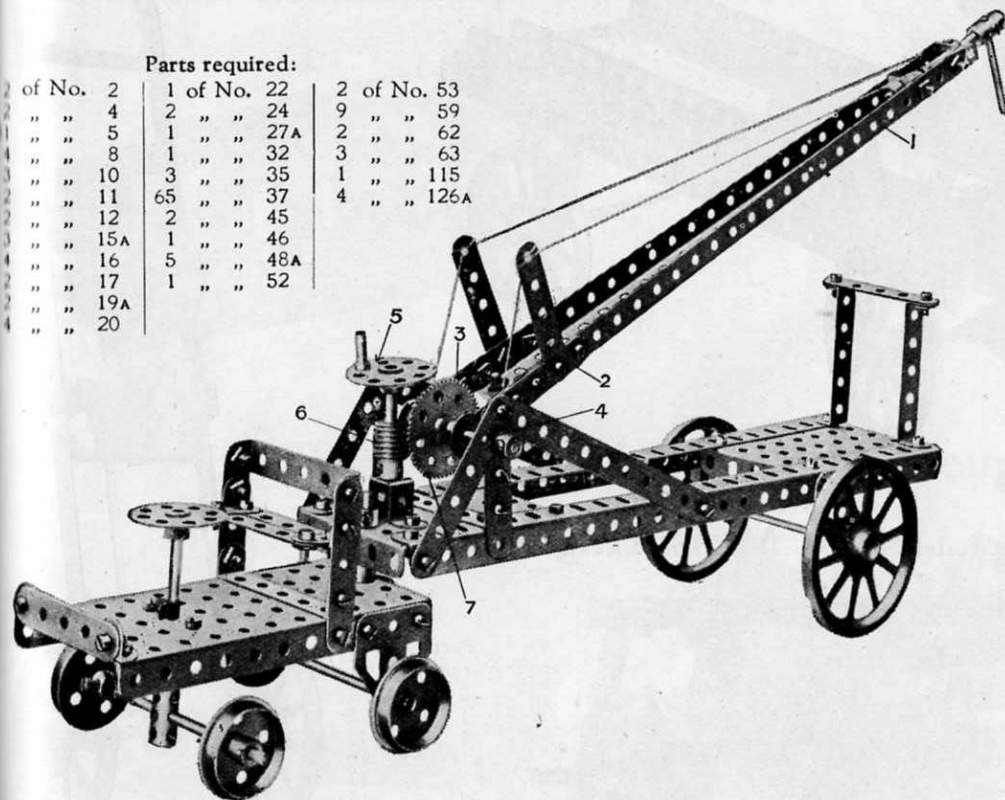
### Parts required:

of No. 2	1 of No. 22	2 of No. 53
" " 4	2 " " 24	9 " " 59
" " 5	1 " " 27A	2 " " 62
" " 8	1 " " 32	3 " " 63
" " 10	3 " " 35	1 " " 115
" " 11	65 " " 37	4 " " 126A
" " 12	2 " " 45	
" " 15A	1 " " 46	
" " 16	5 " " 48A	
" " 17	1 " " 52	
" " 19A		
" " 20		



This is an apparatus for raising a water-hose and directing the nozzle towards high buildings. The hose is led along the support 1, formed of two 12½" angle girders, secured by strips 2 and cranks 3 to the rod 4, forming a pivot for the support. The support is raised or lowered about the pivot by turning the hand-wheel 5, a worm 6 on the spindle of which engages a 57-toothed wheel 7 on the rod 4.

## Model No. 533 Skein Winder

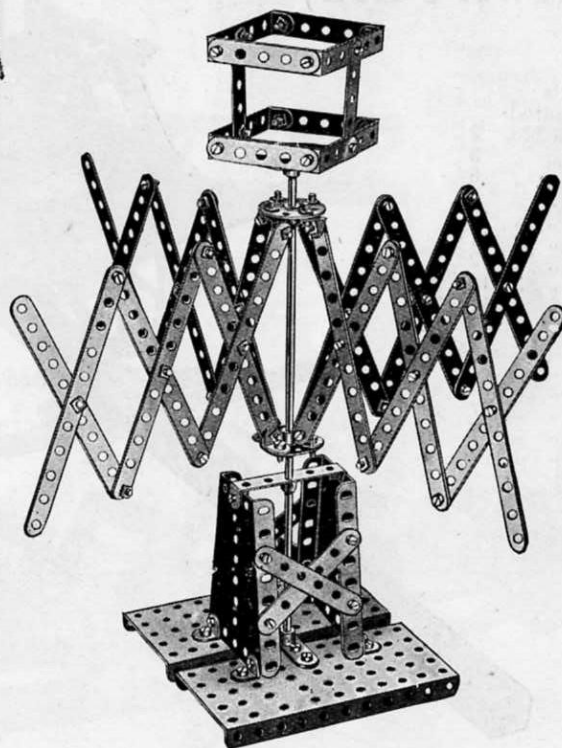


### Parts required:

24 of No. 2	2 of No. 24
4 " " 4	86 " " 37
7 " " 5	5 " " 48A
8 " " 12	2 " " 52
1 " " 13	2 " " 54
1 " " 21	2 " " 59

## Model No. 534

## Brewer's Dray

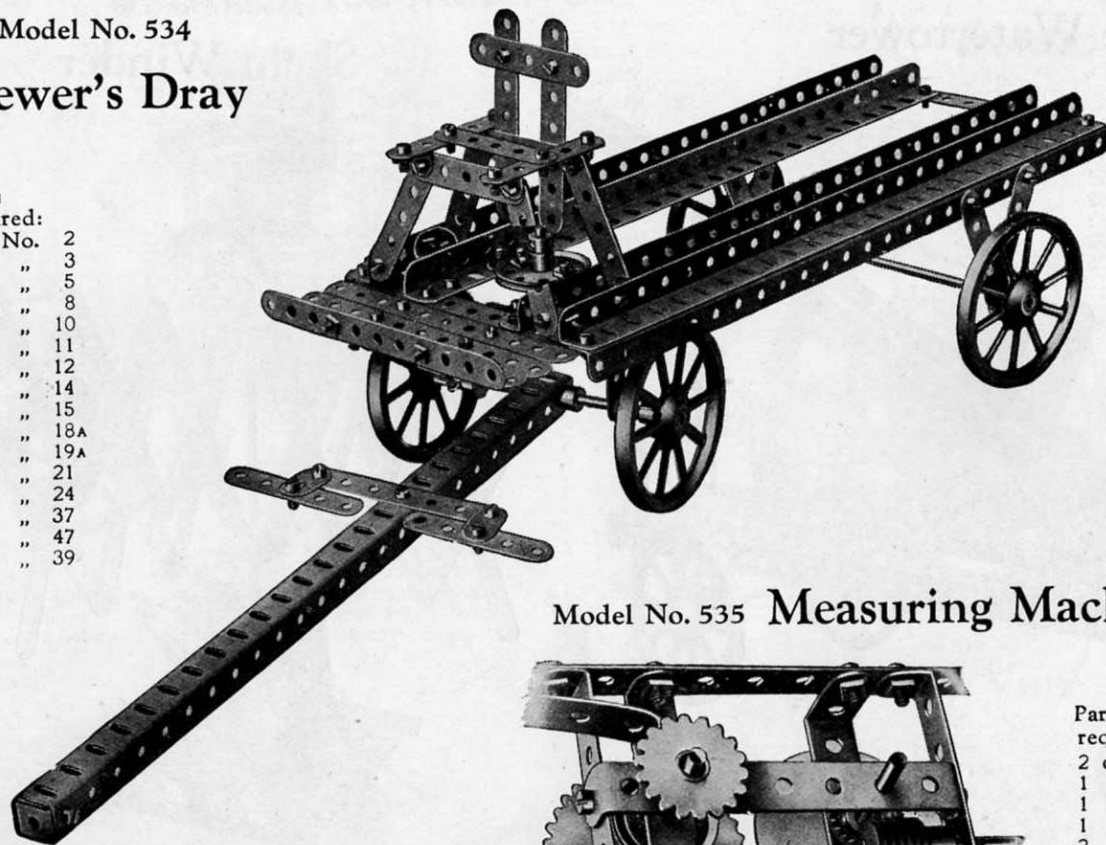Parts required:		
6	of No.	2
3	" "	3
19	" "	5
8	" "	8
2	" "	10
1	" "	11
10	" "	12
1	" "	14
1	" "	15
1	" "	18A
4	" "	19A
1	" "	21
1	" "	24
62	" "	37
1	" "	47
6	" "	39



## Model No. 535 Measuring Machine


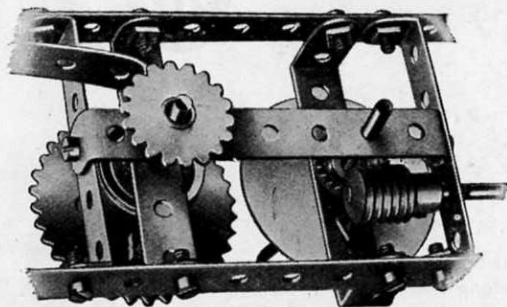



FIG. 535A

Parts required:		
2	of No.	1
1	" "	5
1	" "	15
1	" "	16
2	" "	17
2	" "	19A
1	" "	22
1	" "	26
2	" "	29
1	" "	32
22	" "	37
1	" "	46
5	" "	48A
1	of No.	48B
1	" "	59
1	" "	63
1	" "	65
2	of No.	90
1	" "	95
1	" "	96
1	" "	125

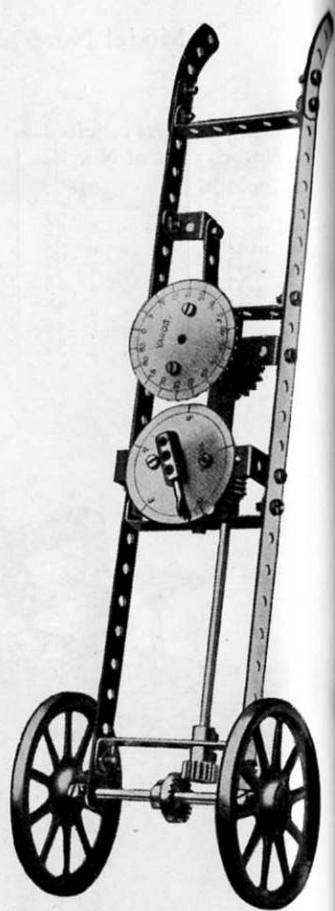


These Models can be made with MECCANO Outfit No. 5, or No. 4 and No. 4A.

## Model No. 536 Mouse Trap

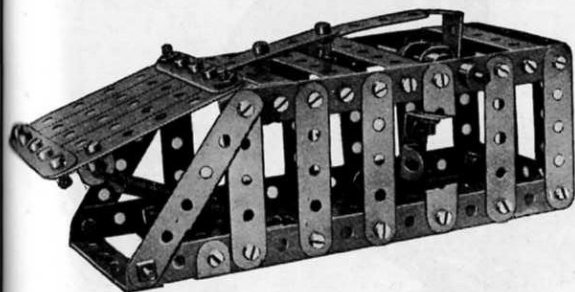


Parts required:	
3 of No.	2
8 " "	4
18 " "	5
1 " "	10
1 " "	11
4 " "	12
1 " "	16
59 " "	37
5 " "	38
1 " "	43
1 " "	48
9 " "	48A
1 " "	52
4 " "	59

## Model No. 537 Ducking Chair

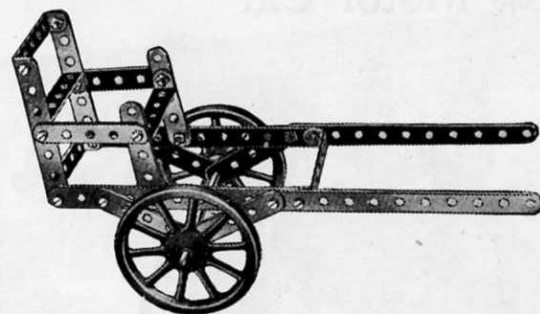


Parts required:	
4 of No.	2
2 " "	3
8 " "	5
1 " "	15A
2 " "	19A
4 " "	35
16 " "	37
5 " "	48A

## Model No. 538 Invalid Chair

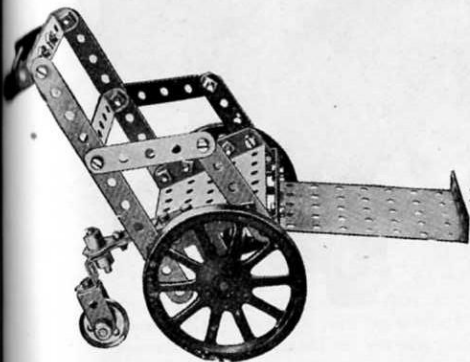

Parts required:	
2 of No.	2
5 " "	5
1 " "	10
1 " "	15A
1 " "	16
2 " "	18A
2 " "	19A
1 " "	22A
25 " "	37
5 " "	38
1 " "	46
3 " "	48B
2 " "	53
5 " "	59
1 " "	62
1 " "	102
1 " "	125
2 " "	126A

## Model No. 539 Touring Tram Car

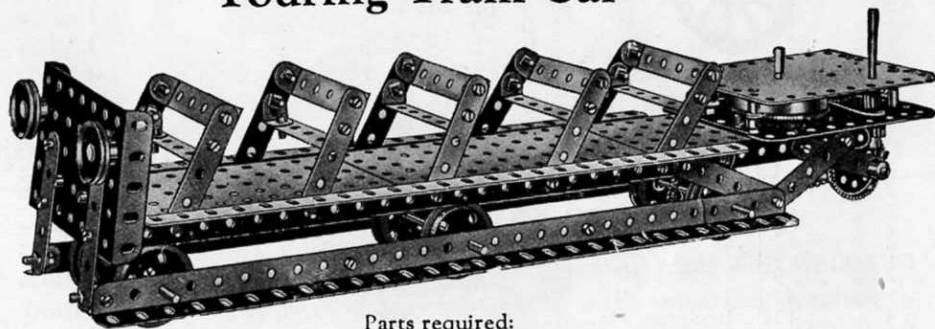


Parts required:			
20 of No.	5	6 of No.	20
6 " "	8	2 " "	22
8 " "	12	1 " "	26
4 " "	16	1 " "	28
		64 " "	37
		8 of No.	48A
		3 " "	52
		1 " "	53
		2 " "	59

Clockwork Motor  
(not included in Outfit)



## Model No. 540 Motor Car

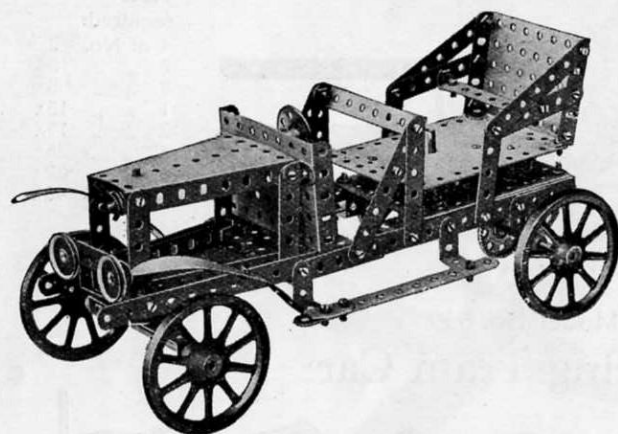

### Parts required:

2 of No.	1	2 of No.	24
2 "	2	2 "	26
7 "	3	1 "	28
4 "	4	1 "	32
7 "	5	67 "	37
2 "	9	3 "	38
9 "	12	2 "	41
4 "	12A	1 "	48A
1 "	14	3 "	48B
2 "	15	3 "	53
1 "	16	2 "	54
4 "	19A	7 "	59
2 "	22	2 "	126A

Clockwork Motor  
(not included in Outfit)


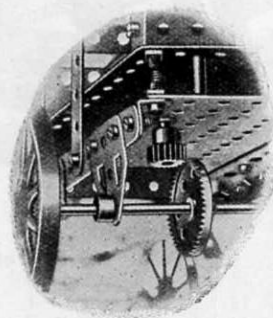


FIG. 540A

## Model No. 541 Distance Indicator

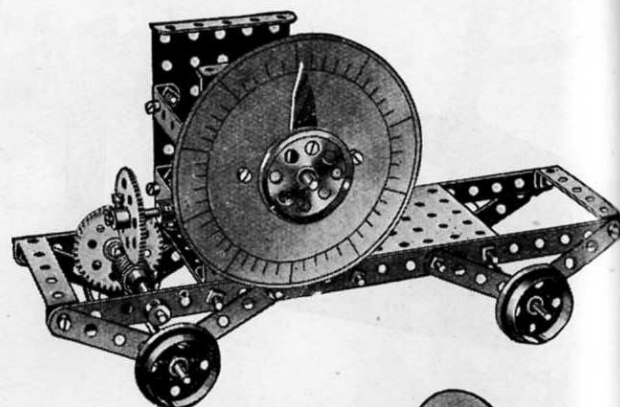

### Parts required:

4 of No.	2
4 "	3
8 "	5
10 "	12
2 "	15
2 "	15A
1 "	16
1 "	17
4 "	20
1 "	21
2 "	22
1 "	24
2 "	26
2 "	27A
1 "	28
1 "	32
38 "	37
2 "	48A
1 "	52
2 "	53
6 "	59

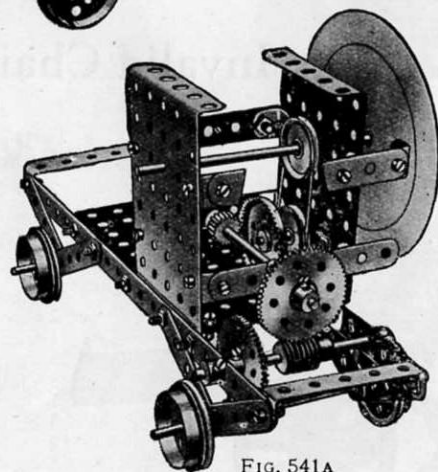


FIG. 541A


These Models can be made with MECCANO Outfit No. 5, or No. 4 and No. 4A.

## Model No. 542 Armoured Motor Tricycle
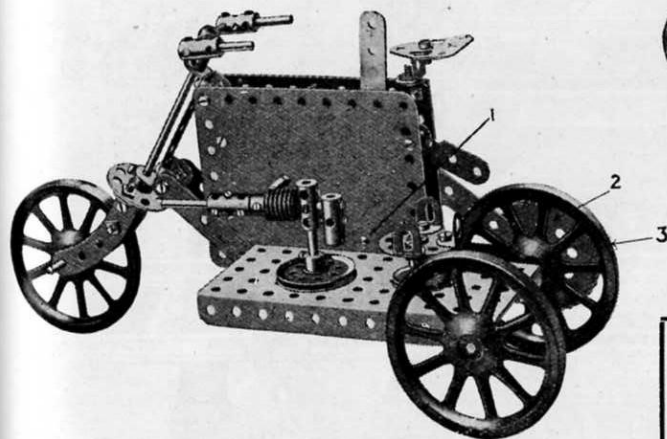
### Parts required:


2 of No. 2	4 of No. 18A	1 of No. 52
2 " " 5	3 " " 19A	1 " " 59
1 " " 9D	1 " " 21	6 " " 63
2 " " 11	3 " " 22	2 " " 90
4 " " 12	2 " " 24	1 " " 95
2 " " 12B	1 " " 32	1 " " 96
1 " " 15A	22 " " 37	1 " " 125
2 " " 16	10 " " 38	1 " " 126A
2 " " 17	1 " " 48A	

Clockwork Motor  
(not included in Outfit)



This is driven from the motor spindle 1, a small sprocket wheel at the rear, not shown in the illustration, being geared by a chain to the larger sprocket wheel 2 bolted on the axle rod of the rear wheels 3.

## Model No. 543 Pullman Car

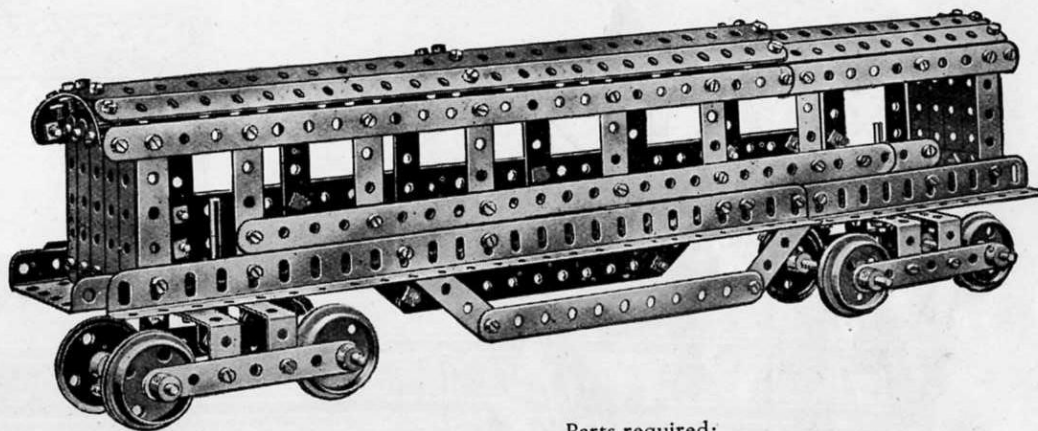

### Parts required:

9 of No. 1	4 of No. 8	116 of No. 37
9 " " 2	4 " " 16	4 " " 46
8 " " 3	2 " " 17	3 " " 52
34 " " 5	8 " " 20	10 " " 59
	2 " " 21	

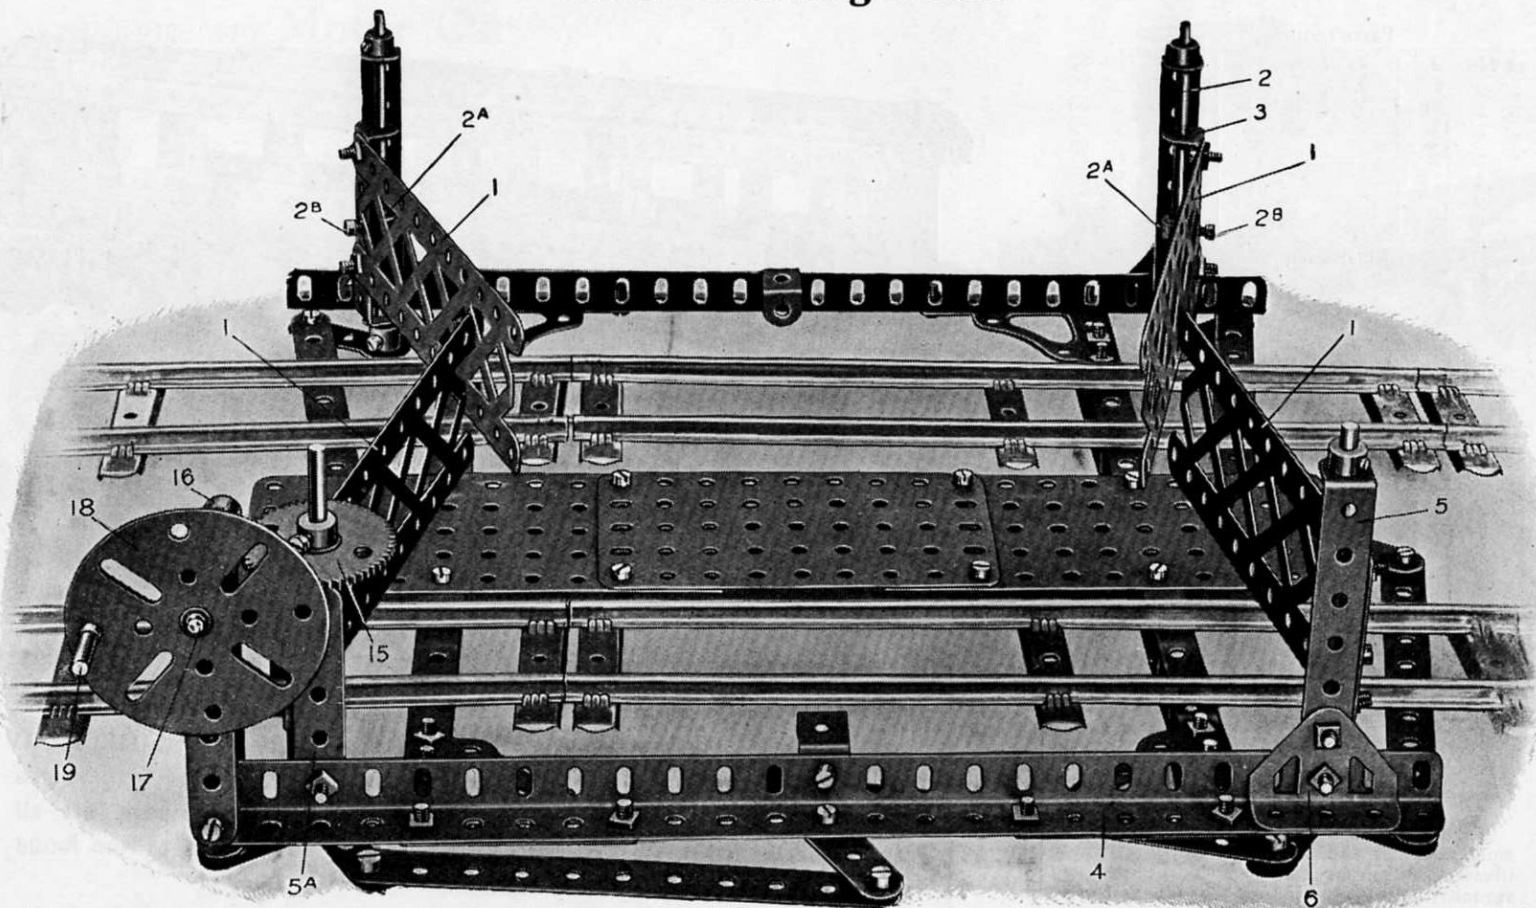
### HOW TO CONTINUE

This completes our examples of Models that may be made with MECCANO Outfit No. 5. The next Models are a little more advanced, requiring a number of extra parts to construct them. The necessary parts are all contained in a No. 5A Accessory Outfit, the price of which will be found in the List at the end of the Manual.

This Model can be made with MECCANO Outfit No. 6, or No. 5 and No. 5A.

# Model No. 601

## Level Crossing Gates



a col  
colla  
by 1  
rods  
2 1/2"  
pivo  
secu  
By

This Model can be made with MECCANO Outfit No. 6, or No. 5 and No. 5A.

105

## Model No. 601 Level Crossing Gates *(continued)*

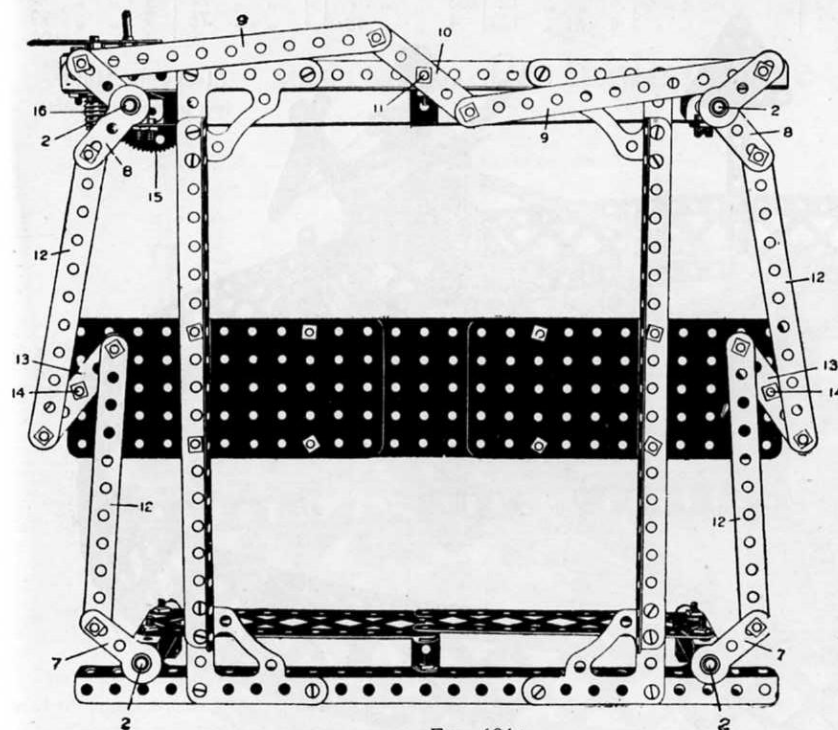


FIG. 601A

### Parts required:

6	of No.	2
2	" "	4
3	" "	5
1	" "	6A
2	" "	8
2	" "	8A
4	" "	11
4	" "	15A
1	" "	17
1	" "	27A
1	" "	32
53	" "	37
16	" "	37A
4	" "	48A
3	" "	48B
1	" "	53A
7	" "	59
2	" "	62
3	" "	70
4	" "	100
4	" "	108
1	" "	109
1	" "	115
3	" "	126
2	" "	128

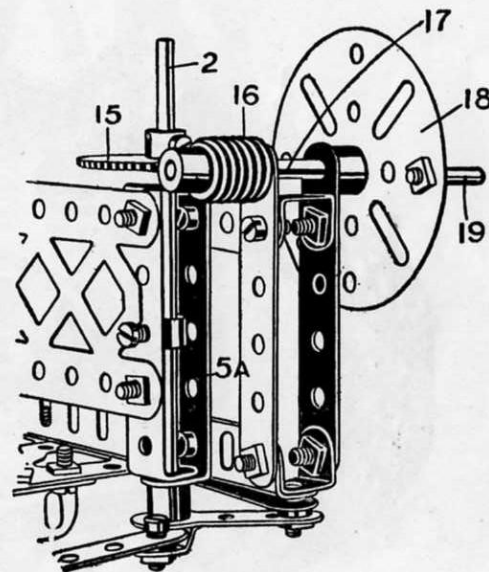


FIG. 601B

The gates consist of 5½" braced girders 1 and are pivotally carried on the rods 2 being bolted to 2½" by ½" double angle strips 3. On each rod 2 is threaded a collar 2A, Fig. 601, and a bolt 2B is passed through the centre hole of the double angle strips 3 and screwed into the thread hole of the collar 2A, nipping the collar to the rod 2, thus ensuring that the braced girders 1 shall turn with the rods 2. Three of the rods 2 are carried from the lower angle girders 4 in 3½" by ½" double angle strips 5, and one in a 2½" by ½" double angle strip 5A, the feet of the strips 5 being reinforced to the angle girders 4 by the trunnions 6. The rods 2 are coupled together by cranks 7 on the rear rods, and bell cranks 8 on the other rods, the ends of the two bell cranks being connected by strips 9 to 2½" strip 10 pivoted on the bolt 11, Fig. 601A, while the bell cranks 8 are connected to the cranks 7 by other strips 12, pivotally connected to 2½" strips 13, pivoted on the bolts 14. Consequently, all the rods 2 are inter-connected. As will be seen from the Figs. 601 and 601B, a 57-toothed gear wheel 15 is secured on one of the rods 2, and is engaged by a worm 16 on a rod 17 to which is secured a face plate 18, fitted with a threaded pin 19, as an operating handle. By turning the face plate 18 the spindles 2 are all rotated, and the gates caused to open or close.




This Model can be made with MECCANO Outfit No. 6, or No. 5 and No. 5A.

## Model No. 602 Roundabout
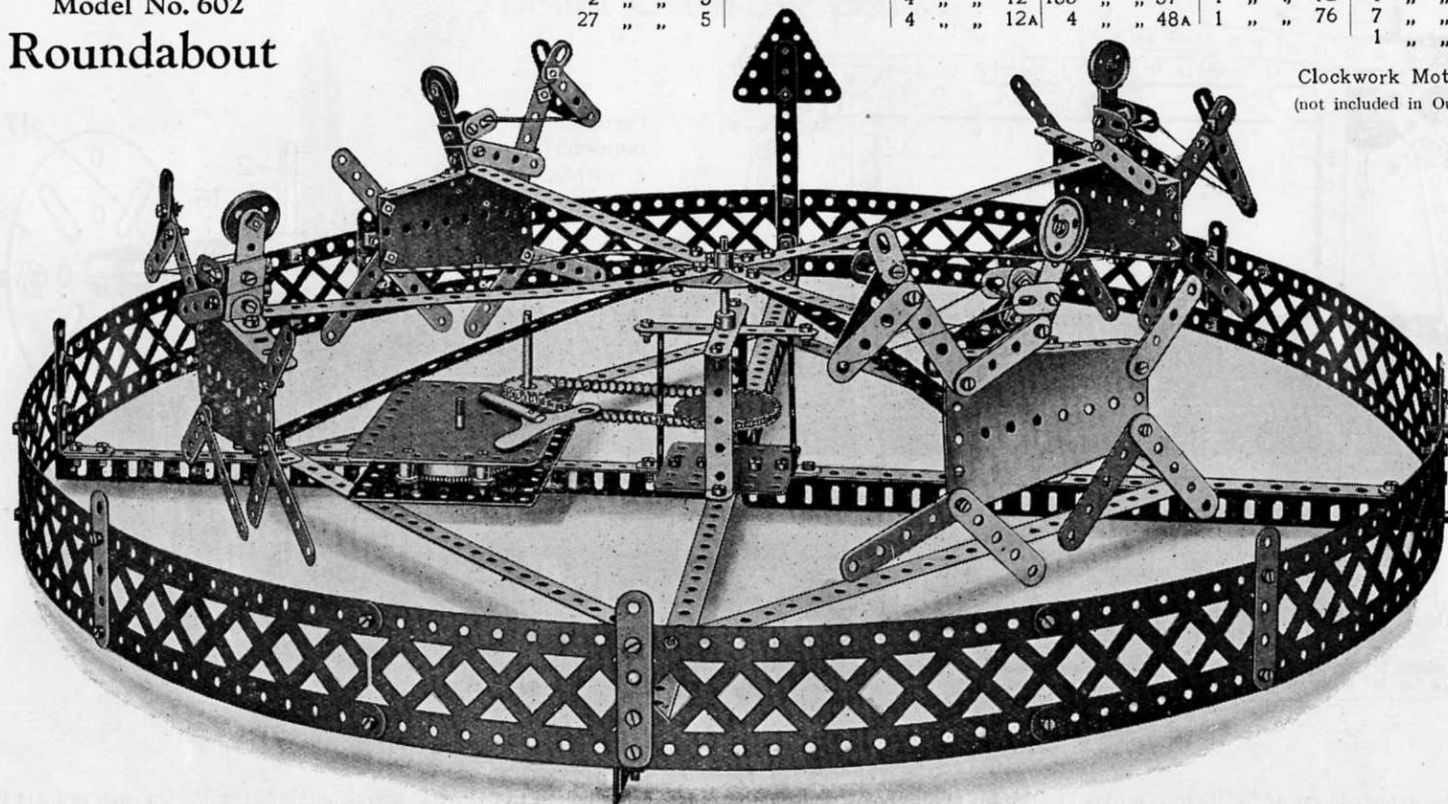
### Parts required:

12 of No. 1	24 of No. 6	16 of No. 10	1 of No. 15	4 of No. 54	14" of No. 94
1 " " 2	4 " " 8	8 " " 11	4 " " 22A	2 " " 59	1 " " 95
2 " " 3		4 " " 12	135 " " 37	1 " " 72	1 " " 96
27 " " 5		4 " " 12A	4 " " 48A	1 " " 76	7 " " 99
					1 " " 109

Clockwork Motor  
(not included in Outfit)



In this model the animals, built up from sector plates and short strips to represent the limbs, are carried from  $9\frac{1}{2}$ " strips bolted to a face plate, which is rotated from the centre rod by means of a chain and a 1" sprocket wheel connected to the spring motor.

The centre rod, by means of which the rotating figures are driven, is supported below the face plate by a light framing to give rigidity.

The model is surrounded by braced girder strips bolted together, and strengthened by  $12\frac{1}{2}$ " cross angle girders, connected in the centre by a  $2\frac{1}{2}$ " by  $2\frac{1}{2}$ " flat plate. The centre hole of this plate carries the lower end of the vertical rod upon which the animals are mounted.

Th  
is move  
wheels  
4 are s  
against  
then ru  
forces  
trunnio  
Th  
Mechan

This Model can be made with MECCANO Outfit No. 6, or No. 5 and No. 5A.

107

## Model No. 603 Portable Crane

Parts required:

12 of No. 2	16 of No. 12	1 of No. 21	1 of No. 40
3 " " 3	1 " " 15	5 " " 22	2 " " 44
6 " " 5	5 " " 16	2 " " 22A	1 " " 45
2 " " 9	4 " " 17	2 " " 23	1 " " 48
	2 " " 18A	1 " " 24	2 " " 48A
	1 " " 19	1 " " 26	1 " " 53
		1 " " 27A	1 " " 57
		74 " " 37	10 " " 59
		16 " " 38	2 " " 62
			2 " " 63
			2 " " 89
			2 " " 90
			4 " " 126A


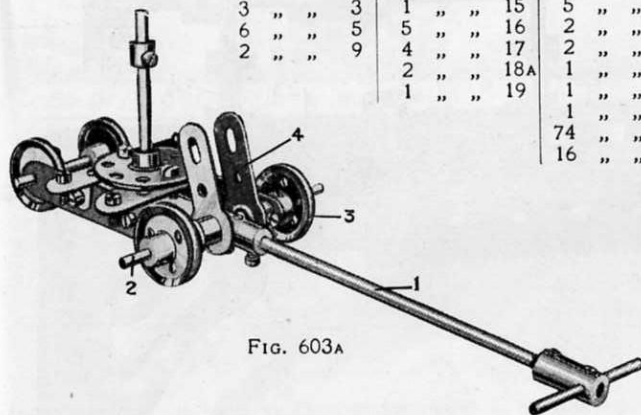


Fig. 603A


The construction of the tower is quite clear from the illustration. The crane is moved about by depressing the handle 1 carrying an axle 2 for the 1" loose pulley wheels 3, which are secured in position by collars and set screws. A pair of cranks 4 are secured to the axle 2 and are arranged when the handle is depressed to bear against the underface of the small rectangular plate 5 and lift the crane so that it then runs on the wheels 3 and 6. When the crane is brought to rest its weight forces down the cranks 4 which raises the handle 1, and the tips 8 of the flat trunnions together with front wheels 6 then support the crane.

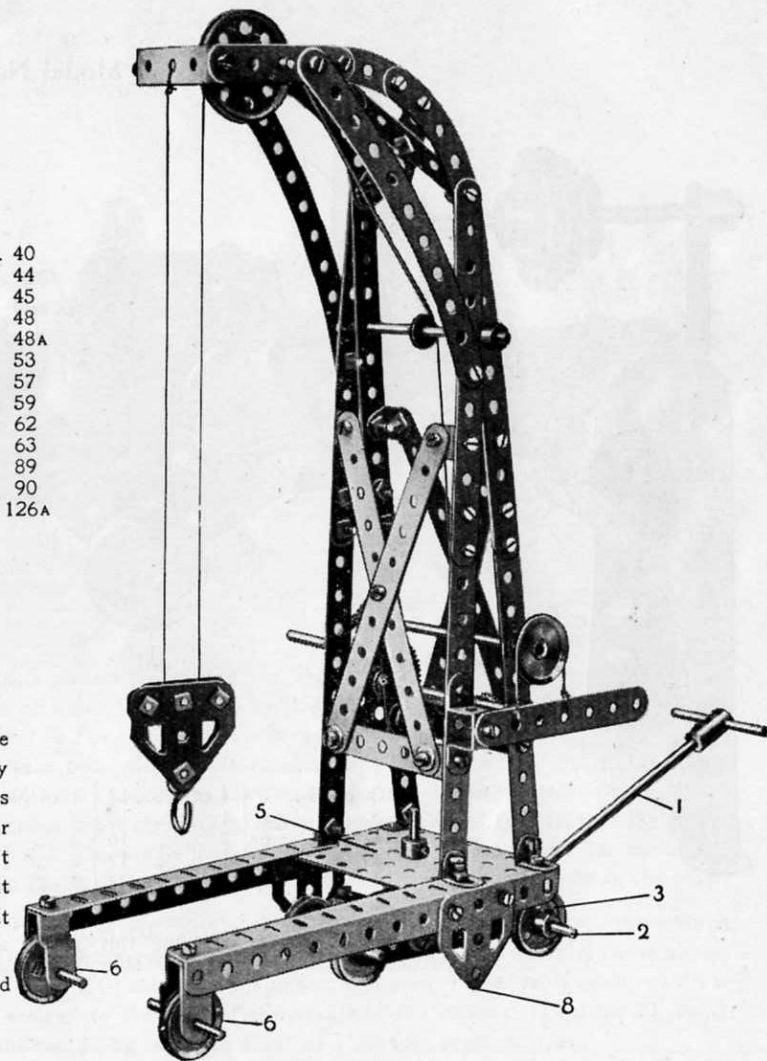The load is controlled by a strap and lever brake (see "Meccano Standard Mechanisms," detail No. 81).



This Model can be made with MECCANO Outfit No. 6, or No. 5 and No. 5A.

## Model No. 604 Lathe

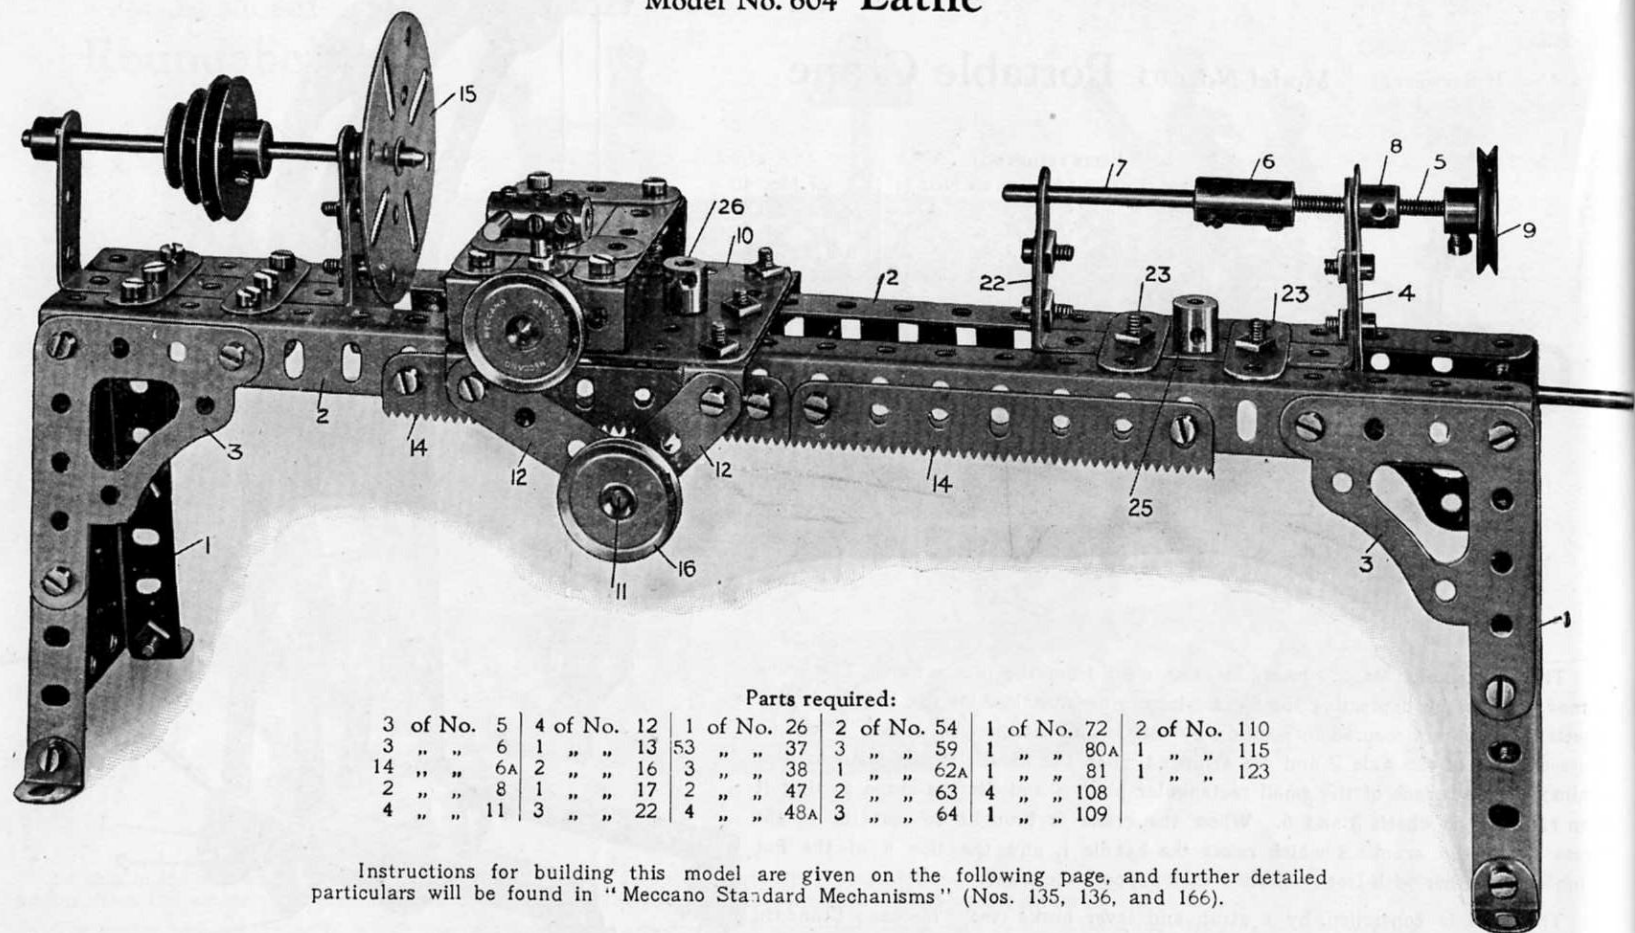

### Parts required:

3 of No. 5	4 of No. 12	1 of No. 26	2 of No. 54	1 of No. 72	2 of No. 110
3 " " 6	1 " " 13	53 " " 37	3 " " 59	1 " " 80A	1 " " 115
14 " " 6A	2 " " 16	3 " " 38	1 " " 62A	1 " " 81	1 " " 123
2 " " 8	1 " " 17	2 " " 47	2 " " 63	4 " " 108	
4 " " 11	3 " " 22	4 " " 48A	3 " " 64	1 " " 109	

Instructions for building this model are given on the following page, and further detailed particulars will be found in "Meccano Standard Mechanisms" (Nos. 135, 136, and 166).

The  
stock 4  
screw 5  
engages  
the rod  
plate 15,  
which is  
stock.

The  
29 are b  
of the st  
fixed be  
bolted a

## Model No. 604 Lathe (continued)

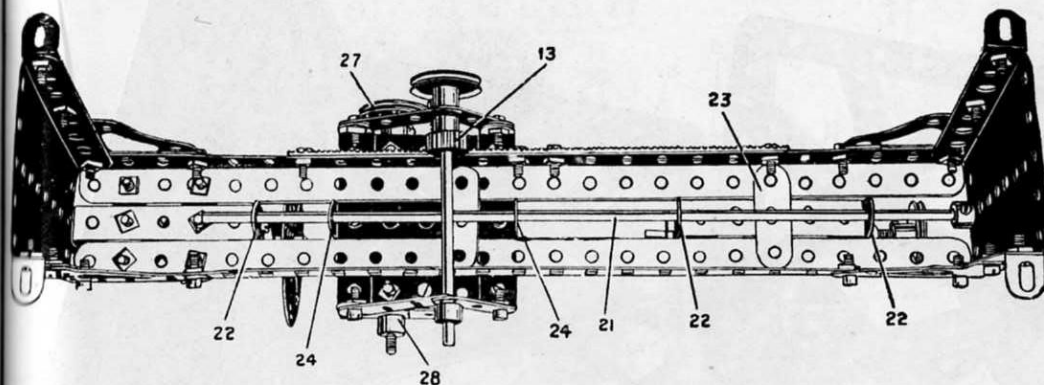


FIG. 604A

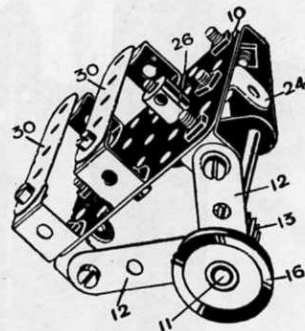


FIG. 604B

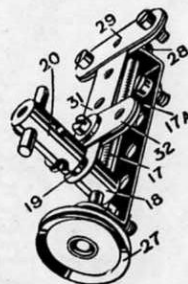


FIG. 604C


The lathe frame is built up from sector plates 1, at each end bolted to  $12\frac{1}{2}$ " angle girders 2, forming the bed, by means of architraves 3. The tail stock 4 slides between the angle girders 2, and has a screw adjustment 5, the screw of which is connected by the coupling 6 to the short rod 7; the screw 5 is threaded into a threaded crank 8, and is operated by the 1" pulley wheel 9. The tail stock is locked by turning the threaded boss 25, which engages the bolt holding the underneath cross strip 23, thus gripping it beneath the lathe bed. The saddle 10, consisting of a  $2\frac{1}{2}$ " by  $2\frac{1}{2}$ " flat plate, carries the rod 11, journaled in the strips 12, and carries a pinion 13, Fig. 604B, which engages the racks 14, so that the saddle may be moved to or from the face plate 15, by turning the pulley wheel 16. The traversing movement is obtained by means of the screw 17, which engages a threaded boss 18, into the end of which is screwed a threaded pin 19, carrying the coupling 20, which forms the tool post. The saddle is locked by the threaded boss 26, similar to the tail stock. The screwed rod 17, is held against end movement in the  $2\frac{1}{2}$ " by  $\frac{1}{2}$ " bent strip 17A, by the pulley wheel 27 at one side and the collar 28 on the other.

The construction of the saddle is shown in Figs. 604B and 604C, where the  $1\frac{1}{2}$ " strips 29, of Fig. 604C are shown removed from Fig. 604B; these strips 29 are bolted at the end of the guide strips 30, Fig. 604B, and form guides for the  $2\frac{1}{2}$ " strip 31, carrying the tool post. They are spaced apart by the thickness of the strips 30, and the  $1\frac{1}{2}$ " strips 32, bolted to the strip 31, slide on the strips 30. As will be seen from the underneath view, Fig. 604A, a guide rod 21, is fixed beneath the bed plates, and is engaged by the end holes of the  $1\frac{1}{2}$ " strips 22, secured to the sides of the head and tail stocks;  $1\frac{1}{2}$ " strips 23, being bolted above and below to retain the tail stock in position. The saddle engages the rod 21 by means of a  $2\frac{1}{2}$ " by  $\frac{1}{2}$ " double angle strip 24.



This Model can be made with MECCANO Outfit No. 6, or No. 5 and No. 5A.

## Model No. 605 Theodolite

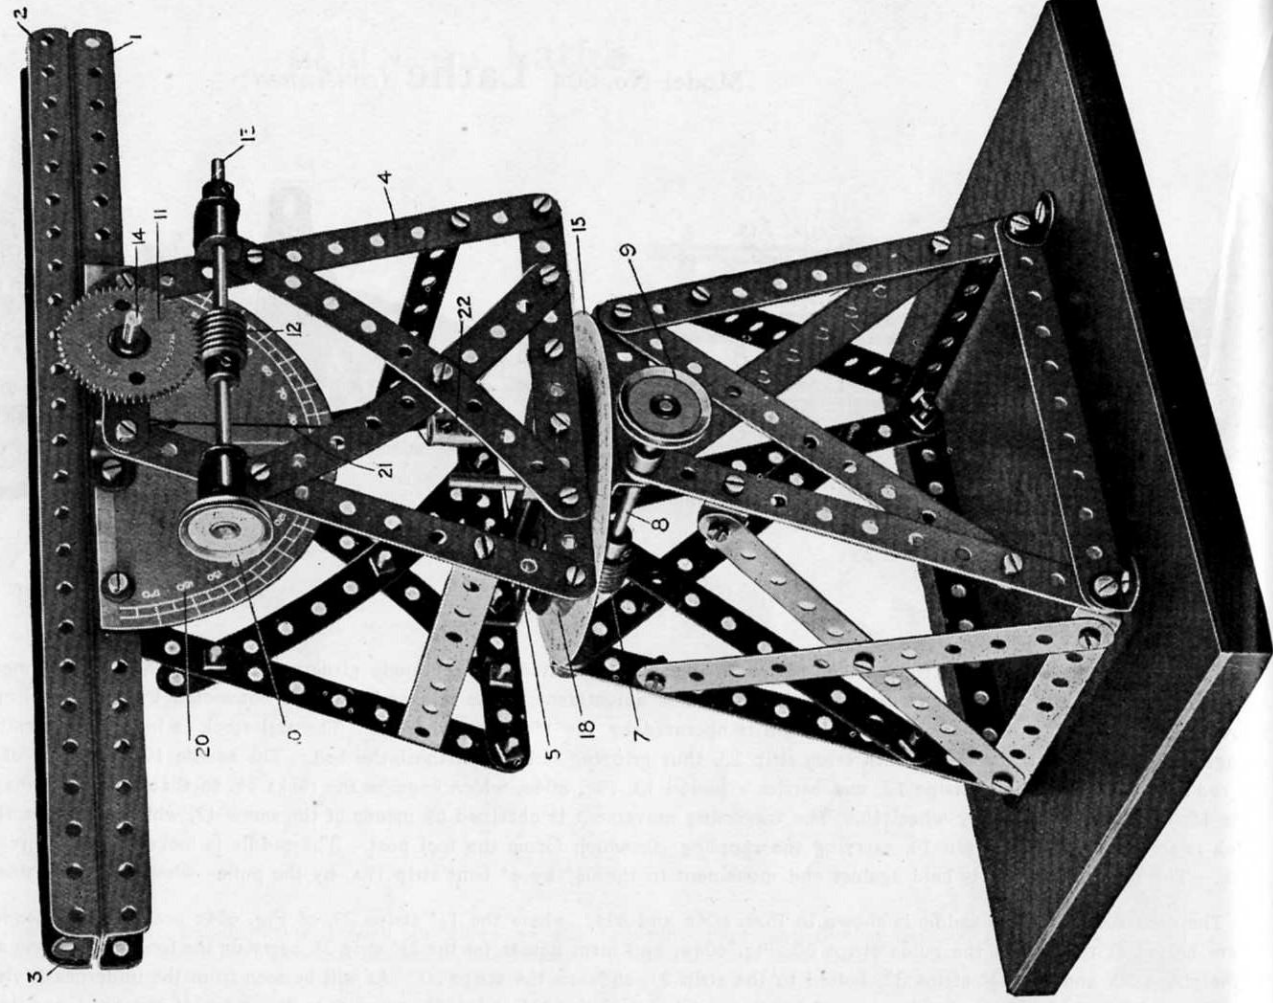

to fo  
of th

worr  
a ro  
of th

fora  
agai  
men

arm  
of th  
give  
are

## Model No. 605 Theodolite (continued)

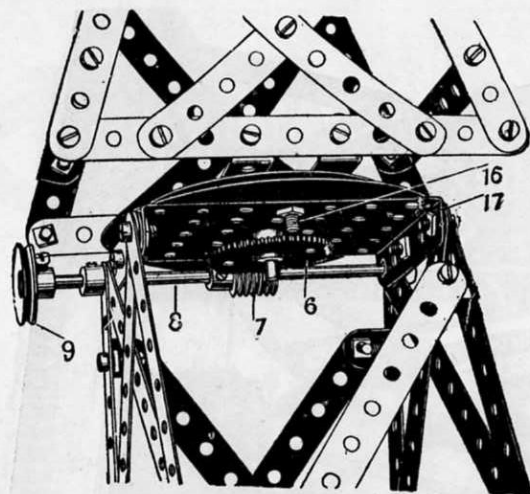


FIG. 605A

Parts required:	
20 of No.	2
2 "	5
6 "	6A
4 "	8
2 "	11
10 "	12
3 "	15
1 "	17
1 "	19B
2 "	22
2 "	27A
2 "	32
60 "	37
1 "	45
6 "	48B
1 "	53
6 "	59
1 "	62
1 "	63
4 "	89
1 "	135

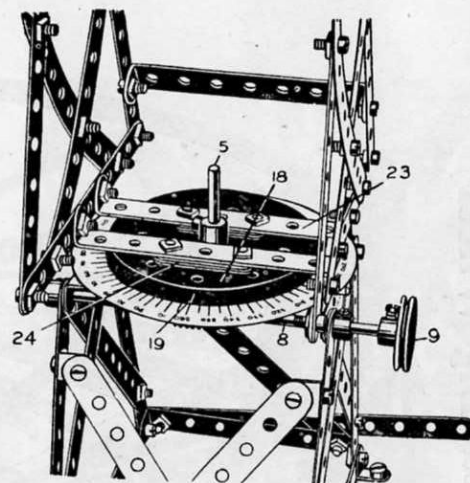


FIG. 605B

The Theodolite is represented by two reverse pairs of angle girders 1 and 2, which form a "sighting arm," an angle bracket 3 being bolted at one end to form an eye piece. A small piece of gummed paper is fastened over the aperture in the angle bracket, and a fine pin-hole made in the paper at the centre of the aperture. Two crossed threads are gummed across the aperture of the angle bracket bolted at the other end of the sighting arm.

The upper framework 4 swivels horizontally with the vertical spindle 5 as a pivot. On the lower end of this rod is a gear wheel 6, Fig. 605A, engaged by a worm 7 on a rod 8, operated by the 1" pulley 9. This gives the horizontal traverse of the upper frame 4, in which the sighting arm is pivotally mounted upon a rod 14, on which is a gear wheel 11 engaged by a worm 12 on a rod 13 operated by a 1" pulley 10. This mechanism gives the vertical traverse or inclination of the sighting arm.


A protractor for the horizontal angular movement of the upper frame 4 consists of a graduated cardboard disc 15, which is bolted by a bolt 16 to a perforated flanged plate  $3\frac{1}{2}$ " by  $2\frac{1}{2}$ " 17, the head of the bolt 16 being above the cardboard disc, and beneath the 3" pulley wheel 18. The cardboard disc is thus held against movement by the bolt 16, its centre hole engaging round the pivot rod 5. An index mark or pointer 19 is made on the pulley wheel 18. The movement of this pointer round the graduated scale on the disc shows the horizontal angular traverse.

Similarly, the vertical traverse of the sighting arm is indicated by means of a semi-circular protractor 20, bolted to the lower angle girder 1 of the sighting arm, a cord 21 carrying a weight 22, being hung from the rod 14, the position of the thread 21 over the protractor 20 indicating the vertical angular adjustment of the sighting arm. The thread 21 has a loop by which it is hung on the rod 14, so that its direction always points truly radially to the rod 14, and this gives the correct angular reading. In order to bring the double angle strips 23 flush with the outer rim of the pulley wheel 18, three  $1\frac{1}{2}$ " packing strips 24 are bolted beneath the double angle strips, as shown in Fig. 605B.

The sighting arm is secured to the rod 14 by a crank bolted to the arm on the opposite side to the protractor and nipped by the set screw to the rod 14.

This Model can be made with MECCANO Outfit No. 6, or No. 5 and No. 5A.

## Model No. 606 Big Wheel

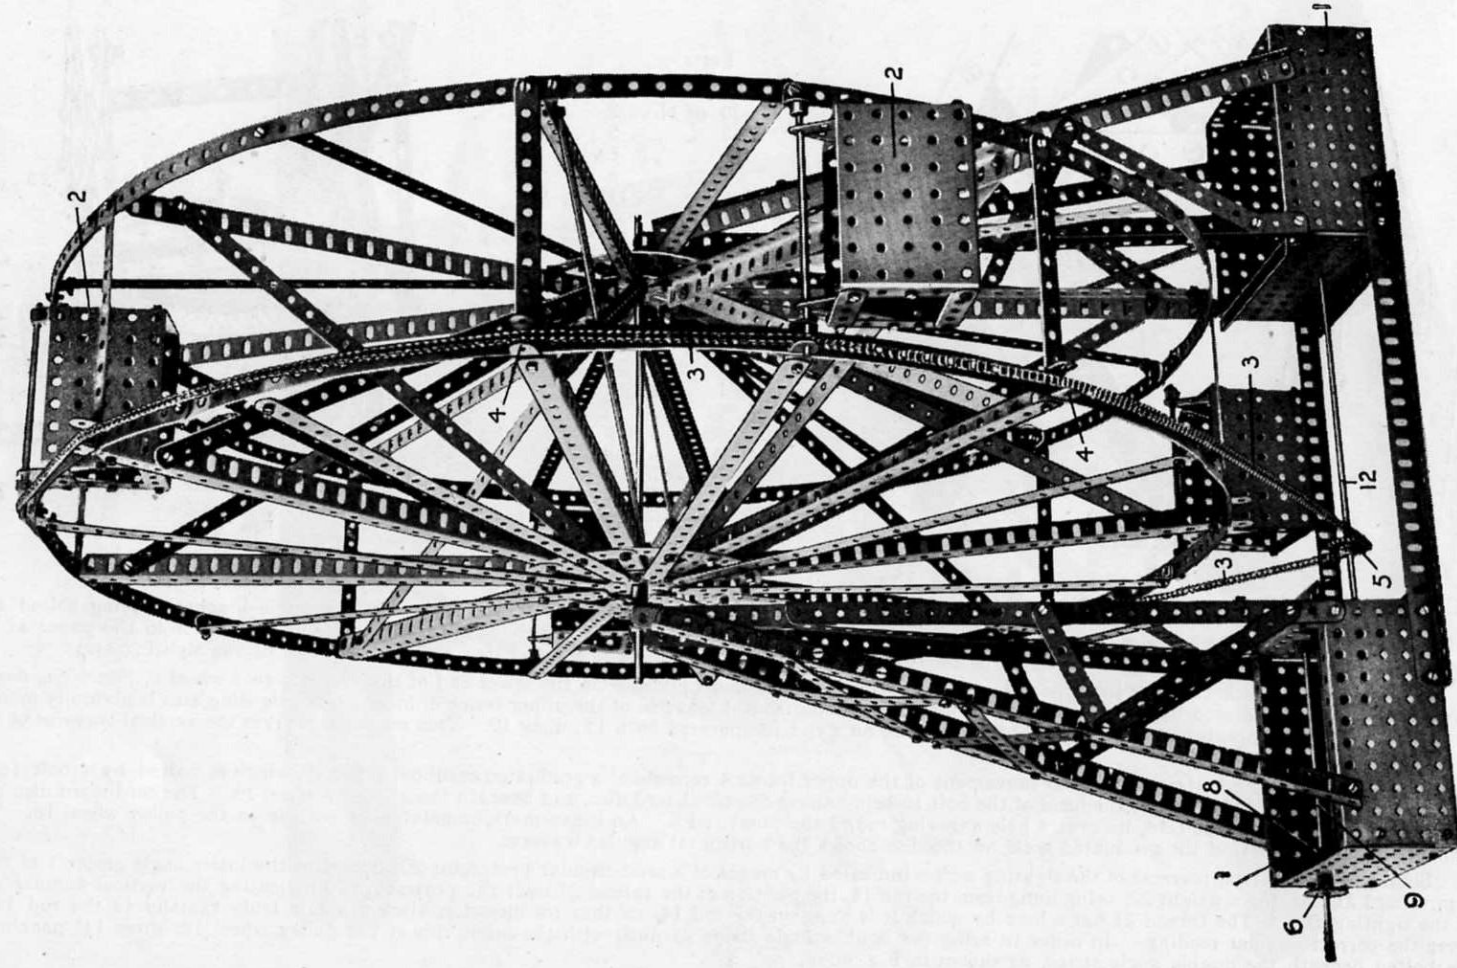

I  
form  
eleme  
F  
drivin  
the s  
F

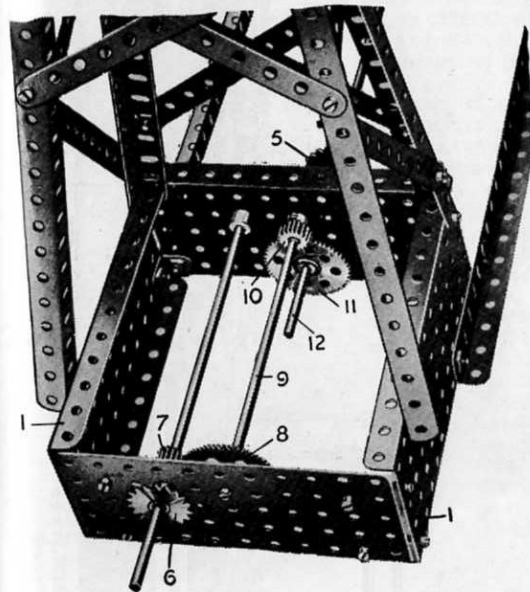
Model No. 606 **Big Wheel** (continued)

FIG. 606A

Parts required:		
46	of No.	1
24	" "	2
4	" "	3
32	" "	5
26	" "	8
4	" "	9
8	" "	11
44	" "	12
2	" "	13
1	" "	13A
1	" "	14
4	" "	15
2	" "	24
2	" "	26
2	" "	27A
308	" "	37
6	" "	38
4	" "	48D
6	" "	52
8	" "	53
2	" "	54
13	" "	59
2	" "	70
16	" "	90
8	" "	94
2	" "	96
2	" "	109

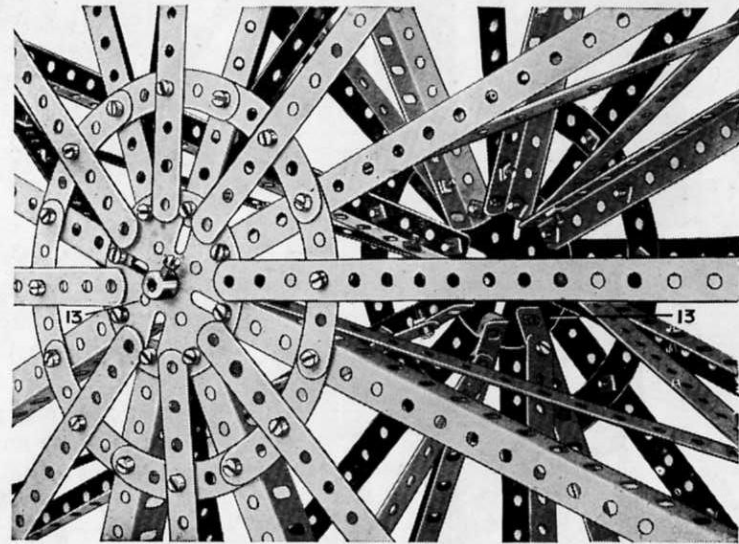


FIG. 606B

In constructing this model, flanged plates 1 are used to form the sides and inner part of the base of the side pedestals, and also to form the suspended cages 2 on the wheel. The driving chain 3 is conveniently kept in position round the periphery of one of the side elements of the wheel by a series of double angle brackets 4, bolted on the ends of the spokes.


Fig. 606A shows how the driving chain 3 is actuated from the sprocket wheel 5. On the axle of the driving sprocket 6 is a  $\frac{1}{2}$ " pinion 7 driving a  $1\frac{1}{2}$ " gear wheel 8 on an axle 9. On the other end of this axle 9 is a  $\frac{1}{2}$ " pinion 10 engaging a  $1\frac{1}{2}$ " gear wheel 11 on the rod 12 of the sprocket wheel 5.

Fig. 606B shows how the wheel is built up from the centre face plates 13.



## Model No. 607
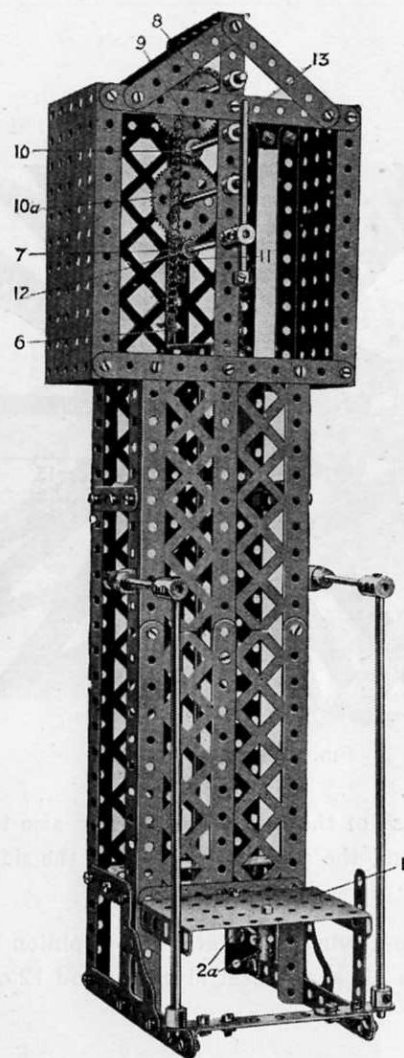
## Automatic Weighing Machine



## Parts required:

2 of No. 1	1 of No. 24	12 of No. 59
6 " " 2	2 " " 26	2 " " 62
2 " " 3	2 " " 27A	6 " " 63
6 " " 4	64 " " 37	10 " " 94
4 " " 5	2 " " 37B	1 " " 96
4 " " 8	1 " " 43	2 " " 99
1 " " 13	1 " " 48A	6 " " 100
2 " " 13A	3 " " 48B	2 " " 108
1 " " 15A	2 " " 52	
7 " " 16	1 " " 53	

The platform 1 is connected by cross rod and couplings 2a to a rod 2 (by means of a further coupling) passing through the centre of the machine and guided in the  $3\frac{1}{2}$ " double angle strips 3 and 3a connected to side strips 4. At the upper end of this rod 2 is a bush wheel 5, to which is connected a cord 6 and sprocket chain 7. This chain passes round a sprocket wheel 8 on the same spindle as the 57-toothed gear wheel 9 engaging a  $\frac{1}{2}$ " pinion 10. The pinion 10 also engages another 57-toothed gear wheel 10a, and this in turn a  $\frac{1}{2}$ " pinion 11 on the spindle 12 carrying the pointer 13. The other end of the chain is coupled by a spring 14 to the cross piece 3a, and the pointer is thus always returned to zero immediately the load is removed from the platform.

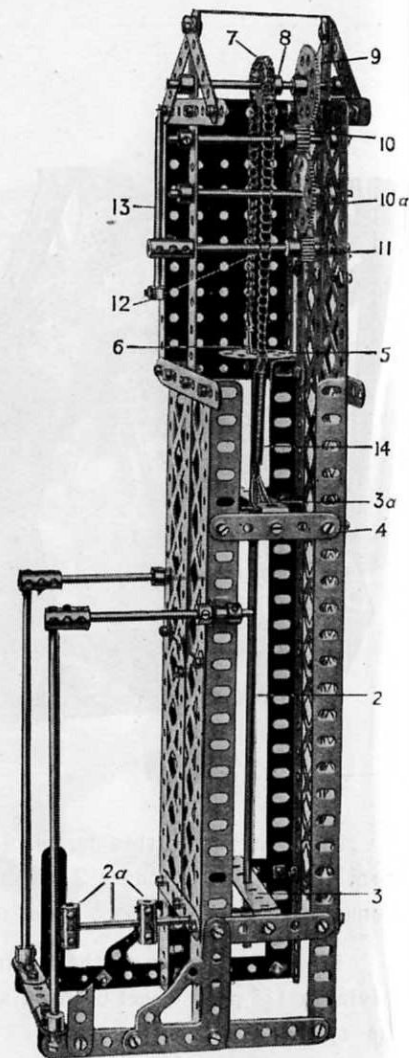


FIG. 607A

Th  
a set of  
a set of  
by a sp  
cord or  
Th  
the end  
crank  
Th  
passed  
the fou  
effecte

FIG.

10 of 1  
6 "  
4 "  
20 "  
4 "  
18 "  
2 "  
6 "  
6 "  
10 "  
1 "  
2 "  
3 "  
2 "

## Model No. 608 Derricking Grab

The grab 1 is suspended by the cords 2 which pass over the pulleys 3 and round the outer pulleys of a set of four 4 at the head of the standard 5. The cords continue down and under the outer pulleys of a set of smaller pulleys 6 and are wound on a crank handle 7 at the centre of which they are connected by a spring clip. (Care should be taken to see that, when winding up, the double lapping of each cord on the rod occurs simultaneously, as otherwise the grab will cant over).

The grab is opened or closed by the cord 8 which, after passing over one of two inner pulleys at the end of the jib 9, then passes over another of the four pulleys 4 and one of the pulleys 6 to the crank handle 10.

The jib 9 is raised or lowered by the cord 11 which is secured to the standard 5, and having passed around the other of the two inner pulleys at the jib-end is passed back and around one of the four pulleys 4 and one of the pulleys 6 to the crank handle 12. The swinging of the jib is effected from the crank handle 13 on the end of a rod, on which is a  $\frac{1}{2}$ " pinion 14 engaging a contrate wheel 15 at the foot of the standard 5.

Gear wheels 16 and 17 are bolted on the crank handles 10 and 7 and are connected by the pinion 18. The crank handle 7 is fixed against longitudinal movement, but the crank handle 10 may be slid clear of the pinion 18, and the handle 7 turning the grab is raised or lowered. If the handle 10 is slid to disengage its gear wheel from the pinion 18 and the handle turned, the grab is opened or closed.


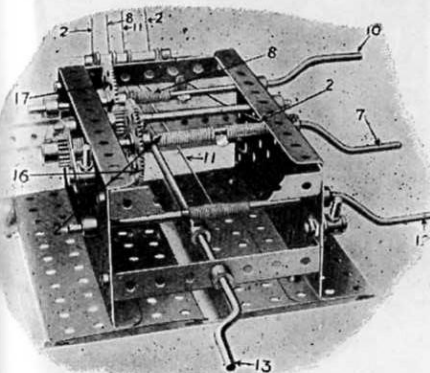


FIG. 608A

### Parts required:

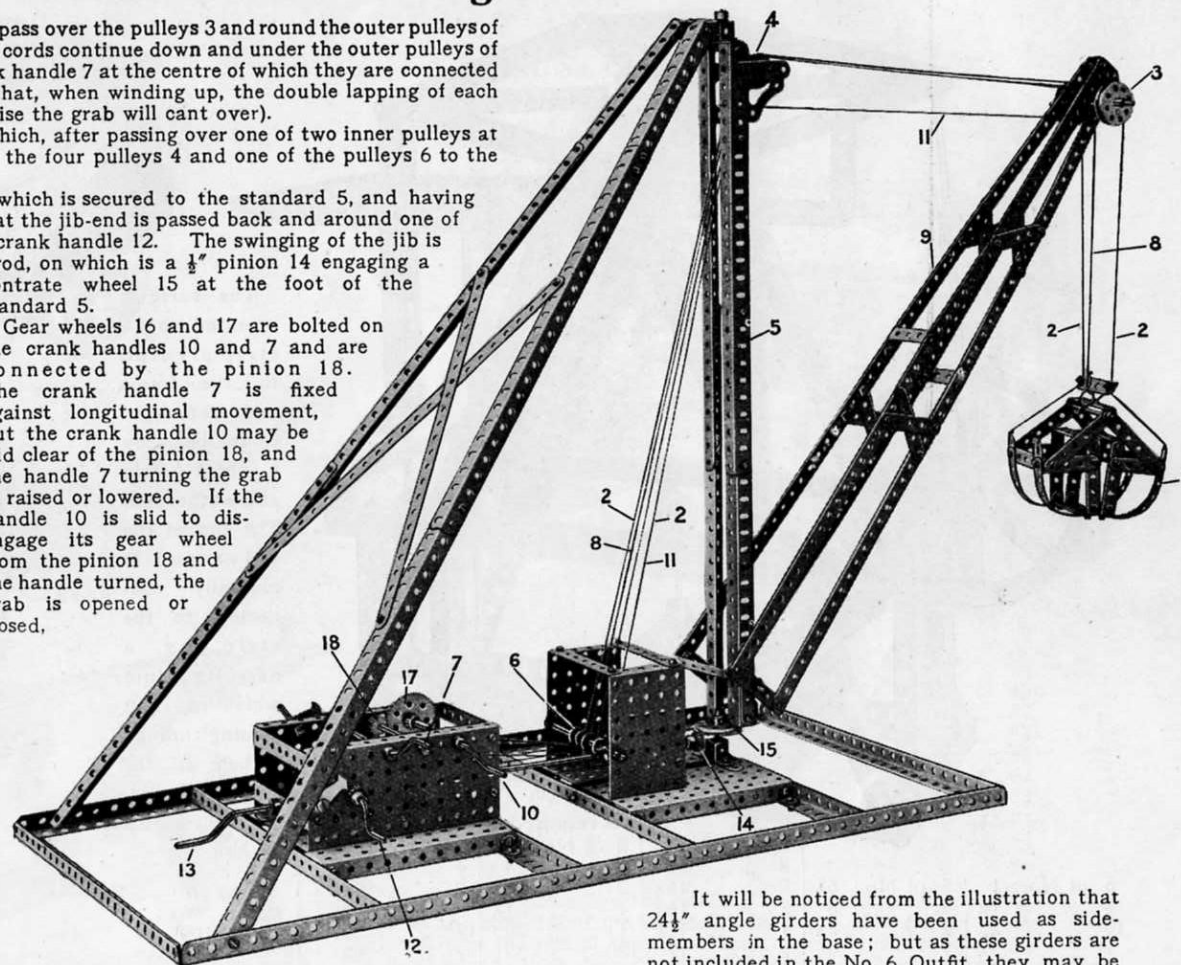
10 of No.	1	1 of No.	18A	9 of No.	48A
6	"	3	4	"	48B
4	"	4	2	"	52
20	"	5	2	"	53
4	"	6	3	"	57
18	"	8	4	"	59
2	"	9	2	"	63
6	"	10	2	"	108
6	"	11	2	"	115
10	"	12	1	"	126
1	"	13	6	"	147A
2	"	15A	16	"	147B
3	"	16	2	"	148
2	"	17	4	"	



It will be noticed from the illustration that  $2\frac{1}{2}$ " angle girders have been used as side-members in the base; but as these girders are not included in the No. 6 Outfit, they may be dispensed with, if desired, by substituting two  $12\frac{1}{2}$ " girders bolted end to end along each side of the base frame.

These Models can be made with MECCANO Outfit No. 6, or No. 5 and No. 5A.


## Model No. 609 Beam Engine

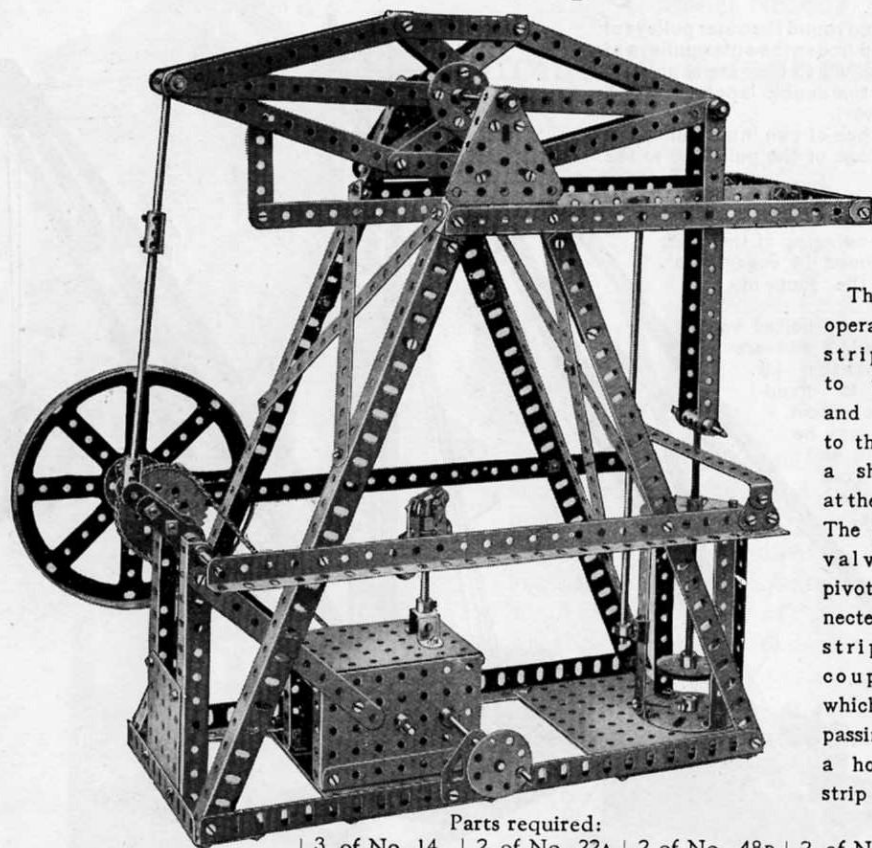

Parts required:

5 of No. 1	5 of No. 6A	3 of No. 14	2 of No. 22A	2 of No. 48b	2 of No. 76
4 " " 1B	8 " " 8	3 " " 15	4 " " 24	1 " " 50	2 " " 77
10 " " 2	2 " " 8A	2 " " 15A	2 " " 26	1 " " 52A	1 " " 95
1 " " 2A	7 " " 9	2 " " 16	1 " " 27A	3 " " 53	1 " " 96A
4 " " 4	2 " " 9B	1 " " 16A	1 " " 29	17 " " 59	2 " " 109
1 " " 5	4 " " 11	2 " " 17	120 " " 37	2 " " 62	1 " " 115
8 " " 6	3 " " 12	2 " " 18A	6 " " 38	6 " " 63	1 " " 118
		1 " " 18B	1 " " 45	1 " " 63B	1 " " 126A
		1 " " 21	3 " " 48c	1 " " 72	2 " " 133

## Model No. 610 Aerocar

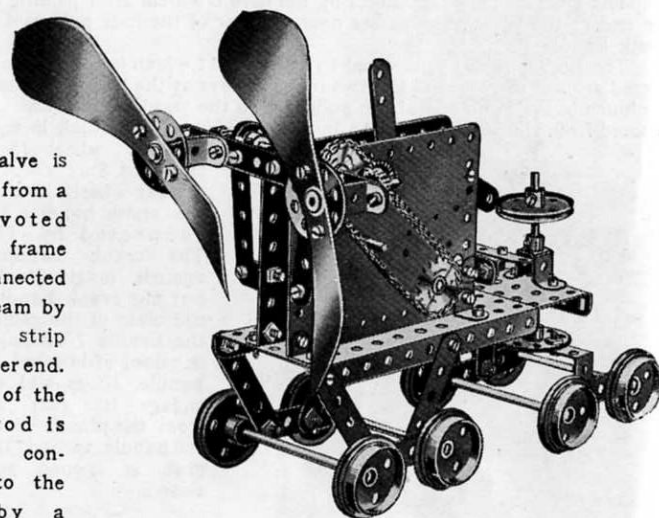

The valve is operated from a strip pivoted to the frame and connected to the beam by a short strip at the other end. The top of the valve rod is pivotally connected to the strip by a coupling into which a bolt passing through a hole in the strip is screwed.

Parts required:

1 of No. 2	2 of No. 29
1 " " 4	47 " " 37
10 " " 5	4 " " 41
10 " " 12	3 " " 45
2 " " 15A	1 " " 46
4 " " 16	1 " " 52
2 " " 17	1 " " 53
8 " " 20	2 " " 59
3 " " 24	2 " " 96
2 " " 26	


Clockwork Motor  
(not included in Outfit)

These Models can be made with MECCANO Outfit No. 6, or No. 5 and No. 5A.

117

Model No. 611

## Jaunting-Car

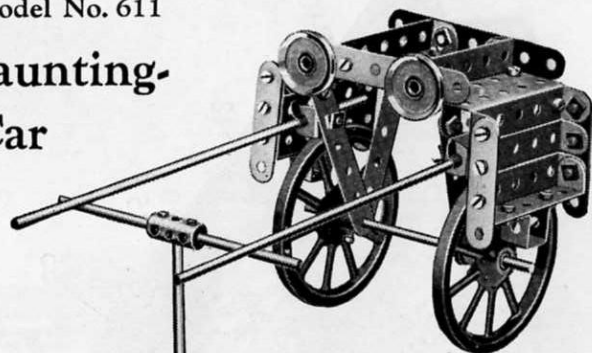


Parts required:

2 of No. 3	2 of No. 15A	39 of No. 37
4 " " 4	1 " " 16B	2 " " 45
4 " " 6	2 " " 19A	10 " " 48A
2 " " 11	1 " " 20	1 " " 53
8 " " 12	2 " " 22	1 " " 63
2 " " 13A	4 " " 35	

Model No. 612 Machine Gun


Parts required:

1 of No. 2A	1 of No. 26
2 " " 3	17 " " 37
2 " " 5	8 " " 38
2 " " 11	1 " " 48B
5 " " 12	1 " " 50
2 " " 12A	7 " " 59
2 " " 12B	1 " " 62A
1 " " 17	1 " " 63
1 " " 18A	1 " " 81
1 " " 18B	2 " " 109

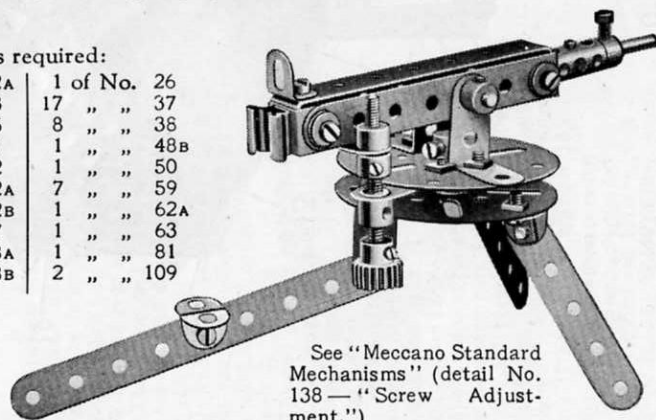

See "Meccano Standard Mechanisms" (detail No. 138—"Screw Adjustment.")

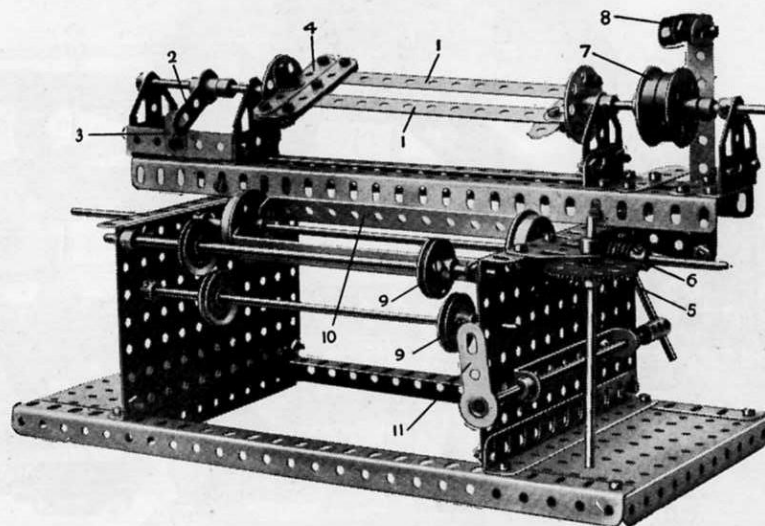Model No. 613 Linen Winder



Parts required:

2 of No. 2	1 of No. 13	1 of No. 27A	2 of No. 48B
1 " " 2A	2 " " 13A	1 " " 32	2 " " 52
8 " " 5	1 " " 14	66 " " 37	2 " " 52A
4 " " 8	1 " " 15A	2 " " 37A	16 " " 59
4 " " 9	2 " " 16	1 " " 37B	2 " " 62
4 " " 9F	1 " " 16A	6 " " 38	2 " " 63
6 " " 10	4 " " 20	1 " " 44	5 " " 126A
1 " " 11	4 " " 22	1 " " 48A	
7 " " 12	2 " " 24	1 " " 48B	

In order to disengage the winding frame bars 1 the crank 2 is lifted clear of the stop 3 and drawn back, this action disengaging the end cross strips 4 from the tips of the frame bars 1 and permitting the wound linen to be removed. The gear wheel 5 engaging the worm 6 forms a counter, 7 are the belt pulleys, and 8 the belt striker operated by crank 11; 9 are the guide pulleys for the main linen drums 10.




# Model No. 614
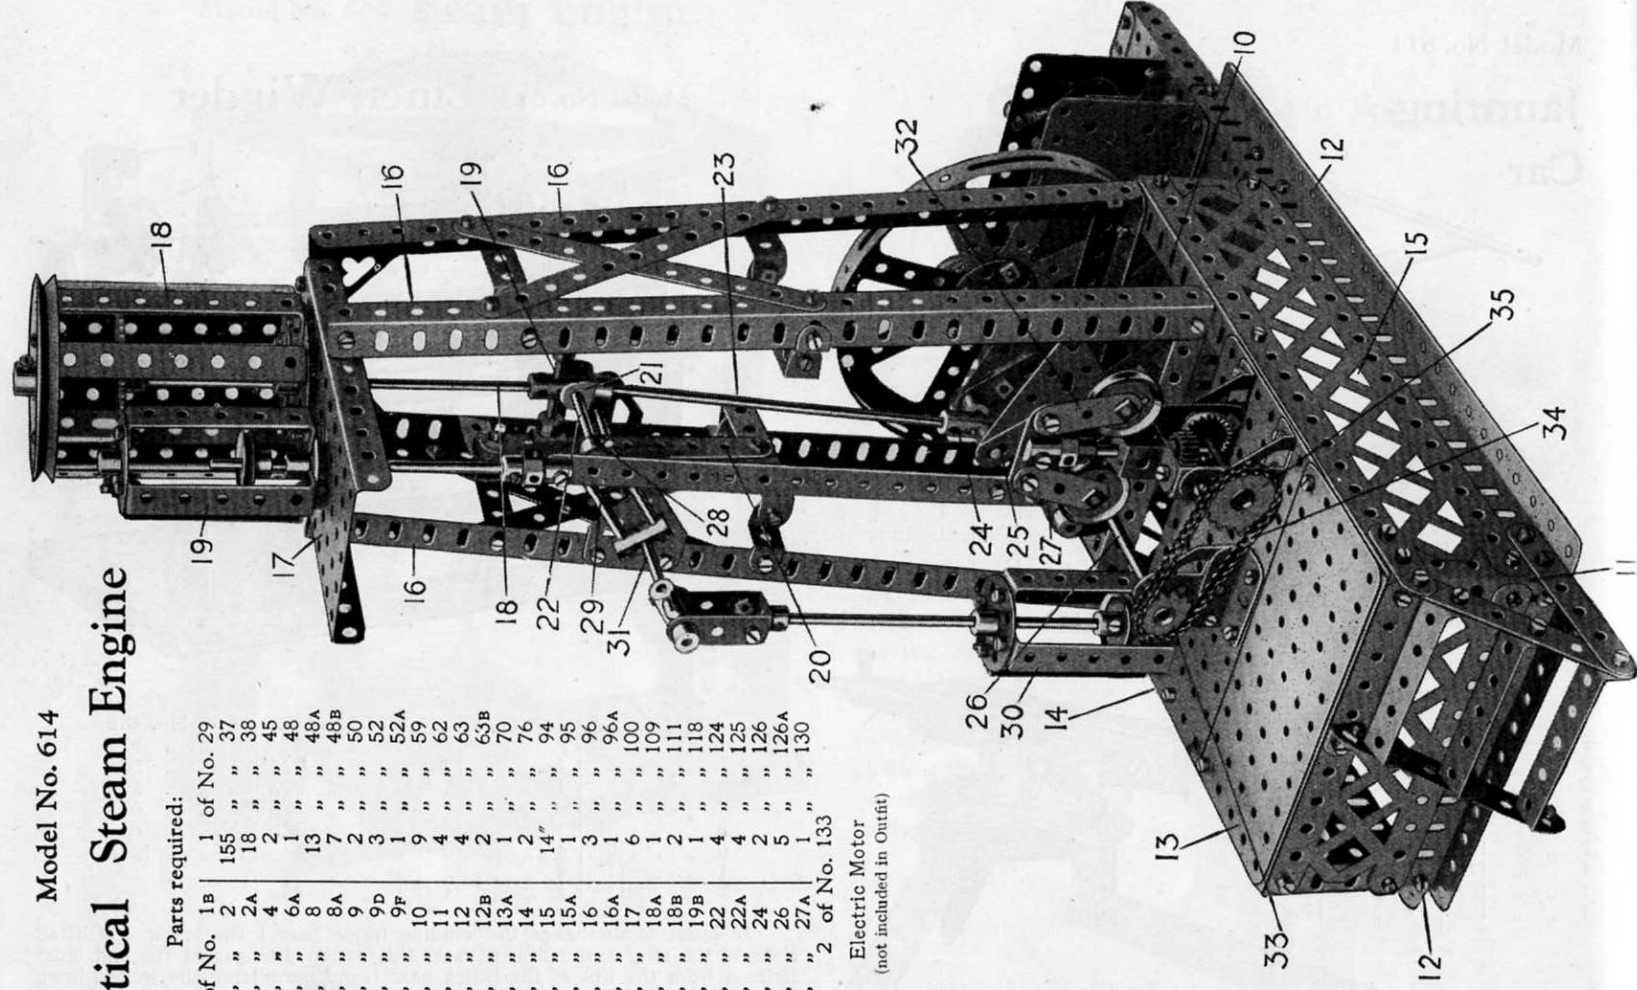
## Vertical Steam Engine

### Parts required:

1 of No.	1B	1 of No.	29
1	4	1	155
2	2	2	18
3	4	2	38
8	6A	1	45
6	8	13	48
2	8A	7	48A
7	9	2	48B
5	9D	3	50
1	9F	1	52
4	10	9	52A
3	11	4	59
3	12	4	62
1	12B	4	63
1	13A	2	63B
1	14	1	70
2	15	2	76
2	15A	14	94
2	16	1	95
4	16A	3	96
4	17	1	96A
4	18A	6	100
1	18B	1	109
1	19B	2	111
2	22	1	118
2	22A	4	124
5	24	4	125
4	26	2	126
3	27A	5	126A
		1	130
		2	133

Electric Motor  
(not included in Outfit)



This Model can be made with MECCANO Outfit No. 6, or No. 5 and No. 5A.

## Model No. 614

# Vertical Steam Engine

(continued)

As shown in Fig. 614A, the motor drives the engine through a reduction gearing arranged as follows:


A  $\frac{1}{2}$ " pinion 1 on the motor spindle drives a 57-tooth gear wheel 2 on the  $2\frac{1}{2}$ " rod 3, on the other end of which a further  $\frac{1}{2}$ " pinion engages a similar gear wheel on the  $2\frac{1}{2}$ " rod 4; a third  $\frac{1}{2}$ " pinion 5 on this rod engages another gear wheel 6 on a  $3\frac{1}{2}$ " rod 7. This rod is coupled to the engine by a sprocket chain 8 connected to 1" sprocket wheels 9.

The bed plate is built up at the sides by two  $9\frac{1}{2}$ " angle girders 10 bolted to  $2\frac{1}{2}$ " angle girders 11 at the corners. These corner girders are bolted to  $12\frac{1}{2}$ " angle girders 12, and the top is formed of one  $5\frac{1}{2}$ "  $\times$   $2\frac{1}{2}$ " flat plate 13 and one  $5\frac{1}{2}$ "  $\times$   $3\frac{1}{2}$ " flat plate 14 bolted down to the girders 10, which support the vertical angle girders 16. The side members 15 are composed of two  $5\frac{1}{2}$ " brace girders overlapped three holes. In the top of the angle girders 16 is bolted a  $5\frac{1}{2}$ "  $\times$   $2\frac{1}{2}$ " flanged plate 17 carrying a cylinder 18 and valve chest 19.

At the lower end of the piston rod 18 is the crosshead formed of a 2" rod 19 passing through the centre hole of a coupling into the end hole of which the piston rod 18 is secured. The ends of the rod 19 engage eye pieces which slide on the  $4\frac{1}{2}$ " strips 20. The fork piece 21 is pivotally connected to the coupling by a  $2\frac{1}{2}$ " rod 22, and the  $6\frac{1}{2}$ " connecting rod 23 is secured to a coupling 24 through which is passed a  $1\frac{1}{2}$ " rod 25; the ends of the latter engage the bosses of two cranks bolted to triangular plates forming the balance weights of the crankshaft.


The  $4\frac{1}{2}$ " rod 26 carries an eccentric 27 which operates the valve in the valve chest 19, and the two collars 28 on the rod 22 engage two 2" rods 29 which actuate the pump 30 from the rocking rod 31. The governor 32 is driven from a  $\frac{1}{2}$ " sprocket wheel 33 coupled by a chain 34 to a 1" sprocket wheel 35. The construction of the governor gear can be clearly seen in the illustration.

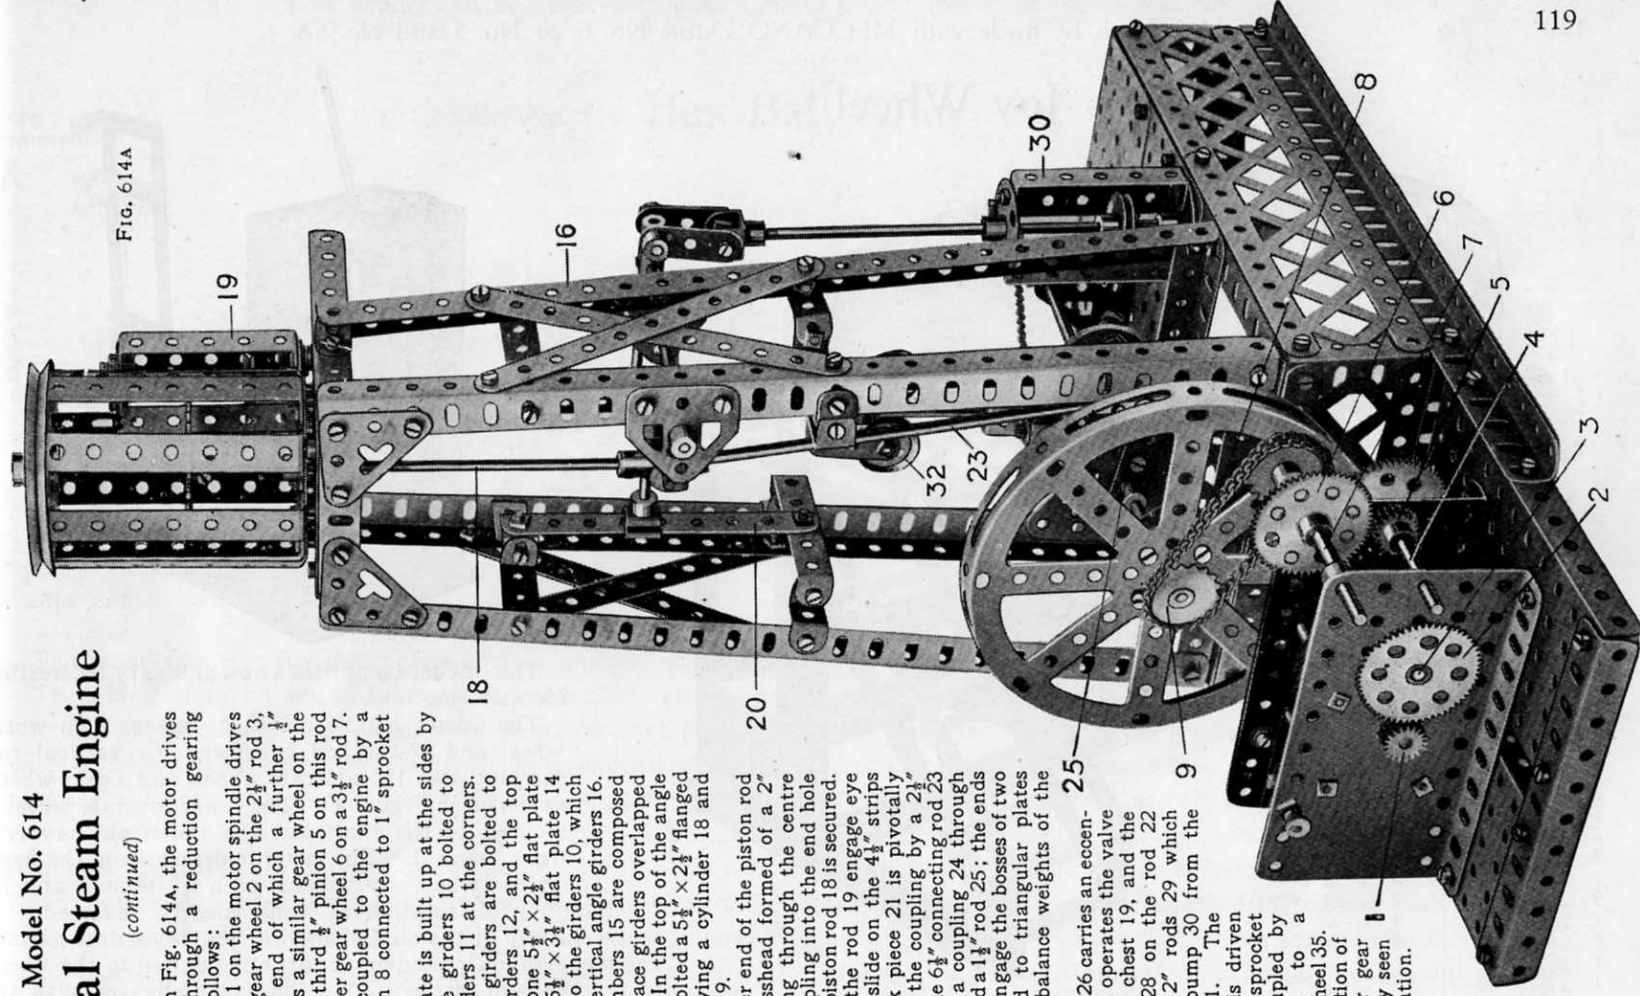Fig. 614A



This Model can be made with MECCANO Outfit No. 6, or No. 5 and No. 5A.

## Model No. 615 Joy Wheel

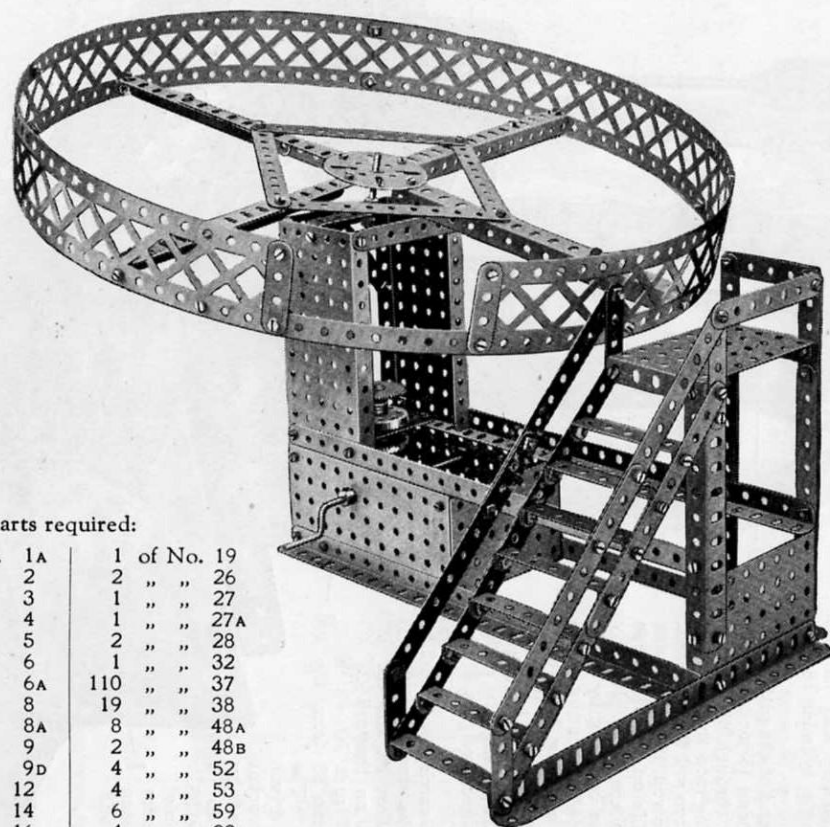

### Parts required:

1 of No. 1A	1 of No. 19
16 " " 2	2 " " 26
4 " " 3	1 " " 27
2 " " 4	1 " " 27A
2 " " 5	2 " " 28
5 " " 6	1 " " 32
2 " " 6A	110 " " 37
4 " " 8	19 " " 38
1 " " 8A	8 " " 48A
9 " " 9	2 " " 48B
1 " " 9D	4 " " 52
5 " " 12	4 " " 53
1 " " 14	6 " " 59
1 " " 16	4 " " 99
1 " " 17	1 " " 109
1 of No. 126	

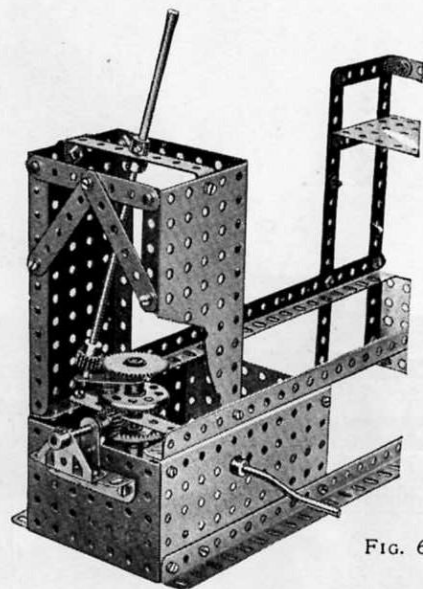


FIG. 615A

This model comprises a new and very interesting Meccano motion.

The Crank handle drives by means of a worm wheel and 57-toothed gear wheel a vertical rod carrying two  $1\frac{1}{2}$ " contrate wheels and a gear wheel, as shown in Figure A. The lower contrate wheel is secured to the shaft but the upper one revolves freely upon it. The latter is driven from the fixed contrate wheel by means of a  $\frac{1}{2}$ " pinion, and its direction of rotation is consequently reversed.

The end of the shaft carrying the revolving part of the model is journalled on a short strip bolted to the upper contrate wheel and carries a  $\frac{1}{2}$ " pinion which engages with the gear wheel secured on the vertical shaft. Thus on operation of the crank handle, the model revolves upon its axis, at the same time twisting slowly round with an amusing "wobble." A circular piece of cardboard is cut and placed in position to represent the floor found in real "Joywheels."

Parts  
requir  
6 of  
19 "  
5 "  
2 "  
15 "  
6 "  
5 "  
27 "  
1 "  
1 "  
2 "  
1 "  
8 "  
132 "  
1 "  
2 "  
2 "  
2 "  
2 "  
2 "  
1 "


T  
T  
afte  
on t  
ben  
ball  
stri  
7 an  
on a  
13 f  
the  
ther  
the

## Model No. 616 Box Ball Alley
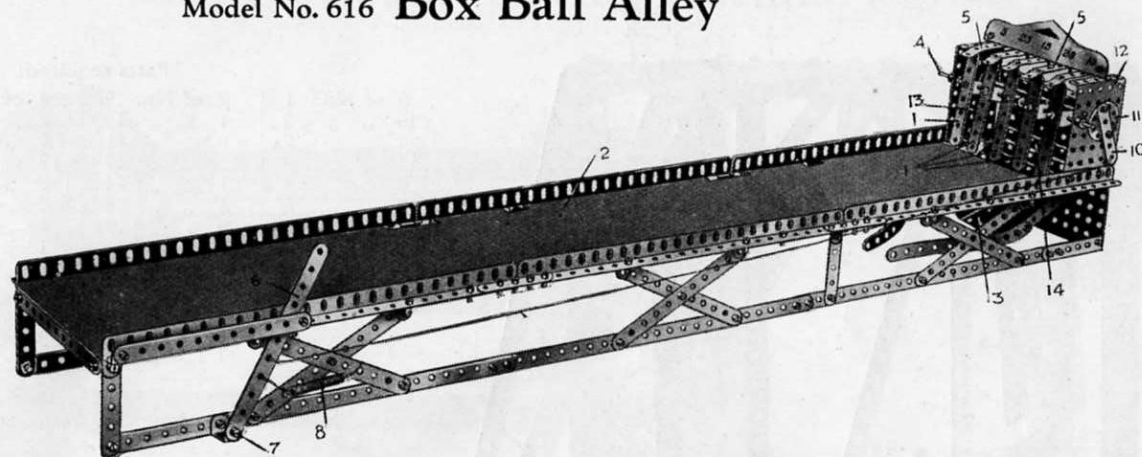
### Parts

#### required:

6	of No.	1
19	" "	2
5	" "	3
2	" "	4
15	" "	5
6	" "	8
5	" "	11
27	" "	12
1	" "	14
1	" "	15
2	" "	16
1	" "	24
8	" "	35
132	" "	37
1	" "	43
2	" "	52
2	" "	53
2	" "	54
2	" "	59
2	" "	62
1	" "	63




This model of a Box Ball Alley gives endless amusement, apart from the actual construction.

The object is to hit one of the strips 1, which have various number values, by means of a ball rolled along the platform 2, the ball after striking and tipping one of the strips being returned by the tray 3 to the player. The strips 1 are pivoted by double bent strips on to a rod 4, so that each strip may swing independently. The upper end of each strip is engaged by strips 5, the ends of which are bent slightly down, as shown, so that while the strips 1 are normally held in the position shown, when one of the strips is struck by the ball it is deflected backward and its upper end snaps outward past the bent end of its strip 5, which thus acts as a spring, the deflected strip being then retained in that position until it is reset. To reset any or all of the strips 1 a handle is formed by a strip 6 pivoted at 7 and controlled by a tension spring 8. A cord 9 connects the strip 6 to a short strip 10 forming a crank and bolted to a bush wheel 11 on an axle journaled in the side plates 12. This axle on its interior carries two further bush wheels to which are secured two short strips 13 forming cranks, a long double bent strip 14 being in turn bolted to the strips 13. When therefore the handle 6 is pulled out against the spring 8 the cord 9 rotates the bush wheel 11 and forces out the long double bent strip 14 which pushes out the strips 1 and resets them in their normal positions. During this resetting operation the upper ends of the strips 1 snap back beneath the bent ends of the spring strips 5.



This Model can be made with MECCANO Outfit No. 6, or No. 5 and No. 5A.

## Model No. 617 Stone-Sawing Machine

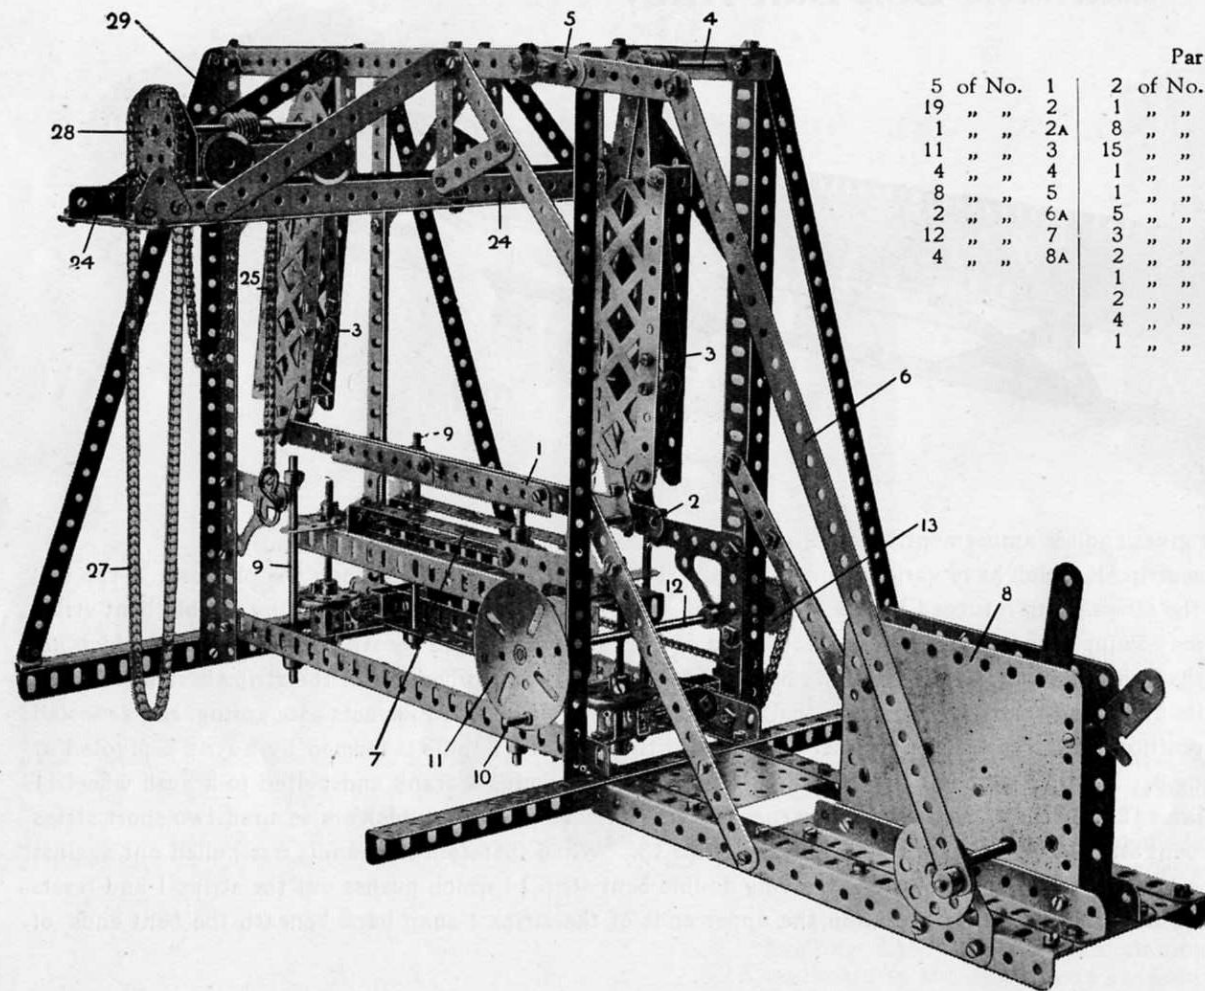

### Parts required:

5 of No.	1	2 of No.	9	3 of No.	26	2 of No.	62A
19	2	1	10	2	28	2	77
1	2A	8	11	1	32	2	80A
11	3	15	12	12	35	40"	94
4	4	1	14	185	37	1	95A
8	5	1	15	32	38	1	96A
2	6A	5	15A	6	45	4	100
12	7	3	16	1	47	4	108
4	8A	2	16A	5	48A	1	109
		1	17	3	53	2	110
		2	18A	2	57	2	115
		4	22	15	59	4	125
		1	24	2	62	3	126A

Clockwork Motor  
(not included in Outfit)

The sawing strip 1 consists of two rack strips bolted to a  $12\frac{1}{2}$ " strip 2 connected by 1" rods to the ends of the swinging frames 3, one loosely pivoted on one of the rods carried in the frame and the other secured by a crank to the rod 4. The swinging frames 3 are oscillated from the crank 5 and connecting rod 6 driven by the clockwork motor 8.

## Model No. 617 Stone-Sawing Machine (continued)

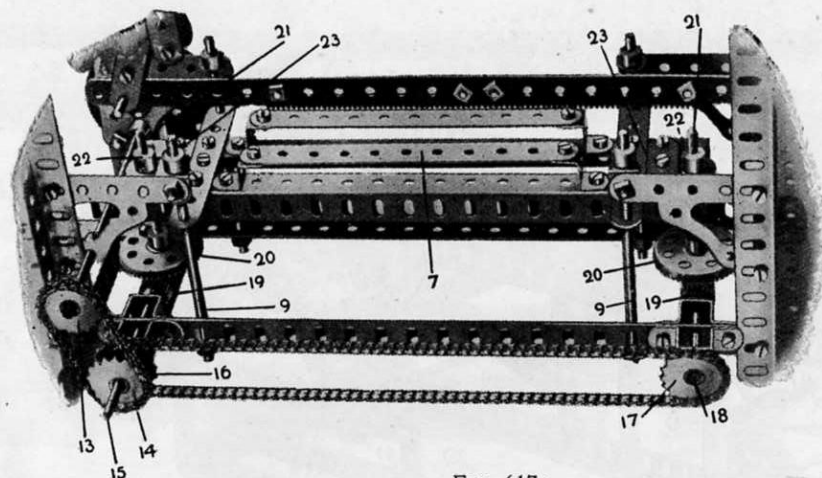


FIG. 617A

The support frame 7 (Fig. A) for the stone to be sawn is raised and lowered as follows: The frame 7 is guided on the vertical rods 9 and raised and lowered by the operation of the threaded pin 10 forming a handle on the face plate 11. This face plate is mounted on a rod 12 carrying a 1" sprocket wheel 13 connected by a chain to another 1" sprocket wheel 14 on a rod 15. A third 1" sprocket 16 on the same rod is coupled to another 1" sprocket wheel 17 at the other end of the machine.

The rods 15 and 18 carry  $\frac{1}{2}$ " pinions 19 driving contrate wheels 20 secured on screwed rods 21 and engaging threaded cranks 22 secured to the frame 7 by  $1\frac{1}{2}$ " strips 23.

The trolley (Fig. B) runs on gantry rails 24 and the load chain 25 passes over a  $\frac{3}{4}$ " sprocket wheel on the rod 26, to be secured at one end to the trolley frame.

The chain 25 is raised or lowered by the operation of a sprocket chain 27 passing over a  $1\frac{1}{2}$ " sprocket wheel 28, the rod of which carries a worm 29. This engages a  $\frac{1}{2}$ " pinion on the rod 26 carrying a sprocket wheel 30 over which the load chain 25 passes.

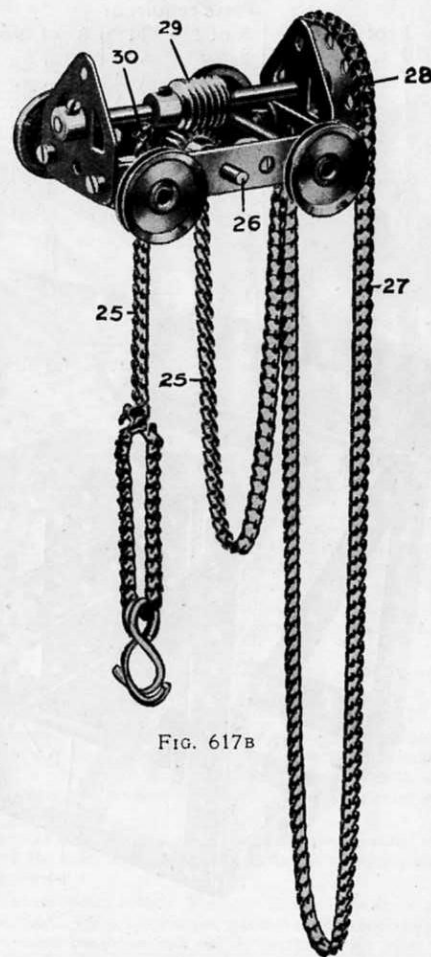


FIG. 617B

This Model can be made with MECCANO Outfit No. 6, or No. 5 and No. 5A.

Model No. 618 **Bagatelle Table**

1 of No. 1		Parts required:		3 of No. 17	
10	" "	2	9 " "	12	2 " "
	" "	2A	1 " "	12B	1 " "
1	" "	3	4 " "	13A	1 " "
1	" "	4	2 " "	14	2 " "
6	" "	5	1 " "	15	134 " "
4	" "	6	2 " "	15A	6 " "
6	" "	6A	1 " "	16	
10	" "	8			
11	" "	9			
6	" "	10			

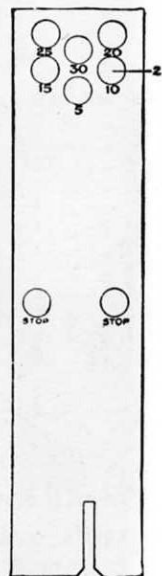
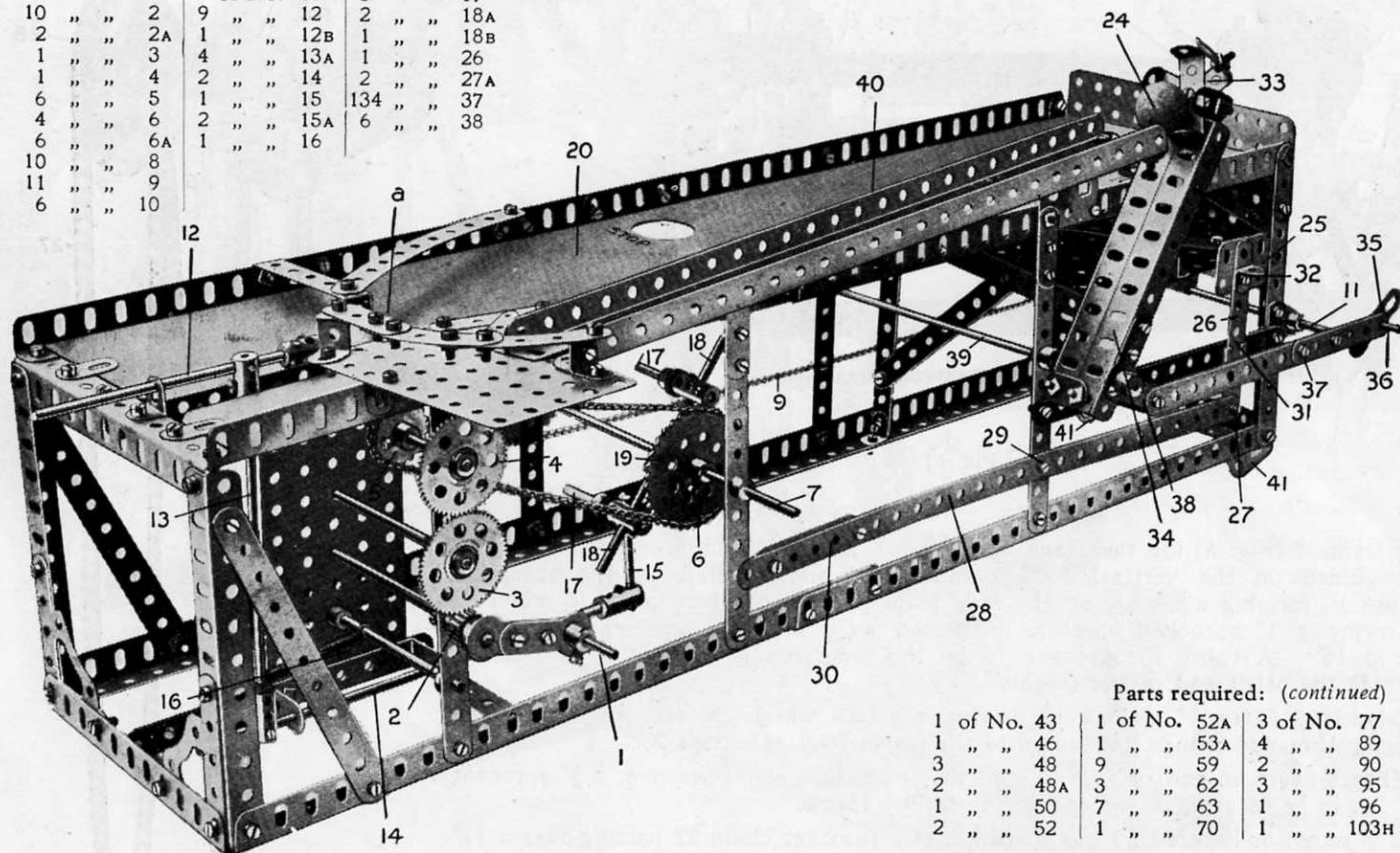


FIG. 618A

Parts required: (continued)			
1 of No. 43	1 of No. 52A	3 of No. 77	2 of No. 108
1 " " 46	1 " " 53A	4 " " 89	1 " " 111A
3 " " 48	9 " " 59	2 " " 90	1 " " 115
2 " " 48A	3 " " 62	3 " " 95	1 " " 125
1 " " 50	7 " " 63	1 " " 96	3 " " 126A
2 " " 52	1 " " 70	1 " " 103H	1 " " 128

This Model can be made with MECCANO Outfit No. 6, or No. 5 and No. 5A.

125

## Model No. 618 Bagatelle Table (continued)

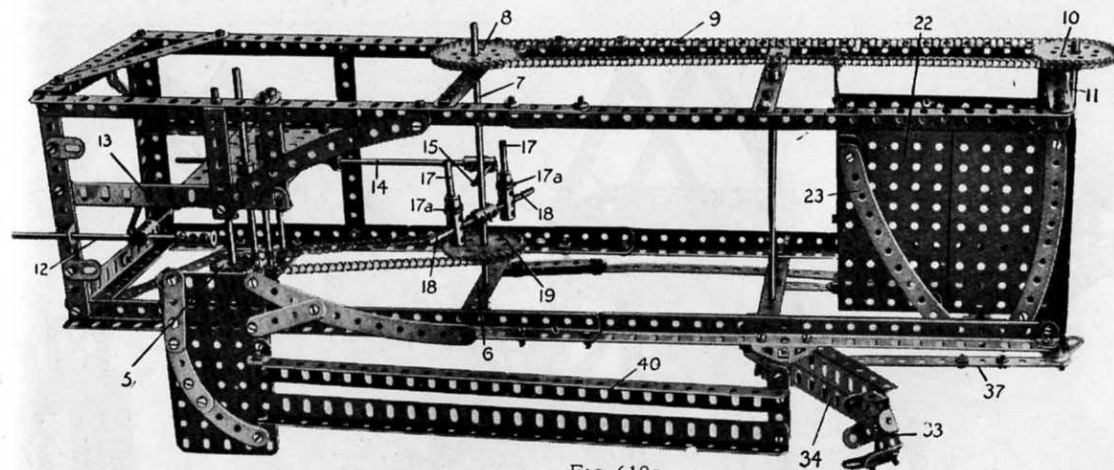


FIG. 618B

The operating handle 1 drives a  $\frac{1}{2}$ " pinion 2 engaging a  $1\frac{1}{2}$ " gear wheel 3. This engages another  $1\frac{1}{2}$ " gear wheel 4 on the axle rod of which is a 1" sprocket wheel 5 coupled by a chain to a 2" sprocket wheel 6 on the axle rod 7. On the further end of this rod 7 is another 2" sprocket wheel 8 connected by a chain 9 to a 2" sprocket wheel 10 on a rear axle rod 11.

The pusher-rod 12 (by means of which the marble is driven from the point a), is carried from a  $5\frac{1}{2}$ " vertical rod 13 which is connected to an 8" rod 14. At the front end of the latter is a 2" rod 15 arranged vertically and a spring 16 tends to pull the pusher-rod forward to strike the marble. The pusher-rod is depressed against the spring by the action of two 1" rods 17 upon which are mounted  $\frac{1}{2}$ " pulley wheels 17a carried from two couplings secured on two 2" rods 18 which enter the central coupling 19. The axle rod 7 passes completely through the coupling 19.

As the rods 17 rotate, the pulleys 17a bear against the rod 15 and depress the pusher-rod rearwardly until released, when the spring pulls the pusher-rod sharply forward to drive the marble from the point a along the table 20 towards the holes 21 (Fig. A). When the marble falls into any one of the holes 21 it drops on to the Plate 22 (Figs. B and C) formed of two  $5\frac{1}{2}$ " flanged plates bolted together. The plate 22 is inclined one hole down, and guides consisting of  $5\frac{1}{2}$ " curved strips 23 (Fig. B) connected to the plate by double angle brackets, lead the marble 24 (Fig. 618) to the end of the plate, where it is retained by a  $1\frac{1}{2}$ " flat girder 25 (Fig. C) carried on a  $3\frac{1}{2}$ " strip 26 pivotally connected at 27 (Fig. 618) by locked nuts to a  $12\frac{1}{2}$ " strip pivoted at 29 and weighted at 30 with  $2\frac{1}{2}$ " strips.

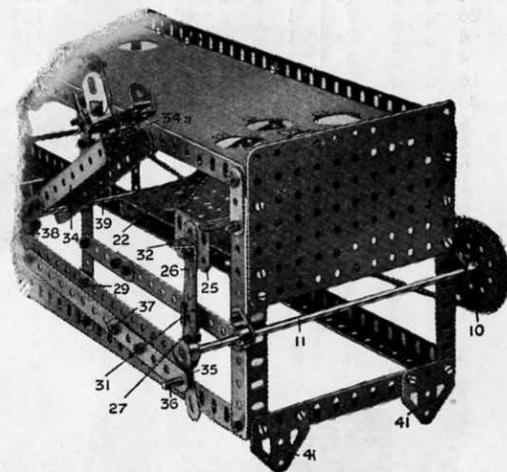


FIG. 618C

The strip 26 (Fig. C) is guided in an eye piece 31 and an angle bracket 32 is bolted near the top of the strip. The pocket 33 consists of three  $1\frac{1}{2} \times \frac{1}{2}$ " double angle strips at the end of an arm 34 formed by two  $5\frac{1}{2}$ " angle girders. The pocket is carried from the arm 34 by a 1" triangular plate 34a the two base holes of which are bolted in the end holes of the angle girders. The pocket is bolted to the apex hole of the triangular plate, with three washers beneath the pocket to set it up.

The arm 34 is rocked from the rod 11 (Fig. 618) by a crank 35, a threaded pin 36 on which engages the end hole of a  $5\frac{1}{2}$ " and a 3" strip 37 overlapped three holes. The other end of the strip is connected to a boss bell crank 38 bolted to the arm 34 and secured to the rod 39.

As the axle rod 11 rotates, the arm 34 is permitted to fall, and in so doing makes contact with the angle bracket 32 and depresses the stop plate 25, permitting the marble to drop from the plate 22 into the pocket 33. Further rotary movement of the rod 11 again raises the arm 34 with the marble in the pocket, until the marble is deposited into the chute 40 and is returned to the point a.


Meanwhile, on the rising of the arm 34 the plate 25 is again raised to close the outlet from the inclined plate 22. The bearings for the axle rod 11 are formed by two 1" triangular plates secured to the rear vertical angle girders.

Figure A indicates the shape of the cardboard table. The holes 21 should be made only slightly larger than the marble or ball used. (The latter is not supplied in Meccano Outfits) The table is given a slight incline towards the pusher-rod end by forming at the other end two feet with two flat trunnions 41 bolted to the lower  $5\frac{1}{2}$ " angle girders.



## Model No. 619 Jack Knife Bridge

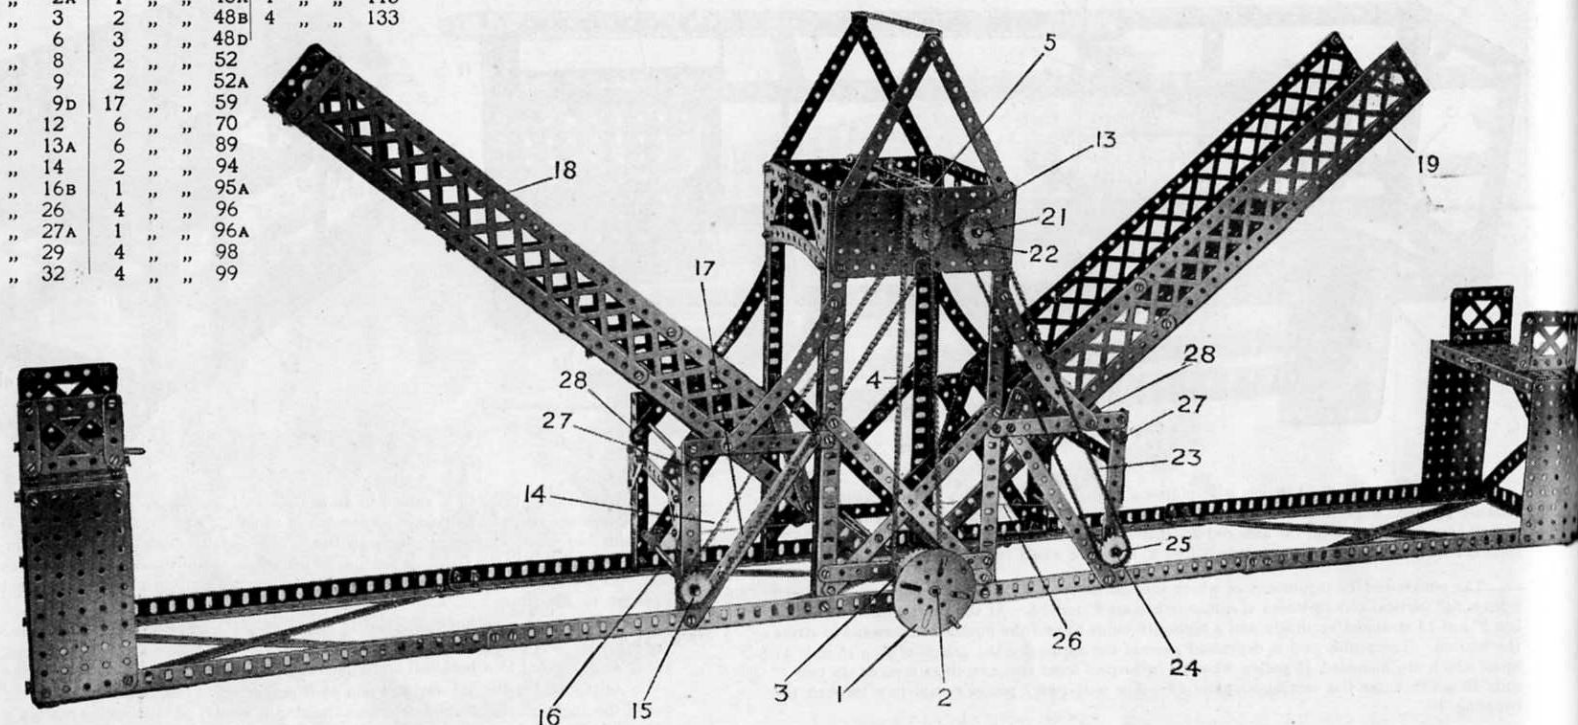Parts required:			
6 of No. 1	210 of No. 37	4 of No. 100	
4 " " 1B	6 " " 38	4 " " 108	
26 " " 2	1 " " 40	1 " " 109	
4 " " 2A	1 " " 48A	1 " " 115	
4 " " 3	2 " " 48B	4 " " 133	
16 " " 6	3 " " 48D		
20 " " 8	2 " " 52		
6 " " 9	2 " " 52A		
4 " " 9D	17 " " 59		
6 " " 12	6 " " 70		
1 " " 13A	6 " " 89		
6 " " 14	2 " " 94		
1 " " 16B	1 " " 95A		
2 " " 26	4 " " 96		
2 " " 27A	1 " " 96A		
1 " " 29	4 " " 98		
1 " " 32	4 " " 99		



The arms of the bridge are raised or lowered by rotating the hand-wheel 1. On the 8" rod 2 of the hand-wheel is mounted a  $1\frac{1}{2}$ " sprocket wheel 3 which is coupled by a chain 4 to a  $\frac{3}{4}$ " sprocket wheel 5 on a  $6\frac{1}{2}$ " rod 6, Fig. 619A. On this rod a worm wheel 7 drives a  $\frac{1}{2}$ " pinion 8 on a  $3\frac{1}{2}$ " rod 9, on which is a  $\frac{3}{4}$ " contrate wheel 10. This engages a  $\frac{3}{4}$ " pinion 11 carried on a 3" rod 12, on the outer end of which is a 1" sprocket wheel 13 connected by a sprocket chain 14 to a 1" sprocket wheel 15 on a  $6\frac{1}{2}$ " rod 16; on this rod a cord 17 is wound, connected to the end of one arm 18 of the bridge. The other arm 19 is operated from a 57-toothed gear wheel 20 on the rod 12

Mod



engag  
rod :  
spro  
to an  
wind  
conn  
bridg  
Th  
carri  
 $1\frac{1}{2}$ " d

These Models can be made with MECCANO Outfit No. 6, or No. 5 and No. 5A.

127

# Model No. 619 Jack Knife Bridge

(continued)

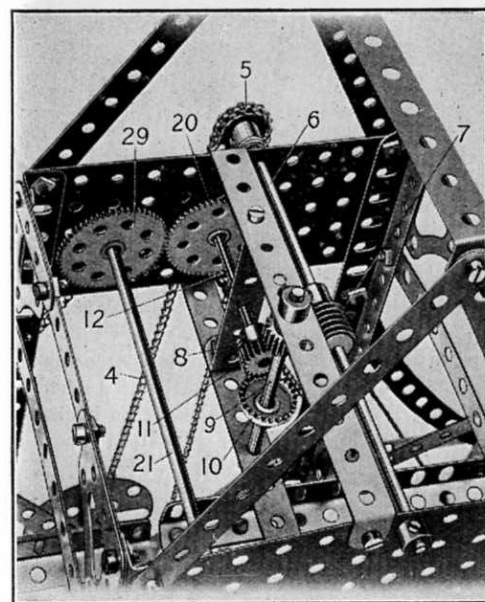



FIG. 619A

engaging a similar wheel 29 on the  $6\frac{1}{2}$ " rod 21. On the end of this rod a 1" sprocket wheel 22 is coupled by a chain 23 to another 1" sprocket wheel 24 on the  $6\frac{1}{2}$ " winding rod 25, the cord 26 from which is connected to the other arm 19 of the bridge.

The arms 18 and 19 are pivotally carried on  $6\frac{1}{2}$ " rods 27 by means of  $3\frac{1}{2}$ "  $\times$   $1\frac{1}{2}$ " double angle strips 28.

# Model No. 620

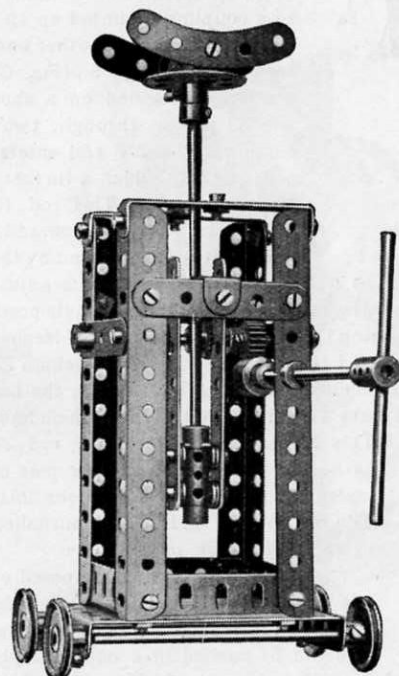
## Jack



Parts required:

5 of No. 5	3 of No. 26
4 " " 9	1 " " 32
4 " " 9D	32 " " 37
2 " " 12	8 " " 38
2 " " 14	3 " " 48A
2 " " 15A	1 " " 53
1 " " 16	7 " " 59
1 " " 16B	2 " " 63
4 " " 22	2 " " 90
1 " " 24	2 " " 110


# Model No. 621 Semaphore

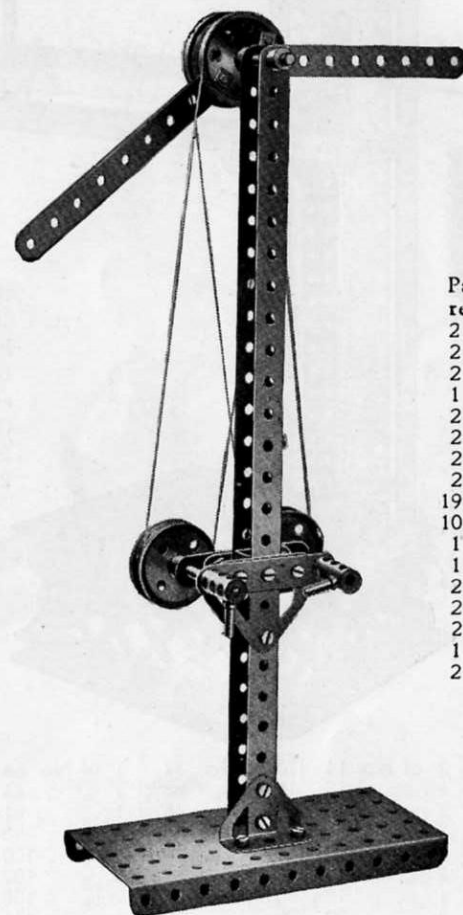

Parts required:

2 of No. 2	2
2 " " 5	5
2 " " 8	8
1 " " 16A	16A
2 " " 17	17
2 " " 20	20
2 " " 21	21
2 " " 24	24
19 " " 37	37
10 " " 38	38
1 " " 40	40
1 " " 52	52
2 " " 59	59
2 " " 63	63
2 " " 115	115
1 " " 126	126
2 " " 126A	126A

## Model No. 622 Platform Scales

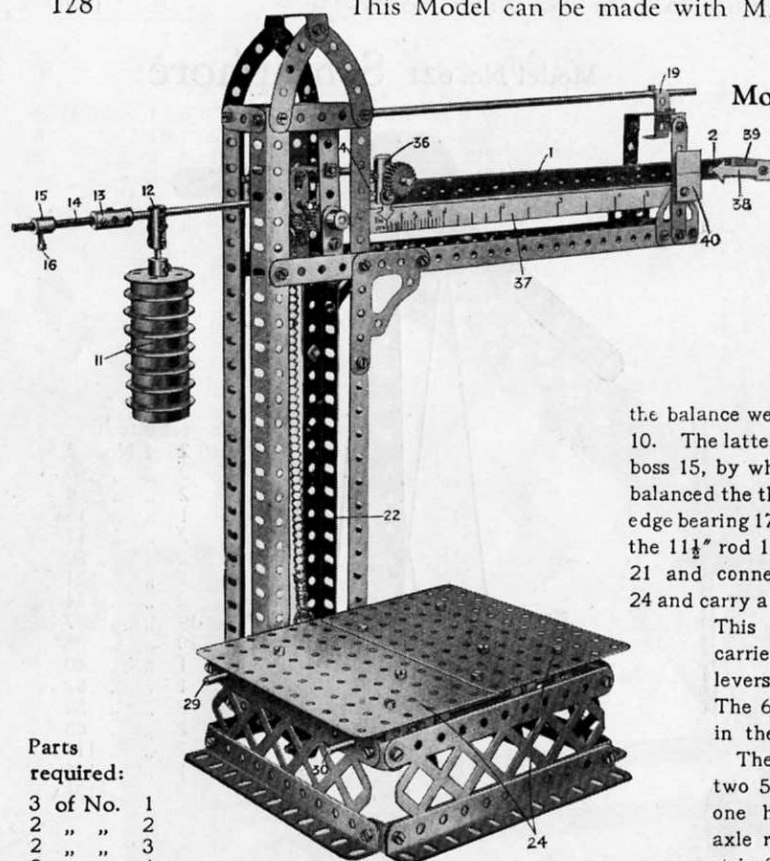

The steelyard 1, consisting of a  $12\frac{1}{2}$ " strip, is bolted at its extreme end at 2 to a coupling mounted on an  $11\frac{1}{2}$ " rod 3, Fig. C, and at its other end 4 to a second coupling 5 (Fig. C). This coupling is carried on a short rod 6 which passes through two further couplings 7 and 8 and enters another coupling 9 in which a further axle rod 10 is mounted. This rod 10 carries

the balance weights 11 which may be secured by means of the coupling 12 in any position on the rod 10. The latter is also extended at its end by the coupling 13 and threaded rod 14 carrying a threaded boss 15, by which very accurate balance adjustment may be made. When the steelyard is exactly balanced the threaded boss is secured in its position by the bolt 16. The fulcrum 7 rests upon a knife-edge bearing 17 (see "Meccano Standard Mechanisms") and is lifted into weighing position by placing the  $11\frac{1}{2}$ " rod 18 under the stop 19. A chain 22 is suspended by means of flat brackets 20 and hook 21 and connects with the levers 23 in the base of the model. These levers are pivoted on hooks 24 and carry a central  $3\frac{1}{2}$ " rod 25 from which hangs a link 26 consisting of a double bracket and  $\frac{3}{4}$ " bolt.

This link supports a further rod 27 carried in the ends of another pair of levers 28 pivoted to the hooks 28A. The  $6\frac{1}{2}$ " rods 29 and 30 are journaled in the framework of the base.

The platform, Fig. A, is composed of two  $5\frac{1}{2}$ " by  $3\frac{1}{2}$ " flat plates overlapped one hole and secured together; the axle rod 31 carried in a double angle strip 32 rests upon the levers 23, while the threaded pins 33 bolted in  $1\frac{1}{2}$ " by  $\frac{1}{2}$ " angle brackets 34 rest upon the levers 28. Two washers are placed on the bolts underneath each end of the double angle strip 32 and four washers are placed beneath each of the brackets 34. Single bent strips 35 form guides for the platform and fit over the rod 30 in the base.

### Parts required:

3 of No. 1	2 of No. 14	78 of No. 37	1 of No. 64
2 " " 2	1 " " 15	14 " " 38	2 " " 65
2 " " 3	3 " " 16	1 " " 46	1 " " 81
2 " " 4	2 " " 16B	3 " " 48	4 " " 90
3 " " 5	1 " " 17	4 " " 48D	3 " " 100
2 " " 6	2 " " 18A	2 " " 52A	2 " " 102
6 " " 6A	1 " " 18B	6 " " 57	2 " " 108
4 " " 8	8 " " 20	20 " " 59	1 " " 111
2 " " 9	1 " " 25	2 " " 62	1 " " 111A
4 " " 10	1 " " 26	8 " " 63	2 " " 115
1 " " 11	8 " " 35	1 " " 63B	2 " " 126A
2 " " 12			
1 " " 12A			
3 " " 12B			
2 " " 13			

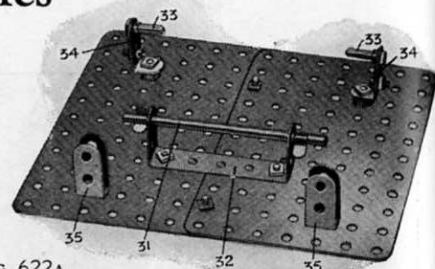


FIG. 622A


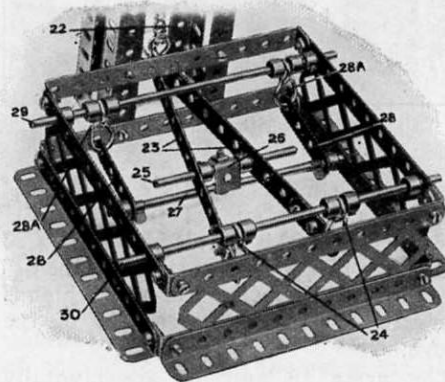


FIG. 622B

Model No. 622 Platform Scales (*continued*)

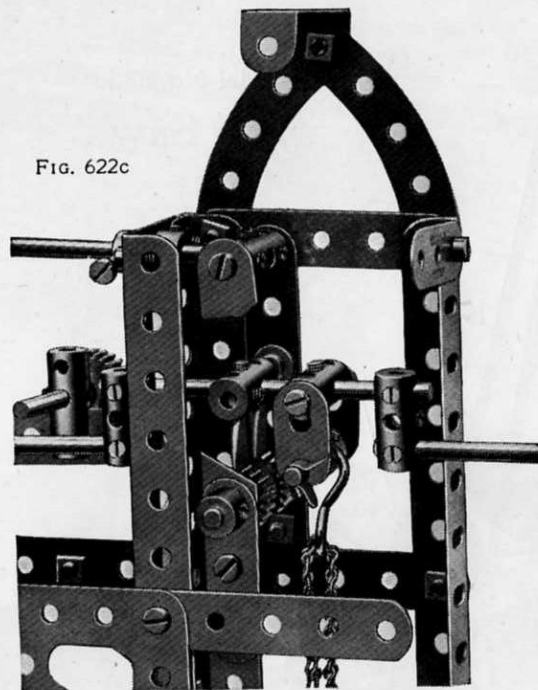FIG. 622c




A weight 36 consisting of a strip coupling, short rod, and  $\frac{3}{4}$ " pinion slides along the steelyard 1 and carries a small arrow, cut from cardboard, which indicates the load being weighed by means of the graduated rule 37. A piece of cardboard 38 also cut in the form of an arrow may be bolted to a 1" reversed angle bracket 39 and arranged to rest against the cardboard indicator 40 when the scales are exactly balanced.

Before commencing to weigh care should be taken in balancing the steelyard so that the arrow 38 points to the line 40 when the sliding weight 36 is at the "O" mark in the rule 37.

## Model No. 623 Field Gun

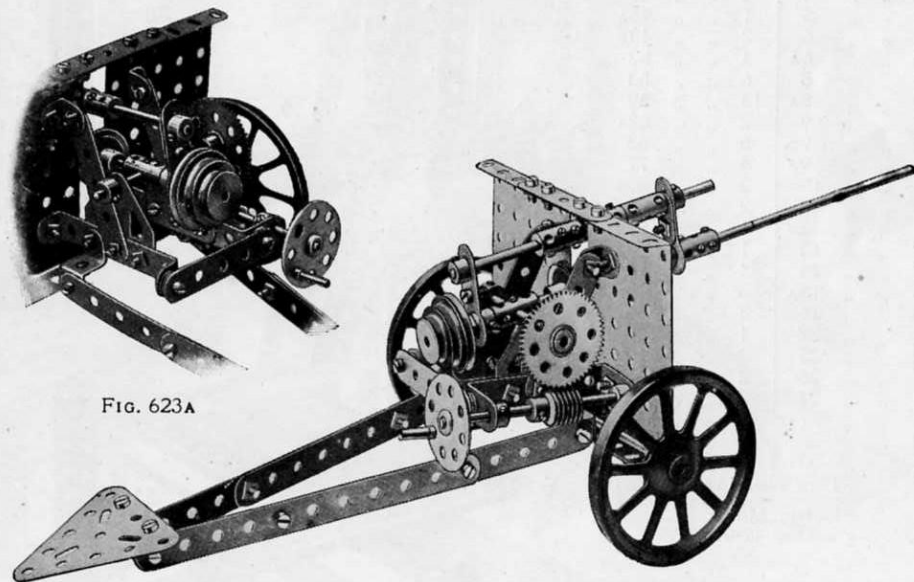FIG. 623A



## Parts required:

4 of No. 2	1 of No. 13A	1 of No. 18B	1 of No. 27A	1 of No. 47	1 of No. 76
5 " " 5	1 " " 14	2 " " 19B	1 " " 32	2 " " 53	1 " " 115
2 " " 10	1 " " 15	3 " " 22	34 " " 37	5 " " 59	1 " " 123
1 " " 11	1 " " 16	1 " " 24	6 " " 38	2 " " 62	2 " " 124
6 " " 12	1 " " 16A	1 " " 26	1 " " 46	4 " " 63	2 " " 126



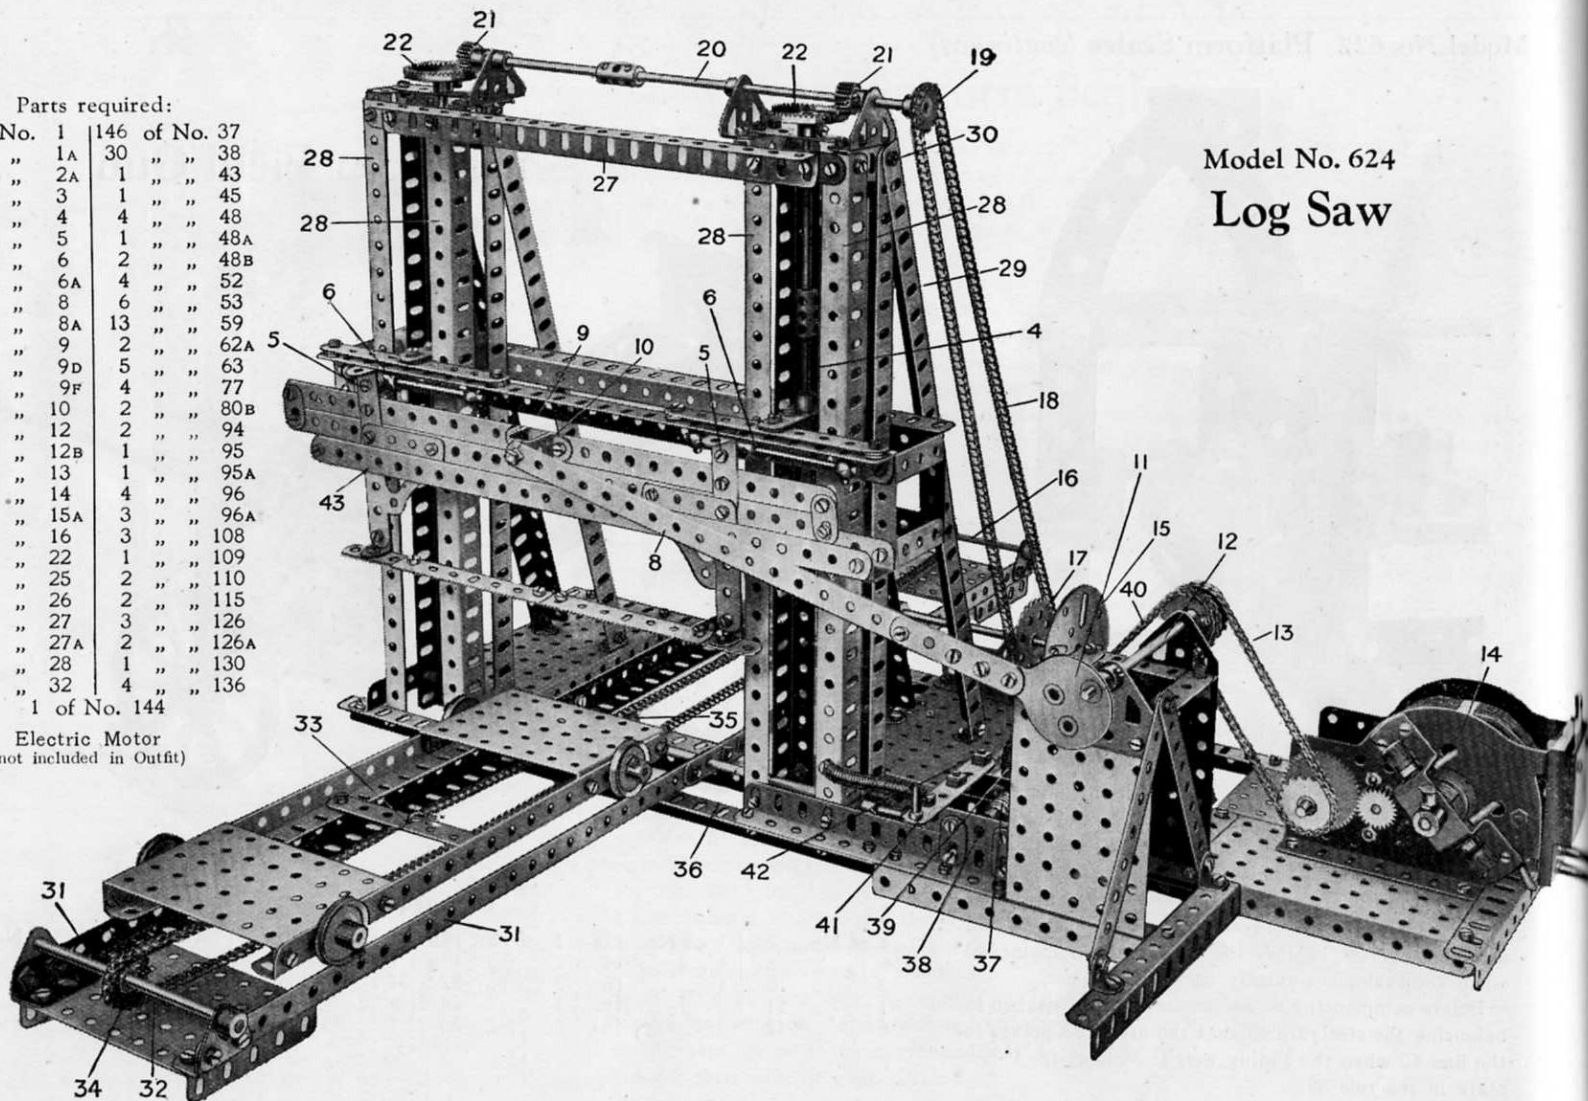
This Model can be made with MECCANO Outfit No. 6, or No. 5 and No. 5A.

Parts required:

3	of No.	1	146	of No.	37
2	"	1 <sub>A</sub>	30	"	38
4	"	2	1	"	43
1	"	3 <sub>A</sub>	1	"	45
1	"	4	4	"	48
8	"	5	1	"	48 <sub>A</sub>
10	"	6	2	"	48 <sub>B</sub>
2	"	6 <sub>A</sub>	4	"	52
23	"	8	6	"	53
4	"	8 <sub>A</sub>	13	"	59
7	"	9	2	"	62 <sub>A</sub>
2	"	9 <sub>D</sub>	5	"	63
4	"	9 <sub>F</sub>	4	"	77
6	"	10	2	"	80 <sub>B</sub>
14	"	12	2	"	94
1	"	12 <sub>B</sub>	1	"	95
1	"	13	1	"	95 <sub>A</sub>
1	"	14	4	"	96
6	"	15 <sub>A</sub>	3	"	96 <sub>A</sub>
5	"	16	3	"	108
4	"	22	1	"	109
2	"	25	2	"	110
3	"	26	2	"	115
1	"	27	3	"	126
1	"	27 <sub>A</sub>	2	"	126 <sub>A</sub>
2	"	28	1	"	130
1	"	32	4	"	136

1 of No. 144

Electric Motor  
(not included in Outfit)



Model No. 624  
**Log Saw**

illustra  
saw sli  
comple  
angle g  
12½" a  
thread  
at this  
and str  
in orde  
sliding  
cranks  
Th  
couplin  
by rail  
lapping  
saw fra  
also bo  
chain 1  
Th  
on a 4  
rod car

This Model can be made with MECCANO Outfit No. 6, or No. 5 and No. 5A.

131

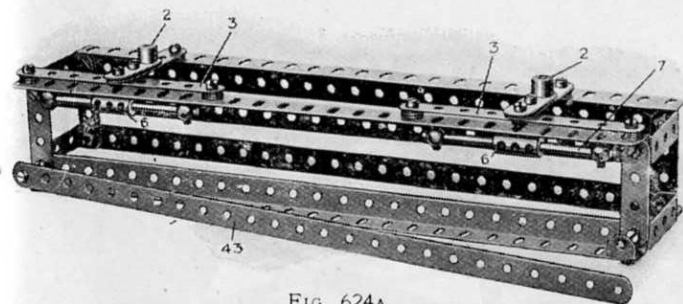


FIG. 624A

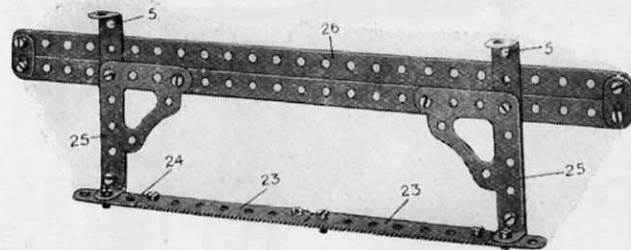


FIG. 624B

The general construction of the main framework of the model is clearly illustrated in Fig. C, while details of the vertically adjustable frame and saw slide are shown in Fig. A and of the saw frame in Fig. B. When completed, the frame (Fig. A) is slipped over the uprights 28. The  $9\frac{1}{2}$ " angle girder 27 is then bolted to the  $12\frac{1}{2}$ " angle girders 28 as shown and the  $12\frac{1}{2}$ " angle girders 29 are joined at 30 to the top of the uprights. The threaded cranks 2 and the strips 3 (Fig. A), are not secured to the saw slide at this stage, but when the slide is in position on the uprights 28 and strips 3 may be bolted in place. The strips 3 are spaced with washers in order to prevent the bolts, which secure the cranks, from fouling the sliding members 6. The threaded rods 4 are then screwed into the cranks 2 (see book of Meccano Standard Mechanisms, Section IX.)

The saw frame, Fig. B, is bolted and spaced with washers at 5 to the couplings 6 which slide on two  $3\frac{1}{2}$ " rods 7 secured to the frame (Fig. A) by rail supports and is reciprocated by means of a  $9\frac{1}{2}$ " and  $2\frac{1}{2}$ " strip 8 overlapping 3 holes and bolted at 9 to a double bent strip 10 on the frame. The saw frame is further retained on the slide by a  $12\frac{1}{2}$ " strip 43. The strip 8 is also bolted to an eccentric 11 on the rod 12, which is driven by a sprocket chain 13 from the motor 14.

The saw slide is adjusted vertically by turning the face plate 15 mounted on a  $4\frac{1}{2}$ " rod journalled in a  $2\frac{1}{2}$ " x 1" double angle strip (Fig. C). This rod carries a  $1\frac{1}{2}$ " sprocket wheel 17 coupled by a chain 18 to a  $\frac{3}{4}$ " sprocket

## Model No. 624 Log Saw (continued)

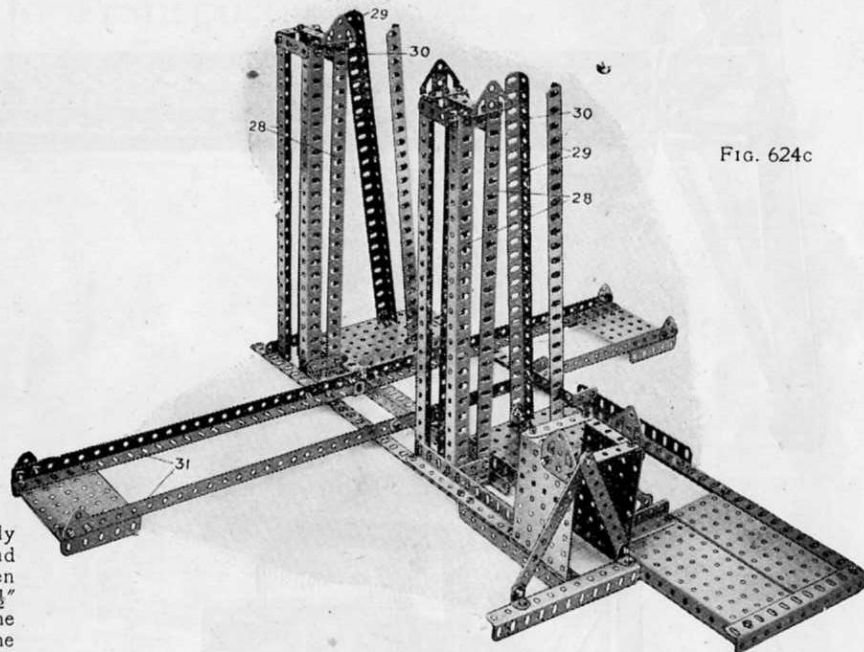


FIG. 624C

wheel 19 on a rod 20 made up of 6" and  $3\frac{1}{2}$ " rods coupled together. Two  $\frac{1}{2}$ " pinions 21 engage  $1\frac{1}{2}$ " contrate wheels 22 each secured to a  $3\frac{1}{2}$ " rod and coupled to the  $4\frac{1}{2}$ " screwed rods 4 which engage the cranks 2.

The saw is made up of two rack strips 23 bolted to a  $9\frac{1}{2}$ " strip 24 carried by architraves 25 from the saw frame. The latter consists of two  $12\frac{1}{2}$ " strips 26 bolted together at the ends.

The feed carriage, which slowly moves the logs against the saw whilst they are being cut, runs on rails 31 formed from  $12\frac{1}{2}$ " angle girders butted together, and is advanced by a sprocket chain 32 connected at 33 to the carriage. This chain passes over a  $\frac{3}{4}$ " sprocket wheel 34 at either end of the rails, while the lower part of the chain passes under and is driven by a  $1\frac{1}{2}$ " sprocket wheel 35 on the 8" rod 36. The latter is connected by a dog clutch to a  $3\frac{1}{2}$ " rod carrying a  $\frac{3}{4}$ " pinion engaged by a worm wheel 37 on a  $2\frac{1}{2}$ " rod, at the other end of which is a 2" sprocket wheel 39. This is driven by a chain 40 from the rod 12. The dog clutch is controlled by the hand lever 41 pivoted at 42. (Meccano Standard Mechanisms, Section V.)

This Model can be made with MECCANO Outfit No. 6, or No. 5 and No. 5A.

## Model No. 625 Crane

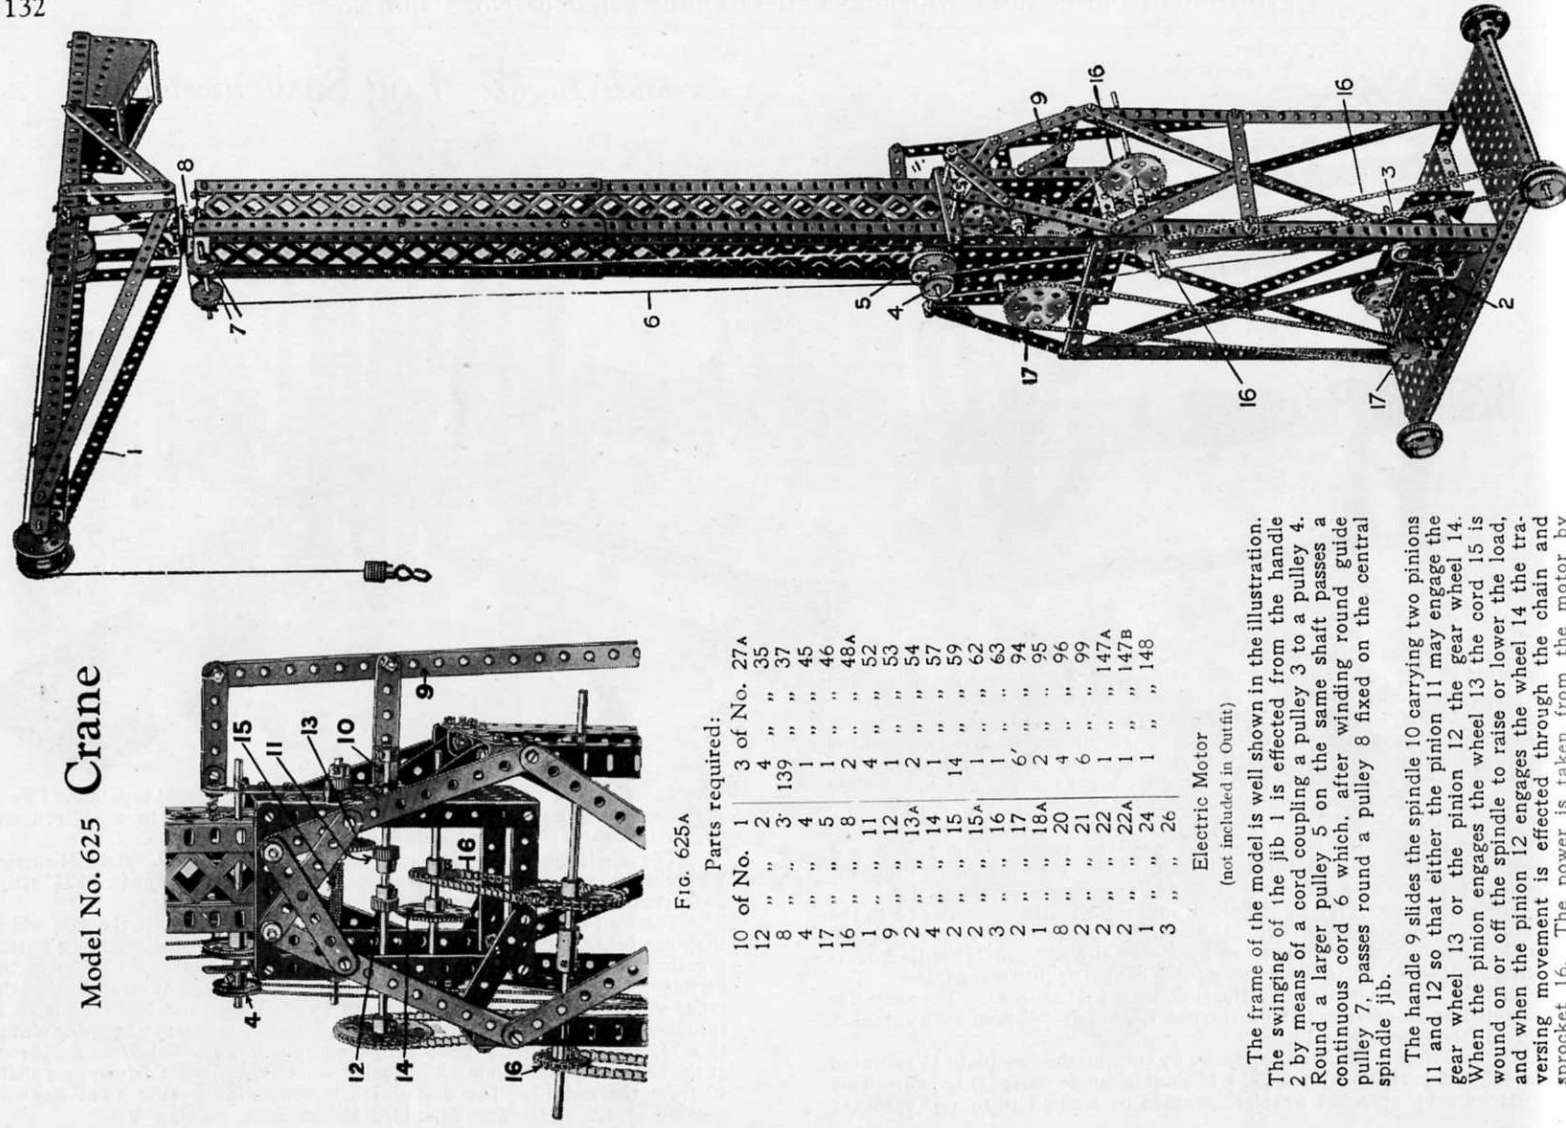


Fig. 625A

Parts required:

10 of No.	1	3 of No.	27A
12	2	4	35
8	"	3	37
4	"	4	45
17	"	5	46
16	"	8	48A
1	"	11	52
9	"	12	53
2	"	13A	54
4	"	14	57
2	"	15	59
2	"	15A	62
3	"	16	63
2	"	17	64
1	"	18A	95
8	"	20	96
2	"	21	99
2	"	22	147A
2	"	22A	147B
1	"	24	148
3	"	26	


Electric Motor

(not included in Outfit)

The frame of the model is well shown in the illustration. The swinging of the jib 1 is effected from the handle 2 by means of a cord coupling a pulley 3 to a pulley 4. Round a larger pulley 5 on the same shaft passes a continuous cord 6 which, after winding round guide pulley 7, passes round a pulley 8 fixed on the central spindle jib.

The handle 9 slides the spindle 10 carrying two pinions 11 and 12 so that either the pinion 11 may engage the gear wheel 13 or the pinion 12 the gear wheel 14. When the pinion engages the wheel 13 the cord 15 is wound on or off the spindle to raise or lower the load, and when the pinion 12 engages the wheel 14 the traversing movement is effected through the chain and sprocket 16. The power is taken from the motor by way of the 1" and 2" sprockets 17, the latter on the

## Model No. 626 St. Malo Transporter Bridge

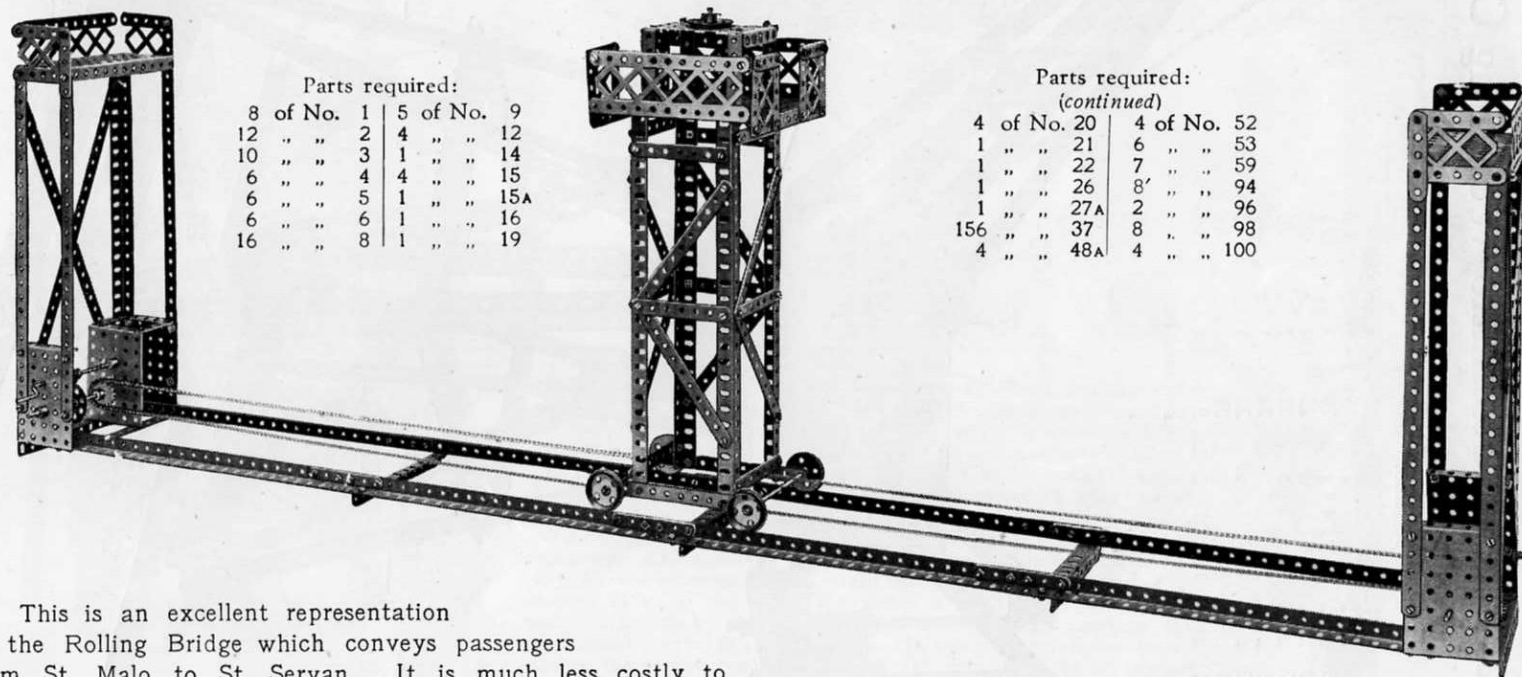

### Parts required:

8 of No. 1	5 of No. 9
12 " " 2	4 " " 12
10 " " 3	1 " " 14
6 " " 4	4 " " 15
6 " " 5	1 " " 15A
6 " " 6	1 " " 16
16 " " 8	1 " " 19

### Parts required:

(continued)

4 of No. 20	4 of No. 52
1 " " 21	6 " " 53
1 " " 22	7 " " 59
1 " " 26	8 " " 94
1 " " 27A	2 " " 96
156 " " 37	8 " " 98
4 " " 48A	4 " " 100

This is an excellent representation of the Rolling Bridge which conveys passengers from St. Malo to St. Servan. It is much less costly to construct than a transporter bridge of the Newport type, but of course it can only be used over marshy land with shallow water over which a solid track can be laid. The clever Meccano boy will know how to add little decorations to the transporter and the landing platforms in the way of flags, etc., and make a first-class toy of this fine model.

and when the pinion 12 engages the wheel 14 the traversing movement is effected through the chain and sprocket 16. The power is taken from the motor by way of the 1" and 2" sprockets 17, the latter on the



This Model can be made with MECCANO Outfit No. 6, or No. 5 and No. 5A.

# Model No. 627 Automatic Weighing Crane

Parts required:

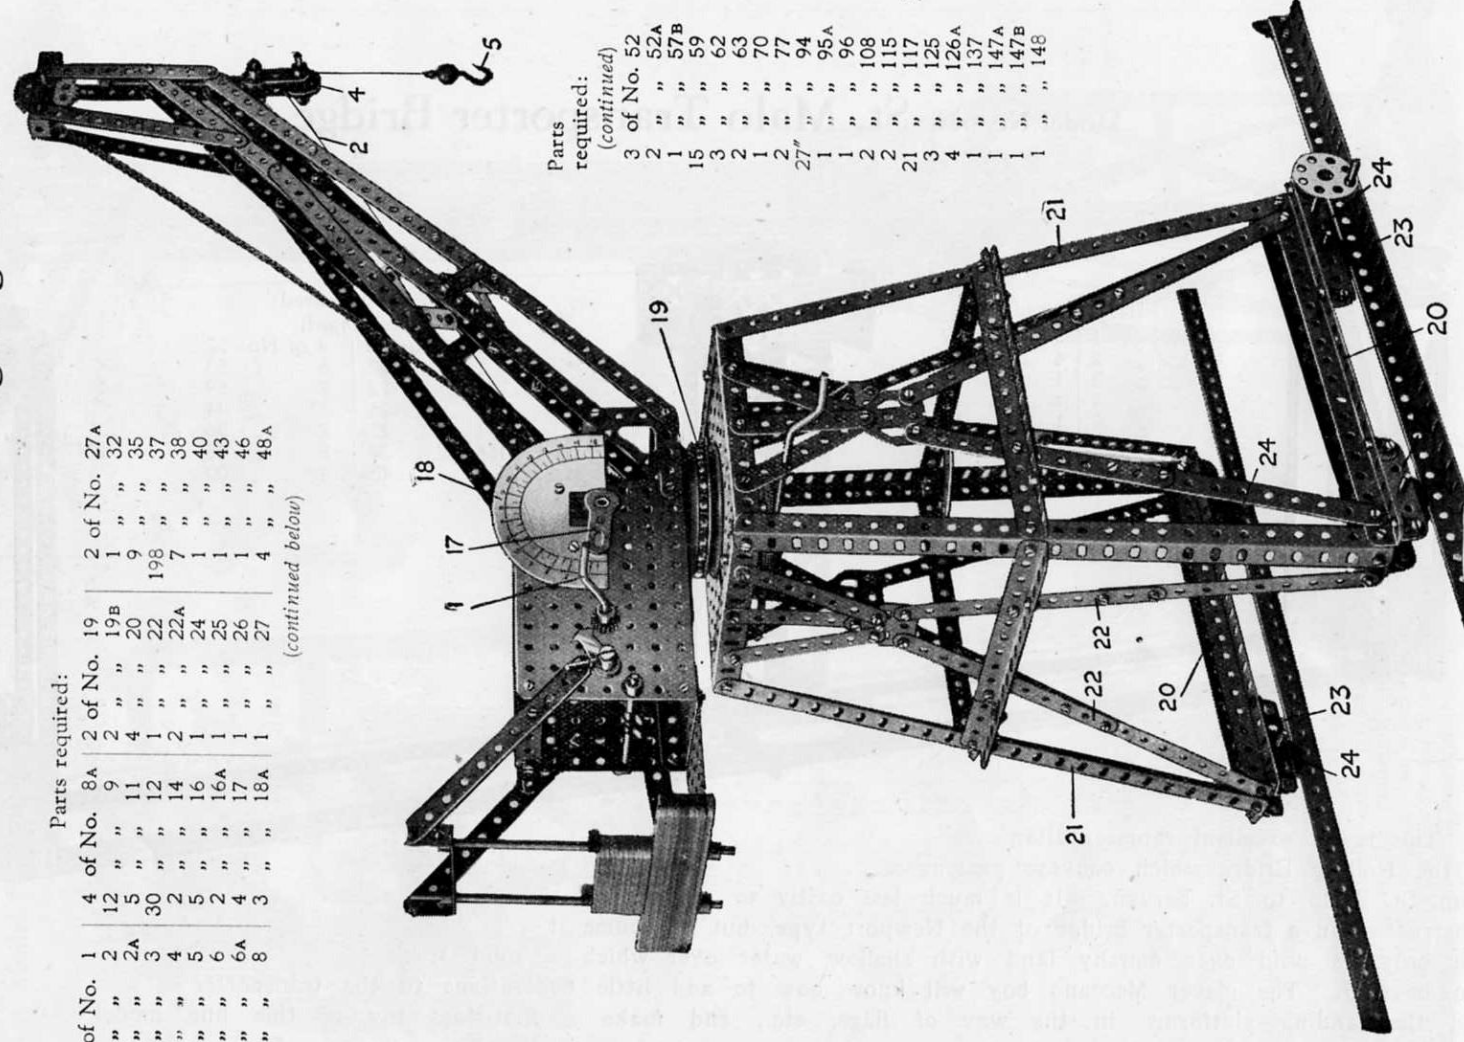
8 of No.	4 of No.	8A	2 of No.	19	2 of No.	27A
50	1	12	2	9	1	32
2	2A	5	2	4	9	35
10	3	30	2	11	20	37
12	4	2	1	12	198	38
36	5	2	2	14	7	40
2	6	5	1	16	1	43
2	6A	2	1	16A	1	46
8	8	4	1	17	1	48
		3	1	18A	4	48A

(continued below)

Parts required:

(continued)

3 of No.	52
2	" 52A
1	" 57B
15	" 59
3	" 62
2	" 63
1	" 70
2	" 77
27	" 94
1	" 95A
1	" 96
2	" 108
2	" 115
21	" 117
3	" 125
4	" 126A
1	" 137
1	" 147A
1	" 147B
1	" 148



dial 18 t  
The  
flanged v  
It w  
the No. 6  
when su

3 —  
16  
2 —

This Model can be made with MECCANO Outfit No. 6, or No. 5 and No. 5A.

135

## Model No. 627 Automatic Weighing Crane (continued)

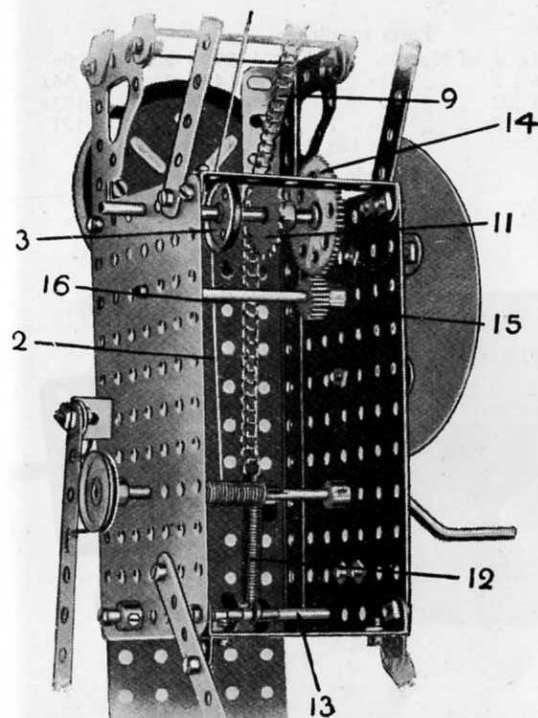


FIG. 627A

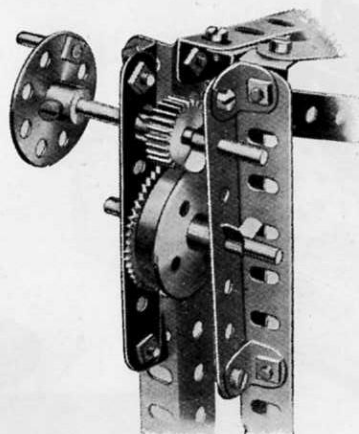


FIG. 627B

This is a model of a crane that, when raising a load, automatically indicates the weight carried. The load is raised or lowered by the operation of the crank handle 1 upon which is wound a lifting cord 2 passing round a 1" pulley 3 and over another 1" pulley 4 (Fig. C) to the loaded hook 5. The 1" pulley 4, which bears the weight of the load, is carried by two cranks 6 connected to a  $3\frac{1}{2}$ " rod 7, slidable in two double brackets 8.

To the top of the rod is connected a sprocket chain 9 which passes over a  $1\frac{1}{2}$ " sprocket wheel 10 and under a 1" sprocket wheel 11 (Fig. A), the other end of the chain being connected to a spring 12, secured to a  $3\frac{1}{2}$ " rod 13. Thus, when a load is being raised the weight is carried by the rod 7 which pulls down in its bearings and consequently extends the spring 12. In this movement, the chain 9 rotates the sprocket wheel 11 and a  $1\frac{1}{2}$ " gear wheel 14 on the rod of the sprocket 11 engages a  $\frac{1}{2}$ " pinion 15 on a rod 16. On the outer end of this rod 16 is a crank 17 that sweeps round the graduated

dial 18 to indicate the weight of the load that is being lifted.

The construction of the remainder of the model will be clearly seen from the illustration. The bearings 23 carrying the flanged wheels 24 are formed of  $2\frac{1}{2}$ " strips connected to the girders 20 by angle brackets.

It will be noted that the crane jib is carried upon ball bearings 19, the balls (Part No. 117) for which are not supplied in the No. 6 Outfit but may be obtained separately. The crane will work well without the ball bearing, but the operation is easier when such a bearing is fitted.


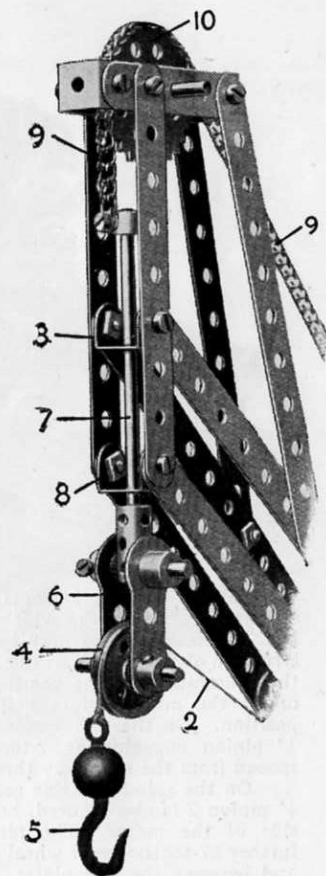


FIG. 627C


This Model can be made with MECCANO Outfit No. 6, or No. 5 and No. 5A.

## Model No. 628 Meccano High-Power Electric Loco Chassis

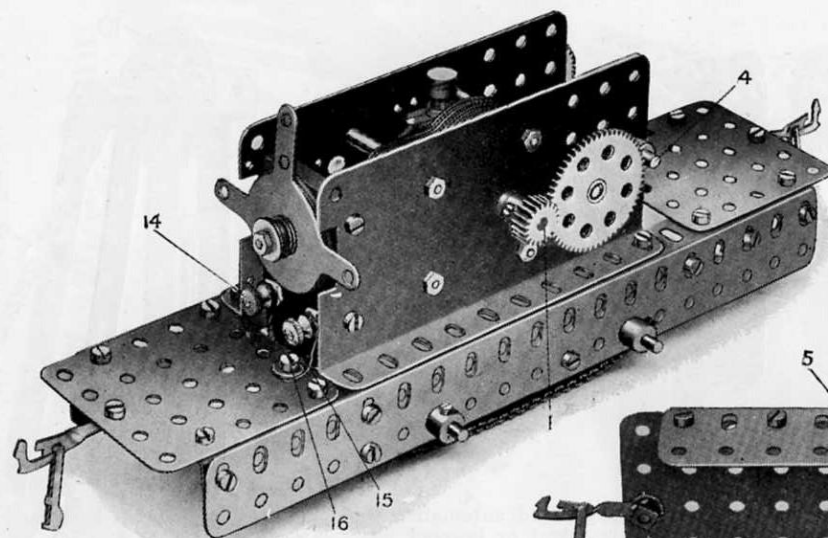

Parts required:

2 of No. 8A	2 of No. 26	4 of No. 59	2 of No. 96
2 " " 16	2 " " 27A	2 " " 64	2 " " 96A
1 " " 17	22 " " 37	2 " " 72	2 " " 103A
4 " " 20	2 " " 48A	1 " " 94	2 " " 121
1 of No. 149			
Electric Motor			
(not included in Outfit)			

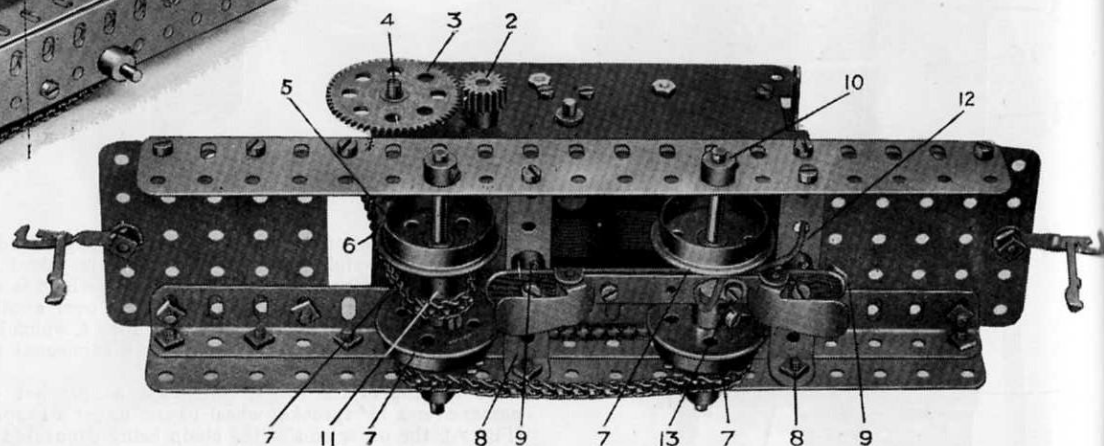


This is a simply constructed and very efficient electric loco, in which either a No. 1 or No. 2 Meccano motor may be used. The construction of the chassis will be clearly seen from the illustrations. The gearing should be built on to the motor before bolting the latter in position. On the motor spindle 1 is secured a  $\frac{1}{2}$ " pinion engaging a 57-toothed gear wheel spaced from the motor by three washers.

On the spindle of this gear wheel a second  $\frac{1}{2}$ " pinion 2 is also secured, but on the opposite side of the motor. The pinion 2 engages a further 57-toothed gear wheel 3 on the spindle 4, and between the side plates, on the latter spindle, is secured a  $\frac{3}{4}$ " sprocket wheel 5. Before inserting the spindle 4 a ring of sprocket chain 6, containing 39 links, should be threaded over the sprockets 5 and 11, after which the motor may be bolted on to the chassis. The flanged travelling wheels 7 may now be placed in position as shown. The sprocket wheel 11 is  $\frac{3}{4}$ " in diameter and the sprocket wheels connecting the axles are 1". The ring of sprocket chain for these should contain 52 links.

The new Meccano electric shoe is bolted to the  $2\frac{1}{2}$ " double angle strips 8, spaced with a threaded boss 9 at each end to give clearance to the axle rod 10. One end of a piece of insulated wire 12 is connected to the bolt head 13, and the other end to the terminal 14, while another piece of wire is connected with the terminal 15 and the bolt head 16.

The loco is designed to run on "0" gauge electric rails, and may be coupled to Hornby train rolling stock. Any suitable superstructure may be built up on the chassis, to represent an electric loco, to suit the builder's taste.

## Model No. 629 Knife Grinder

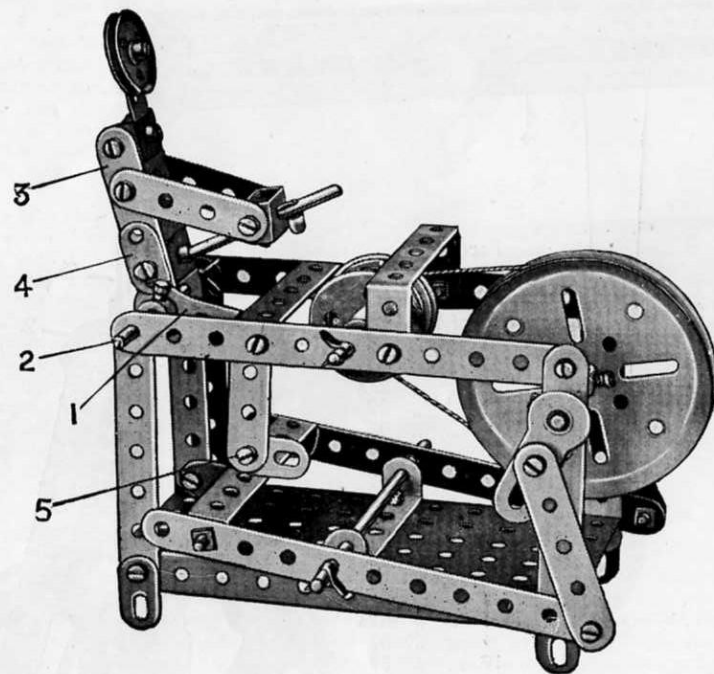Parts  
required:

4	of No.	2
4	" "	3
2	" "	4
4	" "	5
3	" "	6
4	" "	10
3	" "	11
2	" "	12
1	" "	15
3	" "	16
1	" "	17
1	" "	19A
2	" "	20
1	" "	22
1	" "	22A
2	" "	35
32	" "	37
6	" "	37A
1	" "	46
2	" "	48A
1	" "	48B
1	" "	52
3	" "	62

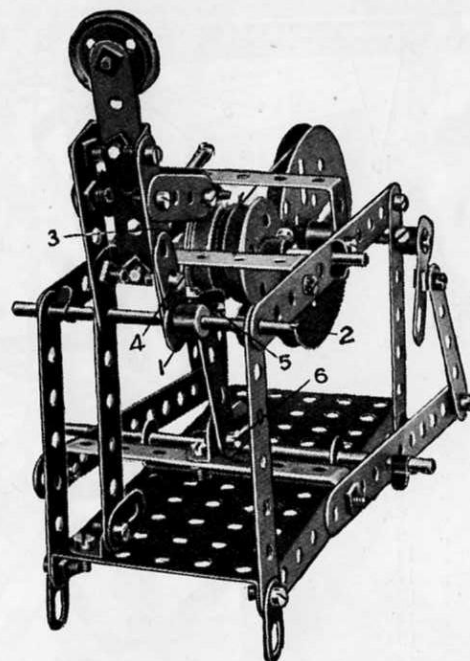


FIG. 629A

The crank 1 is secured to the rod 2, and the  $2\frac{1}{2}$ " side-strip 3 is clamped to the crank 1 by the flat bracket 4. The bolt at the end of the crank forming the knee and the bolt 5 are lock-nutted to allow free movement. When the treadle is operated the body works backwards and forwards.



The i  
the vertica  
crank han  
The l  
engages a  
the block  
at the out  
arm the l  
The t  
this a  $\frac{1}{2}$ " F  
which are  
of the jib.  
trolley to  
The v  
strips 5c c

This Model can be made with MECCANO Outfit No. 6, or No. 5 and No. 5A.

139

## Model No. 630 Radial Travelling Crane (continued)

Begin to build this model by constructing the main tower, the details of which are clearly brought out in the illustrations on the previous page. Notice that the inclined corner angle girders 1 are connected at the top (as shown in Fig. A) by a bush wheel 2 secured by angle brackets. This bush wheel forms a bearing for the vertical rod 3 by which the cantilever arm 4 is turned.

The cantilever arm 4 turns on a wheel-race formed of flanged wheels 5, which run on a circular girder 6 supported by four  $1\frac{1}{2} \times \frac{1}{2}$  angle brackets bolted to the corner girders 1. The cantilever is built up (as shown in Fig. B) from two  $9\frac{1}{2}$  angle girders 8 braced by two  $5\frac{1}{2}$  angle girders 9 overlapped nine holes. From these,  $12\frac{1}{2}$  angle girders 10 extend at one side, and to similar girders 10 at the other side are connected  $5\frac{1}{2}$  girders 11.

The inclined strips 12 are connected at the top, by means of angle brackets, to a face plate 13 secured to the vertical rod 3. At the foot of the rod 3 is a  $1\frac{1}{2}$  gear wheel 14 engaged by a worm wheel 15 operated by the crank handle 16 and in this way the cantilever arm is swung round, the wheels 5 riding on the circular girder 6.

The load carried from the hook 17 is raised or lowered by the crank handle 18, a  $\frac{1}{2}$  pinion 19 on which engages a  $1\frac{1}{2}$  gear wheel 20 on a rod 21 on which is wound a cord 22. This cord passes over a  $\frac{1}{2}$  pulley 23 to the block 24 and back over another  $\frac{1}{2}$  pulley on the trolley, and is secured to the  $3\frac{1}{2} \times \frac{1}{2}$  double angle strip 25 at the outer end of the cantilever arm. Consequently, when the trolley is caused to travel along the cantilever arm the load remains suspended at a constant height—an important point and an interesting detail.

The trolley is caused to move to and fro along the cantilever arm by the action of the crank handle 26. On this a  $\frac{1}{2}$  pinion 27 engages a  $1\frac{1}{2}$  gear wheel 28 on a rod on which is wound the cord 29, the opposite ends of which are connected to the opposite ends of the trolley. The cord 29 passes round a pulley 30 at the outer end of the jib. By turning the crank handle 26, therefore, the cord 29 winds on and off its rod, and moves the trolley to and fro, its wheels 31, as shown in Fig. C, running on the angle girders 10.

The wheels 5 are connected to  $1\frac{1}{2}$  rods 5a which are journaled in double bent strips 5b bolted to  $3\frac{1}{2}$  strips 5c carried from the angle girders 8 by corner brackets 5d.

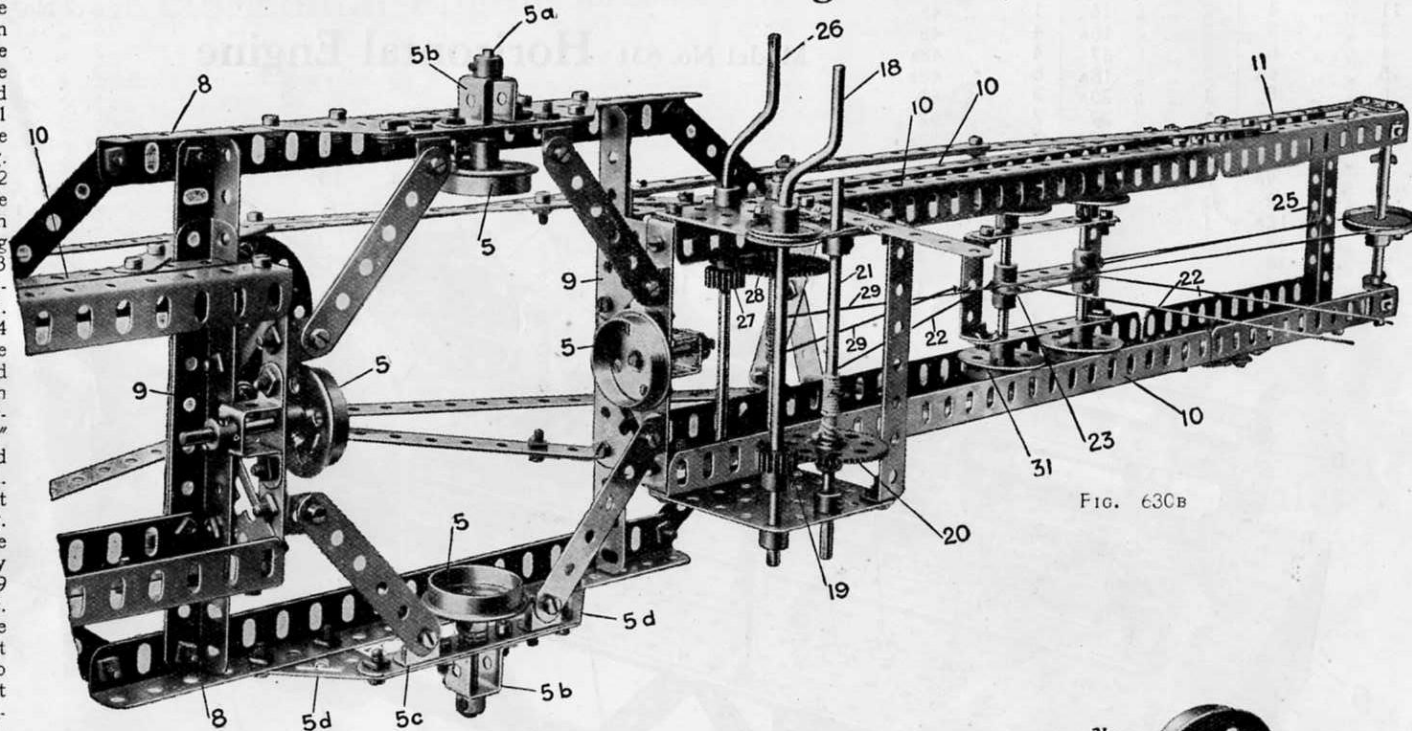


FIG. 630B

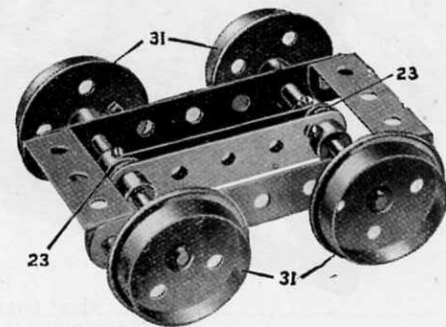


FIG. 630C

## Parts required:

2 of No. 3	1 of No. 15A	20 of No. 38
11 " " 4	2 " " 16	1 " " 45
8 " " 5	2 " " 16A	4 " " 48
1 " " 6	5 " " 17	4 " " 48A
5 " " 6A	2 " " 18A	6 " " 48B
8 " " 8	1 " " 20A	2 " " 50
1 " " 8A	1 " " 22	7 " " 52
3 " " 9	2 " " 22A	2 " " 52A
1 " " 9B	3 " " 24	4 " " 53
3 " " 9F	3 " " 26	16 " " 59
2 " " 12	2 " " 27A	
1 " " 12A	1 " " 29	
1 " " 13	160 " " 37	
2 " " 14		
1 " " 15		

## Model No. 631 Horizontal Engine

## Parts required:

(continued)

4 of No. 62	2 of No. 109
6 " " 63	2 " " 116
2 " " 63B	1 " " 118
3 " " 70	2 " " 126
2 " " 76	3 " " 126A
26 " " 94	4 " " 133
1 " " 95	4 " " 136
3 " " 96	

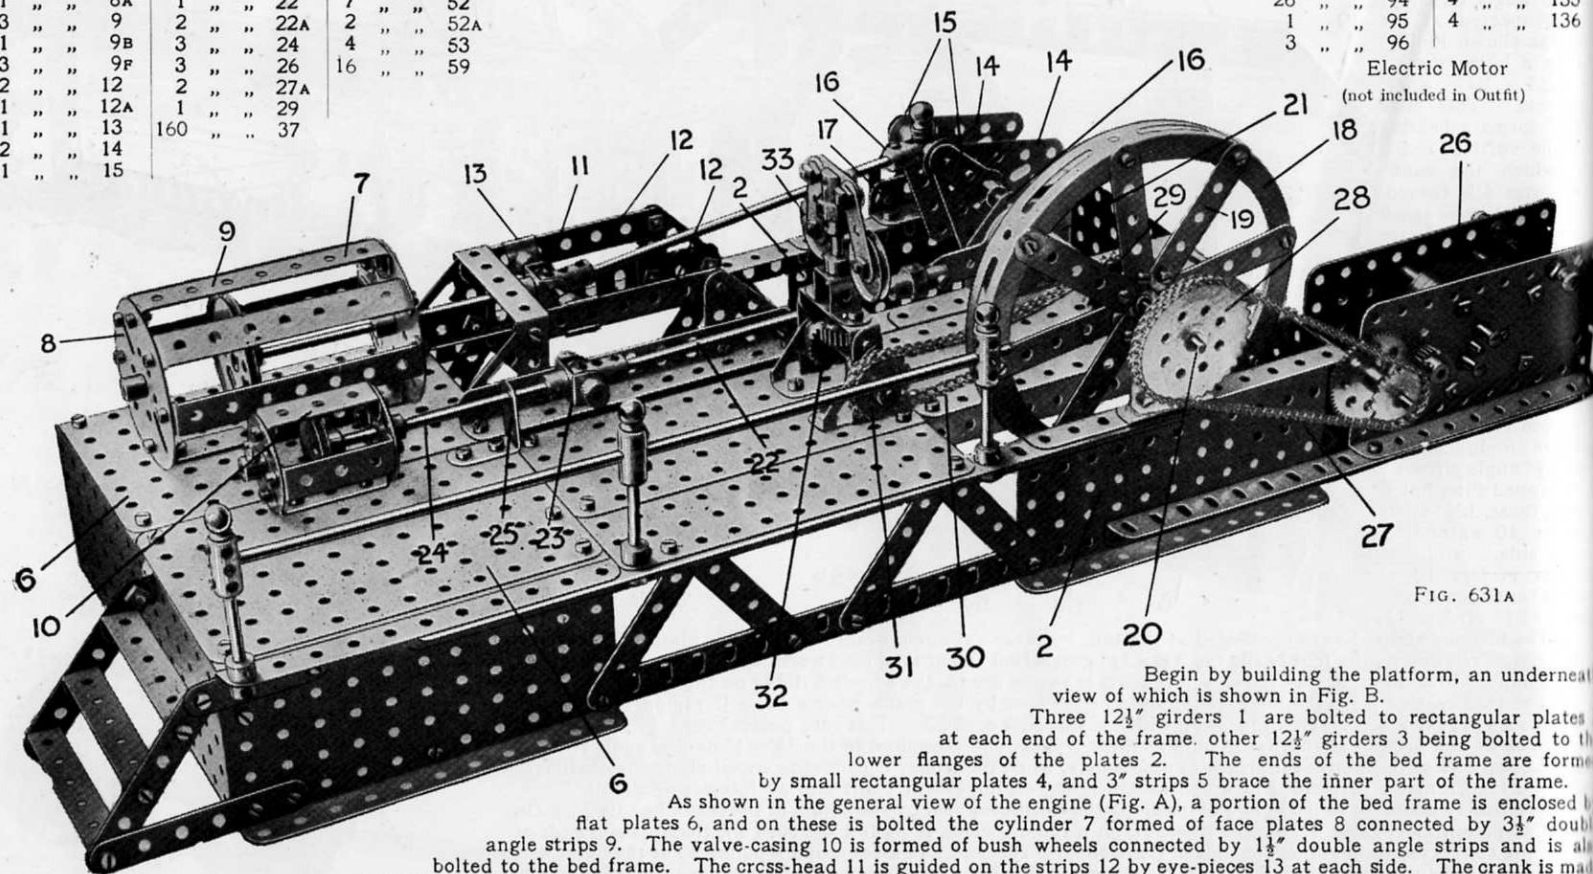
Electric Motor  
(not included in Outfit)

FIG. 631A

Begin by building the platform, an underneath view of which is shown in Fig. B.

Three  $12\frac{1}{2}$ " girders 1 are bolted to rectangular plates 2 at each end of the frame. Other  $12\frac{1}{2}$ " girders 3 being bolted to the lower flanges of the plates 2. The ends of the bed frame are formed by small rectangular plates 4, and 3" strips 5 brace the inner part of the frame.

As shown in the general view of the engine (Fig. A), a portion of the bed frame is enclosed by flat plates 6, and on these is bolted the cylinder 7 formed of face plates 8 connected by  $3\frac{1}{2}$ " double angle strips 9. The valve-casing 10 is formed of bush wheels connected by  $1\frac{1}{2}$ " double angle strips and is also bolted to the bed frame. The cross-head 11 is guided on the strips 12 by eye-pieces 13 at each side. The crank is made up of triangular plates 14 representing the balance weights, secured to cranks 15. The main or crank shaft 20 is journaled in flat trunnions 16 secured to  $1\frac{1}{2}$ " girders 17, which are in turn bolted to the flanges of the rectangular plates 2.

The fly-wheel  
strips 19 to  
eccentric 2  
the fork pie  
in the 1"  
motor 26 c  
sprocket 2  
A 1" sprock  
by sprock  
another 1"  
wheel 31  
governor.



cor  
crank shaft  
speed limi  
engine to s

These Models can be made with MECCANO Outfit No. 6, or No. 5 and No. 5A.

141

## Model No. 631 Horizontal Engine (continued)

The fly-wheel is made of a circular girder 18 connected by strips 19 to a bush wheel secured to the shaft 20. The eccentric 21 is pivotally connected by a rod 22 to the fork piece 23 on the valve rod 24, which slides in the 1" angle bracket 25. The electric motor 26 drives by sprocket chain 27 a 1" sprocket wheel 28 on the shaft 20. A 1" sprocket wheel 29 drives by sprocket chain 30 another 1" sprocket wheel 31 in the governor.

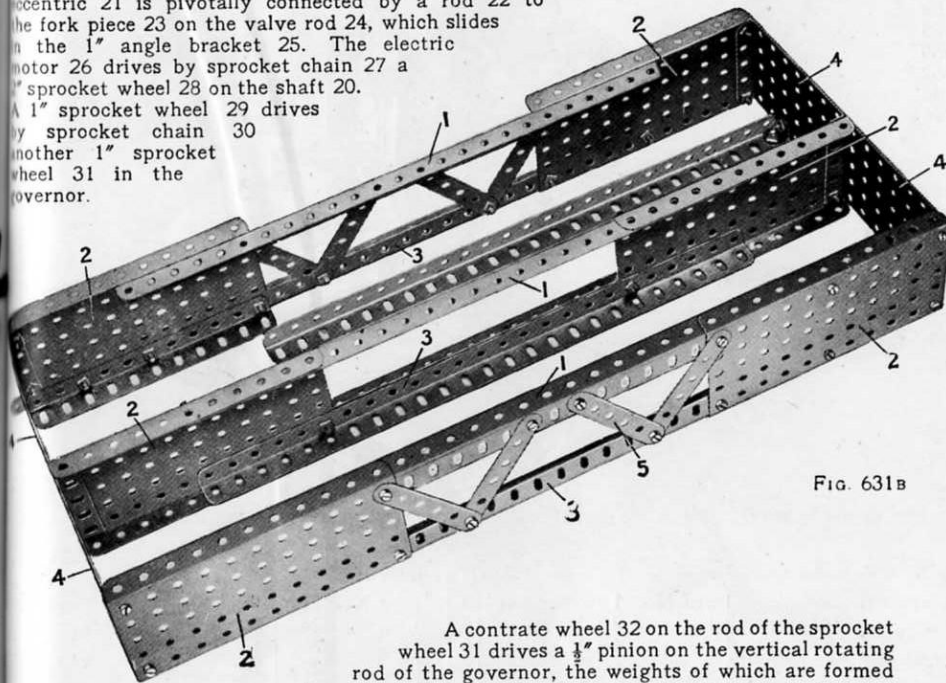


FIG. 631B


A contrate wheel 32 on the rod of the sprocket wheel 31 drives a  $\frac{1}{2}$ " pinion on the vertical rotating rod of the governor, the weights of which are formed by two pulley wheels 33 pivotally hung by  $1\frac{1}{2}$ " strips, lock-nutted in the outer holes of a horizontal  $1\frac{1}{2}$ " strip. This strip is bolted in the slot of an octagonal coupling, secured to the top of the vertical rod of the governor.

In the operation of an engine such as the model represents, the valve 10 controls the admission of steam to each end of the cylinder 7, thus causing the crank shaft 20 to be driven. Should the engine tend to "race," or to exceed a certain speed limit, the weights 33 of the governor fly out and shut off steam, causing the engine to slow down again. The governor thus keeps the engine speed constant.

## Model No. 632 Roller Skate

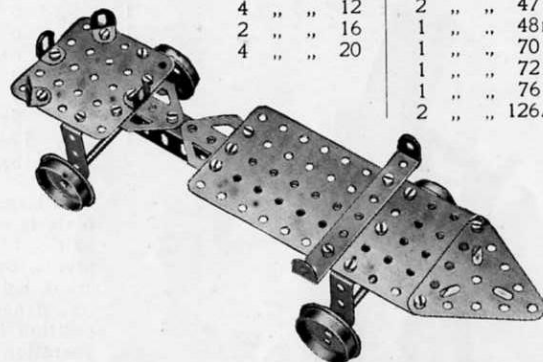Parts required:

2 of No. 8B	19 of No. 37
4 " " 12	2 " " 47
2 " " 16	1 " " 48B
4 " " 20	1 " " 70
	1 " " 72
	1 " " 76
	2 " " 126A




## Model No. 633 Scales

Parts

required:

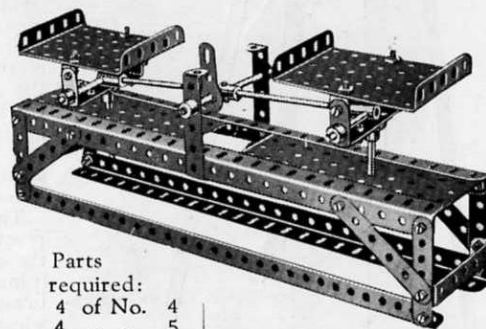4 of No. 4	2 of No. 52
4 " " 5	2 " " 53
4 " " 8	6 " " 59
5 " " 16	3 " " 62
2 " " 17	3 " " 63
30 " " 37	
2 " " 46	
6 " " 48A	






These Models can be made with MECCANO Outfit No. 6, or No. 5 and No. 5A.

Model No. 634

## Heliograph

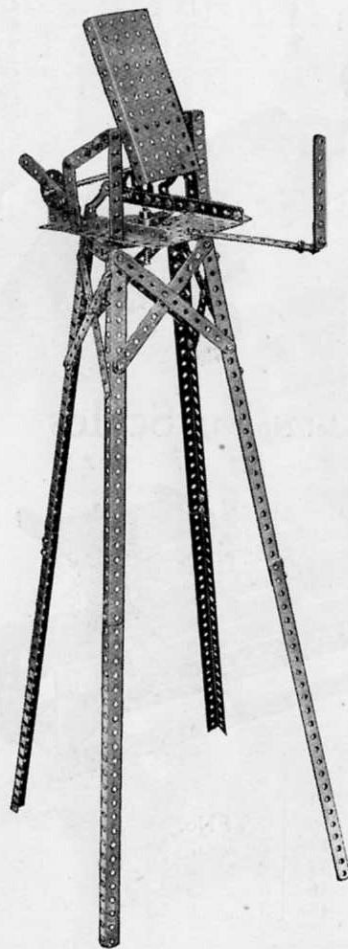

## Parts required:

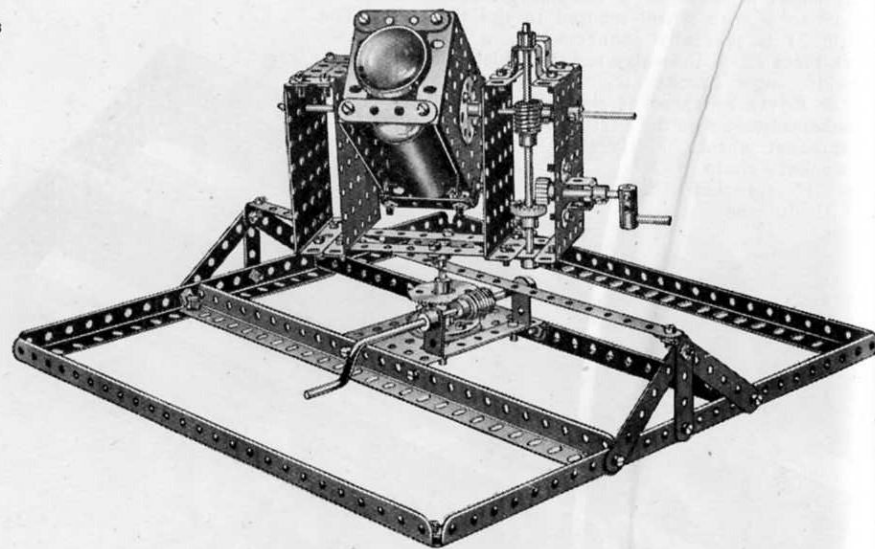
9 of No. 2	1 of No. 17
1 " " 3	1 " " 19B
1 " " 4	1 " " 24
1 " " 5	61 " " 37
1 " " 6	1 " " 48B
6 " " 6A	1 " " 52
8 " " 8	2 " " 53
2 " " 9	5 " " 59
2 " " 9B	2 " " 62
1 " " 12A	2 " " 108
2 " " 15A	2 " " 126A

A large rectangular plate is secured to an axle, about which it pivots, by means of a crank bolted to one of its flanges, and its position is altered on operation of the lever shown.

The rectangular plate should be fitted with a mirror, and a sighting aperture mounted in front, the operator bringing one of the perforations in the plate in line with the aperture while signalling, so that he can see the opposite instrument in the distance.

The platform is pivotally mounted on the standard so that it may be swung round to any position, a bush wheel being bolted to the top of the standard in which the pivot works. The platform is made of two small rectangular plates butted together and connected on each side by strips.

Model No. 635 Searchlight




## Parts required:

1 of No. 1	6 of No. 12	1 of No. 21	62 of No. 37
2 " " 2	1 " " 15	3 " " 24	3 " " 45
4 " " 4	1 " " 16	2 " " 26	1 " " 46
6 " " 6	2 " " 17	1 " " 27A	7 " " 53
6 " " 8	1 " " 18A	1 " " 29	8 " " 59
2 " " 10	1 " " 19	2 " " 32	1 " " 63

A splendid model with which great fun may be obtained by fitting an electric flash lamp. The light may be quickly manœuvred in any direction and enemy aircraft "spotted" at once.

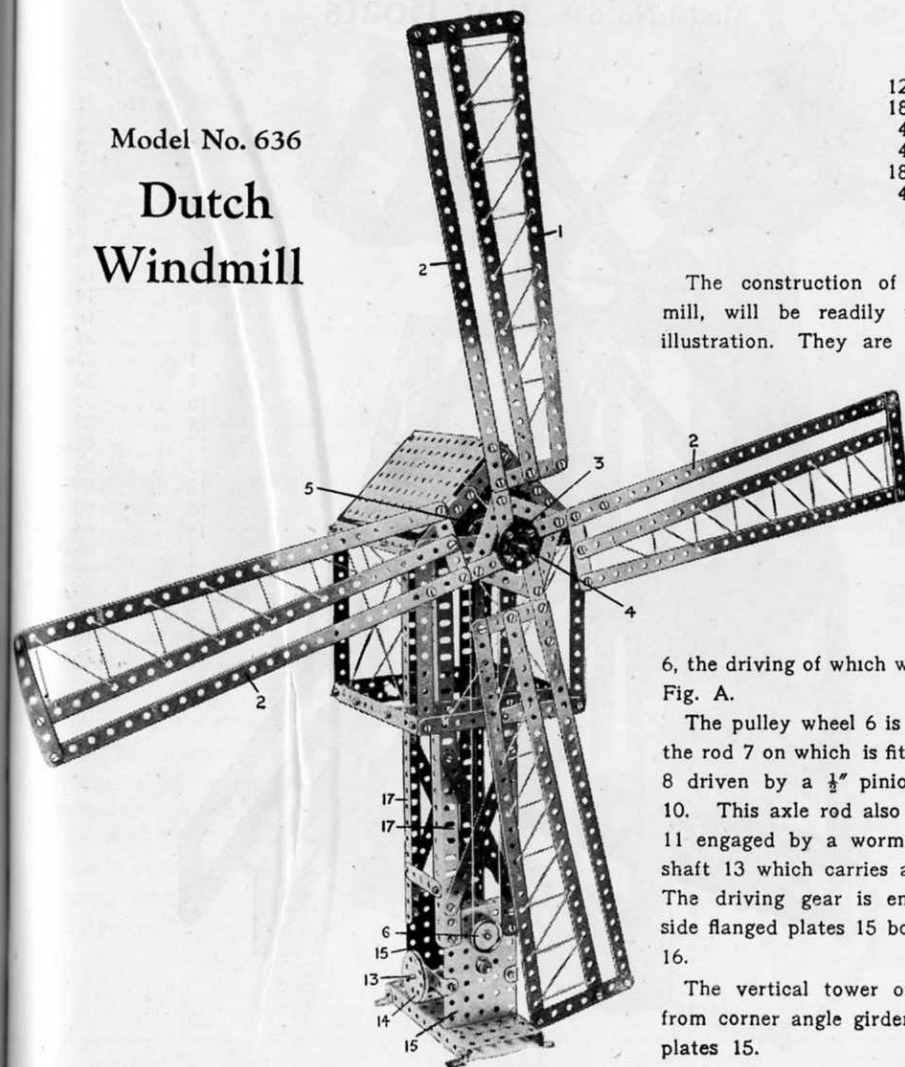Model No. 636

Dutch  
Windmill

## Parts required:

12 of No. 1	24 of No. 12	2 of No. 26	2 of No. 52
18 " " 2	1 " " 14	1 " " 27A	2 " " 52A
4 " " 3	3 " " 16	1 " " 32	2 " " 53
4 " " 4	1 " " 21	124 " " 37	5 " " 59
18 " " 5	2 " " 22	1 " " 40	
4 " " 8	1 " " 24	2 " " 48A	

The construction of the sails 1 of the mill, will be readily followed from the illustration. They are bolted to an inner strip frame 2 and to a bush wheel 3 fixed on a rod 4, on which is also mounted a pulley wheel 5. The driving cord passes round this pulley wheel to a lower pulley wheel 6, the driving of which will be followed from Fig. A.

The pulley wheel 6 is on the outer end of the rod 7 on which is fitted a  $1\frac{1}{2}$ " gear wheel 8 driven by a  $\frac{1}{2}$ " pinion 9 on the axle rod 10. This axle rod also carries a  $\frac{1}{2}$ " pinion 11 engaged by a worm 12 on the driving shaft 13 which carries a driving pulley 14. The driving gear is enclosed in two small side flanged plates 15 bolted to a base plate 16.

The vertical tower of the mill is made from corner angle girders 17 bolted to side plates 15.


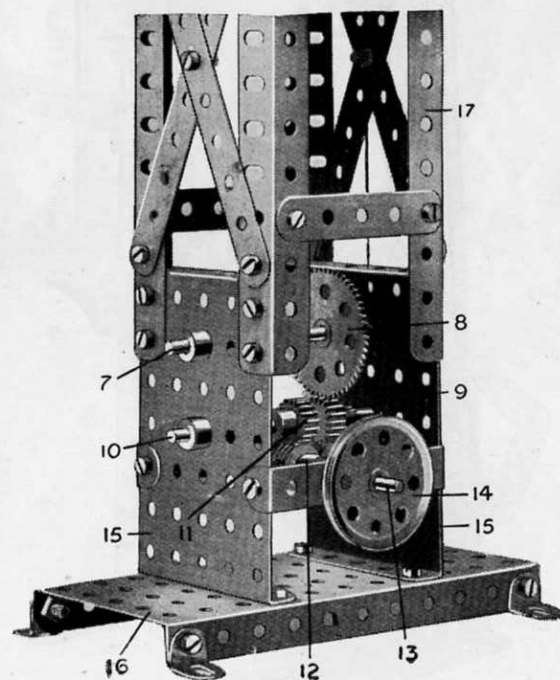


FIG. 636A

These Models can be made with MECCANO Outfit No. 6, or No. 5 and No. 5A.


## Model No. 637 Punching Machine

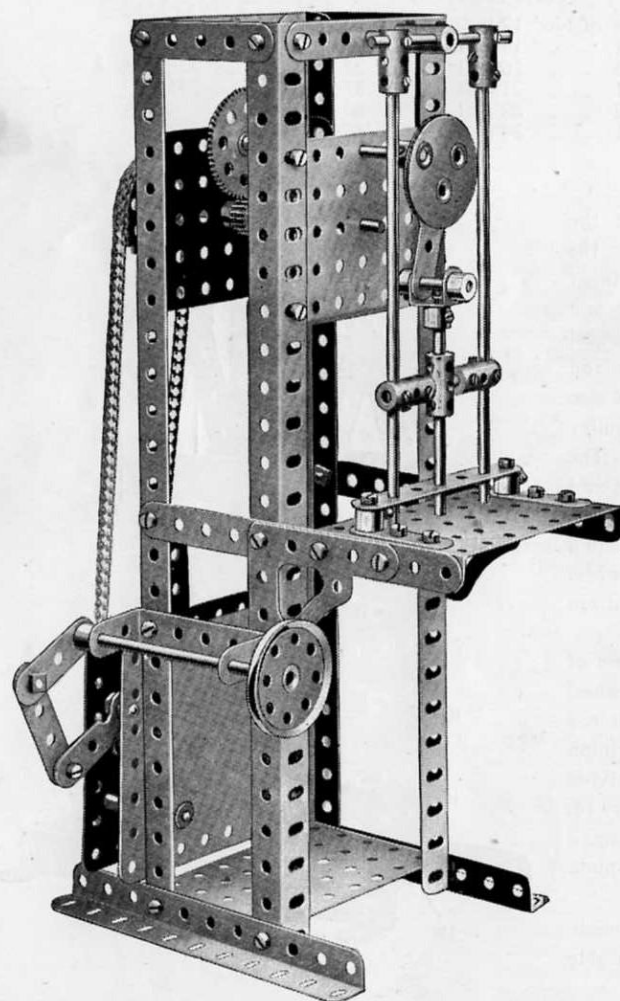

Parts required:	
of No.	
2	3
3	5
2	6
1	8
4	9
2	14
2	15A
2	16
1	16B
1	17
1	18A
2	18B
1	21
1	26
1	27A
42	37
1	38
1	46
4	53
6	59
3	62
6	63
1	94
1	95A
1	96
2	108
1	116
1	130

Clockwork Motor  
(not included in Outfit)


## Model No. 638 Fly Boats

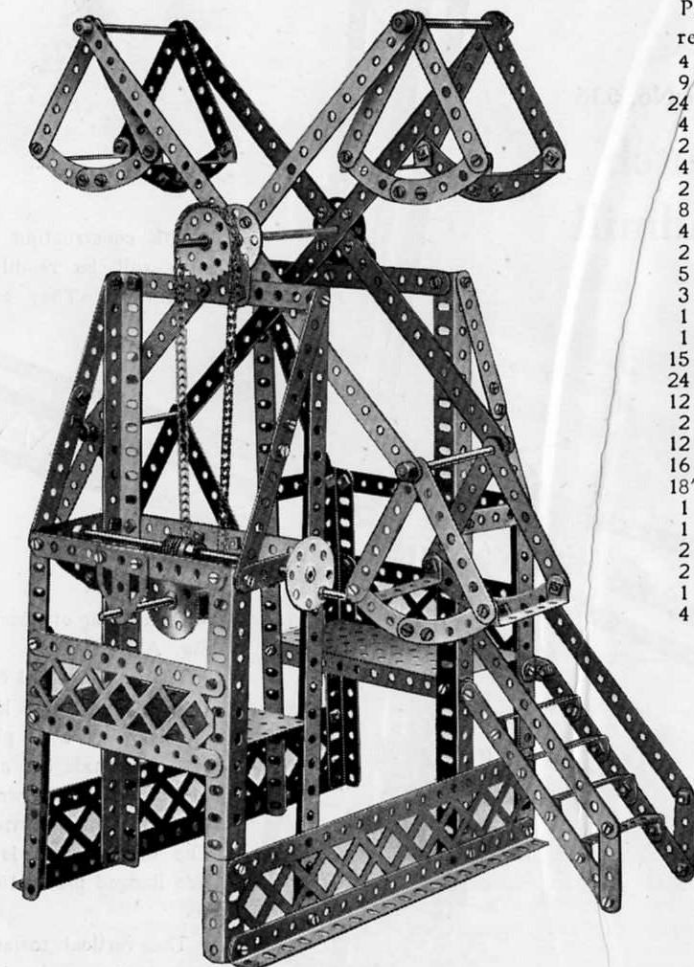

Parts required:	
of No.	
4	1
9	2
24	3
4	5
2	6
4	8
2	8A
8	9
4	12
2	14
5	16
3	24
1	27A
1	32
15	37
24	38
12	48A
2	52
12	59
16	90
18	94
1	95A
1	96
2	99A
2	100
1	115
4	126A

The  
broug  
arm  
three  
overl  
whic  
the 2  
Tw  
the o  
drivin  
aerop  
the o  
There  
prop  
bolte  
This  
passe  
on th

## Model No. 639 Revolving Aeroplane

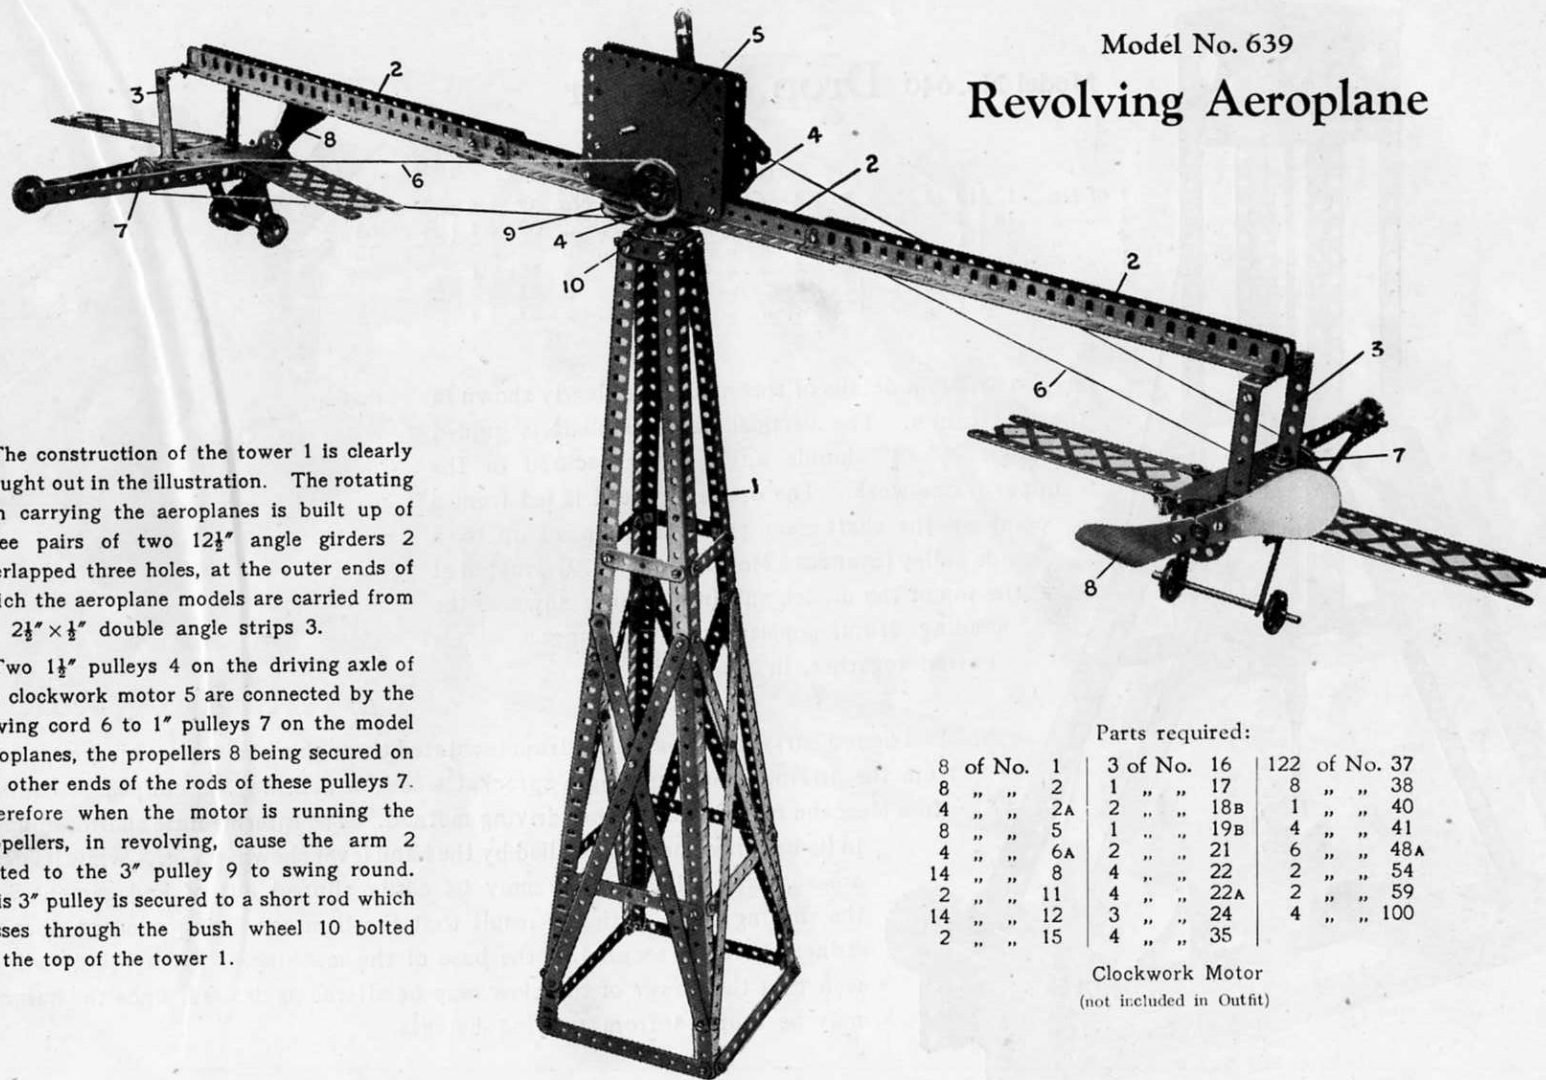

The construction of the tower 1 is clearly brought out in the illustration. The rotating arm carrying the aeroplanes is built up of three pairs of two  $12\frac{1}{2}$ " angle girders 2 overlapped three holes, at the outer ends of which the aeroplane models are carried from the  $2\frac{1}{2}$ "  $\times$   $\frac{1}{2}$ " double angle strips 3.

Two  $1\frac{1}{2}$ " pulleys 4 on the driving axle of the clockwork motor 5 are connected by the driving cord 6 to 1" pulleys 7 on the model aeroplanes, the propellers 8 being secured on the other ends of the rods of these pulleys 7. Therefore when the motor is running the propellers, in revolving, cause the arm 2 bolted to the 3" pulley 9 to swing round. This 3" pulley is secured to a short rod which passes through the bush wheel 10 bolted on the top of the tower 1.

### Parts required:

8 of No. 1	3 of No. 16	122 of No. 37
8 " " 2	1 " " 17	8 " " 38
4 " " 2A	2 " " 18B	1 " " 40
8 " " 5	1 " " 19B	4 " " 41
4 " " 6A	2 " " 21	6 " " 48A
14 " " 8	4 " " 22	2 " " 54
2 " " 11	4 " " 22A	2 " " 59
14 " " 12	3 " " 24	4 " " 100
2 " " 15	4 " " 35	

Clockwork Motor  
(not included in Outfit)



This Model can be made with MECCANO Outfit No. 6, or No. 5 and No. 5A.

## Model No. 640 Drop Hammer

Parts required:

1 of No. 1	10 of No. 8	4 of No. 16	75 of No. 37	5 of No. 59
2 " " 1B	2 " " 9D	6 " " 20	6 " " 38	1 " " 63
4 " " 2	1 " " 11	1 " " 22A	1 " " 40	2 " " 72
1 " " 2A	1 " " 12A	2 " " 24	4 " " 48A	1 " " 95A
4 " " 3	1 " " 13	2 " " 26	2 " " 52	2 " " 97
4 " " 5	1 " " 15A	2 " " 27A	1 " " 53	4 " " 108

The construction details of this model are clearly shown in the illustration. The vertical hammer shaft is guided through  $2\frac{1}{2} \times \frac{1}{2}$  double angle strips secured in the upper frame-work. The operating cord is led from a point on the shaft near the hammer-head up to a guide pulley (Standard Mechanism No. 39) situated at the top of the model, and from thence down to the winding drum, consisting of two flanged wheels butted together, in the gear box.

The rod carrying the winding drum is rotated through a chain of reduction gearing from the driving shaft carrying a sprocket wheel, which may, of course, be coupled to a Meccano motor or any other driving method. The intermediate shaft is slidable in its bearings and is controlled by the hand lever shewn in Fig. A, while its gears are so arranged that they may be easily slipped out of engagement with the driving shaft, with the result that the hammer, being released, forcibly strikes the table secured in the base of the machine. From this it will be seen that the power of the blow may be altered as desired, since the hammer may be dropped from varying heights.



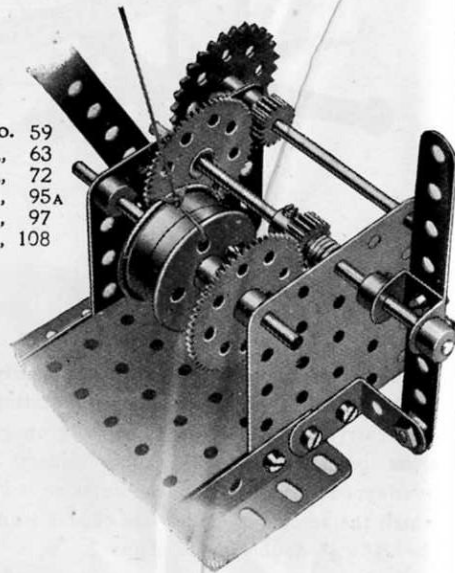


FIG. 640A

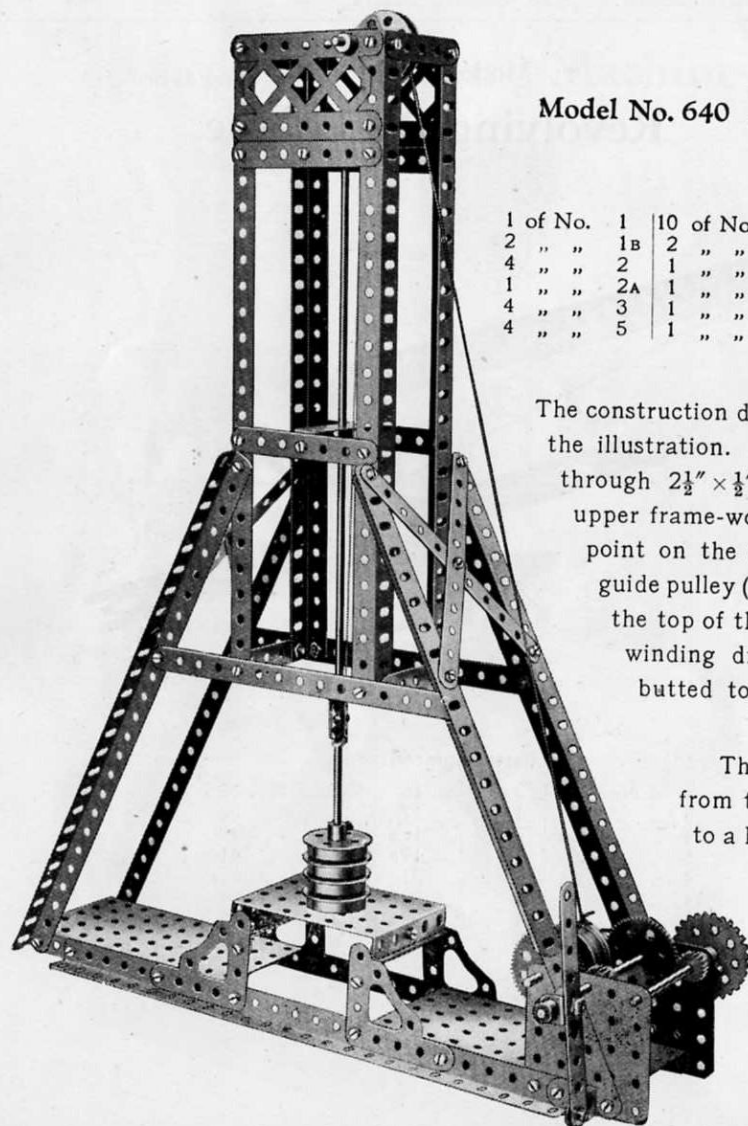

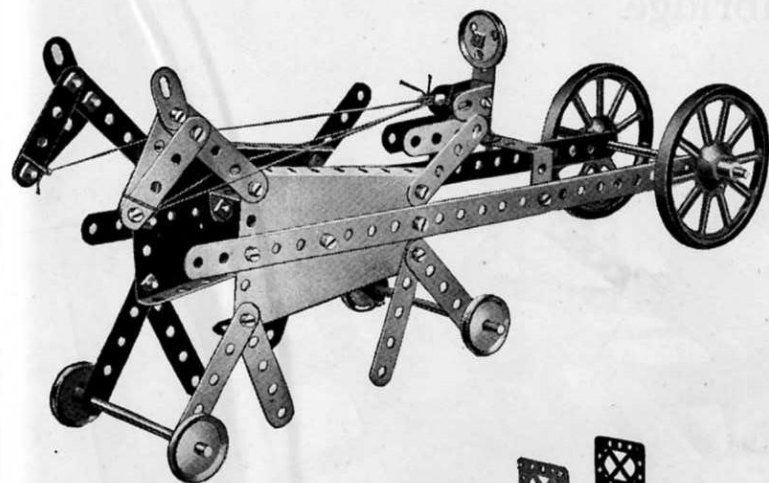

Model No. 641

## Sulky and Driver

Parts required:

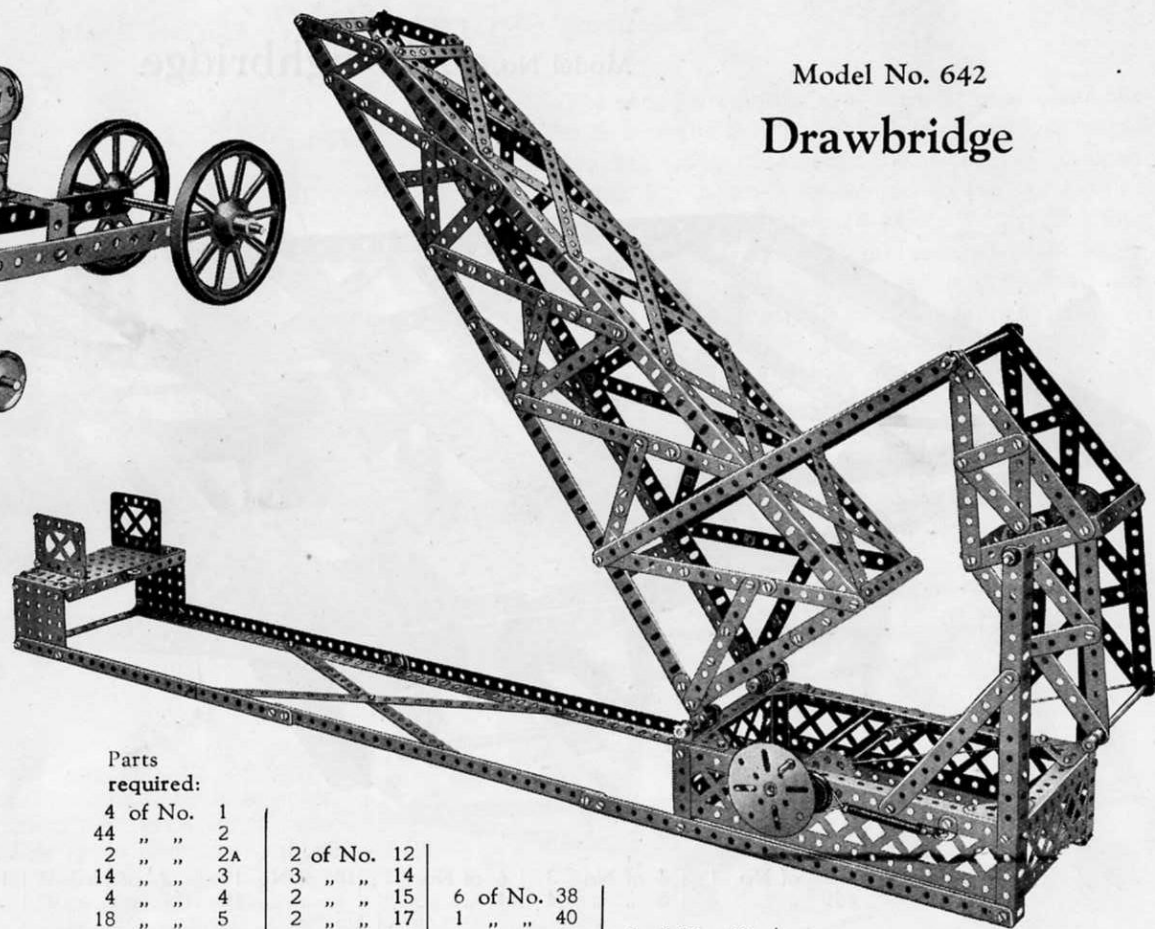
2 of No. 1	2 of No. 19A
10 " " 5	4 " " 22
9 " " 6	1 " " 22A
4 " " 10	32 " " 37
2 " " 11	1 " " 46
1 " " 12	2 " " 48A
3 " " 15A	2 " " 54

Parts required:

4 of No. 1					
44 " " 2					
2 " " 2A					
14 " " 3	2 of No. 12				
4 " " 4	3 " " 14				
18 " " 5	2 " " 15	6 of No. 38			
8 " " 6	2 " " 17	1 " " 40			
14 " " 8	1 " " 22	1 " " 43	2 of No. 62		
4 " " 8A	2 " " 24	2 " " 48	2 " " 72		
2 " " 9	1 " " 26	2 " " 48B	2 " " 98		
6 " " 9D	1 " " 27A	1 " " 52	2 " " 99A	1 of No. 109	
	177 " " 37	23 " " 59	2 " " 100	1 " " 115	
				4 " " 133	


Model No. 642

## Drawbridge



This Model can be made with MECCANO Outfit No. 6, or No. 5 and No. 5A.

## Model No. 643 Weighbridge

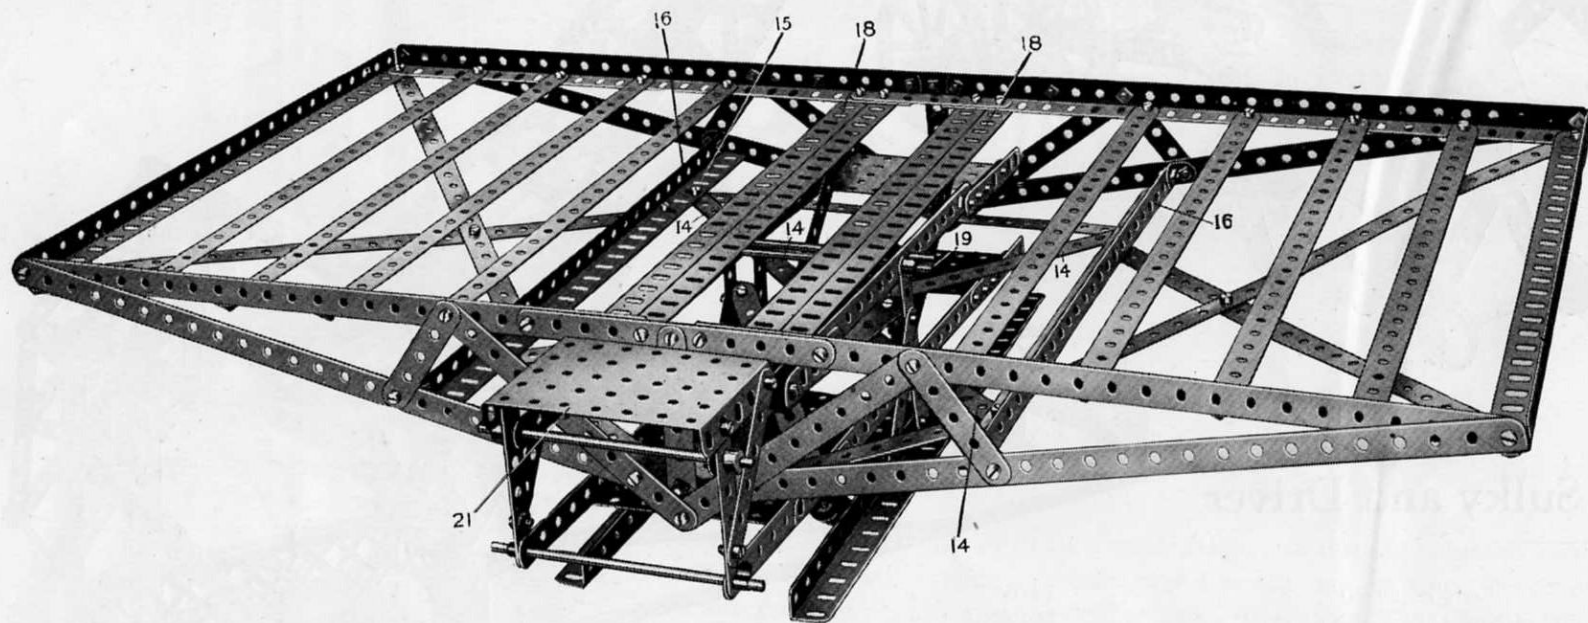

### Parts required:

22 of No. 1	8 of No. 3	6 of No. 5	10 of No. 12	2 of No. 35	16 of No. 37A
10 " " 2	6 " " 4	14 " " 8	6 " " 15A	107 " " 37	6 " " 53
		6 of No. 59			

## Model No. 643 Weighbridge (continued)

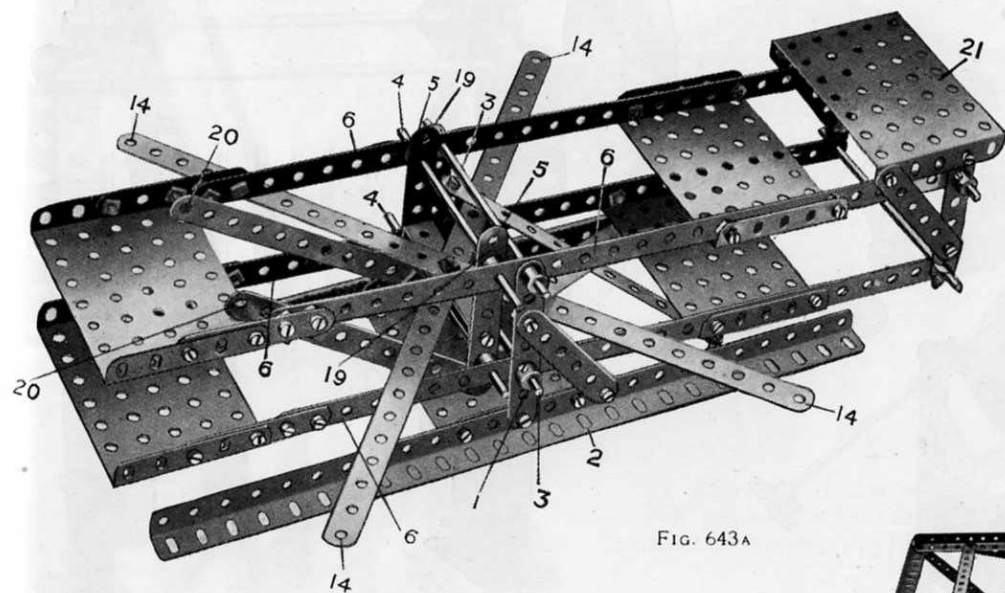


FIG. 643A

Begin the construction of this model by making the weigh beam, Fig. A. The side strips 1 are bolted to the base angle girders 2, and in the strips 1 are journaled the rods 3 which form the fixed pivots of the weigh beam. The upper and lower rods 4 are journaled in the strips 5 and form the moving pivots of the beam. All the rods 3 and 4 pass through perforations in the upper and lower strips 6 of the beam. Next construct the platform, Fig. B, leaving the strips at one side unconnected, as shown. The platform is then passed between the upper and lower parts of the weigh beam, and the unconnected strips then bolted, as follows:

The ends 7 are bolted to the lowest hole 8, and the ends 9 to the bolt 10, which also carries an angle bracket. The outer holes 14 of the  $12\frac{1}{2}$ " crossed strips, Fig. A, are then bolted to the same holes 15 in the angle girders 16 as the strips 17. The other ends of the strips 17 are secured to the angle brackets at 10. The double angle girders 18 are then bolted in position, and the upper holes 19, Fig. A, are bolted to the angle girders 18 in the centre holes and the holes 20, Fig. A, to the angle girders 18 at the fifth hole from the girder ends. The load to be weighed rests on the main platform, and the weights are placed on the small rectangular plate 21 at the end of the weigh beam.


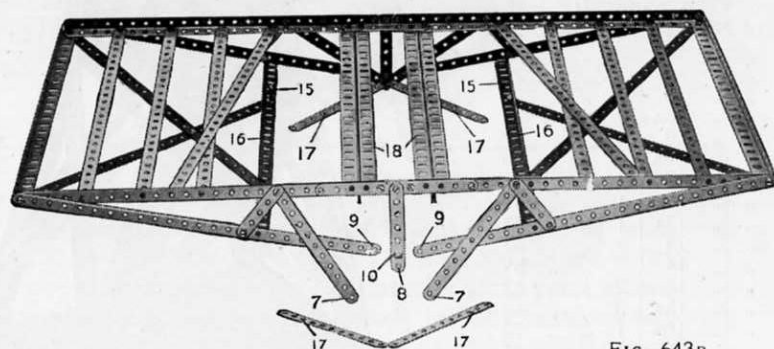


FIG. 643B

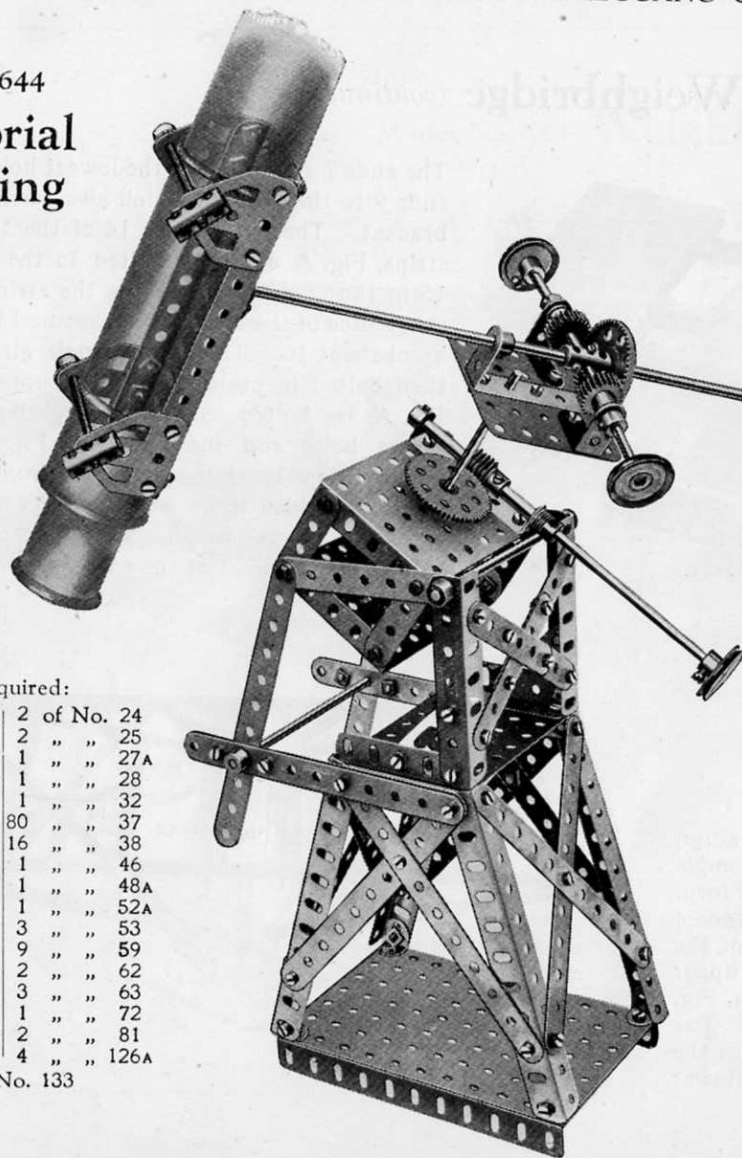

These Models can be made with MECCANO Outfit No. 6, or No. 5 and No. 5A.


## Model No. 644 Equatorial Mounting


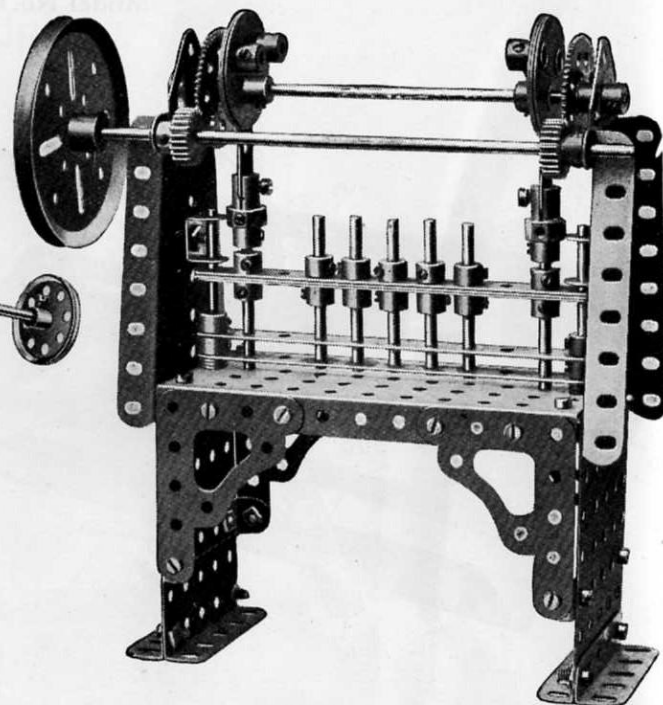
### Parts required:

4	of No.	2	2	of No.	24
2	"	3	2	"	25
4	"	4	1	"	27A
4	"	6	1	"	28
2	"	6A	1	"	32
8	"	9	80	"	37
2	"	9B	16	"	38
2	"	9D	1	"	46
4	"	12	1	"	48A
2	"	12A	1	"	52A
1	"	13	3	"	53
1	"	14	9	"	59
1	"	15	2	"	62
2	"	15A	3	"	63
2	"	16B	1	"	72
1	"	21	2	"	81
3	"	22	4	"	126A
2 of No. 133					

## Model No. 645 Punching Press



### Parts required:

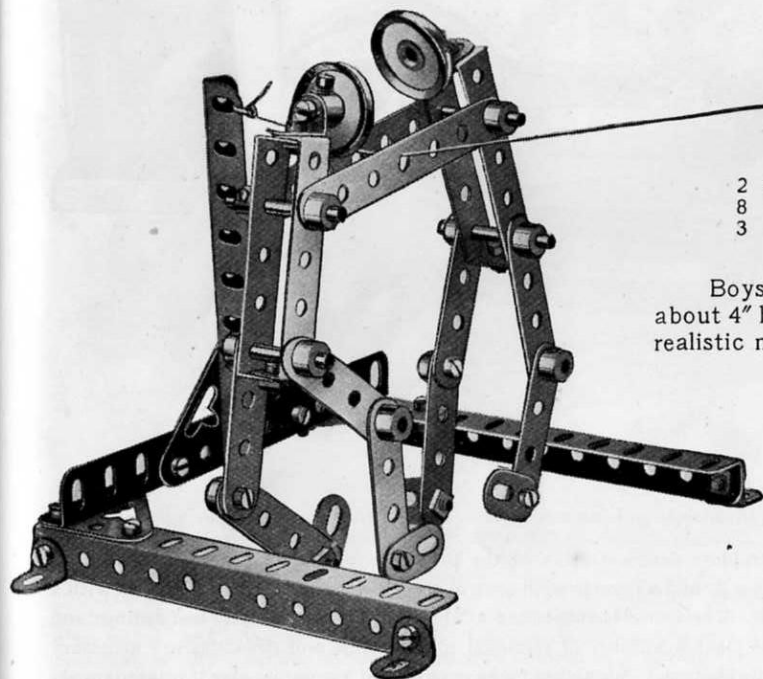
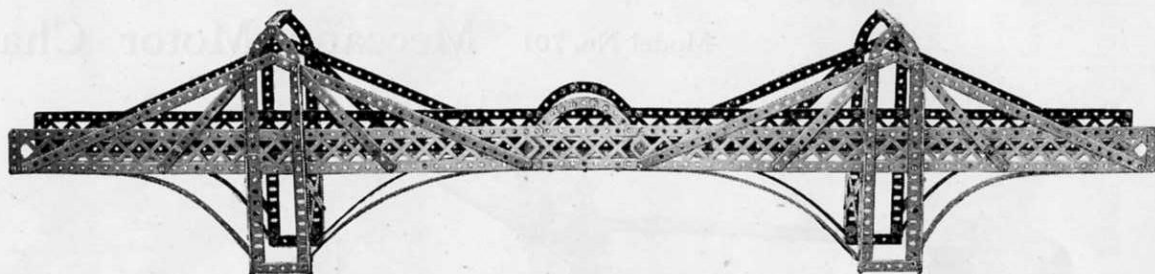
5	of No.	2	1	of No.	19B	2	of No.	53
2	"	6	2	"	25	2	"	54
2	"	9D	2	"	27A	21	"	59
2	"	11	34	"	37	2	"	63B
1	"	13A	6	"	38	4	"	108
1	"	14	2	"	48A	2	"	126A
9	"	17	1	"	52	2	"	130

## Model No. 646

## Cantilever Bridge

Parts required:

16 of No. 1	8 of No. 6A	2 of No. 48B
16 " " 2	8 " " 8	14 " " 90
3 " " 3	18 " " 9	8 " " 99
4 " " 5	8 " " 12	2 " " 100
4 " " 6	136 " " 37	



## Model No. 647 The Wrestlers

Parts required:

2 of No. 3	1 of No. 9A	4 of No. 18A	6 of No. 37B	12 of No. 59
8 " " 6	4 " " 10	2 " " 22	1 " " 38	4 " " 133
3 " " 9	6 " " 12	22 " " 37	4 " " 48A	

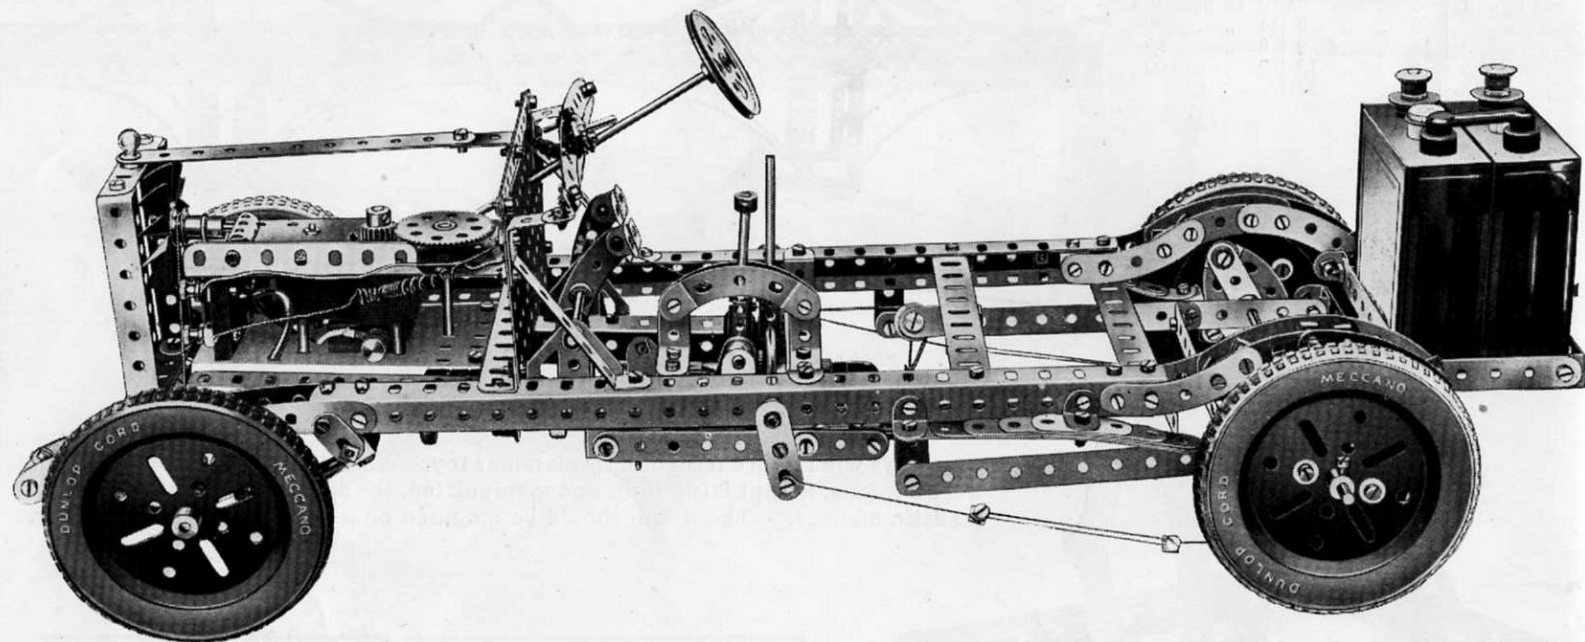
Boys will at once recognise this familiar toy. When the cord, which should be about 4" long, is kept fairly tight and manipulated, the figures will wrestle in a most realistic manner. The model should be mounted on a board, to keep it steady.

## HOW TO CONTINUE

This completes our examples of Models that may be made with MECCANO Outfit No. 6. The next Models are a little more advanced, requiring a number of extra parts to construct them. The necessary parts are all contained in a No. 6A Accessory Outfit, the price of which will be found in the List at the end of the Manual.

This Model can be made with MECCANO Outfit No. 7, or No. 6 and No. 6A.

## Model No. 701 Meccano Motor Chassis



The Meccano Motor Chassis is a model of exceptional interest, for it provides a complete demonstration of the principles of a real motor chassis. It is equipped with differential, Ackermann steering gear, and gear box giving three forward speeds and a reverse with central change lever. It is provided also with a clutch, internal expanding brakes on the rear wheels, and foot brake on the cardan shaft. The frame is suspended at the front on semi-elliptic leaf springs and at the rear on cantilever springs. In order to make the construction of the model quite clear a number of sectional photographs and drawings are necessary and it is impossible to find space for these and the instructions which go with them, in this Manual. We therefore have compiled a separate sheet, printed on art paper, containing full instructions and clear illustrations. A copy of this sheet is included in every No. 7 Outfit. It may also be purchased from any Meccano dealer or direct from Meccano Ltd., Liverpool. Price 3d. (post free, 4d.)

3 1/2" f  
bott

by t  
5 on  
arm  
to th  
8 pa  
on t  
whic

This Model can be made with MECCANO Outfit No. 7, or No. 6 and No. 6A.

153


Model No. 702

## Dredger

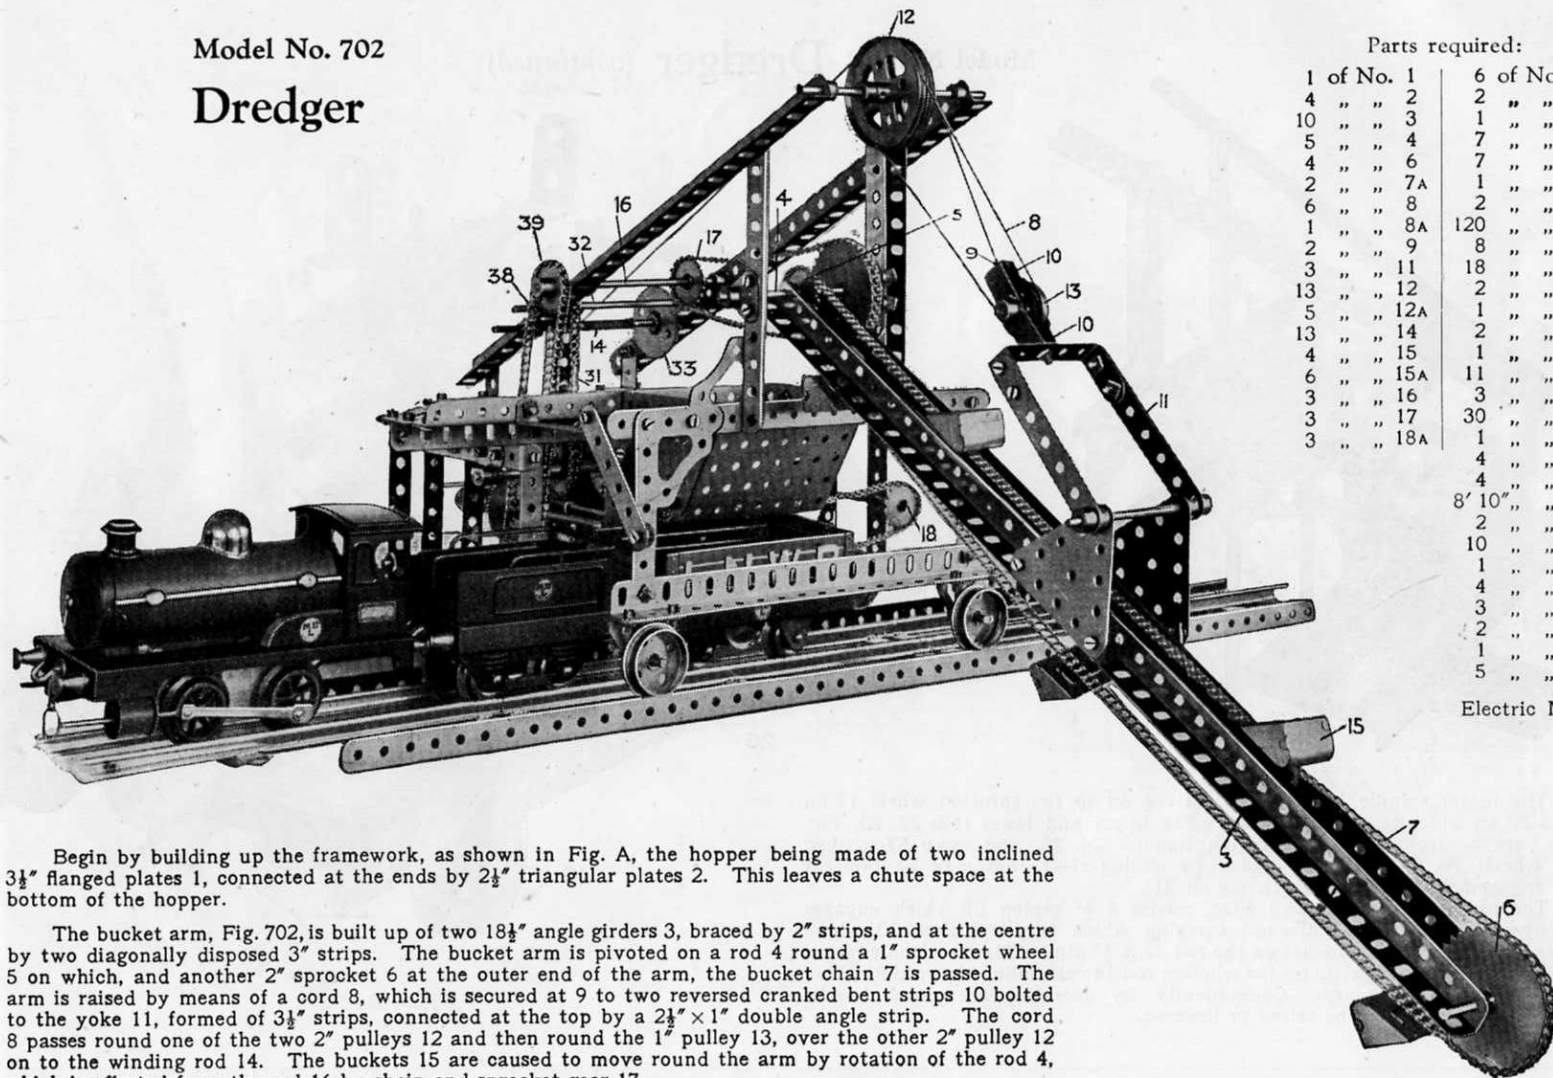Parts required:

1 of No. 1	6 of No. 20
4 " " 2	2 " " 20A
10 " " 3	1 " " 22A
5 " " 4	7 " " 26
4 " " 6	7 " " 27A
2 " " 7A	1 " " 28
6 " " 8	2 " " 30
1 " " 8A	120 " " 37
2 " " 9	8 " " 37A
3 " " 11	18 " " 38
13 " " 12	2 " " 44
5 " " 12A	1 " " 46
13 " " 14	2 " " 48
4 " " 15	1 " " 48A
6 " " 15A	11 " " 48B
3 " " 16	3 " " 53
3 " " 17	30 " " 59
3 " " 18A	1 " " 72
	4 " " 76
	4 " " 77
	8' 10" " 94
	2 " " 95
	10 " " 96
	1 " " 103B
	4 " " 108
	3 " " 115
	2 " " 126
	1 " " 128
	5 " " 131

Electric Motor



Begin by building up the framework, as shown in Fig. A, the hopper being made of two inclined  $3\frac{1}{2}$ " flanged plates 1, connected at the ends by  $2\frac{1}{2}$ " triangular plates 2. This leaves a chute space at the bottom of the hopper.

The bucket arm, Fig. 702, is built up of two  $18\frac{1}{2}$ " angle girders 3, braced by 2" strips, and at the centre by two diagonally disposed 3" strips. The bucket arm is pivoted on a rod 4 round a 1" sprocket wheel 5 on which, and another 2" sprocket 6 at the outer end of the arm, the bucket chain 7 is passed. The arm is raised by means of a cord 8, which is secured at 9 to two reversed cranked bent strips 10 bolted to the yoke 11, formed of  $3\frac{1}{2}$ " strips, connected at the top by a  $2\frac{1}{2}$ " x 1" double angle strip. The cord 8 passes round one of the two 2" pulleys 12 and then round the 1" pulley 13, over the other 2" pulley 12 on to the winding rod 14. The buckets 15 are caused to move round the arm by rotation of the rod 4, which is effected from the rod 16 by chain and sprocket gear 17.



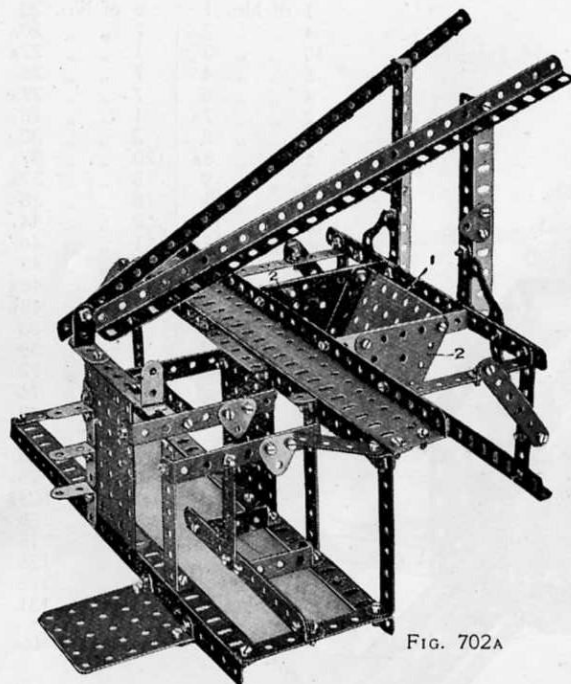
Model No. 702 **Dredger** (continued)

FIG. 702A

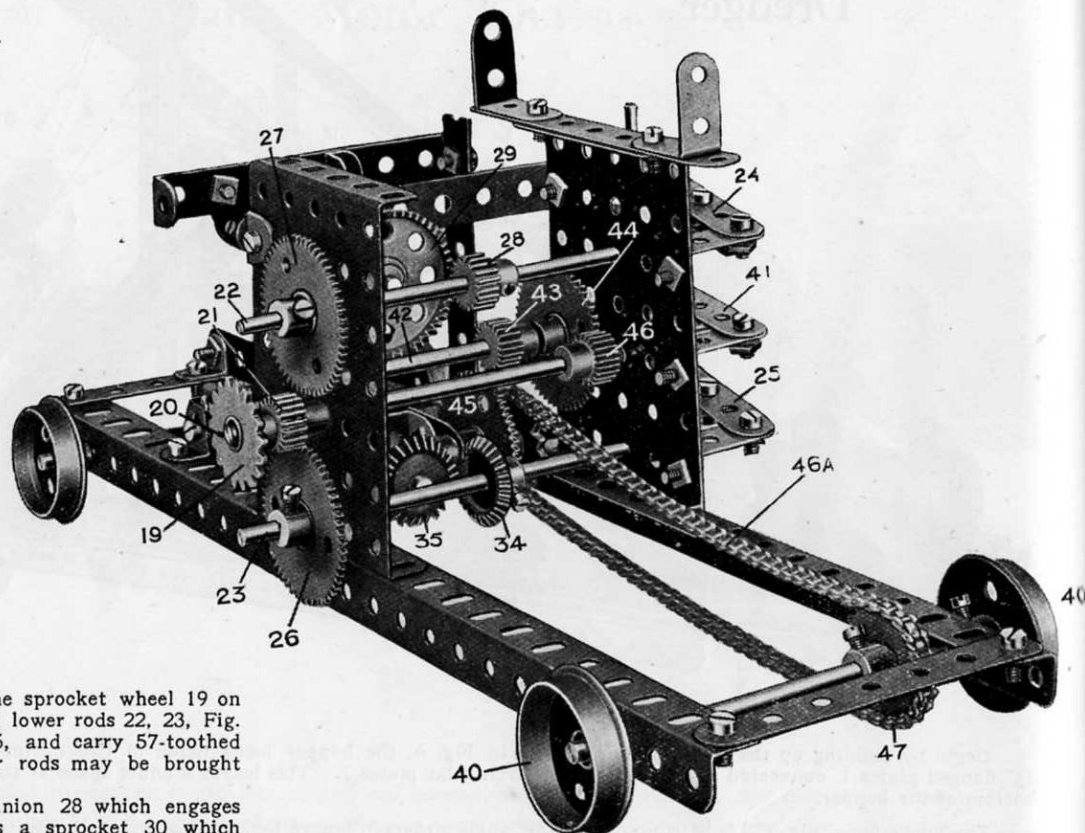


FIG. 702B

The motor spindle 18, Fig. 702, drives on to the sprocket wheel 19 on a rod 20 on which is a  $\frac{1}{2}$ " pinion 21. The upper and lower rods 22, 23, Fig. 702B, are controlled by their clutch handles 24, 25, and carry 57-toothed gear wheels 26, 27, either of which by sliding their rods may be brought into engagement with the driven pinion 21.

The rod 22, Fig. 702B and 702c, carries a  $\frac{1}{2}$ " pinion 28 which engages a contrate wheel 29, on the rod carrying which is a sprocket 30 which drives by a chain 31 a sprocket on the rod 32, a  $\frac{1}{2}$ " pinion 33A on which engages and drives the gear wheel 33 on the winding rod 14 controlling the cord 8, which raises and lowers the arm. Consequently by operating the clutch handle 24 the bucket arm may be raised or lowered.

This Model can be made with MECCANO Outfit No. 7, or No. 6 and No. 6A.

155

## Model No. 702 Dredger (continued)

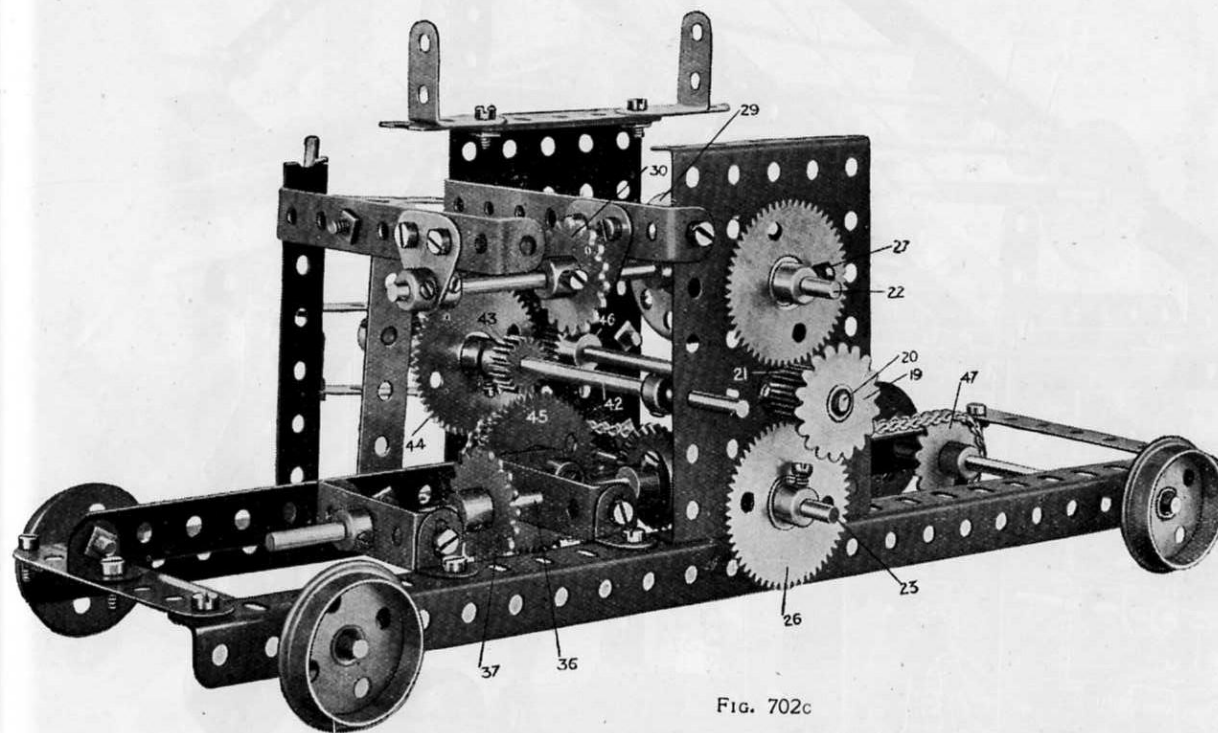


FIG. 702c

The rod 23, Fig. 702B, similarly may be moved by its clutch arm 25 and the gear wheel 26 brought into engagement with the pinion 21. On the rod 23 is a bevel 34 engaging another bevel wheel 35, on a rod 36, Fig. 702c, on which is a sprocket wheel 37. This sprocket drives by a chain 38, Fig. 702D, a sprocket wheel 39, on the rod 16, which as previously described, operates the movement of the buckets, which are thus under the control of the clutch handle 25.

The travelling of the apparatus on the wheels 40 is controlled by a middle clutch handle 41, which moves the rod 42, Fig. 702c, this rod carrying a  $\frac{1}{2}$ " pinion 43 and a 57-toothed gear wheel 44, which are operated by the sliding movement of the rod 42 to engage or disengage respectively with a gear wheel 45 and a  $\frac{1}{2}$ " pinion 46, the latter being on the same rod as the pinion 21, whilst the gear wheel 45 is on a short rod, carrying a sprocket 45A, Fig. 702D, which drives through a chain 46A another sprocket 47, Fig. 702B, on the rod of the travelling wheels 40. Consequently, the drive from the motor is taken from the sprocket 19, Fig. 702B, through the pinion 46 and rod 42 to the chain 46A, and so to the sprocket 47 driving the travelling wheels 40. In order to reverse any of the movements, the switch handle of the motor is connected to the bell crank 48 pivoted on the rod 49, Fig. 702D, and provided with a handle strip 50.

This Model can be made with MECCANO Outfit No. 7, or No. 6 and No. 6A.

Model No. 702

# Dredger

(continued)

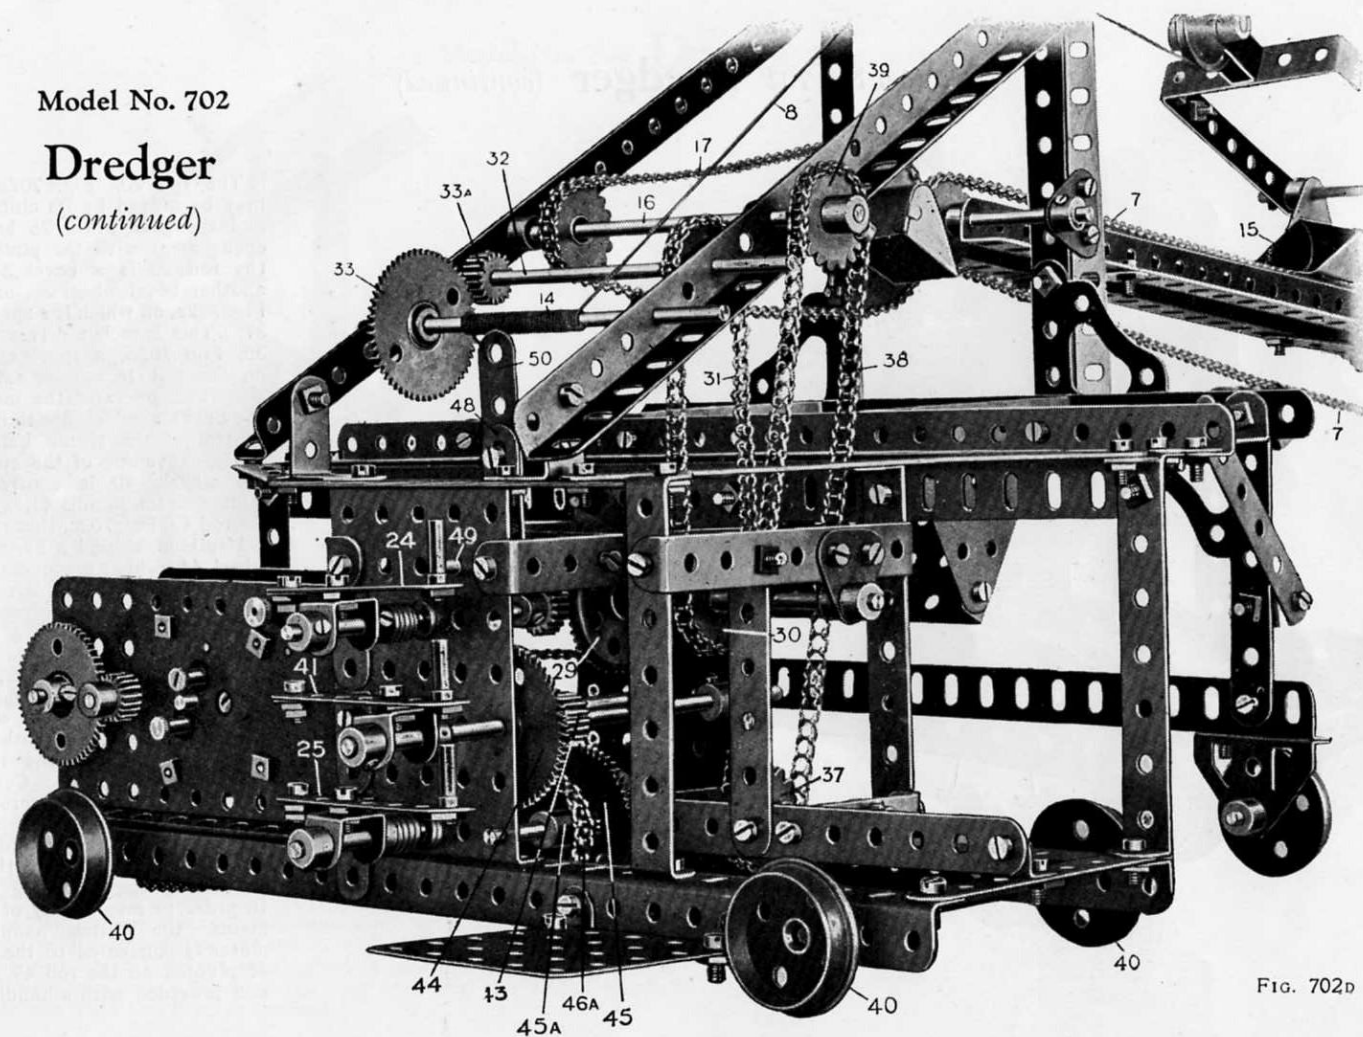


FIG. 702b

This Model can be made with MECCANO Outfit No. 7, or No. 6 and No. 6A.

157

## Model No. 703 Coal-Cutting Machine

### Parts required:

4 of No. 2	4 of No. 26
6 " " 3	3 " " 27A
8 " " 4	1 " " 28
20 " " 6	2 " " 30
2 " " 7	6 " " 35
4 " " 8	75 " " 37
2 " " 9	1 " " 44
9 " " 12	1 " " 50
1 " " 13A	1 " " 52A
5 " " 15	6 " " 59
1 " " 16	1 " " 63
1 " " 17	4 " " 77
1 " " 18A	12" " 94
6 " " 20	1 " " 95
1 " " 22A	1 " " 96
1 " " 24	

### Clockwork Motor

This apparatus, by hauling on a rope, pulls itself along in a direction parallel to the coal-face, while its revolving cutters slice into the coal, which may afterwards be removed in large blocks.

The clockwork motor 1 drives, by the chain and sprocket gear 2, the rod 3, which is connected by bevel wheels 4 to the horizontal rod 5, a  $\frac{1}{2}$ " pinion on the end of which drives a contrate wheel 7 on the rod 8 of the cutting wheel 9. The rod 3 also drives through a gear train 10 a rod 11 on which is a drum composed of two flanged wheels 12. A cord 13 winding from the drum round a pulley 14, is connected to the trolley 15. The cord 13 is fixed to the trolley 15 which runs on flanged wheels 16 on the rails 17. Consequently, as the cutting wheel 9 is rotated from the motor, the cord 13 is also slowly wound on the drum 12, and the whole carriage moving along, the cutting wheel also travels along the coal face. The post carrying the pulley 14, is secured in a convenient position at the end of the track.

The mechanism may be thrown out of gear by pressing the rod 11 which slides in its bearings. The strip 18 forms a spring to hold it in gear.


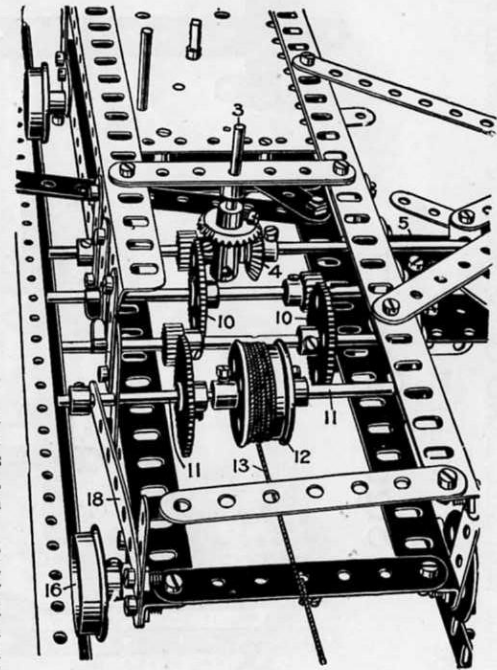



FIG. 703A

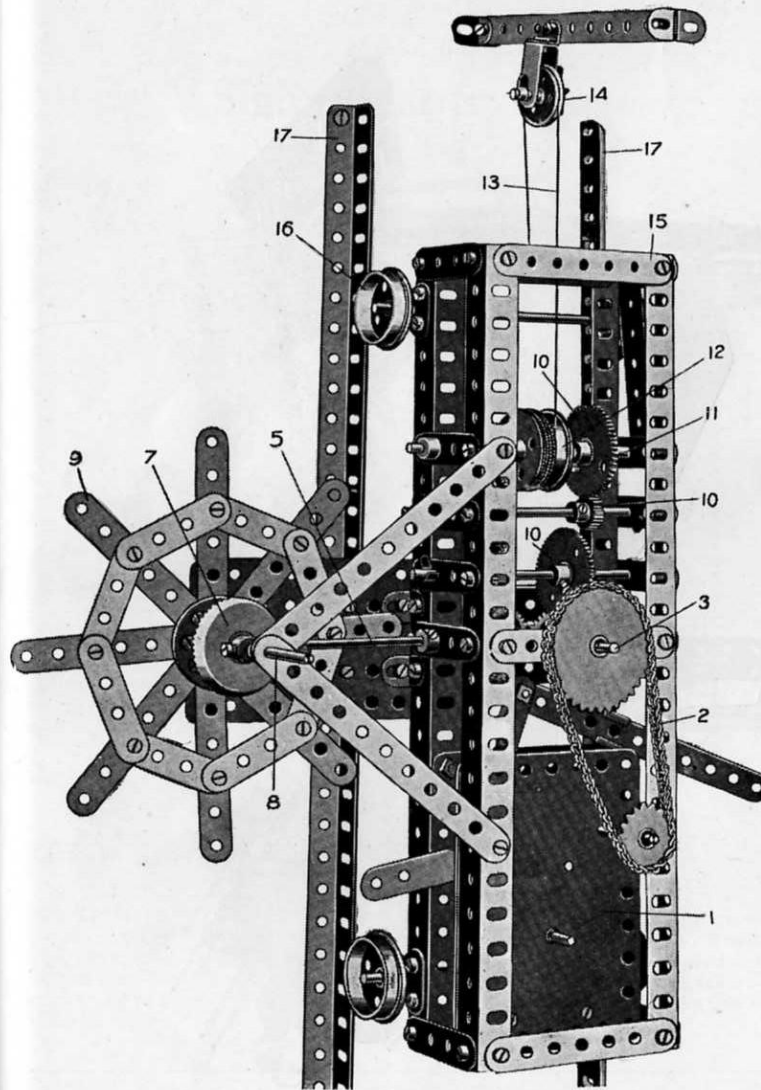

This Model can be made with MECCANO Outfit No. 7, or No. 6 and No. 6A.

Model No. 704

## Signal Gantry

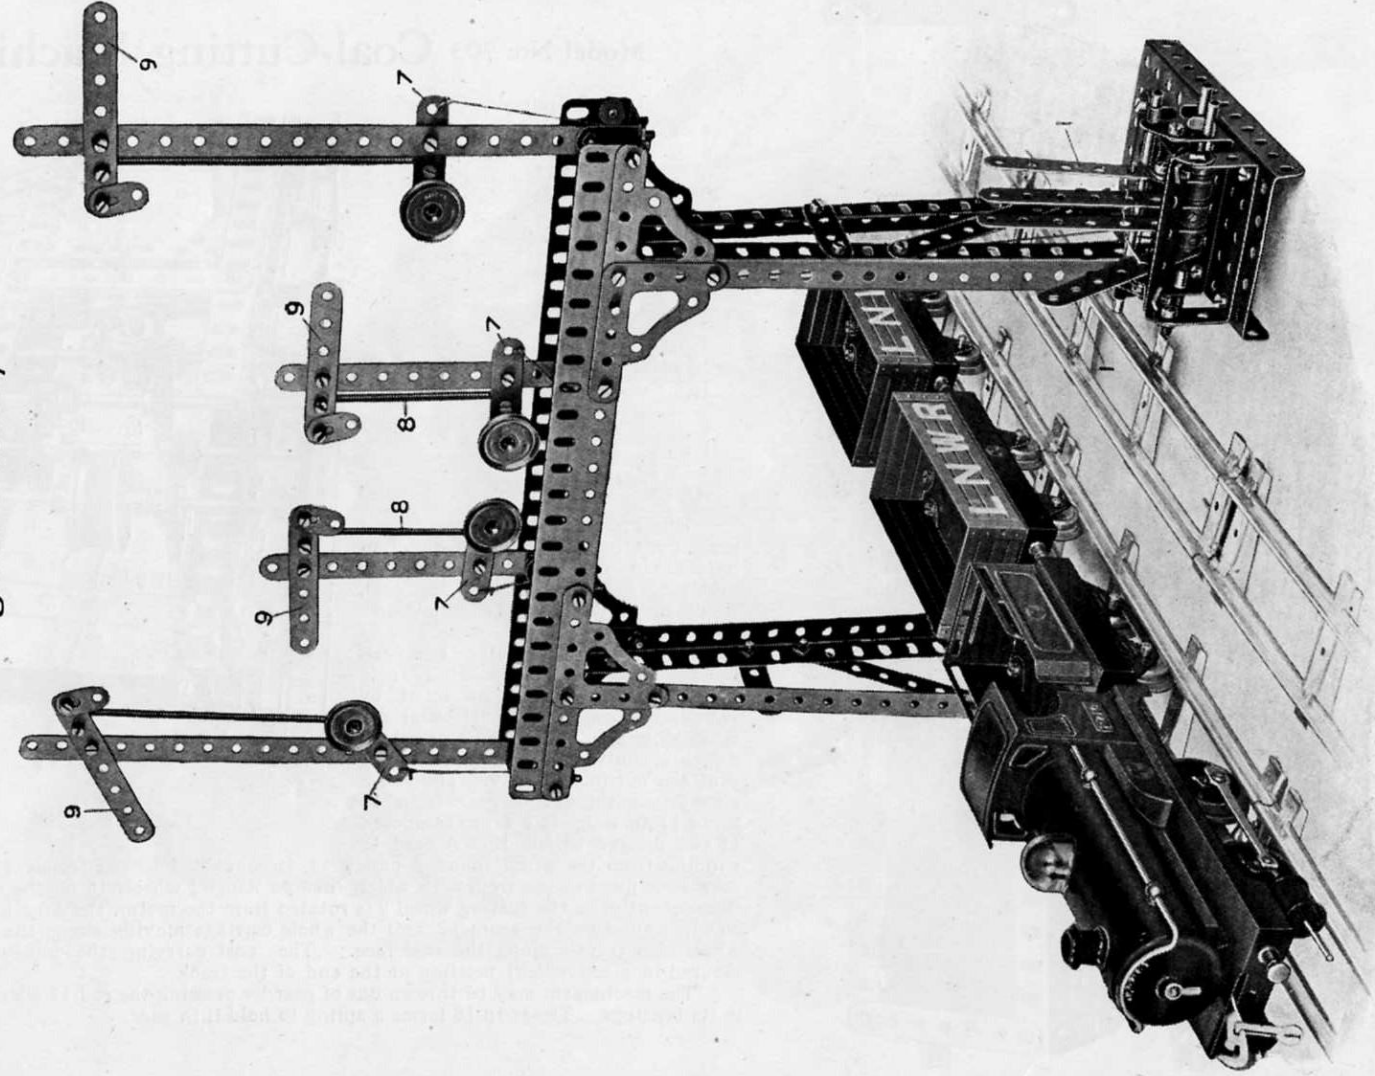

## Model No. 704

## Signal Gantry (continued)

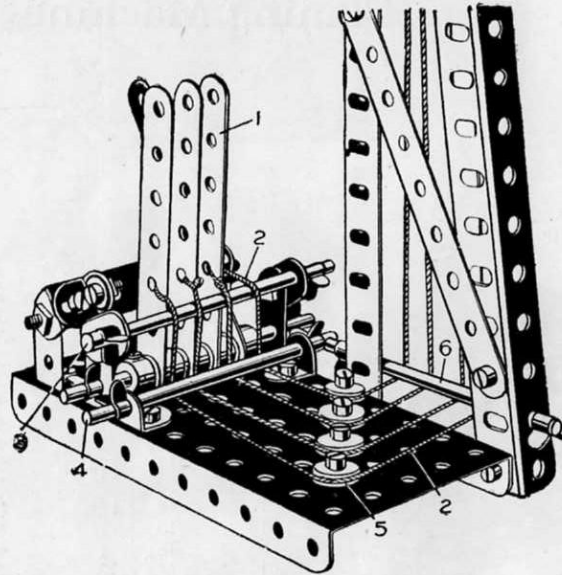


FIG. 704A

Parts  
required:

2 of No.	1A
2 "	2
2 "	2A
6 "	3
2 "	4
1 "	5
6 "	6
4 "	8A
6 "	10
4 "	12A
4 "	16
1 "	17
4 "	22
8 "	23
10 "	35
77 "	37
4 "	37B
10 "	38
2 "	46
1 "	48A
1 "	52
5 "	59
8 "	64
2 "	80
2 "	80A
2 "	103B
8 "	108
4 "	147B

The detail views, Figs. 704A and 704B, bring out the construction of the various parts. In Fig. 704A the levers 1 operate the cords 2 which are passed round the upper and lower rods 3 and 4, and round the  $\frac{1}{2}$ " pulleys 5, giving the cords a quarter turn before they pass round the rods 6, thence to the various weighted levers 7, which are connected as shown in Fig. 704B to threaded bosses 8 on the signal arms 9 by threaded rods 10.


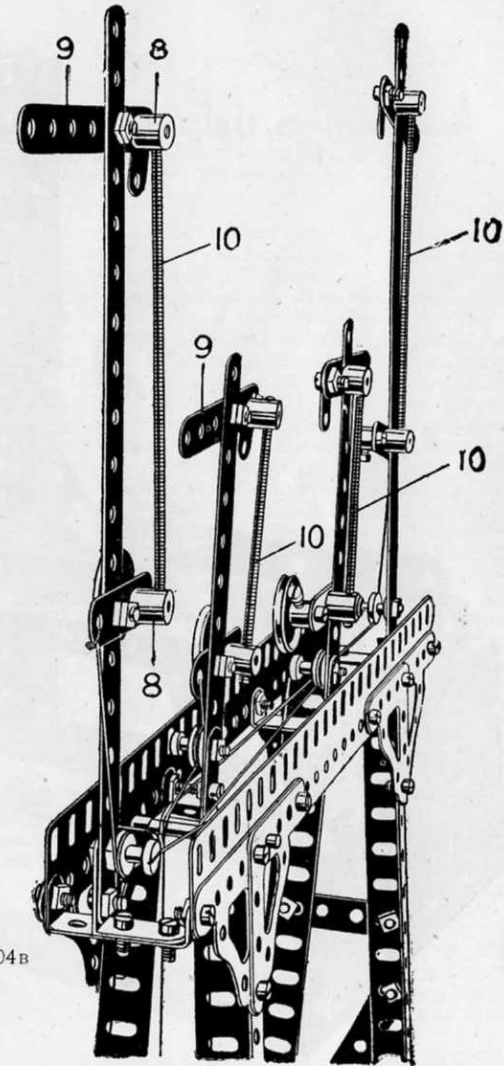


FIG. 704B

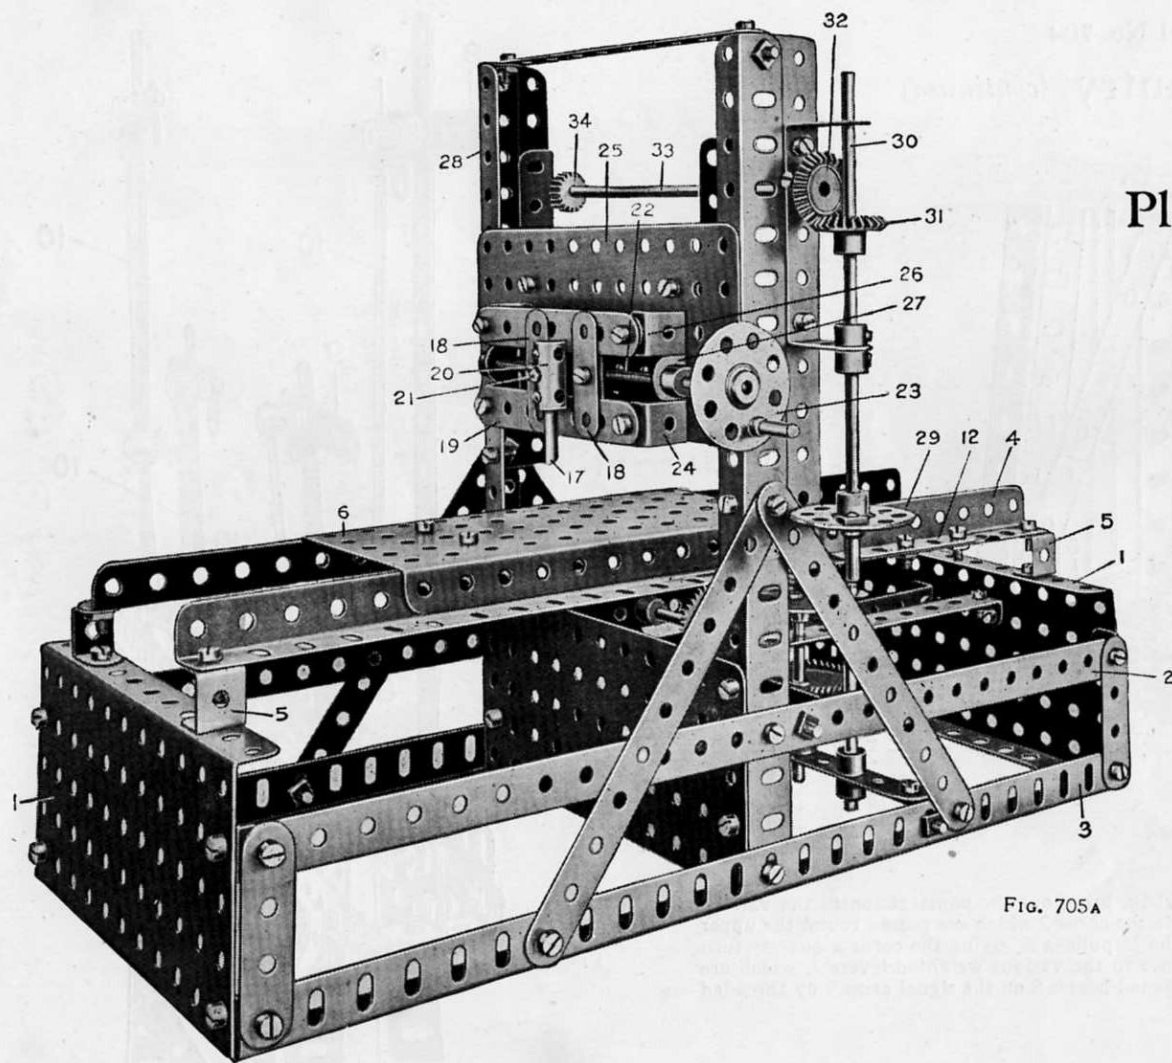This Model can be made with MECCANO Outfit No. 7, or No. 6 and No. 6A.



## Model No. 705 Planing Machine

Parts required:

2 of No. 1	1 of No. 28
7 " " 2	2 " " 30
3 " " 3	74 " " 37
1 " " 5	3 " " 37A
4 " " 6	9 " " 38
3 " " 6A	2 " " 46
4 " " 8	1 " " 48B
2 " " 8A	5 " " 48D
8 " " 11	1 " " 50
12 " " 12	2 " " 52
1 " " 14	12 " " 59
1 " " 15	1 " " 63
5 " " 16	1 " " 64
1 " " 18A	2 " " 70
2 " " 20	1 " " 80
3 " " 24	2 " " 103
5 " " 26	2 " " 110
2 " " 27A	2 " " 115

FIG. 705A

This Model can be made with MECCANO Outfit No. 7, or No. 6 and No. 6A.

161

## Model No. 705

# Planing Machine *(continued)*

Fig. 705A is a perspective view from the front.

Fig. 705B is a rear view.

The main frame is built up from  $5\frac{1}{2}$ " flanged plates 1, connected by angle brackets to  $12\frac{1}{2}$ " strips 2 and lower angle girders 3. Angle girders 4 are bolted to the flanged plate 1 by double brackets 5. These angle girders 4 form the rails upon which the table 6 of the planer slides. The table consists of a  $5\frac{1}{2}$ " flanged plate. The table is moved to and fro, being bolted by the double bent strip 7, Fig. 705B, to a  $5\frac{1}{2}$ " strip 8 the end of which is attached at 9 to a  $3\frac{1}{2}$ " strip 10, pivoted on a rod 11. The strips should be lock-nutted to allow free movement. The rod 11 passes through one of the elongated holes in the angle girder 4, and to prevent play of the rod a  $2\frac{1}{2}$ " strip 12 is bolted on the flange of the angle girder 4, and in the end hole of this strip the top of the rod 11 is pivoted. The strip 10 engages an eye piece 12A bolted to a bush wheel 13. The eye piece is lock-nutted on the bush wheel, so that while held to the bush wheel it may rotate freely about the bolt as a pivot. Consequently, as the wheel 13 rotates, the table 6 will be moved in one direction, while cutting, more slowly than on the return movement when the work is being brought back. A gear framing by which the bush wheel 13 is driven is made by  $5\frac{1}{2}$ " by  $\frac{1}{2}$ " double angle strips 14, Fig. 705B. The gear is driven from the belt pulley 15, formed of two flanged wheels reversed. The gear train may be clearly followed from the illustration, terminating in a pinion driving the contrate wheel 16, secured on the bush wheel rod.

The traversing movement of the cutting tool 17 is effected by means of a guide, formed of two  $1\frac{1}{2}$ " strips 18, bolted to two corresponding strips at the rear of the horizontal  $3\frac{1}{2}$ " strips 19, a middle spacing  $1\frac{1}{2}$ " strip being horizontally arranged between the strips 18. The cutting tool 17 is carried in a coupling 20, which is connected by a threaded pin 21, to a threaded boss on a feed screw 22, which is operated from the bush wheel 23, Fig. 705A. The horizontal strips 19 are supported by double angle brackets 24 from the flat plate 25, and washers 26 are placed beneath the nuts on the strips 19, in order to give the necessary distance at the rear for clearance for the threaded boss on the threaded rod 22. The threaded rod 22 is journaled in the ends of a  $3\frac{1}{2}$ " by  $\frac{1}{2}$ " double angle strip 27, bolted to the plate 25. The vertical movement of the plate 25 on the upright angle girders 28 is effected from the bush wheel 29 mounted on a rod 30, a bevel wheel 31 engaging a corresponding bevel 32 on a rod 33, carrying 2 pinions 34, which engage the racks 35, secured by angle brackets 36 to  $5\frac{1}{2}$ " strips 37, bolted to the plate 25, with spacing washers between, so that a clearance is provided between the ends of the strips 37 and the plate 25, to engage in a sliding movement round the flanges of the angle girders 28.

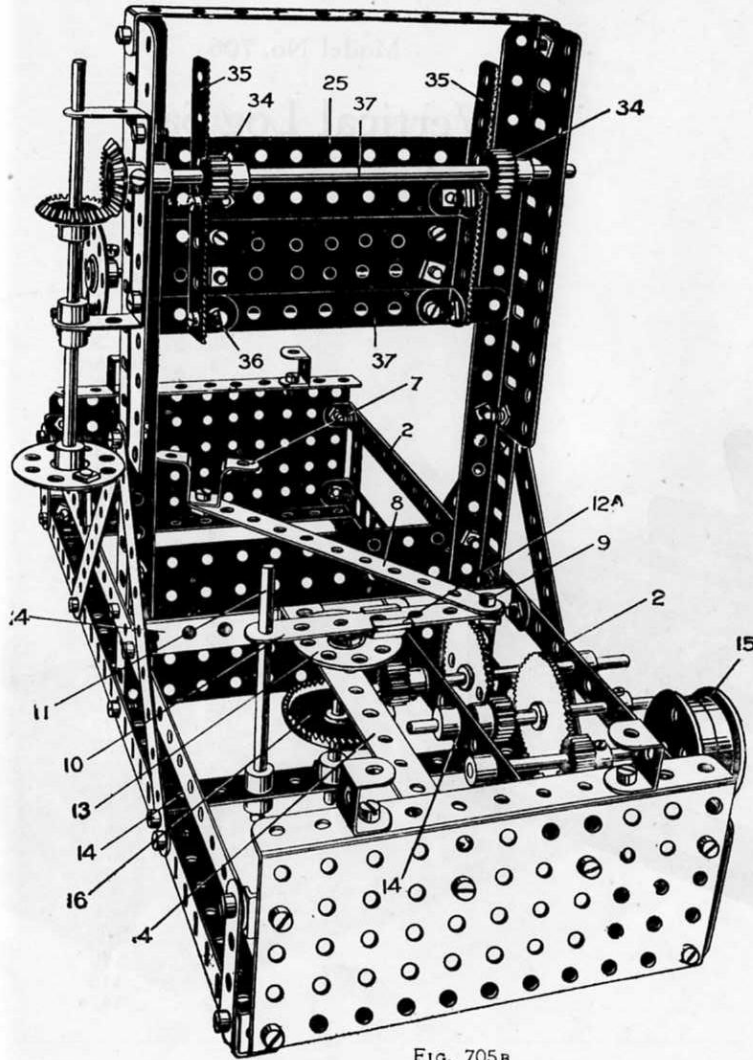



Fig. 705B



This Model can be made with MECCANO Outfit No. 7, or No. 6 and No. 6A.

Model No. 706

## Vertical Log Saw

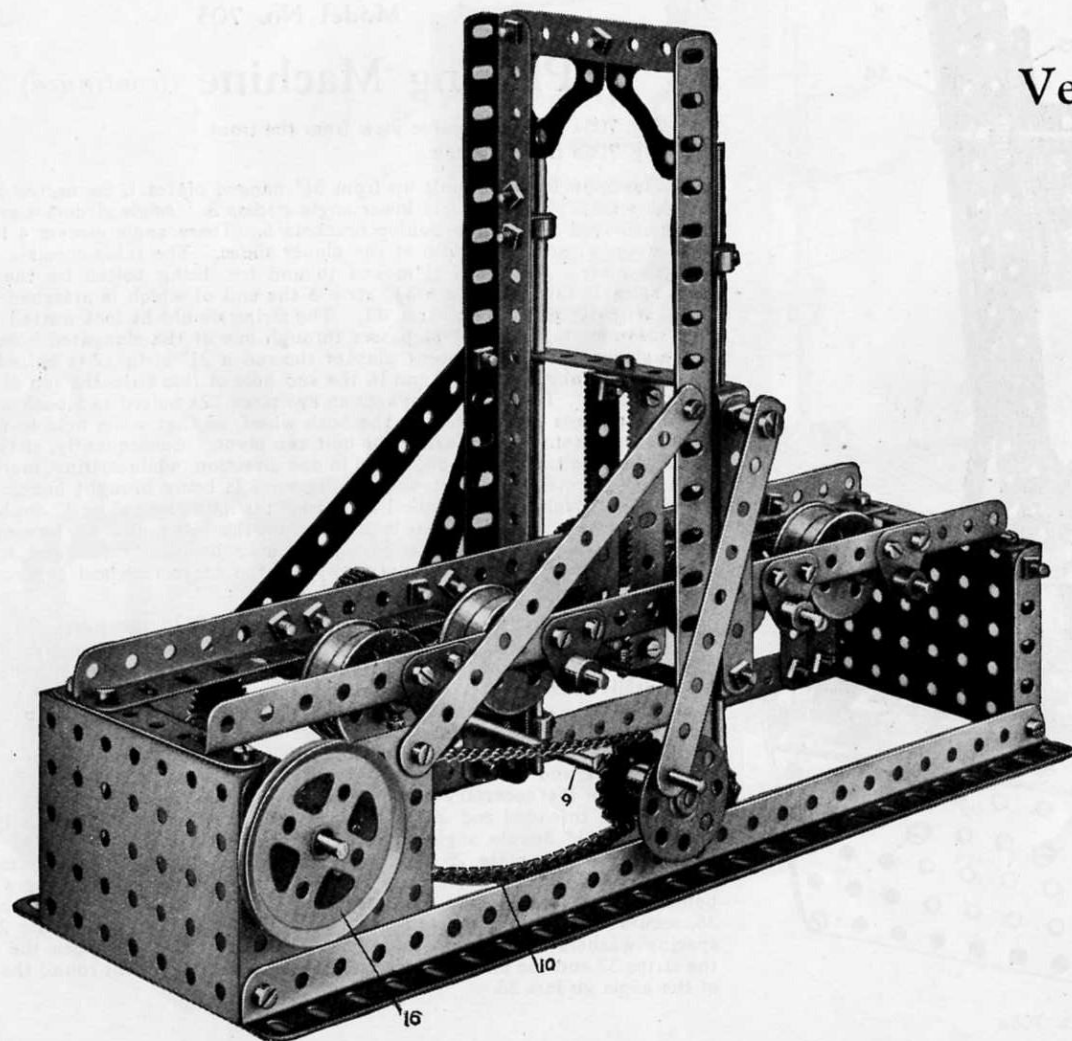

Parts  
required:

2	of No.	2
2	" "	2A
5	" "	3
1	" "	6
4	" "	8
2	" "	8A
12	" "	12
2	" "	12A
1	" "	13
2	" "	13A
1	" "	15
4	" "	15A
2	" "	16
8	" "	20
1	" "	20A
2	" "	24
2	" "	25
1	" "	26
1	" "	27A
2	" "	30
2	" "	32
59	" "	37
6	" "	37A
2	" "	48B
2	" "	53
17	" "	59
2	" "	72
10	" "	77
12"	" "	94
2	" "	96
2	" "	108
2	" "	110
2	" "	115
2	" "	147B

This Model can be made with MECCANO Outfit No. 7, or No. 6 and No. 6A.

163

Model No. 706

## Vertical Log Saw

(continued)

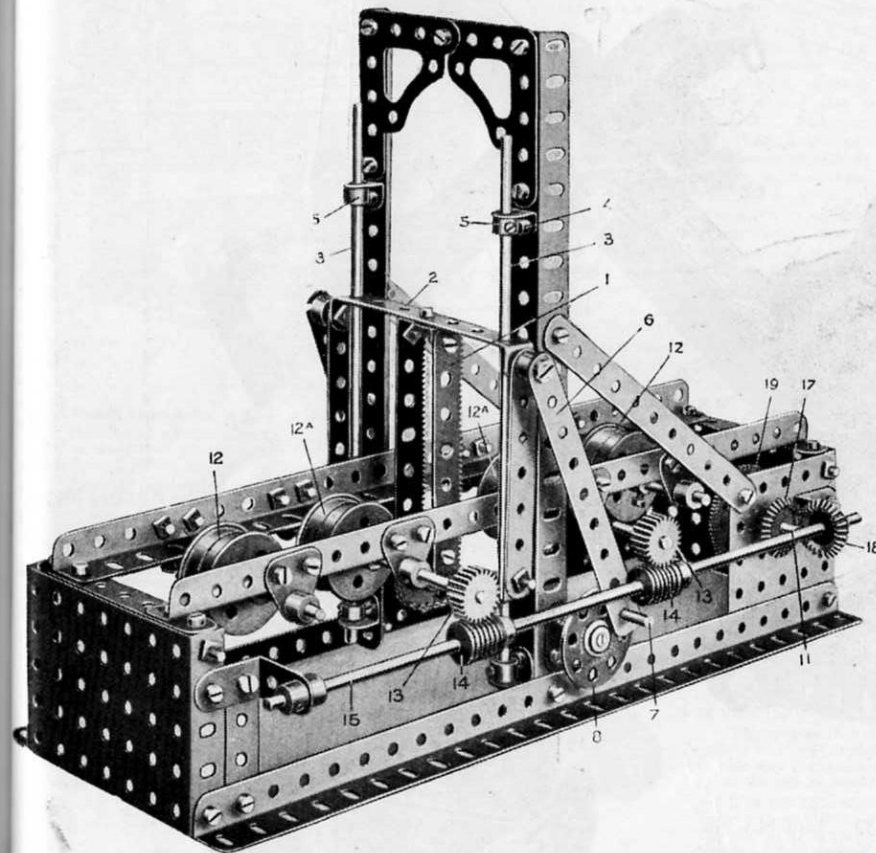


FIG. 706A

This is a model of a machine used for sawing logs into planks.

Fig. 706 is a front perspective view of the log saw, and Fig. 706A a rear perspective view.


The saws represented by the rack strips 1 are carried in a vertical movable frame 2 which slides on the rods 3 as guides. These rods 3 are rigidly held in the angle brackets 4 by the collars 5. The saw frame is reciprocated on the guide rods 3 by the link strips 6, connected to the frame 2 by pivot bolts lock-nutted to the frame and spaced with collars and the lower holes engage the threaded pins 7 on the bush wheels 8 the rod 9 of which is connected by a sprocket chain 10 to a sprocket wheel on the spindle 11. The log is caused to move past the saws by being supported on the pairs of reversed flanged wheels 12 and 12A, the centre pairs of which are positively driven from the  $\frac{3}{4}$ " pinions 13, which are engaged by the worm 14 on the rod 15. The movement of the flanged pulleys 12A and of the saws 1 are both effected from the 2" pulley wheel 16, the rod of which carries a  $\frac{1}{2}$ " pinion engaging a 57-toothed wheel 19 on the rod 11. At the outer end of this rod 11 is a bevel wheel 17 engaging a corresponding bevel 18 on the rod 15. Consequently, if the pulley wheel 16 be driven, the saw frame is reciprocated vertically, and the centre pairs of the flange wheels rotated, causing the log to be fed towards the saws. The opposite end of the rod carrying the pulley wheel 16 passes through one of the holes of the 1" angle bracket forming the bearing for the rod 15.

## Model No. 707 Steam Shovel

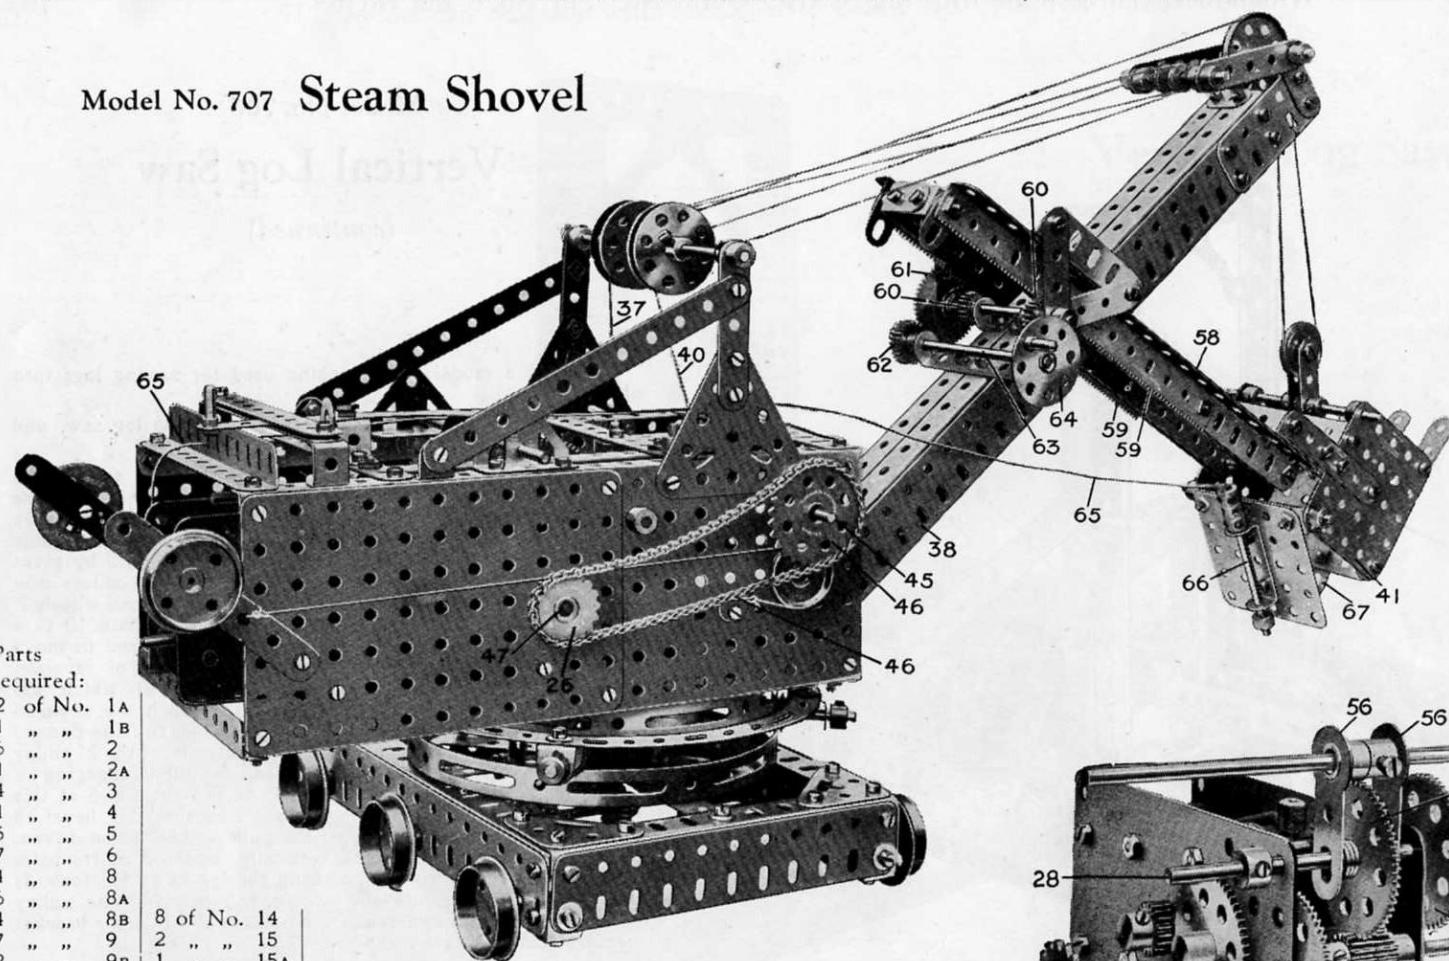Parts  
required:

2	of No.	1A
1	"	1B
6	"	2
1	"	2A
4	"	3
1	"	4
5	"	5
7	"	6
4	"	8
6	"	8A
4	"	8B
7	"	9
2	"	9B
4	"	9D
4	"	9F
7	"	10
6	"	11
11	"	12
4	"	12B
2	"	13A
8	of No.	14
2	"	15
1	"	15A
7	"	16
4	"	16A
1	"	18A
5	"	18B
8	"	20
1	"	21
2	"	22

4	of No.	22A	1	of No.	27	1	of No.	32	1	of No.	48
2	"	23	7	"	27A	5	"	35	3	"	48A
4	"	23A	1	"	27B	37	"	37	1	"	48B
5	"	24	1	"	28	24	"	38	5	"	52A
1	"	25	2	"	30	1	"	40	36	"	59
9	"	26	2	"	31	1	"	45			

Parts  
required:  
(continued)

3	of No.	62
2	"	63
4	"	72
2	"	76
2	"	77
36	"	94
1	"	95
1	"	95A
3	"	96
1	"	96A
2	"	103
2	"	103H
2	"	103W
1	"	103H
2	"	103W
4	"	110
4	"	111
2	"	115
1	"	118
4	"	125
3	"	126
4	"	133
1	"	143
1	"	145
1	"	147H

Electric Motor

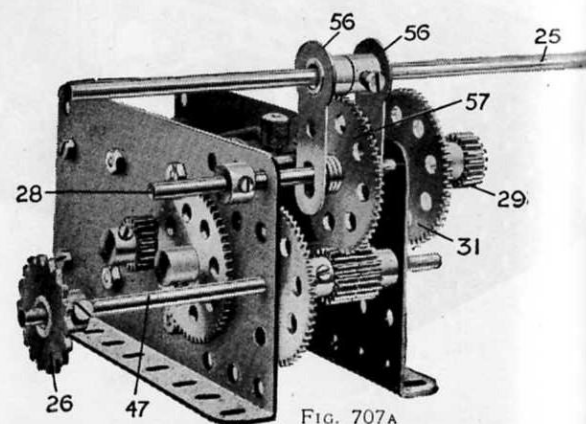


FIG. 707A

held by th  
Next  
The whole  
18 is bolte  
The to  
second hol

This Model can be made with MECCANO Outfit No. 7, or No. 6 and No. 6A.

165

## Model No. 707 Steam Shovel

(continued)

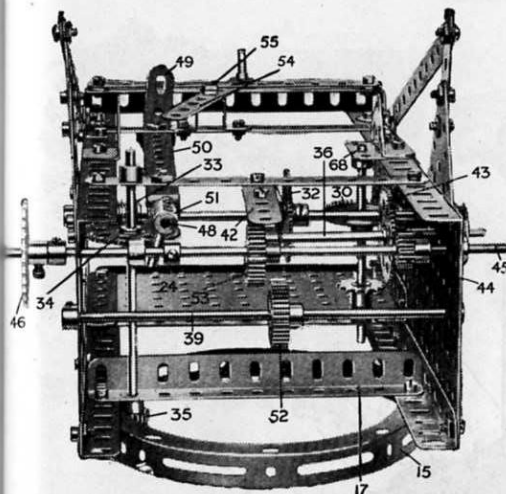


FIG. 707B

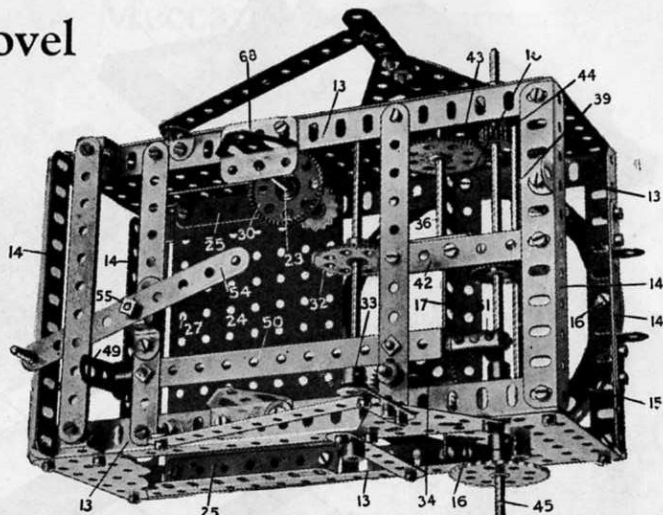


FIG. 707C

held by the same bolts, is a  $5\frac{1}{2}$ " angle girder 17. Through this angle girder passes the rod 9 carrying a  $2\frac{1}{2}$ " sprocket wheel 18, Fig. D. A collar 19 engages above the angle girder 17.

Next build up the roller race, Fig. D, formed of four double brackets 20, bolted to a circular strip 21.  $\frac{1}{2}$ " fast pulleys are secured on  $1\frac{1}{2}$ " rods 22, which are journaled through the brackets 20. The whole is then placed on the top edge of the hub disc and the body is threaded on to the rod 9 in the centre hole of the angle girder 17. After the collar 19 is secured in position, the sprocket wheel 18 is bolted to the rod 9.

The top bearing for the  $3\frac{1}{2}$ " rod 23 is formed by a  $1\frac{1}{2}$ " flat girder, over which is secured a trunnion. A  $3\frac{1}{2}$ " x  $5\frac{1}{2}$ " flat plate 24 is secured to each side of the body by  $3\frac{1}{2}$ " angle girders 25 in the second hole up. This provides a bed to which the electric motor is secured. On the lower part of rod 23 is secured a  $3\frac{1}{2}$ " sprocket wheel from which a chain drives the sprocket wheel 18 which operates the lower levels to drive the travelling wheels.

Now build up the motor unit, leaving off the rod 25 and sprocket 26. (The gear wheels and rods are clearly seen in Fig. A). The motor is then secured to the plate 24, the correct position being found when the fourth hole from the back of the motor registers with hole 27 in the plate, Fig. C.

When the motor is in position, owing to the rod 28 being slideable the pinion 29 may be engaged with the contrate wheel 30 or the gear wheel 31 with the gear wheel 32. The spindle of the latter gear wheel 32 carries a worm 33, Fig. B, which engages a gear wheel 34. On the spindle of 34 is a pinion 35, which engages and drives the  $3\frac{1}{2}$ " gear wheel 11, thus rotating the Shovel.

On the  $3\frac{1}{2}$ " rod 36 is wound the cord 37 for raising and lowering the jib 38, and on the  $6\frac{1}{2}$ " rod 39 is wound the cord 40 for raising and lowering the shovel 41. The rod 36 is journaled in a trunnion bolted underneath the strip 42 and carries a  $1\frac{1}{2}$ " gear wheel 43, which is engaged by a pinion 44 on an  $8\frac{1}{2}$ " rod, 45. This is driven by a  $1\frac{1}{2}$ " sprocket wheel 46 from the  $1\frac{1}{2}$ " sprocket wheel 26 on the motor spindle 47.

The spindle 45 is slideable by the rotation of an  $8\frac{1}{2}$ " rod 48 operated by the crank 49, the rod being journaled in the ends of a  $5\frac{1}{2}$ " x  $1\frac{1}{2}$ " double angle strip 50, a coupling 51 carrying a  $1\frac{1}{2}$ " rod which engages between two collars on the rod 45. In this way the pinion 44 may be meshed with the gear wheel 43 in order to raise or lower the jib, or a  $1\frac{1}{2}$ " gear wheel 52 on the rod 39 may be engaged with a  $1\frac{1}{2}$ " gear wheel 53 to raise or lower the shovel arm 58.

The rod 28 is slideable by a  $4\frac{1}{2}$ " strip 54 pivoted at 55, the outer end of which engages between two cranks 56. These grip on either side of a  $1\frac{1}{2}$ " gear wheel 57, several washers being placed between the cranks to take up the slack. The shovel 41 is carried on a sliding frame consisting of angle girders 58 to which are bolted racks 59. These are engaged by  $\frac{1}{2}$ " pinions 60 on a  $3\frac{1}{2}$ " rod. A 50-toothed gear wheel 61, which is driven by a  $\frac{1}{2}$ " pinion 62 on a  $3\frac{1}{2}$ " rod 63 operated by the hand wheel 64. The bottom of the shovel is released by a cord 65 connected to a sliding rod 66, the end of which enters the aperture of a flat bracket 67.

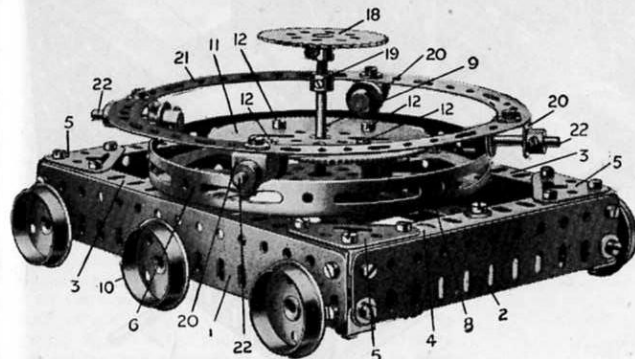



FIG. 707D




23 This Model can be made with MECCANO Outfit No. 7, or No. 6 and No. 6A.

Model No. 708

## Meccanograph

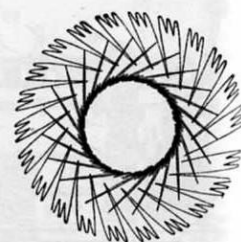

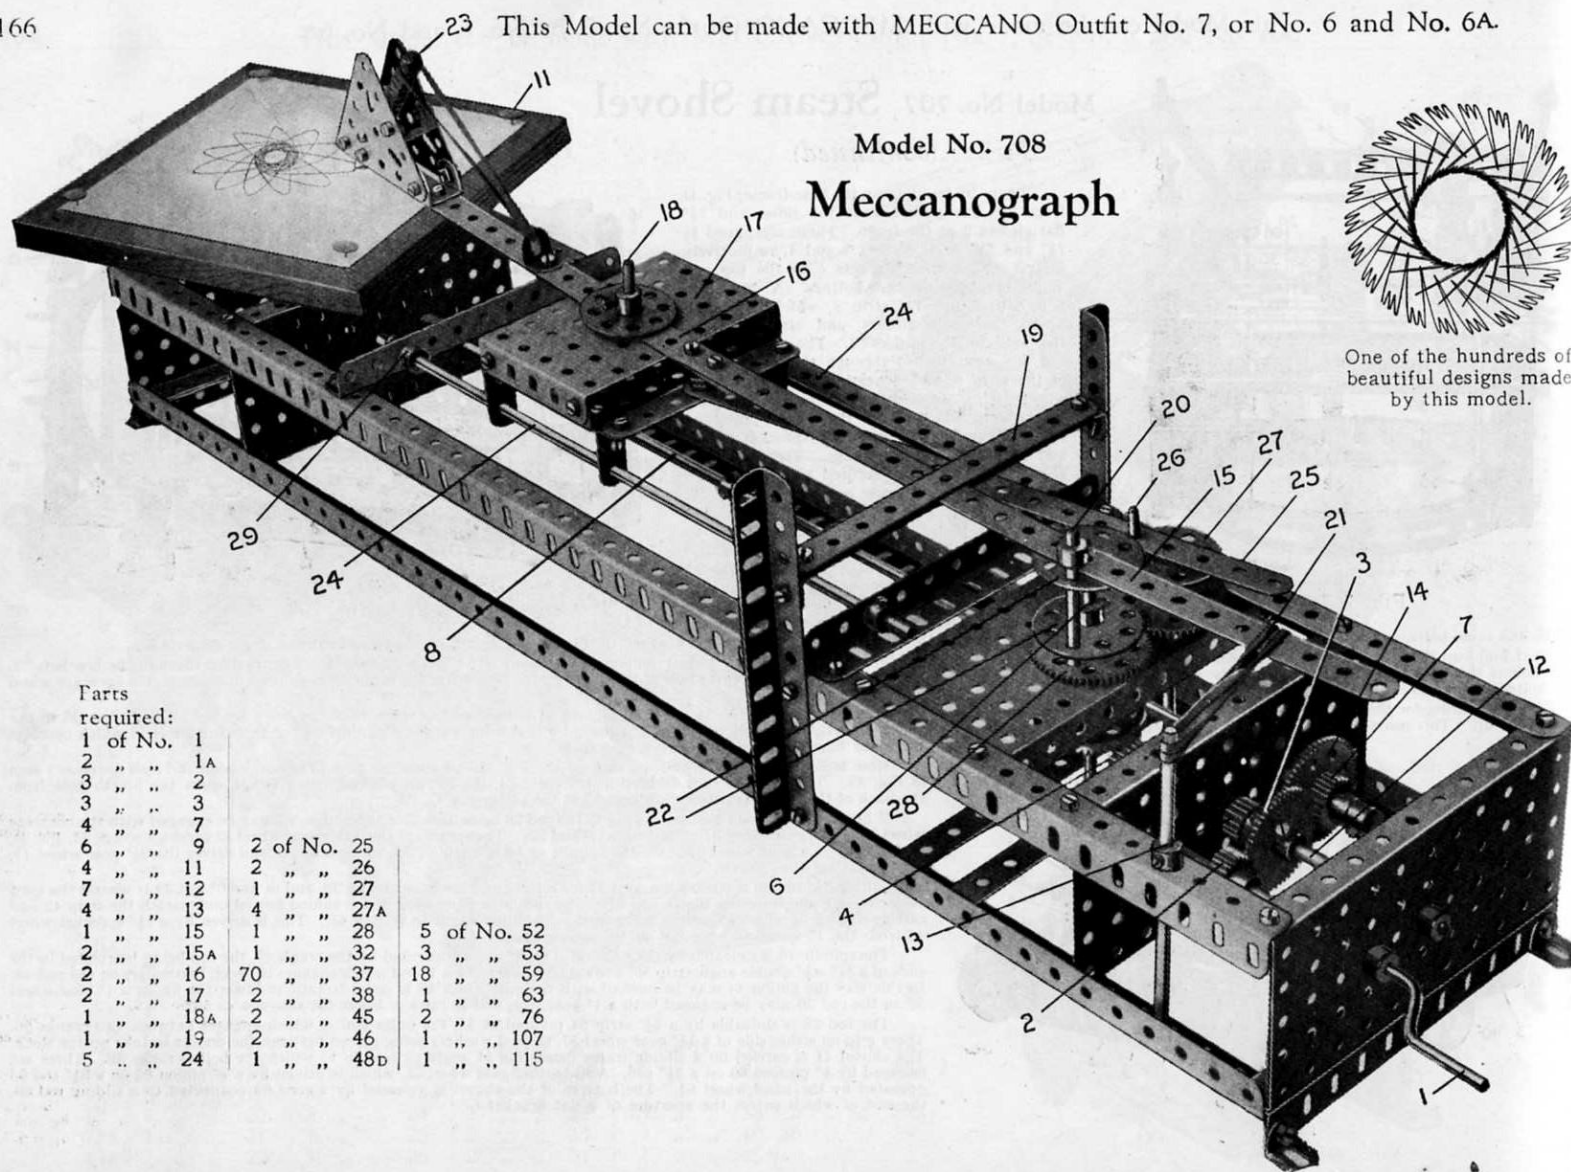One of the hundreds of beautiful designs made by this model.



Parts  
required:

1 of No. 1		
2 " " 1A		
3 " " 2		
3 " " 3		
4 " " 7		
6 " " 9		
4 " " 11	2 of No. 25	
7 " " 12	2 " " 26	
4 " " 13	1 " " 27	
1 " " 15	4 " " 27A	
2 " " 15A	1 " " 28	5 of No. 52
2 " " 16	1 " " 32	3 " " 53
2 " " 17	70 " " 37	18 " " 59
1 " " 18A	2 " " 38	1 " " 63
1 " " 19	2 " " 45	2 " " 76
5 " " 24	2 " " 46	1 " " 107
	1 " " 48D	1 " " 115

This  
it. Wit  
paper a  
that has  
of other  
whatever  
to be ma  
tasteful  
the effe  
The  
1 on wh  
toothed  
toothed  
on the  
toothed  
the tabl  
a 57-to  
to which  
wheel.  
the tabl  
an alter  
there is  
pinion 1  
14. Cor  
and 14  
3 and 7  
its rod a  
to their  
a much

This Model can be made with  
Model No. 708

MECCANO Outfit No. 7, or No. 6 and No. 6A.

167

## Meccanograph (continued)

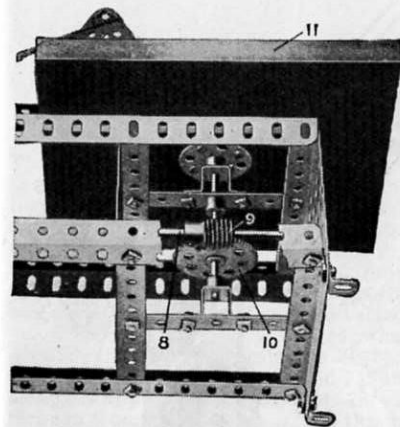


FIG. 708A

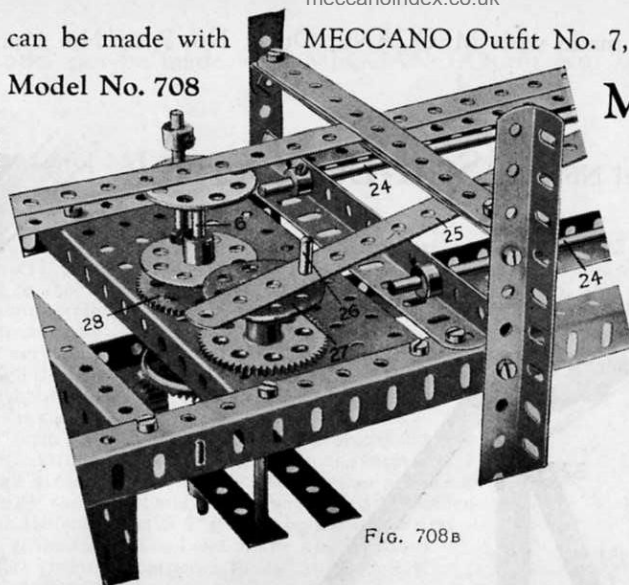


FIG. 708B

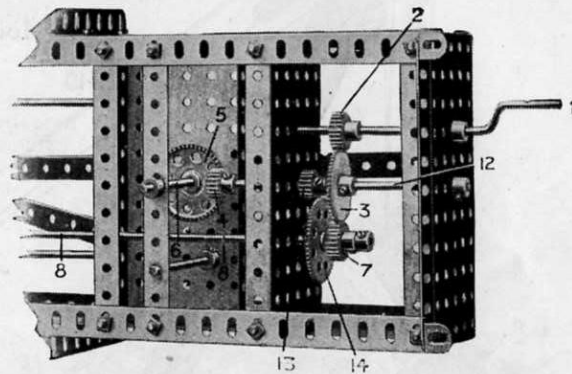


FIG. 708C

This is a model of extraordinary interest, and we hope that all Meccano boys will build it. With it any boy can make an amazing variety of exquisite designs by fixing a sheet of paper and pen in position and turning the handle. We have reproduced a neat design that has been made with the Meccanograph, and this could be supplemented by thousands of others if we had the space. We must content ourselves by saying that there is no limit whatever to the variety and beauty of the designs to be made by simply varying the adjustments. When tastefully filled-in with different tints of water colours, the effect is most pleasing.

The Meccanograph is driven from the handle 1 on which is a 25-toothed pinion 2 engaging a 50-toothed gear wheel 3 on the axle of which is a 19-toothed pinion 4 engaging a  $1\frac{1}{2}$ " contrate wheel 5 on the spindle 6. The gear wheel 3 drives a 25-toothed pinion 7 on an axle rod 8 extending along to the table and by means of a worm 9 (Fig. A) drives a 57-toothed gear wheel 10 on the upright spindle to which the rotating table 11 is secured by a bush wheel. In order to vary the speed of rotation of the table 11 for a constant turning of the handle 1 an alternative drive is arranged. For this purpose there is loosely mounted on the rod 12 a 19-toothed pinion 13 adapted to engage a 57-toothed gear wheel 14. Consequently, the rod 8, when the wheels 13 and 14 are loose, is driven by the toothed wheels 3 and 7, and if the pinion 7 be disconnected from its rod and the pinion 13 and gear wheel 14 be fixed to their respective rods, the table will be driven at a much lower speed.

The arm is built up of a  $12\frac{1}{4}$ " strip 15 and a  $9\frac{1}{2}$ " strip 16 overlapped three holes and adjustably connected to the carriage 17 by a 1" rod 18. It passes through one of the perforations in the strip 16 so that, in order to vary the design produced, the rod 18 may be inserted in any suitable hole in the strip 16 or in any suitable hole in the carriage 17. The strip 15 is guided between the  $5\frac{1}{4}$ " strips 19 spaced by washers at each end. The strip 15 of the arm continually bears against the rod 20 by the pulling action of an elastic band 21, the rod 20 passing through two bush wheels 22 secured on the rod 6. Consequently, as the bush wheels rotate, the rod 20 acts as a crank to oscillate the arm about the pivot rod 18 and moves the pen 23 to and fro across the table 11. The carriage 17 is simultaneously caused to travel to and fro along the guide-rods 24 by means of a strip 25, Fig. B, one hole of which engages a threaded pin 26 in a bush wheel 27. This is driven by means of a  $1\frac{1}{2}$ " gear wheel on its axle rod, being engaged and driven by a similar gear wheel 28 secured on the vertical rod 6.

One series of designs is obtained from the Meccanograph as shown in the illustration, but an entirely different set of designs may be obtained if the strip 25 is disconnected from the threaded pin 26 and the carriage 17 locked on the guide rods 24 by means of collars 29. The pen 23 is held in the holder, Fig. D, formed by two  $2\frac{1}{2}$ " triangular plates 30 connected by two double brackets 31 to the arm 16, and connected together also by two further double brackets 32. The pen 23 is retained in this holder by an elastic band 33 connected to an angle bracket 34 on the arm.

Care should be taken to see that all parts of the model work smoothly and that no jolting takes place, otherwise the lines of the design will be uneven.


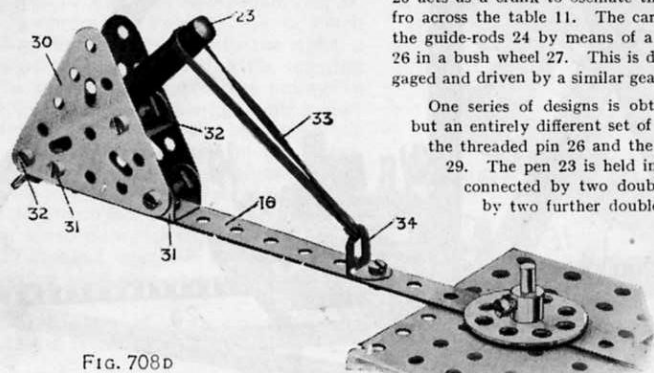
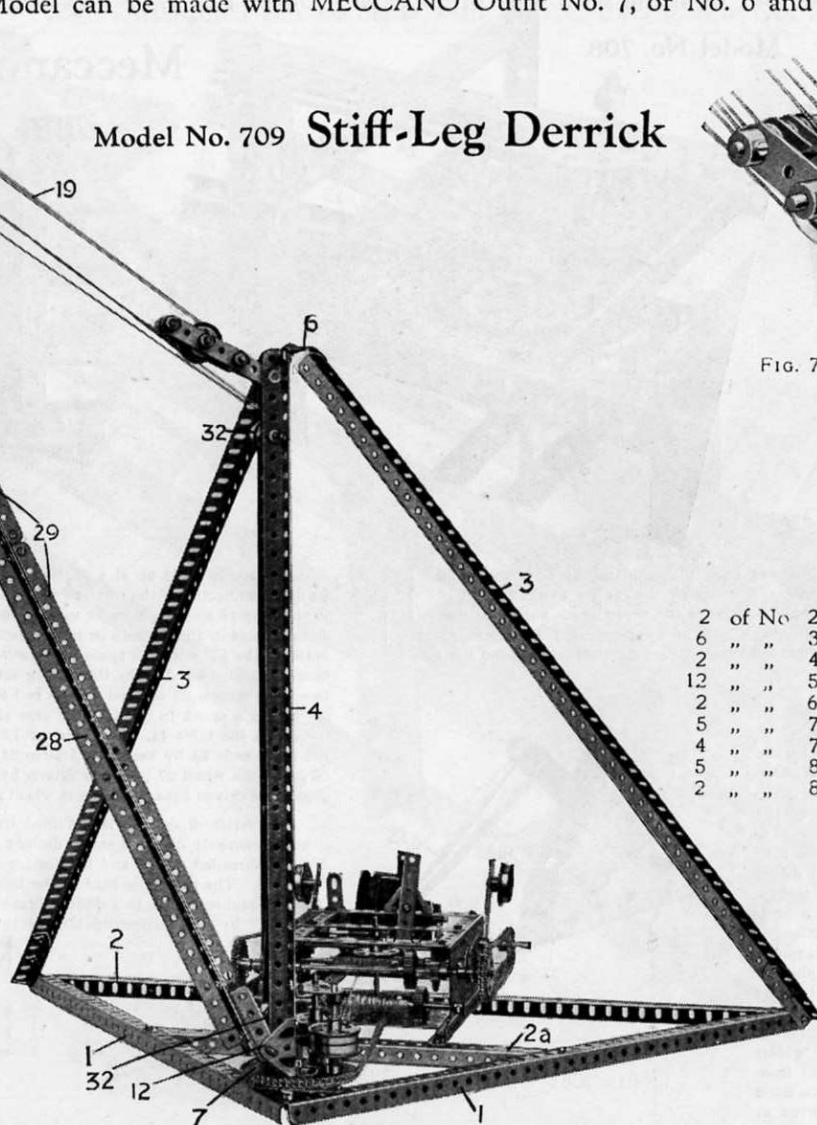


FIG. 708D

This Model can be made with MECCANO Outfit No. 7, or No. 6 and No. 6A.

## Model No. 709 Stiff-Leg Derrick

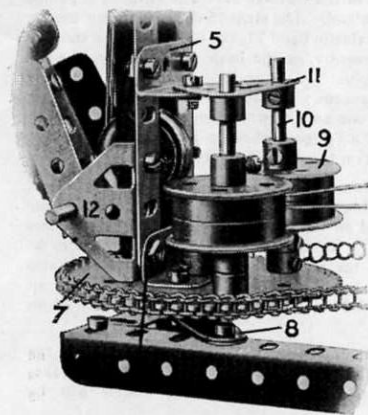

Parts required:									
2	of No.	2	6	of No.	9B	3	of No.	27A	
6	" "	3	2	" "	9E	2	" "	31	
2	" "	4	3	" "	9F	1	" "	32	
12	" "	5	2	" "	12	3	" "	35	
2	" "	6	2	" "	13A	79	" "	37	
5	" "	7	4	" "	14	88	" "	38	
4	" "	7A	1	" "	16	2	" "	40	
5	" "	8	3	" "	16A	1	" "	48C	
2	" "	8B	4	" "	17	2	" "	52	
			9	" "	18A	2	" "	52A	
			5	" "	18B	1	" "	57B	
			6	" "	20	50	" "	59	
			1	" "	21	1	" "	62	
			2	" "	22	1	" "	63	
			15	" "	22A	2	" "	76	
			2	" "	26	1	" "	94	
						2	" "	95A	
						1	" "	95B	
						2	" "	96	
						2	" "	103	
						3	" "	126	
						1	" "	133	

Electric Motor



## Model No. 709 Stiff-Leg Derrick (continued)

The base of the model is formed of  $18\frac{1}{2}$ " angle girders 1 bolted to a  $24\frac{1}{2}$ " girder 2 and held rigid by a  $12\frac{1}{2}$ " girder 2a. The side members 3 are constructed from  $24\frac{1}{2}$ " angle girders extended at their lower ends by  $2\frac{1}{2}$ " girders overlapped three holes.  $2\frac{1}{2}$ " strips 6, Fig. A, bolted to the tops of the girders 3 are slightly bent, as shown, and meeting together form a bearing for the bolt 6a, about which the upright member 4 pivots. The latter consists of  $18\frac{1}{2}$ " angle girders, bolted together at each extremity by  $1\frac{1}{2}$ " girders 5. The lowest of these  $1\frac{1}{2}$ " girders is secured to a 3" sprocket wheel 7, which forms the swivelling base of the jib. The pivot is a  $1\frac{1}{2}$ " rod passed through the centre hole of the  $1\frac{1}{2}$ " girder and through the boss of the sprocket wheel and carried in a bearing 8 built up from two  $2\frac{1}{2}$ " strips bolted across the base girders 1. Two collars should be placed on this rod, one above the sprocket 7 and one below the strips 8. Fig. B.

Two flanged wheels butted together form guide pulleys 9 (Standard Mechanism No. 40).

The jib is built up from two  $24\frac{1}{2}$ " angle girders 28 bolted together in the form of a T and strengthened by pairs of  $12\frac{1}{2}$ " and  $7\frac{1}{2}$ " angle girders 29 similarly bolted together and secured along the upper sides of the girders 28. A  $2\frac{1}{2}$ " rod, about which the jib pivots, is journalled through trunnions 12, Fig. B, and through the end holes of 2" girders bolted in the first and third holes from the end of the  $24\frac{1}{2}$ " girders 28. The head of the jib (Standard Mechanism No. 31) is formed by two  $5\frac{1}{2}$ " flat girders 13 secured to  $2\frac{1}{2}$ " angle girders bolted in the first and fourth holes of the girders 28.

The jib is raised or lowered by means of the cord 19 winding on the rod 18, Fig. C. The drive from the motor is led to this rod 18 by way of chain gear 17 and rod 16 which is slideable in its bearings. On operation of the crank 24, the 1" gear wheel 31 is brought into engagement with a similar gear secured to the shaft 18 (Standard Mechanisms). This operates the cord 19, which, after passing round 1" guide pulleys 32 in the vertical member 4, is led round the sheaves of the pulley block pivoted at the rear of the jib-head and those of the pulley-block attached to the head of the upright (Fig. A) in a similar manner to that described in Standard Mechanism No. 37.

The hoisting-block is operated by the cord 20 winding on a rod 21, Fig. C, which also carries a 57-toothed gear wheel. On moving the lever 24 over to the right, a  $\frac{1}{2}$ " pinion 23 is brought into mesh with this gear wheel, so connecting the hoisting mechanism with the drive from the motor. The cord 20 is led over the pulleys in the vertical member in a similar manner to the cord 19 before passing over a  $1\frac{1}{2}$ " pulley in the jib-head; it next engages alternately the sheaves of the hoisting-block and of the second fixed block in the jib-head, being finally secured to the latter.

The rotation of the jib is effected as follows: a rod 25 driven by sprocket chain from the rod 16 may be moved to and fro in its bearings on operation of a lever 26 (see Standard Mechanisms), and this movement is employed to engage or disengage a  $\frac{1}{2}$ " pinion with a 57-toothed gear wheel 22 on a secondary shaft 33. The latter carries a worm wheel gearing with another 57-toothed gear wheel on a vertical rod 27 and a 1" sprocket wheel on this rod rotates by means of a sprocket chain the 3" sprocket wheel 7 forming the base of the jib.

Brakes are provided in the form of weighted levers 34 as described in Section VI., "Meccano Standard Mechanisms." This method prevents falling-back of the jib or hoisting-block when the gears are released.


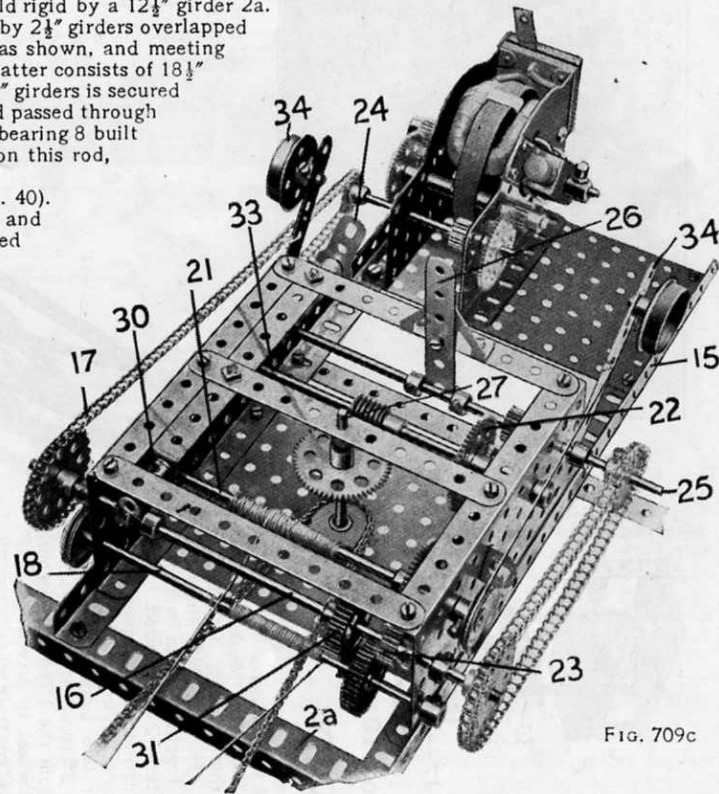


FIG. 709c

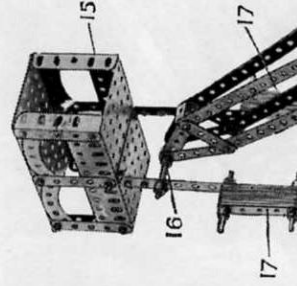



## Model No. 710 Aeroscope

The rotary roller base of the model is similar to that described in "Meccano Standard Mechanisms." To this rotary frame is bolted at 1 two 3½" angle girders bolted together, upon which the superstructure 2 is secured. At the top of this superstructure is journalled a 6½" rod 3 bolted to the swinging arm 4 by means of two bush wheels 5. On the rod 3 is a 3" sprocket wheel 6 driven by a chain 7 from the 1" sprocket wheel 8. This sprocket wheel is driven by a ¼" pinion 9 and a 1½" contrate wheel 10 which in turn are driven from a worm wheel 11 on a 4½" rod 12. This rod is driven by a reducing gear train from the 5" rod 13 in the motor, Fig. A.

The gear mechanism just described rotates the arm 4 about the rod 3. The arm is balanced at the foot by thirty-two 12½" strips 14, and the carriage 15, pivoted at 16, is balanced by a weight on each side consisting of twenty 2½" strips 17.

The mechanism for rotating the superstructure 2 consists of a 3" sprocket wheel 18 engaging the chain 23 and is operated by the ¼" pinion 19, the drive from which is led through a 57-toothed gear wheel 20, and worm 21 on to the 57-toothed wheel 22.

Parts required:	
48 of No.	
4	1A
1	1B
34	2
20	3
48	5
8	6
12	8
2	9
6	9A
7	9B


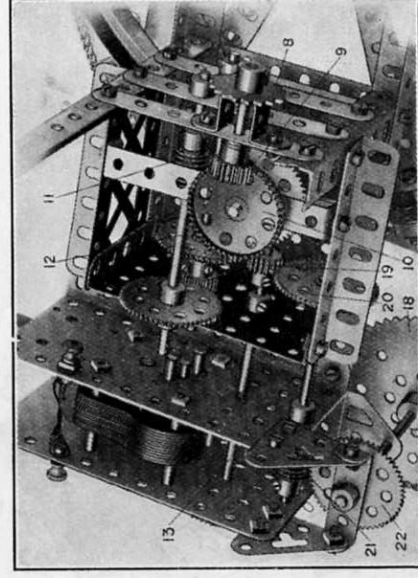


Fig. 710A

Parts required:  
(continued)

4 of No.	9p	1 of No.	46
16	12	1	48
1	14	18	"
1	15	1	48A
3	15A	2	48B
13	16	1	52
5	17	2	52A
1	18	38	53
8	20	1	59
2	24	2	62
3	26	4	76
6	27A	2	90
1	28	2	94
2	32	2	95B
240	37	1	96
15	38	5	97
1	45	2	103
		1	109
		8	119
		1	126A
		6	133
			Electric Motor

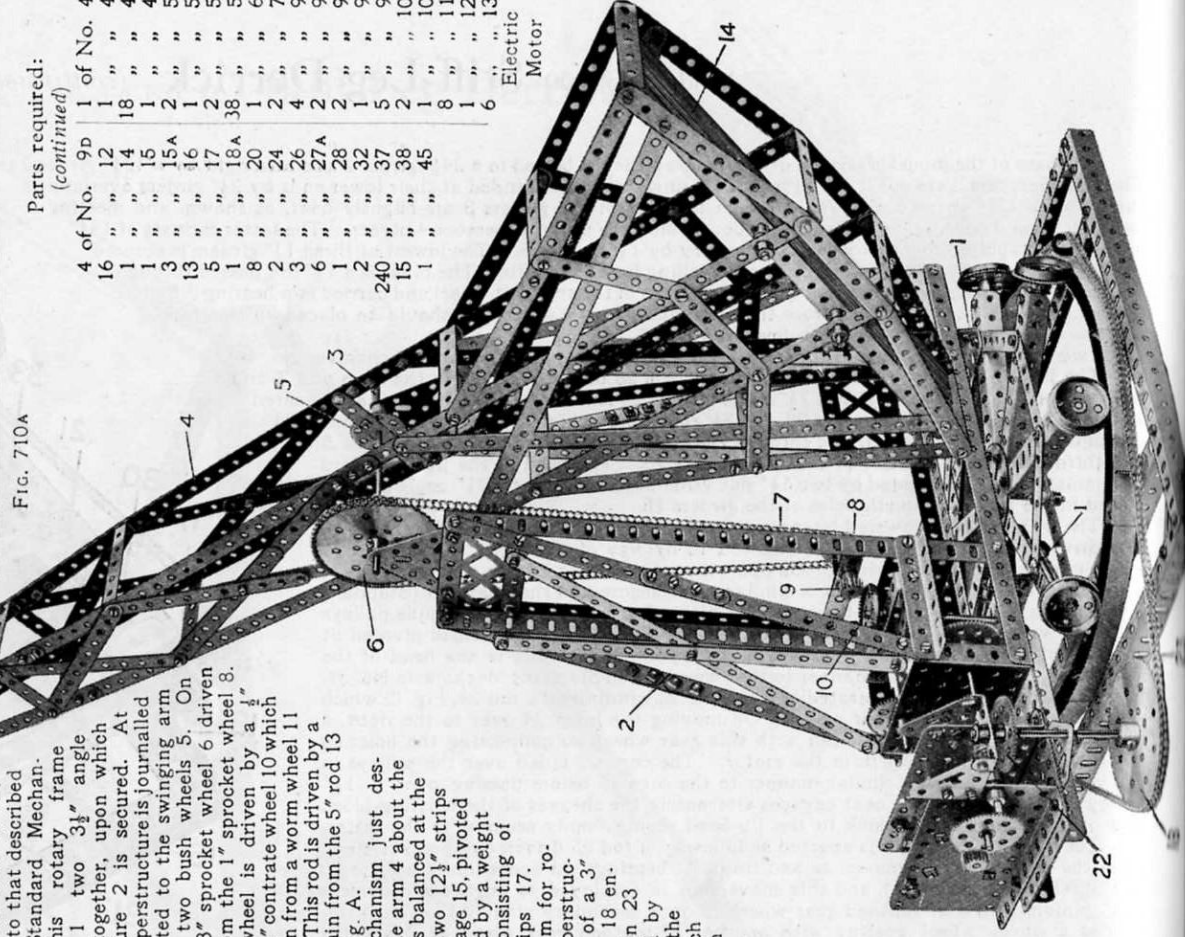

1 of 1  
7 "  
2 "  
1 "  
2 "  
2 "  
1 "  
2 "  
3 "  
1 "  
3 "  
4 "  
1 "  
1 "  
2 "  
4 "

Th  
2½" and  
This ho  
being h  
9, on a  
or dis  
the wir  
wound.  
on the  
worm 1  
21, for

In  
the spi

It  
other, a  
give a  
sisting  
the wir


This Model can be made with MECCANO Outfit No. 7, or No. 6 and No. 6A.

171

## Model No. 711 Wire Covering Machine
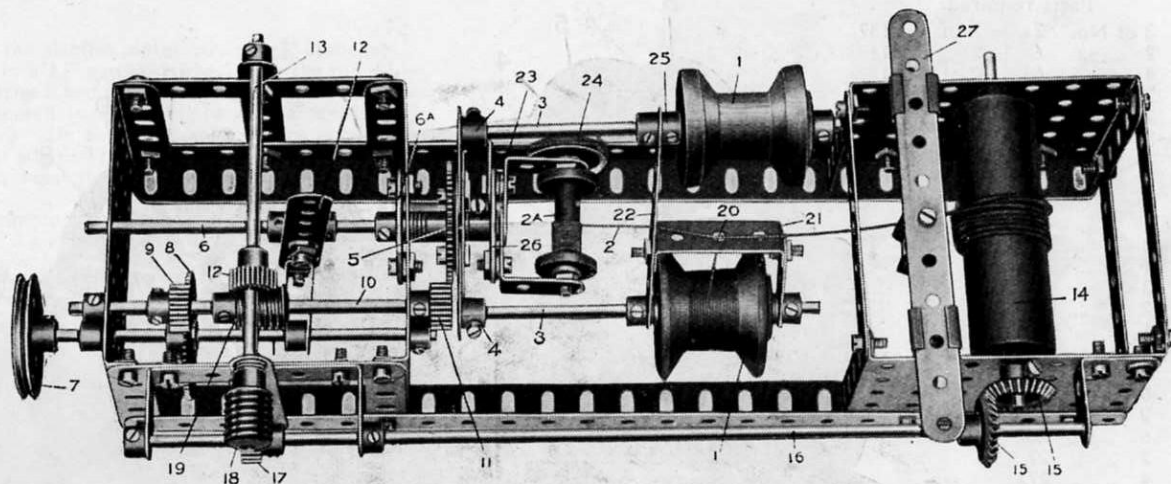
## Parts required:

1 of No. 2	2 of No. 27A
7 " " 3	2 " " 30
2 " " 4	2 " " 32
1 " " 5	41 " " 37
2 " " 6A	17 " " 38
2 " " 8	2 " " 44
1 " " 10	1 " " 46
2 " " 12	1 " " 48
3 " " 12A	2 " " 50
1 " " 13	4 " " 53
3 " " 15	12 " " 59
4 " " 15A	2 " " 62
1 " " 21	1 " " 63
1 " " 22	1 " " 81
2 " " 24	1 " " 106
4 " " 26	1 " " 301



The bobbins 1, carrying the thread by means of which the wire 2 is covered, are carried in a yoke consisting of two rods 3, secured in cranks 4, between a  $2\frac{1}{2}$ " and  $1\frac{1}{2}$ " strip, and bolted to a 57-toothed gear wheel 5, rotatable loosely on a fixed 5" rod 6. On the rod 6, is a bush wheel 6A, bolted thereto and to the frame. This holds the rod against rotation. The bobbin 2A is carried in the two 1" angle brackets, forming a frame which is bolted to the bush wheel 26, the latter being held by its screw fixedly on the rod 6. The yoke is rotated from the pulley wheel 7, a 57-toothed gear wheel 8, on the spindle of which drives a  $\frac{1}{2}$ " pinion 9, on an upper 4" rod 10, another  $\frac{1}{2}$ " pinion 11, on the end of which engages and drives the gear wheel 5; this rotates the yoke. The gear 8 is caused to engage or disengage with the pinion 9 by a clutch mechanism operated by the handle 12. As the yoke rotates, the thread from the bobbins is wound closely round the wire 2, and in order to ensure an even wrapping of the thread on the wire, the take-up roller 14, is provided, on to which the wire as it is covered is wound. The take-up roller is driven with a very slow movement by bevel pinions 15, from a side rod 16, a  $\frac{1}{2}$ " pinion 17 on which is driven by a worm 18, on the rod 13. Consequently, the same rotary movement of the rod 10, to drive the bobbin yoke, also operates the worm 19, engaging the pinion 12 and worm 18, engaging the pinion 17, which drives the take-up roller 14, bringing the uncovered wire 2 slowly past a perforation 20, in the guide strip 21, formed of  $1\frac{1}{2}$ " by  $\frac{1}{2}$ " double angle strip and carried from the yoke arm 22.

In order to prevent the wire 2 unwinding too freely from its bobbin 2A, a brake is provided, consisting of a cord 23, passing round a pulley 24, on the spindle of the bobbin 2A, and connected to a flat bracket bolted on the bush wheel 26.

It will be noticed that a collar 25 is placed on one side of the yoke strip 22, which has the effect of setting one of the bobbins slightly to the rear of the other, and the effect of this is to give two windings round the wire, one over the other. The thread on the bobbins may be of different colours, which would give a variegated effect to the covering. In order to cause the covered wire to be wound evenly on the take-up roller 14, a distributor is provided, consisting of a strip 27, beneath which is bolted a double bracket through which the covered wire passes. By moving the strip 27 from one side to the other, the wire winds evenly on the roller 14.

This Model can be made with MECCANO Outfit No. 7, or No. 6 and No. 6A.

## Model No. 712 Tractor

### Parts required:

3 of No.	2A	2 of No. 137
2 "	6	2 " " 147A
4 "	6A	2 " " 147B
2 "	8B	2 " " 148
2 "	9B	
3 "	9C	Electric Motor
1 "	11	
3 "	12A	
1 "	13A	
1 "	14	
3 "	15	
1 "	15A	
3 "	16	
2 "	16B	
1 "	17	
2 "	19B	
2 "	21	
5 "	24	
2 "	25	
6 "	26	
2 "	27	
4 "	27A	
2 "	30	
1 "	32	
180 "	37	
60 "	38	
1 "	47	
1 "	48	
2 "	48D	
1 "	50	
4 "	52A	
2 "	53	
20 "	59	
1 "	62	
2 "	63	
4 "	72	
18 "	94	
4 "	95A	
2 "	96A	
2 "	103H	
2 "	115	
4 "	118	
2 "	130	
1 "	132	

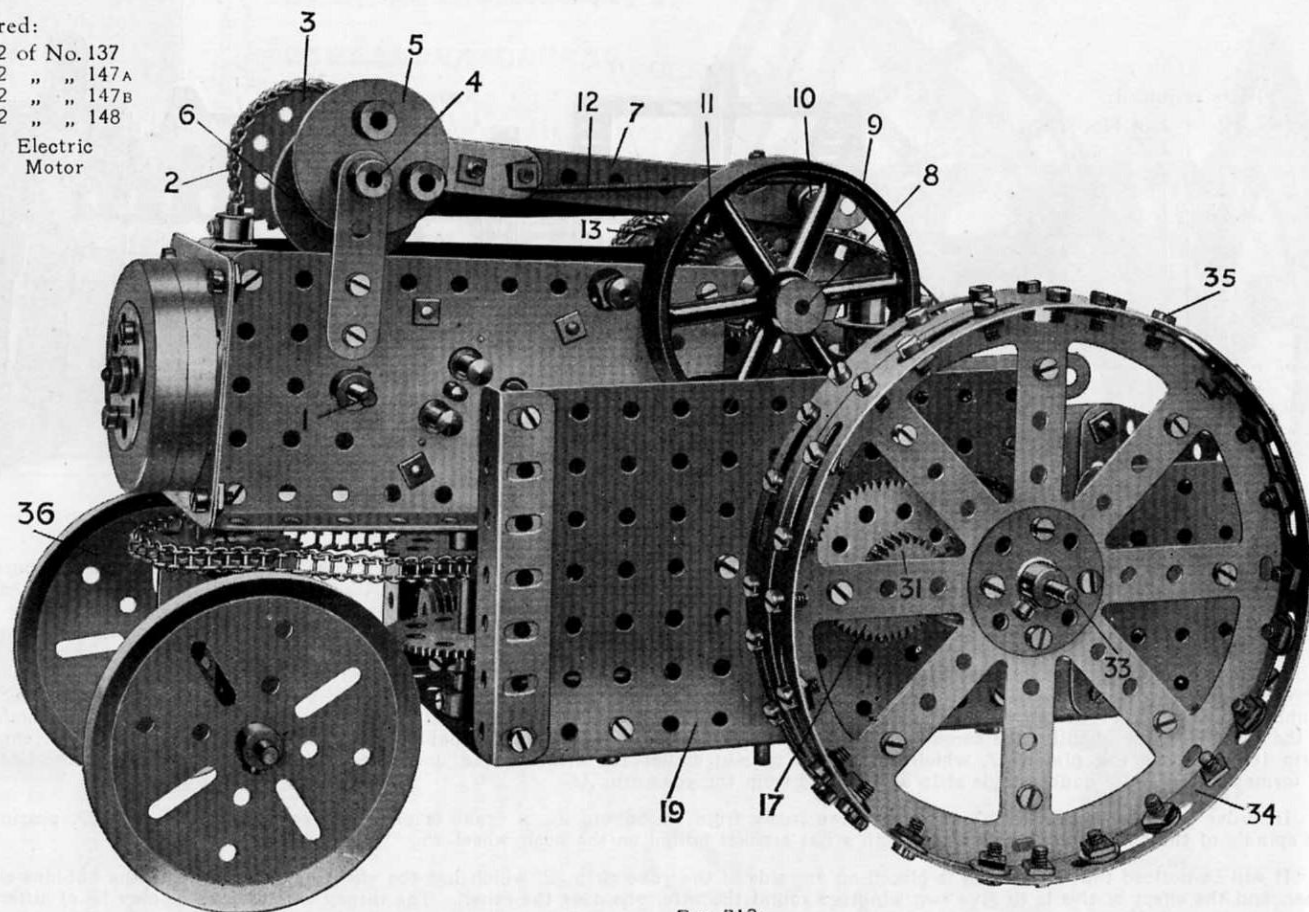


FIG. 712A

The  
wheel, v  
Sec  
pivot b  
about a  
double  
cord 12  
the gea  
Con  
pawls t  
the rod  
of the r  
This ro  
wheel 1  
forming  
The  
ment is  
Drive-cl  
On  
crank 2  
this pin  
mount  
55 on t

10a



## Model No. 712 Tractor (continued)

The driven spindle 1, Fig. A, of the electric motor carries a  $\frac{1}{2}$ " sprocket wheel, which is coupled by a chain 2 to a  $1\frac{1}{2}$ " sprocket wheel 3 on the rod 4.

Secured on this rod are two eccentrics 5 and 6 connected by  $4\frac{1}{2}$ " strips 7 to pivot bolts 10, Fig. B. These are secured to  $1\frac{1}{2}$ " flat girders 10a pivoting about a rod 8 carrying the fly wheel 9. On the pivot bolts 10 are pivoted double pawls, which engage two 1" gear wheels 11 secured on the rod 8. Spring cord 12 connected to the screws 11b keep the pawls in engagement with the gear wheels 11.

Consequently, when the motor is running, the eccentrics 5 and 6 cause the pawls to rock to and fro about the rod 8 and so rotate the gear wheels 11 and the rod 8 to which the wheels are secured. A  $\frac{1}{2}$ " sprocket wheel 13 on the end of the rod 8 is coupled by a chain to a  $1\frac{1}{2}$ " sprocket wheel 14, Fig. C, on a rod 15. This rod carries at its other end a  $\frac{1}{2}$ " pinion 16 engaging a 57-toothed gear wheel 17 on a rod 18, which is mounted to slide in the rectangular plates 19 forming the sides of the tractor.

The rod 18 is caused to slide by turning the crank 20, Fig. C. This movement is fully explained in "Meccano Standard Mechanisms" (see Section V., Drive-changing Gear).

On the rod 18 is a  $\frac{1}{2}$ " pinion 53 and when the short rod mounted in the crank 20 is moved to the left to the next hole in the bush wheel 29, this pinion moves into gear with another  $\frac{1}{2}$ " pinion 54. This pinion 54 is mounted on a short rod and permanently in engagement with another pinion 55 on the rod 33, upon which are fixed the travelling wheels 34.

The rod 33 also carries two 50-toothed gear wheels 32. Two  $\frac{1}{2}$ " pinions 31 on the rod 18 are adapted to be engaged with these 50-toothed gear wheels when the crank 20 is moved one hole to the right in the bush wheel 29 and the pinion 53 is out of engagement with the pinion 54. In this manner the pinions 53, 54 and 55 form a reversing gear, and by moving the crank 20 in either direction a forward or reverse drive of the tractor may be obtained. The central position of the

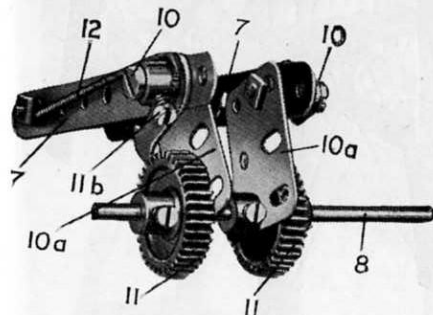


Fig. 712B

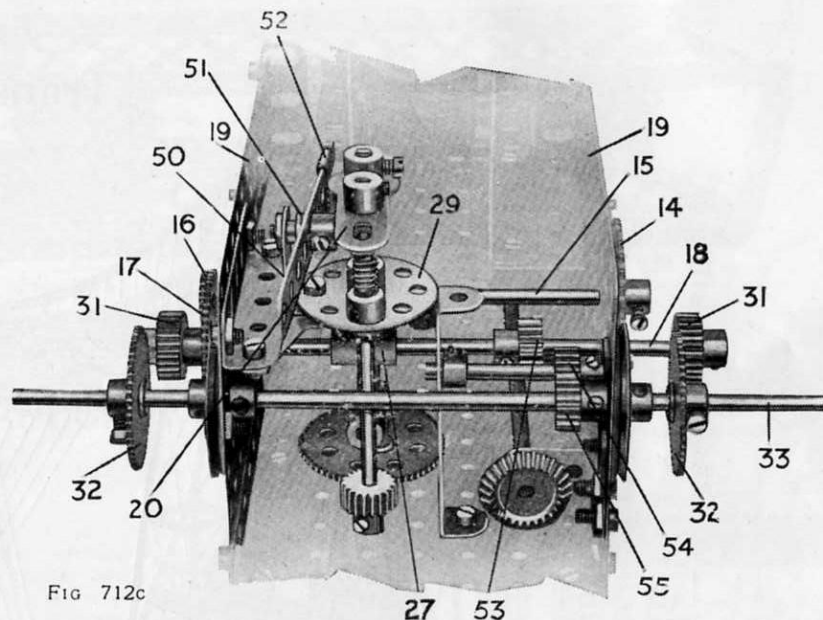


FIG 712C

crank 20 throws all three pinions on the rod 18 out of gear; the motor is then allowed to run freely.

Each of the road-wheels 34 is made up of two hub discs bolted back to back, a number of bolts 35 being secured round the flanges to enable the wheels to obtain a grip on the ground.

The steering gear is described in "Meccano Standard Mechanisms."

The switching of the motor on or off is controlled by the strip 50, Fig. C, pivoted at 51 and connected to the control lever of the motor by an eye piece 52.

It will therefore be seen that if the motor is switched on and the clutch (formed by the pinions 31) be placed in gear, the drive from the motor to the wheels 34 will be effected through the eccentrics 5 and 6, gear wheels 11 and gear train 16, 17, 31 and 32 to the rod 33 carrying the wheels 34. While the motor is still running the drive may be declutched by operating the crank handle 20.

It should be noted that the eccentrics 5 and 6 are opposed to one another when secured to the Rod 4. In this way they alternately impart the thrust, or driving motion, to the rod 8.

An accumulator may be carried in a box formed from two  $2\frac{1}{2}$ "  $\times$   $2\frac{1}{2}$ " flat plates and one  $3\frac{1}{2}$ "  $\times$   $2\frac{1}{2}$ " flanged plate at the rear of the road wheels, Fig. A.



This Model can be made with MECCANO Outfit No. 7, or No. 6 and No. 6A.


## Model No. 713 Transporter Bridge

### Parts

#### required:

32	of No.	1
52	" "	2
8	" "	3
32	" "	4
120	" "	5
32	" "	6
4	" "	7
20	" "	8
8	" "	9
4	" "	10
10	" "	11
89	" "	12
3	" "	14
2	" "	15A
1	" "	17
4	" "	18A
4	" "	20
1	" "	21
5	" "	22
1	" "	26
1	" "	27A
507	" "	37
10	" "	48A
6	" "	52
7	" "	53
15	" "	59
10	" "	94
4	" "	96
3	" "	97
8	" "	99
6	" "	100

Electric Motor

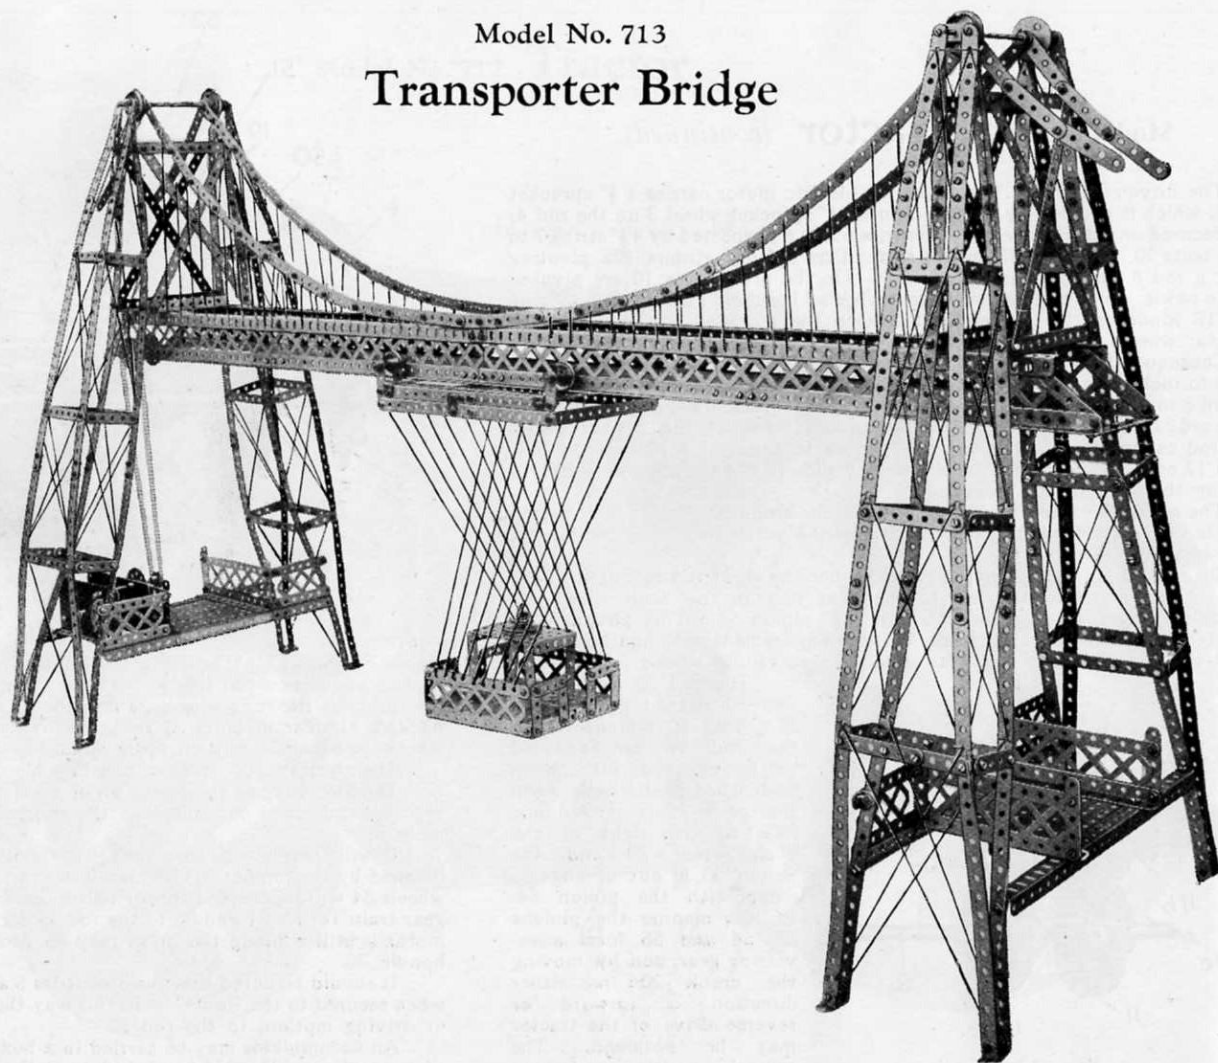

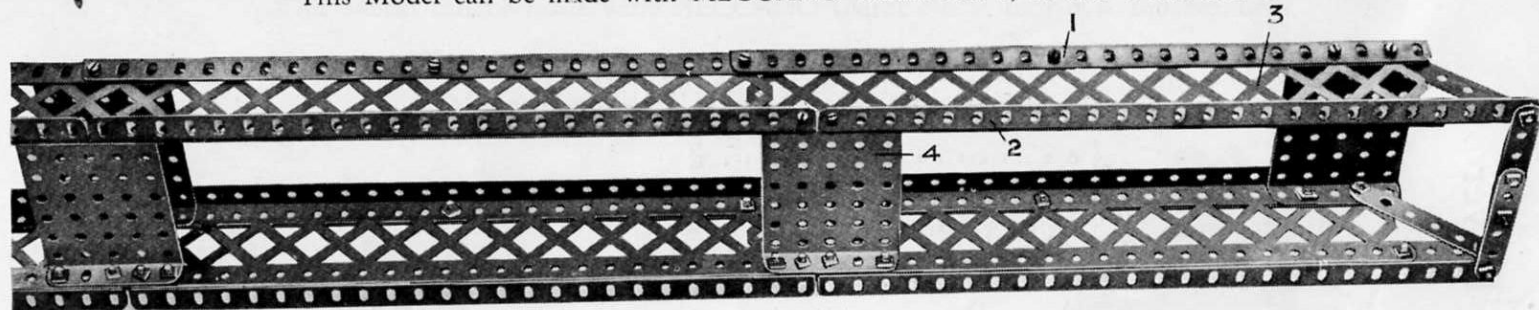


FIG. 713A

### Model No. 713

## Transporter

(continued)

The main girder is built up of side pieces, consisting of top and bottom angle girders 1 and 2 (Fig. A) reversed, and connected together by the braced girder 3. The sides are connected across by small rectangular plates 4. The ends of the main girder are supported from the end towers, as shown in Fig. B. The travelling platform 5 (Fig. C), supported from the carriage 6, runs on 1" pulleys, which travel along the outer edges of the lower angle girders 2. The carriage 6 is moved by a sprocket chain 7 passing round wheels 8 supported in the main girder and operated from the pinion and 57-toothed gear wheel 9 by the sprocket chain 10 driven by the motor.

FIG. 713B


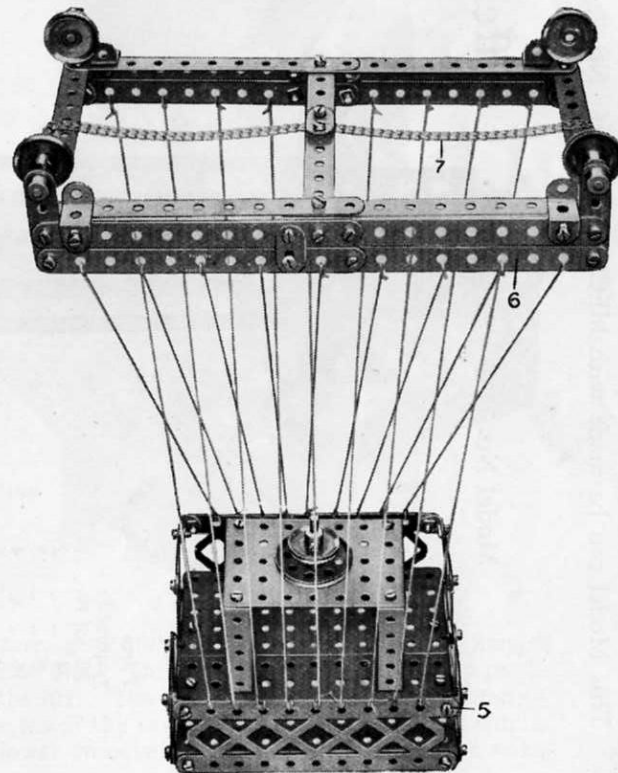


FIG. 713C

Model No. 714

# Eiffel Tower

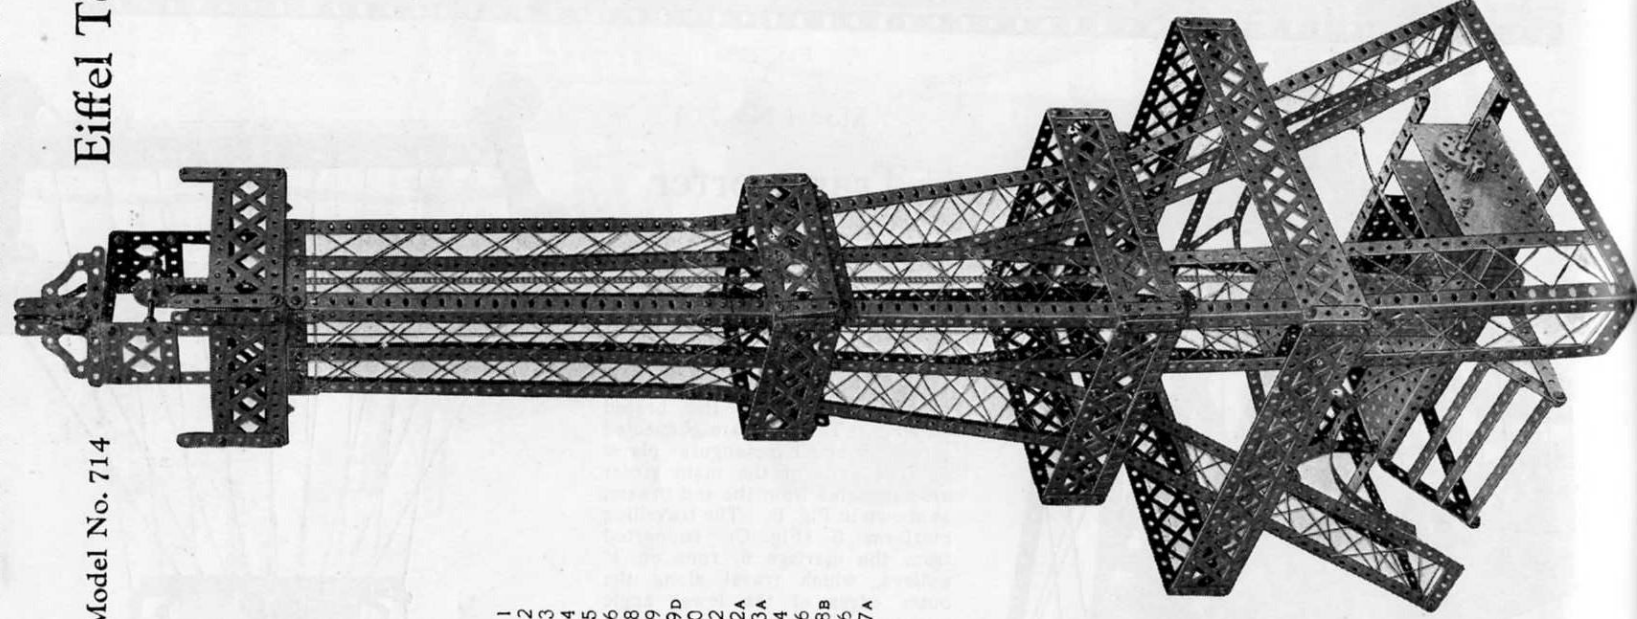

Parts required:	
22 of No.	
24	1
24	2
16	3
8	4
20	5
24	6
18	8
16	9
2	9D
4	10
72	12
4	12A
1	13A
2	14
1	16
1	18B
1	26
2	27A

Parts required:	
1 of No.	
337	32
6	37
1	40
6	47
1	48A
3	48B
3	48D
4	52
8	53
2	59
2	72
3	94
2	96
4	98
4	99
16	100
4	108
Electric Motor	


Model No. 714 Eiffel Tower (*continued*)

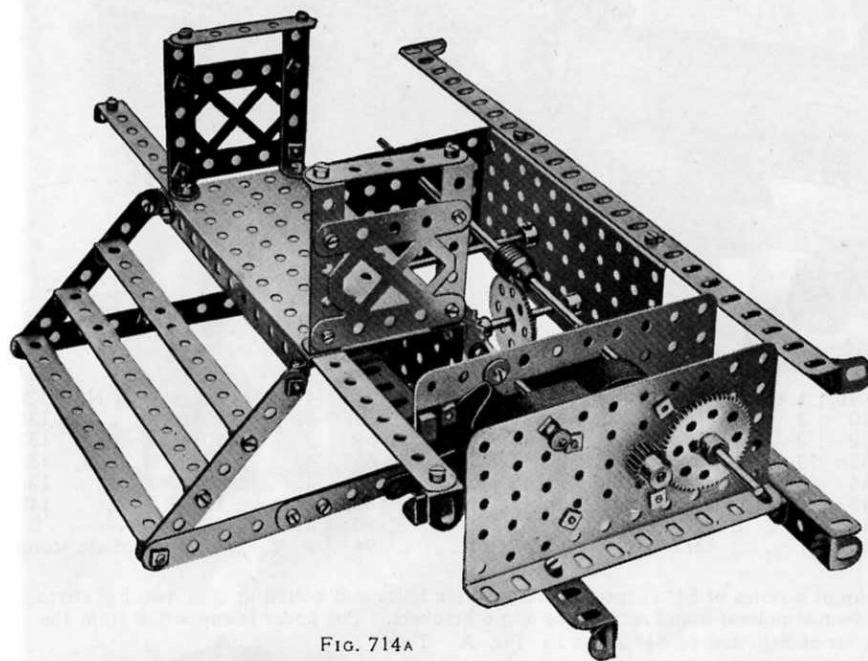FIG. 714A

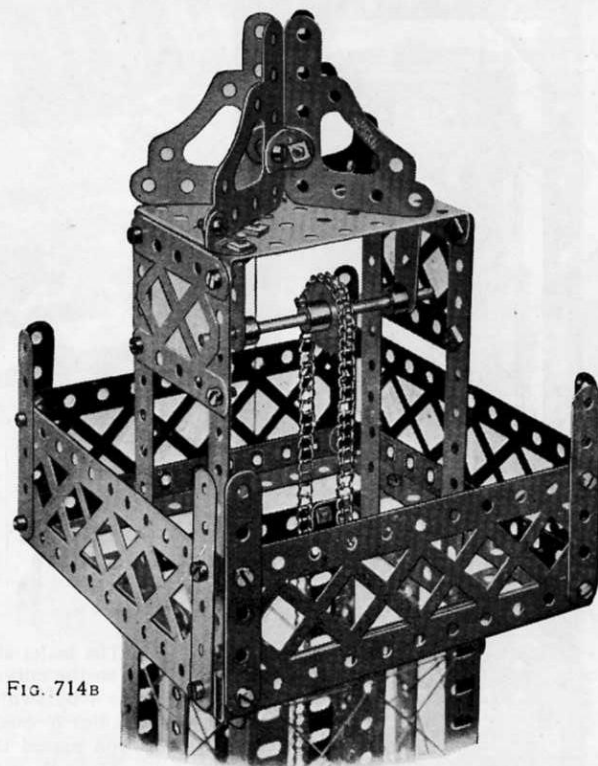


FIG. 714B

The construction of the tower may be followed from the illustrations. The lift carriage is built up from two  $3\frac{1}{2}$ " by  $2\frac{1}{2}$ " flanged plates and two  $2\frac{1}{2}$ " by  $2\frac{1}{2}$ " flat plates and runs on a length of cord which acts as a guide line. This cord is secured to the top of the tower and to a transverse rod in the base, and passes through holes in the plates of the lift. The operation of the lift is affected by means of a length of sprocket chain passing round the 1" sprocket wheel situated in the top of the tower, Fig. 714B, and round a similar wheel in the base, Fig. 714A. The ends of the chain are secured to the lift. The lower sprocket wheel is operated through worm gearing from the electric motor, Fig. 714A.



## Model No. 715 Locomotive and Tender (4-4-0)


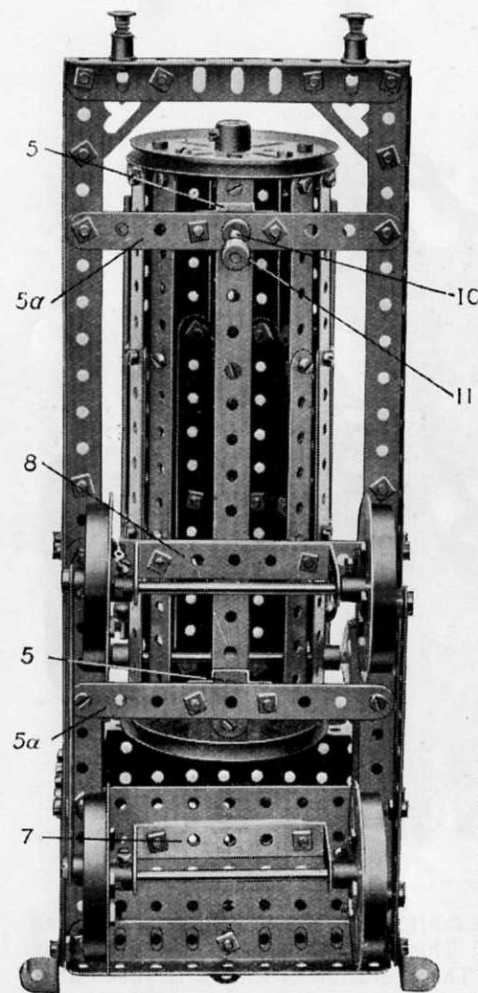


FIG. 715A

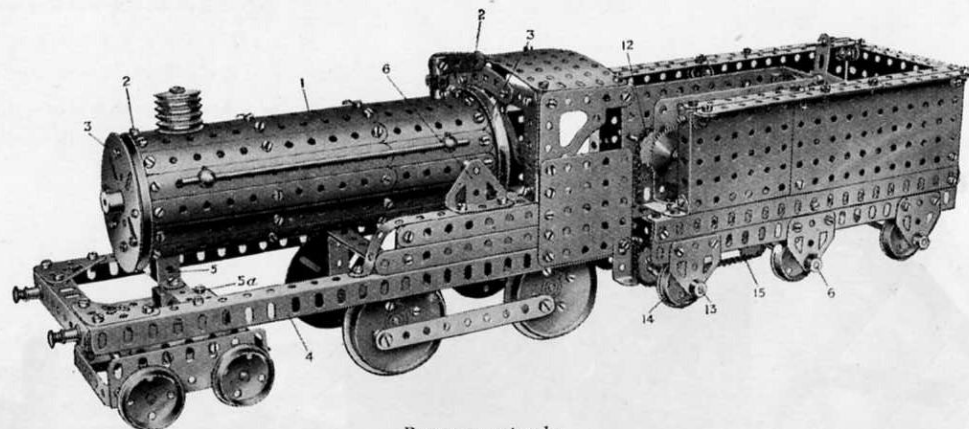

## Parts required:

37 of No. 2	4 of No. 9B	1 of No. 18A	230 of No. 37	2 of No. 53	4 of No. 96	6 of No. 126A
10 " " 2A	1 " " 10	2 " " 18B	12 " " 38	3 " " 53A	2 " " 103A	1 " " 128
2 " " 3	31 " " 12	2 " " 19B	3 " " 45	16 " " 59	3 " " 103D	2 " " 133
2 " " 5	4 " " 12B	10 " " 20	2 " " 47	1 " " 63B	4 " " 108	4 " " 136
1 " " 6A	2 " " 14	5 " " 22A	1 " " 48	3 " " 72	4 " " 109	4 " " 137
2 " " 8	3 " " 15	1 " " 25	2 " " 48A	1 " " 82	1 " " 115	4 " " 147B
2 " " 8A	4 " " 16	1 " " 27	2 " " 52	1 " " 90	4 " " 120A	
4 " " 9A	2 " " 16A	1 " " 27A	1 " " 52A	1 " " 94	2 " " 126	Electric Motor

The boiler shell is built up of a series of  $5\frac{1}{2}$ " strips 1 overlapped six holes and bolted at 2 to two  $5\frac{1}{2}$ " strips bent to the curvature of the two 3" pulleys 3 and secured by angle brackets. The boiler is supported from the frame 4 by two double bent strips 5 bolted to  $4\frac{1}{2}$ " strips 5a, Fig. A. Two trunnions 6, one on each side of the boiler, are bolted to the frame and a  $3\frac{1}{2}$ " rod passed through the boiler and secured at each side by a collar and set screw, the ends resting in the top hole of the trunnions to steady the boiler. The floor of the cab is formed by bolting a  $4\frac{1}{2} \times 2\frac{1}{2}$ " flat plate to the frame, and to the underside of this is bolted a  $2\frac{1}{2} \times 1\frac{1}{2}$ " double angle strip 7, which forms the bearings for the axle of the rear driving wheels; two  $2\frac{1}{2}$ " strips are spaced between this strip and the footplate to allow proper clearance for the wheels. A similar double angle strip 8 is also bolted to a cross strip and spaced away from the engine frame by a washer on each bolt. The bogie, Fig. B, is connected pivotally to the frame by means of a double bent strip 9, into the hole of which is entered the end of a 1" rod

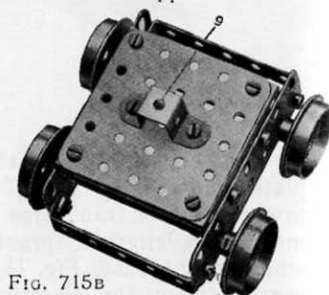


FIG. 715B

# Model No. 715 Locomotive and Tender

(continued)


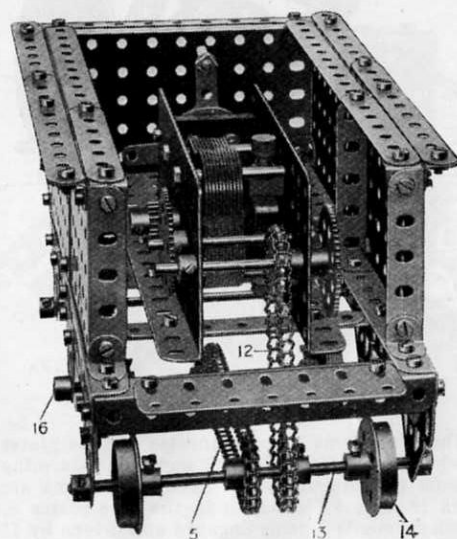


FIG. 715c

10, Fig. A. and retained by two collars 11 on the end of the rod. The loco is propelled from the motor in the tender, Fig. C, the motor driving by the sprocket chain 12 (containing 52 links) the 5" axle rod 13 carrying the flanged wheels 14. The rod 13 is coupled by another chain 15 (containing 59 links) to the middle axle rod 16, thus driving four of the travelling wheels. The four sprocket wheels are 1" in diameter. The accumulator for supplying the current is housed in the tender behind the motor.

# Model No. 716
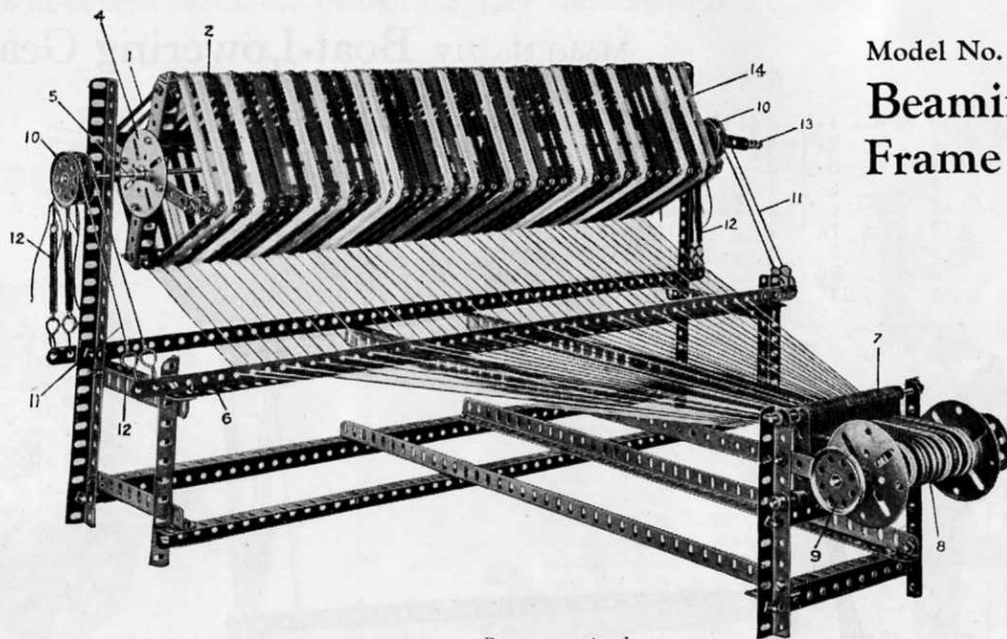
## Beaming Frame



### Parts required:

2 of No. 1	4 of No. 7	8 of No. 12	253 of No. 37	10 of No. 59	1 of No. 147A
4 " " 2	2 " " 7A	2 " " 13	89 " " 38	1 " " 63	1 " " 147B
44 " " 5	12 " " 8	3 " " 14	4 " " 43	1 " " 103	1 " " 148
4 " " 6	10 " " 9	6 " " 21	8 " " 57	4 " " 109	

The frame upon which the warp threads are wound is built up of 12½" angle girders, 2, overlapped seven holes and bolted to a 5½" girder 1 and 5½" strip crossed and connected to face plates 4 on the 11½" rod 5. Inside the frame, two 5½" angle girders are bolted nine holes from each end to form the inner bearings for the rods 5. Another 5½" girder is bolted crosswise to these in the centre to form a stay.

The warp threads are first wound upon the warp-frame, and pass through the holes in a 24½" angle girder 6, and, converging together, pass between the 2½" strips 7 forming the reed, and so on to the beam 8. On the far side of the beam rod is a ½" pinion engaged by a pawl (not shown on the photograph) which prevents backward rotation of the beam as the warp threads are wound thereon by turning the 1½" pulley wheels 9.

A brake mechanism for tensioning the frame 2 is provided by securing two 1" pulley wheels 10 at each end of the frame rod 5, cords 11, secured by hooks passing over the pulleys 10 and being kept taut by the springs 12.

A handle 13 is provided on the rod 5 by means of which the warp threads 14 are originally wound on the frame.

This Model can be made with MECCANO Outfit No. 7, or No. 6 and No. 6A.

## Model No. 717 Boat-Lowering Gear

Parts required:

10 of No. 1A	2 of No. 12	6 of No. 23	2 of No. 48B	3 of No. 109
2 " " 2A	1 " " 12A	4 " " 26	5 " " 52A	1 " " 115
6 " " 3	2 " " 12B	2 " " 27A	6 " " 53	2 " " 126
7 " " 5	1 " " 13	2 " " 31	2 " " 57	2 " " 126A
8 " " 6	2 " " 13A	2 " " 32	13 " " 59	4 " " 129
2 " " 7A	1 " " 15	142 " " 37	2 " " 62	4 " " 147B
2 " " 9	3 " " 16	14 " " 38	2 " " 63	
2 " " 9D	2 " " 16A	1 " " 40	8 " " 90	
3 " " 11	1 " " 18A	5 " " 48A	4 " " 102	

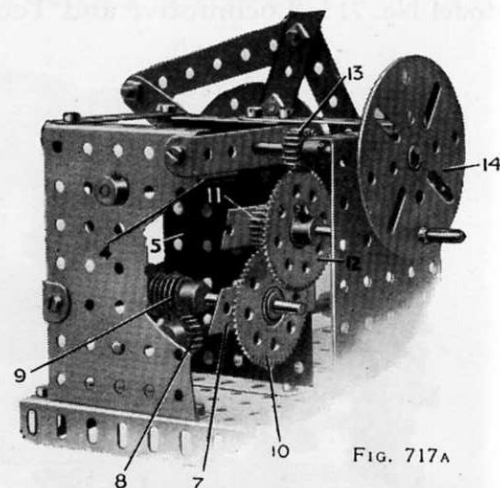
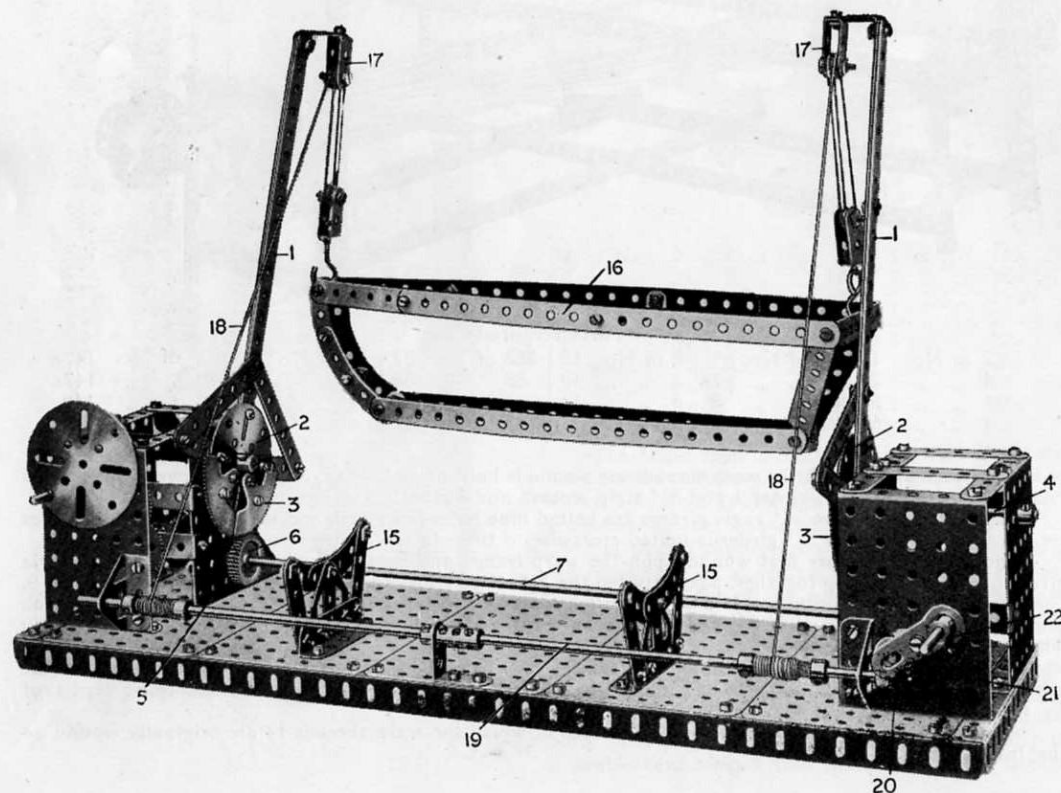


FIG. 717A

The davit arms 1 are connected to face plates 2 to which are bolted two rack segments 3 forming the usual geared quadrants. The davit arms are secured to rods 4 journaled in the face plates 5, the rack segments 3 being engaged and driven by 1" gear wheels 6 on an axle rod 7. This rod 7 carries a pinion 8, Fig. A, driven by a worm 9 and a rod, to which is secured a  $1\frac{1}{2}$ " gear wheel 10. This is driven by a  $\frac{1}{2}$ " pinion 11 on a rod to which is also secured a  $1\frac{1}{2}$ " gear wheel 12 driven by a  $\frac{1}{2}$ " pinion 13 rotated by a hand wheel formed by a face plate 14. As the hand wheel is rotated, the davit arms are raised outward when launching the boat 16 or inward when it is desired to deposit the boat on the chocks 15.


The boat 16 is raised or lowered from the blocks 17 by the ropes 18 which wind on to a rod 19. On this rod is secured a  $\frac{1}{2}$ " pinion 20 engaged by a worm 21 which is rotated by the crank handle 22 formed of two cranks bolted together, and in this way the boat may be lowered over the ship's side.

These Models can be made with MECCANO Outfit No. 7, or No. 6 and No. 6A.

181

Model No. 718

## A Gay Start

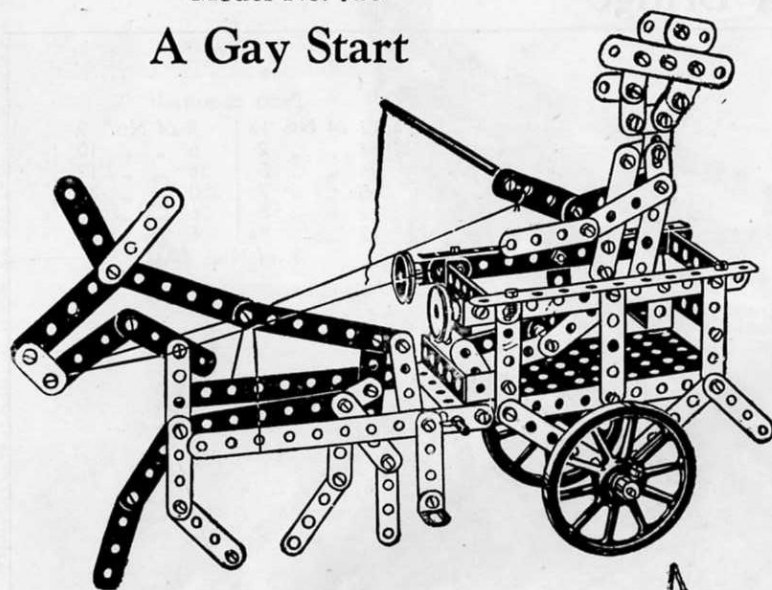


Parts

required:

6	of No.	2
2	"	3
5	"	4
10	"	5
24	"	6
23	"	10
8	"	12
1	"	15
1	"	15A
1	"	16
2	"	19B
2	"	22
2	"	35
71	"	37
2	"	46
3	"	48A
1	"	52

Model No. 719

## The End of a Perfect Day

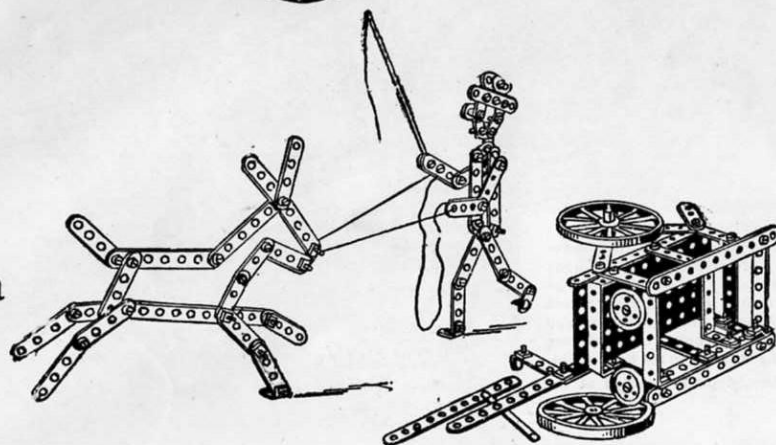


Model No. 720

## Grandfather Clock

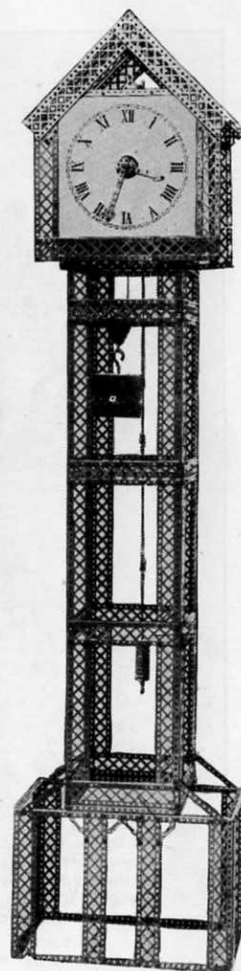This Meccano model of a Grandfather Clock stands over 6 ft. in height and keeps perfect time. With the exception of an 18 lb. weight, the dial plate and a small piece of flat spring (about 2" in length), the model is made entirely from Meccano parts. It would take up too much space to describe the construction of the Clock in detail in this Manual and we have therefore prepared a special leaflet in which the model is fully described and illustrated. The leaflet is included in the No. 7 Outfit. It may also be purchased either from any Meccano dealer or from Meccano Ltd., Liverpool, price 1½d. (post free 2d.)

It should be noted that in constructing the Clock frame exactly as shown in the illustration, 33 12½" and 22 9½" braced girders are required in addition to the No. 7 Outfit. These girders are only ornamental however, and they can be dispensed with if necessary. In addition the wire line (part No. 141) with which the weight is suspended, is not included in the Outfit.





This Model can be made with MECCANO Outfit No. 7, or No. 6 and No. 6A.

## Model No. 721 Forth Bridge

### Parts required:

12 of No. 1A	8 of No. 9
74 " " 2	6 " " 10
24 " " 5	36 " " 12
6 " " 7	350 " " 37
12 " " 8	26 " " 38
12 " " 8A	6 " " 52
3 of No. 52A	

Each of the cantilever spans is made of  $9\frac{1}{2}$ " angle girders, connected by their lower ends to a  $5\frac{1}{2}$ " angle girder. The inclined  $12\frac{1}{2}$ " angle girders are connected at the apex of the cantilever to the top holes of the inclined girders coupled by flat brackets and at their lower outer ends to horizontal angle girders. The horizontal girders are connected across by  $5\frac{1}{2}$ " strips disposed at intervals of about 11 holes apart. On these are secured gauge 0 track rails, held to the cross strips by bolts, beneath the heads of which are washers engaging the lower flange of the track rails and binding them on to the cross strips.

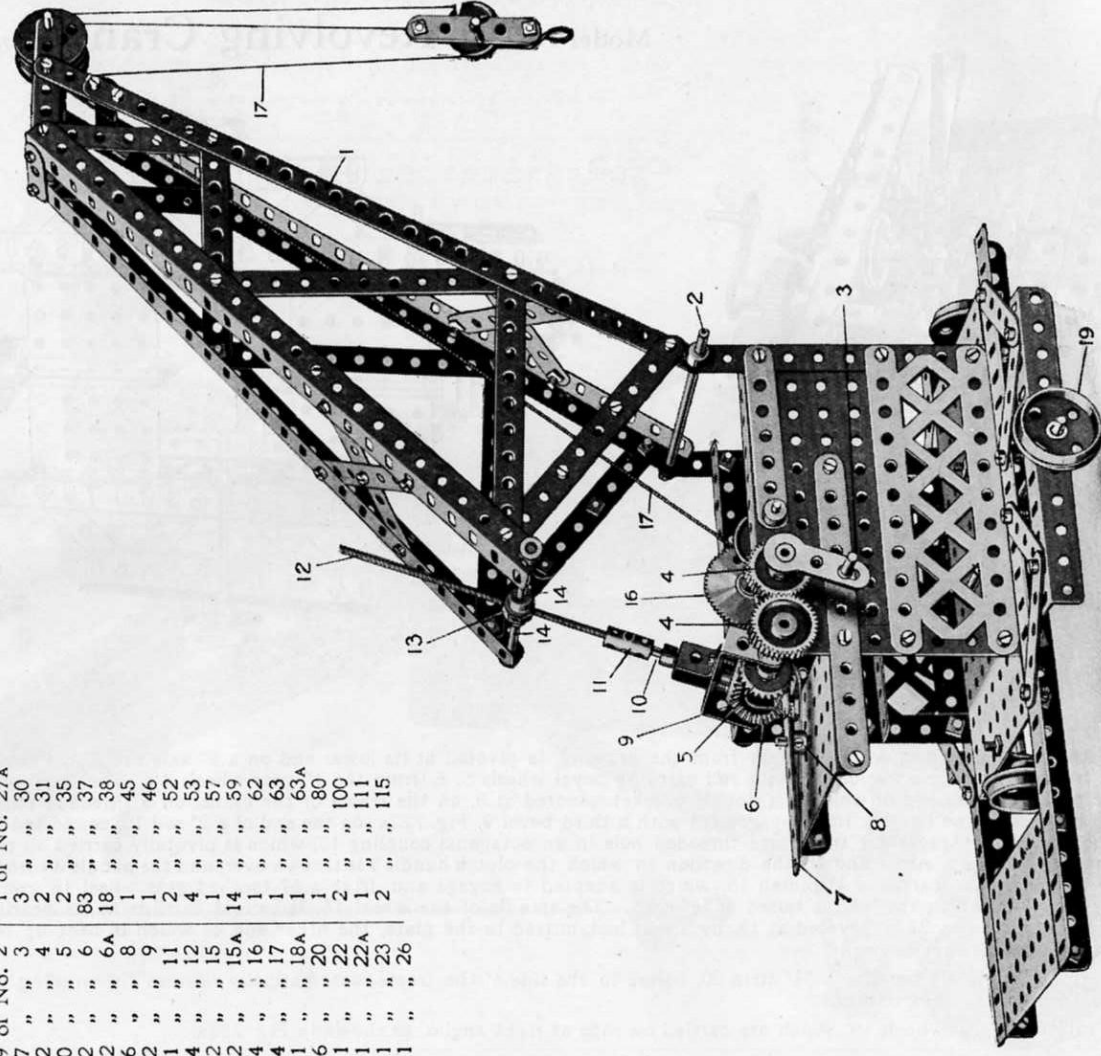
The bases of the cantilevers are formed by two  $5\frac{1}{2}$ " flanged plates coupled at the centre by a  $5\frac{1}{2}$ " flat plate.

This Model can be made with MECCANO Outfit No. 7, or No. 6 and No. 6A.

## Model No. 722 Revolving Crane

Parts required:

9 of No. 2	1 of No. 27A
17	3
2	3
10	2
2	2
2	83
2	18
6	1
2	1
1	1
2	11
4	12
2	15
2	15A
4	16
4	17
1	18A
6	20
1	22
1	22A
1	23
1	26



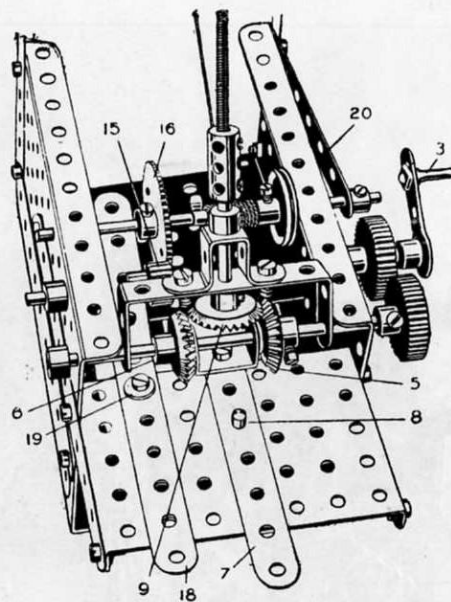
Model No. 722 **Revolving Crane** (continued)

FIG. 722A

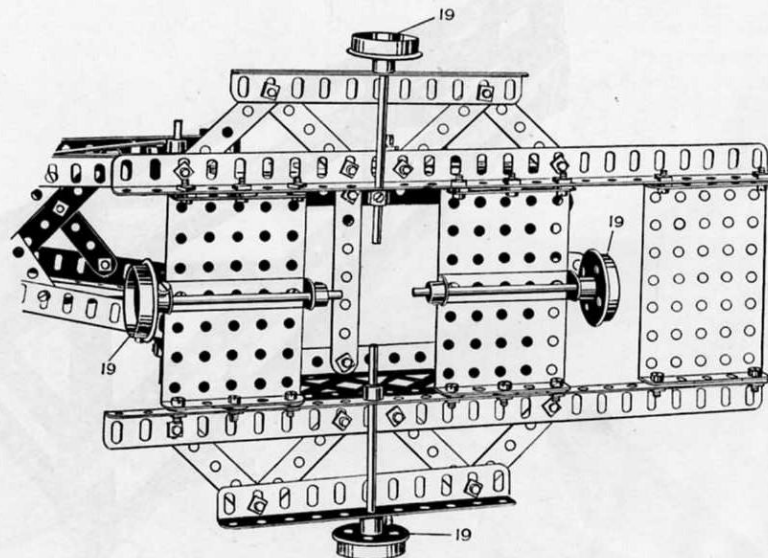


FIG. 722B

The jib 1, the construction of which is clear from the drawing, is pivoted at its lower end on a 5" axle rod 2, the movement of the jib about this pivot being obtained from the handle 3, which drives a rod carrying bevel wheels 5, 6 (from the 1" gear wheels 4). The bevel wheel rod is arranged to slide in its bearings by the strip 7, at the end of which is a double bracket, pivoted at 8, on the frame of the crane, on a threaded pin under which is a collar, and thus bring either the bevel 5, or the bevel 6, into engagement with a third bevel 9, Fig. 722A, on the end of a 2" rod 10, connected by the coupling 11, to a 5" screwed rod 12. This screwed rod engages the transverse threaded hole in an octagonal coupling 13, which is pivotally carried on two 2" rods 14, so as to give a clear way for the screwed rod 12. According to the direction in which the clutch handle 7 is thrown over, and the handle 3 turned, the jib will be raised or lowered. The rod of the handle 3, also carries a  $\frac{1}{2}$ " pinion 15, which is adapted to engage and drive a 57-toothed gear wheel 16, round the spindle of which is wound the cord 17, by means of which the load is raised or lowered. The spindle of the wheel 16, is caused to slide in its bearings to engage the pinion 15, by means of the  $5\frac{1}{2}$ " strip 18, Fig. 722A, pivoted at 19, by a bolt lock-nutted to the plate, the other end of which is bent up to engage between the boss of the gear wheel 16, and a collar (not shown).


A spring formed by slightly bending a  $3\frac{1}{2}$ " strip 20, bolted to the side of the frame, automatically releases the winding spindle from engagement with the pinion 15 when the handle 18 is released.

The crane rotates on the wheels 19, which are carried on rods at right angles, as shown in Fig. 722B.

This Model can be made with MECCANO Outfit No. 7, or No. 6 and No. 6A.

Model No. 723

## Hydraulic Crane

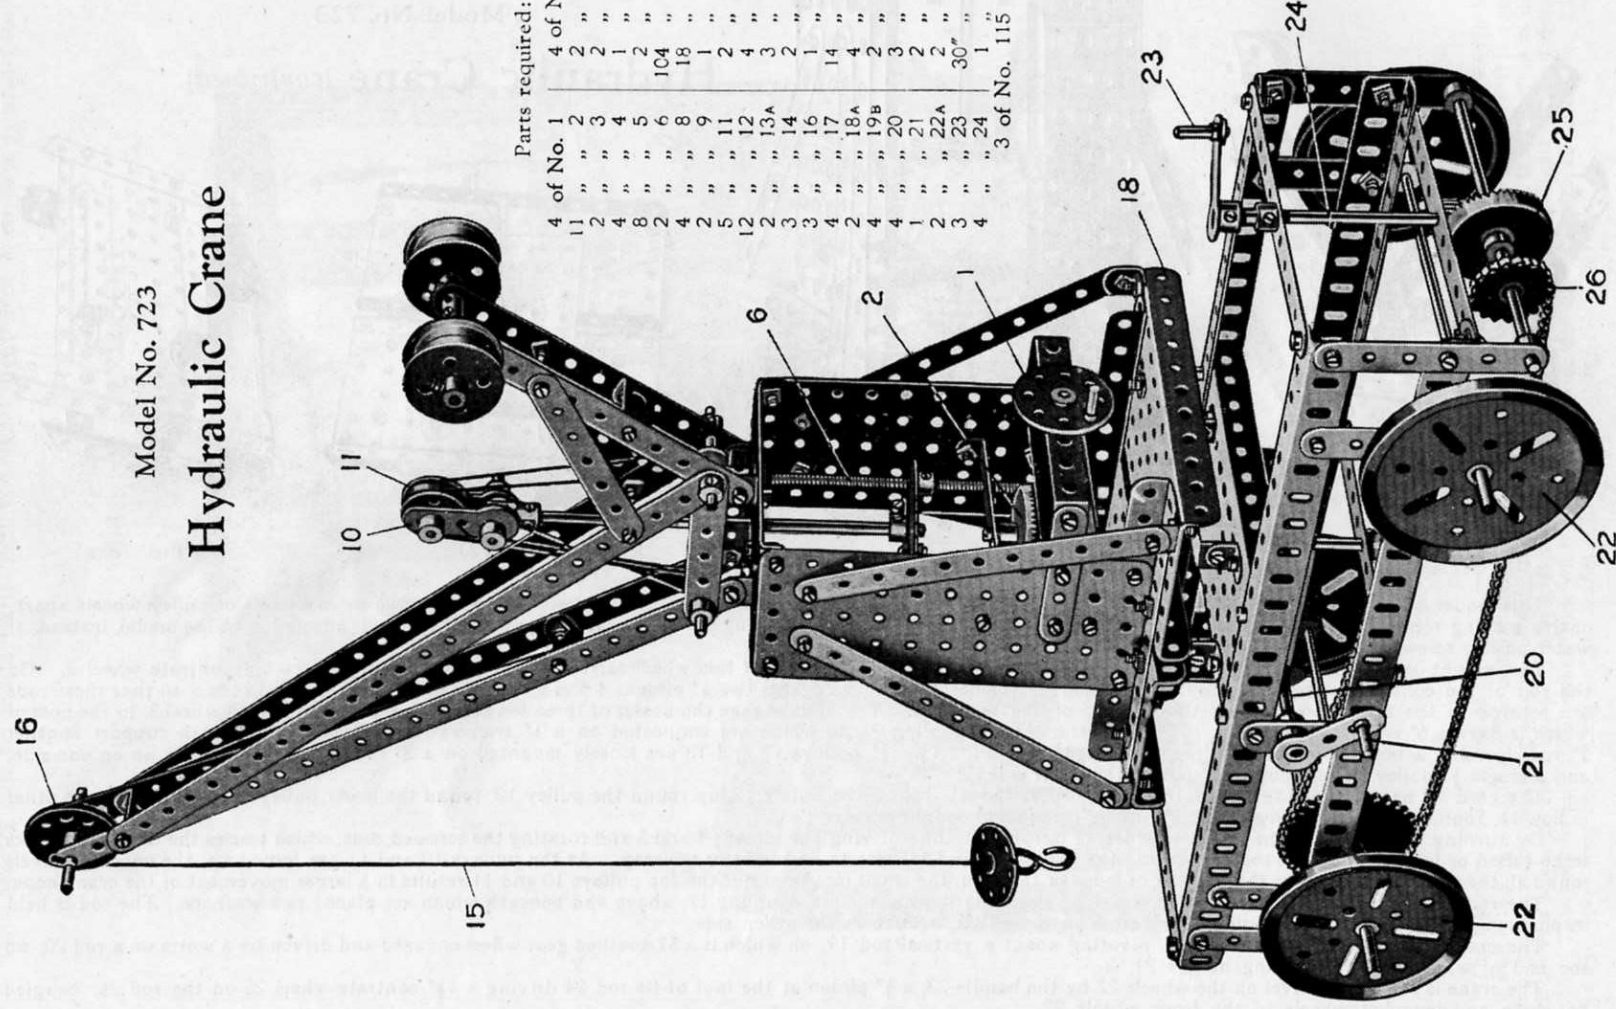

Parts required:

4 of No. 1	4 of No. 26
11	27A
2	2
3	28
4	1
8	32
2	35
4	37
2	104
4	18
2	38
5	1
11	45
12	2
2	48A
3	48B
3	52
4	53
3	57
4	59
2	62
4	62A
4	63
1	70
2	80
3	94
4	95
2	30"
1	3 of No. 115



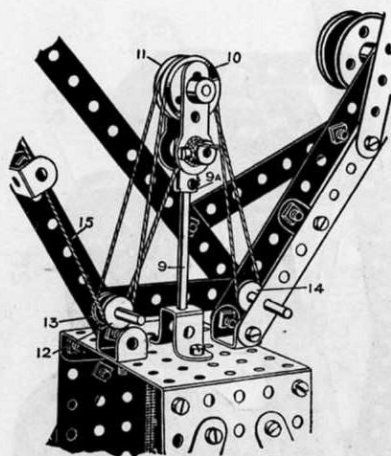


FIG. 723b

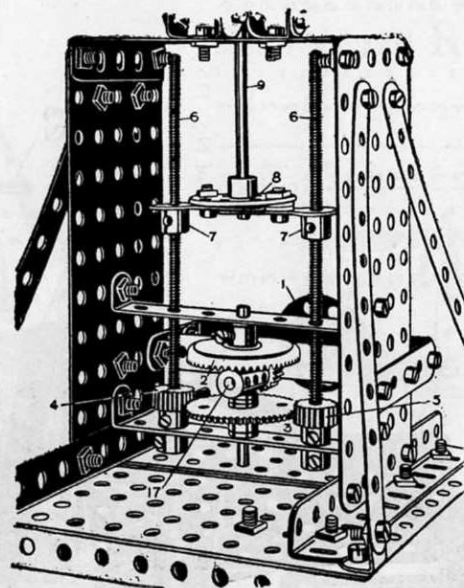


FIG. 723c

## Model No. 723 Hydraulic Crane *(continued)*

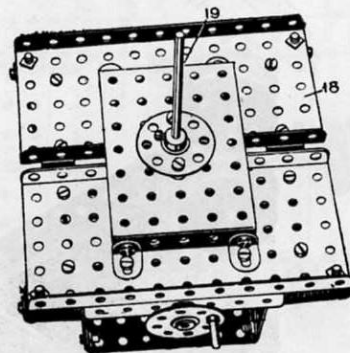


FIG. 723d

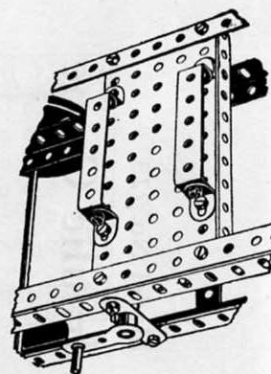


FIG. 723e

This model is designed to illustrate the operating of a Hydraulic Crane, in which great power is utilised to force two or more sets of pulley wheels apart, chains passing round the pulley wheels so that by a small movement of the operating power a great movement of the load is effected. In the model, instead of water-power, screws are used to move the chain or cord pulleys.

The weight is raised or lowered by operating the hand-wheel 1. The rod of this wheel carries a pinion which gears with a  $1\frac{1}{2}$ " contrate wheel 2. On the rod of the contrate wheel is a lower 57-toothed gear wheel 3, which engages two  $\frac{1}{2}$ " pinions 4 and 5, secured on vertical screwed rods 6, so that these rods are rotated in the same direction on the turning of the handle 1. The rods engage the bosses of threaded cranks 7, secured on a bush wheel 8, in the boss of which is fixed a 6" rod 9. This rod at the top is secured in a coupling 9a, to which are connected on a 1" transverse rod two cranks which support another 1" rod, forming a bearing for two 1" loose pulleys 10 and 11. Two  $\frac{1}{2}$ " pulleys 12 and 13 are loosely mounted on a 2" rod at the base of the jib on one side, and a single  $\frac{1}{2}$ " pulley 14 on another 2" rod at the other side.

The cord 15 passes over the pulley 16 at the top of the jib, round the pulley 12, up round the pulley 10, round the lower pulley 14, back round the other pulley 11, round the small pulley 13, and is made fast to the coupling 9a.

By turning the handle 1 the contrate wheel 2 is rotated, thus driving the pinions 4 and 5 and rotating the screwed rods, which causes the threaded cranks to be raised or lowered, and the rod 9, carrying the pulleys 10 and 11, also to be raised or lowered. As the pulleys 10 and 11 are forced up, the cord 15 travels round all the pulleys, and, due to the number of loops of the cord, the small movement of the top pulleys 10 and 11 results in a larger movement of the crane hook.


The rod of the bush wheel 1, which carries a  $\frac{1}{2}$ " pinion, is journaled in a coupling 17, above and beneath which are placed two washers. The rod is held in position by the wheel 1 on one side of the cross strip, and by a collar on the other side.

The crane is carried on a platform 18, pivoting about a vertical rod 19, on which is a 57-toothed gear wheel engaged and driven by a worm on a rod 20, on the end of which is the operating handle 21.

The crane is caused to travel on the wheels 22 by the handle 23, a  $\frac{1}{2}$ " pinion at the foot of its rod 24 driving a  $1\frac{1}{2}$ " contrate wheel 25 on the rod 26, coupled by chain and sprocket wheels to the front wheels 22.

This Model can be made with MECCANO Outfit No. 7, or No. 6 and No. 6A.

## Model No. 724 Loom

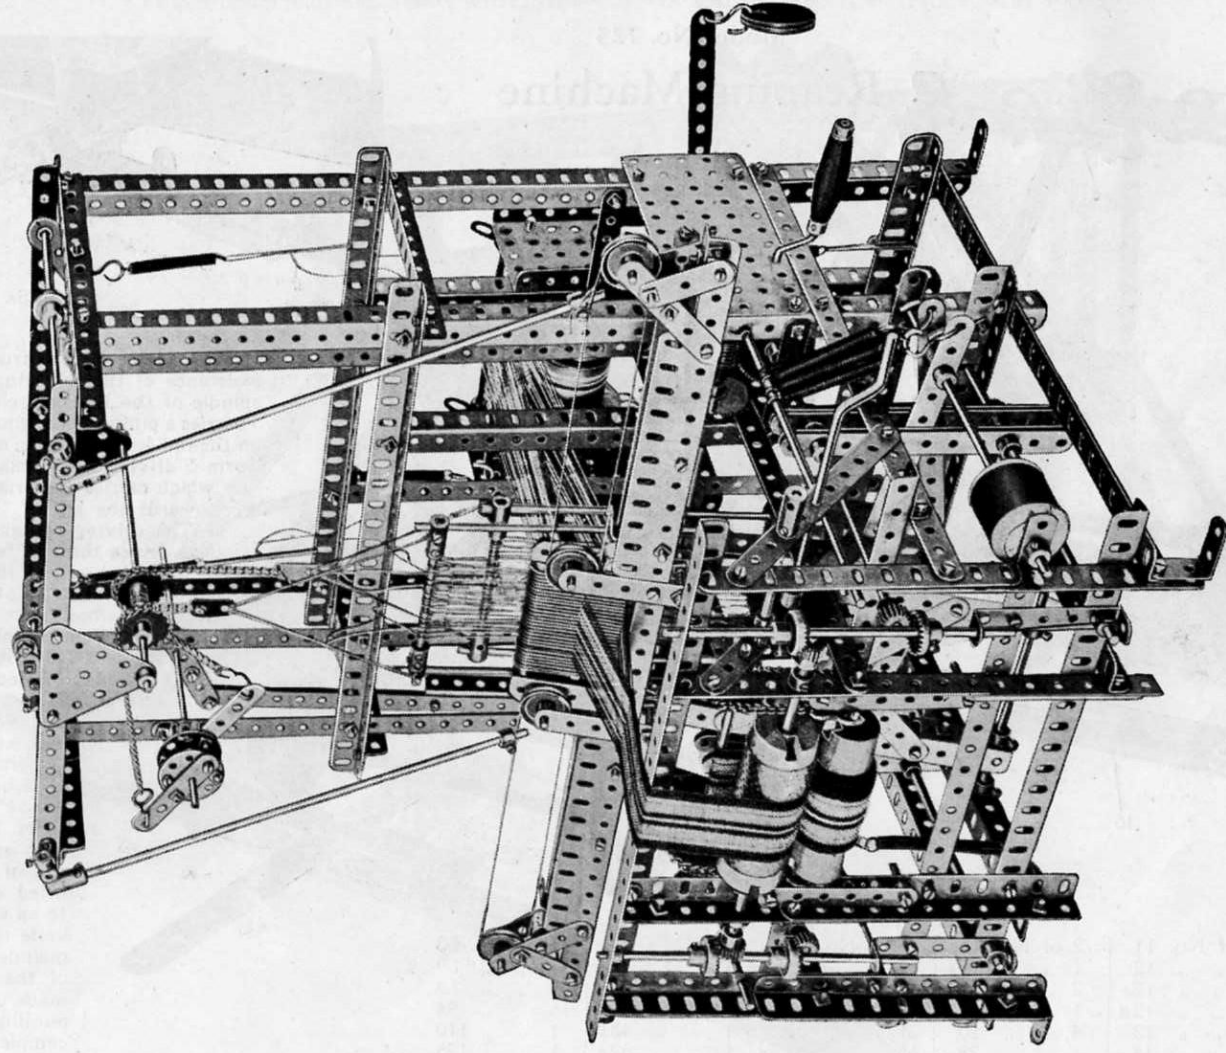

The Meccano Loom is one of the most remarkable and interesting models that can be made with Meccano. It is absolutely automatic and beautiful material may be woven by simply turning the handle. It is a somewhat complicated model, requiring careful construction and accurate adjustment and as it is impossible to do justice to it in this book, we have compiled a special sheet of instructions in which it is illustrated and described in detail. This may be purchased either from your local Meccano dealer or from Meccano Limited, Liverpool. Price 1½d. (post free, 2d.) A copy of the leaflet is included in every No. 7 Outfit.

This Model can be made with MECCANO Outfit No. 7, or No. 6 and No. 6A.

### Model No. 725

## Reaping Machine

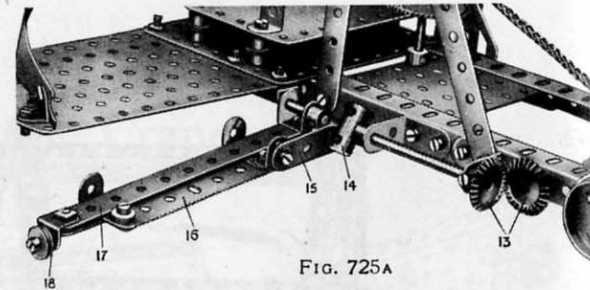
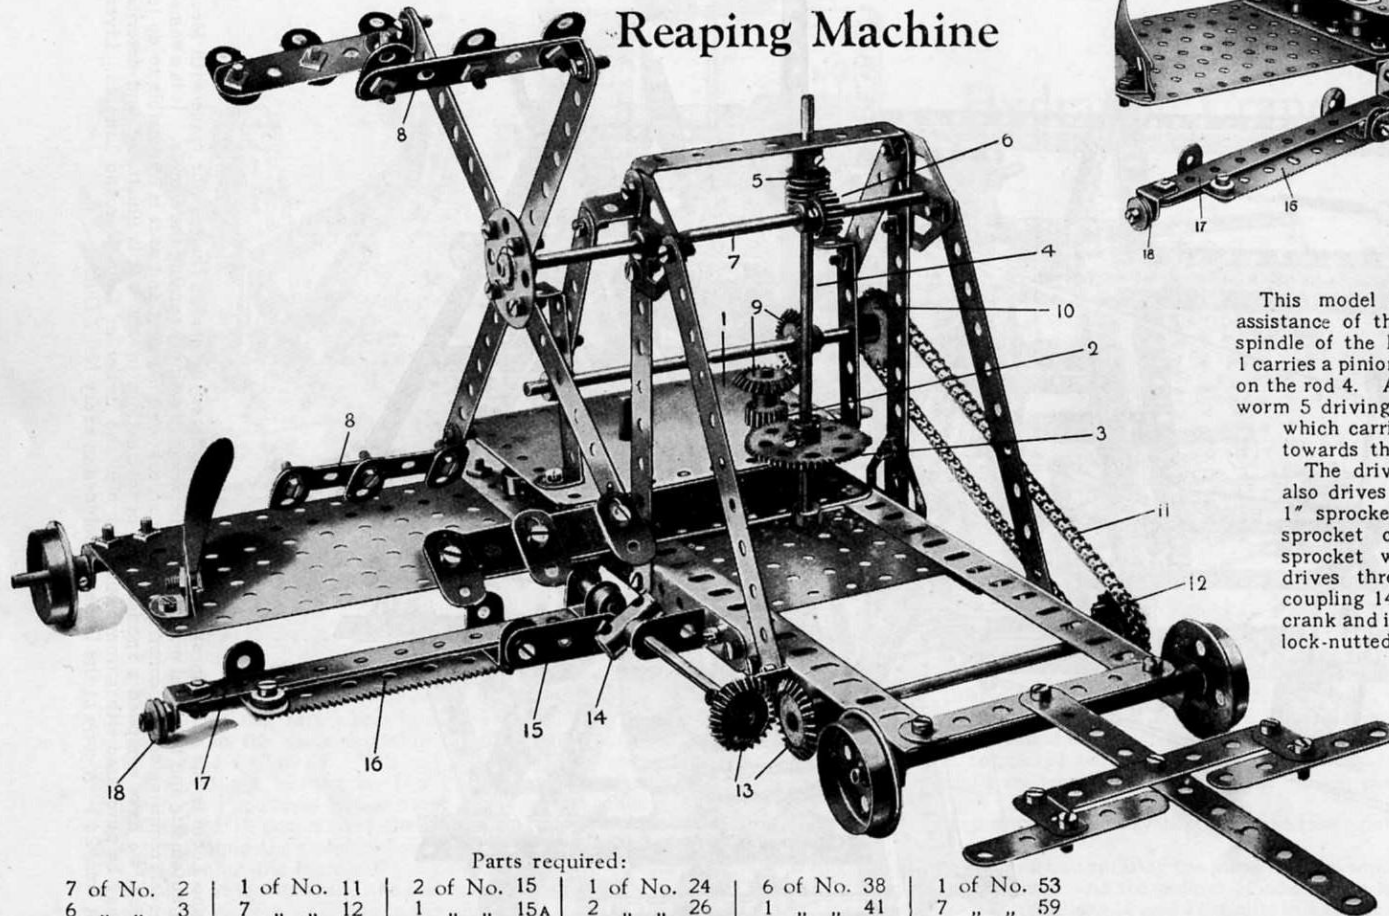


FIG. 725A

This model is constructed with the assistance of the following details. The spindle of the Meccano clockwork motor 1 carries a pinion 2 engaging a gear wheel 3 on the rod 4. At the top of this rod 4 is a worm 5 driving a  $\frac{1}{2}$ " pinion 6 on a rod 7 which carries the arms 8 that sweep towards the knife.

The driving spindle of the motor also drives through bevel pinions 9 a 1" sprocket wheel 10 coupled by a sprocket chain 11 to another 1" sprocket wheel 12, which in turn drives through bevel wheels 13 a coupling 14. This coupling acts as a crank and is connected by  $1\frac{1}{2}$ " strip 15 lock-nutted to the cutter 16. The

cutter is formed by a rack strip guided to and fro by two  $1" \times \frac{1}{2}"$  angle brackets between two  $5\frac{1}{4}"$  strips 17 spaced apart by washers at each end. The outer end of these strips is fitted with a  $\frac{1}{2}"$  pulley 18 on which the cutter knife travels. The remainder of the detail of the model will be made quite clear from our illustration. When completed the model works in a very realistic manner.

#### Parts required:

7 of No. 2	1 of No. 11	2 of No. 15	1 of No. 24	6 of No. 38	1 of No. 53
6 " " 3	7 " " 12	1 " " 15A	2 " " 26	1 " " 41	7 " " 59
8 " " 5	2 " " 12A	2 " " 16B	1 " " 27A	1 " " 48	1 " " 63
1 " " 6A	4 " " 12B	1 " " 17	4 " " 30	2 " " 48A	16 " " 94
2 " " 8A	1 " " 13	4 " " 20	1 " " 32	1 " " 48B	1 " " 110
14 " " 10	2 " " 14	1 " " 23	66 " " 37	1 " " 52A	1 " " 125

3 of No. 126A

Clockwork\_Motor

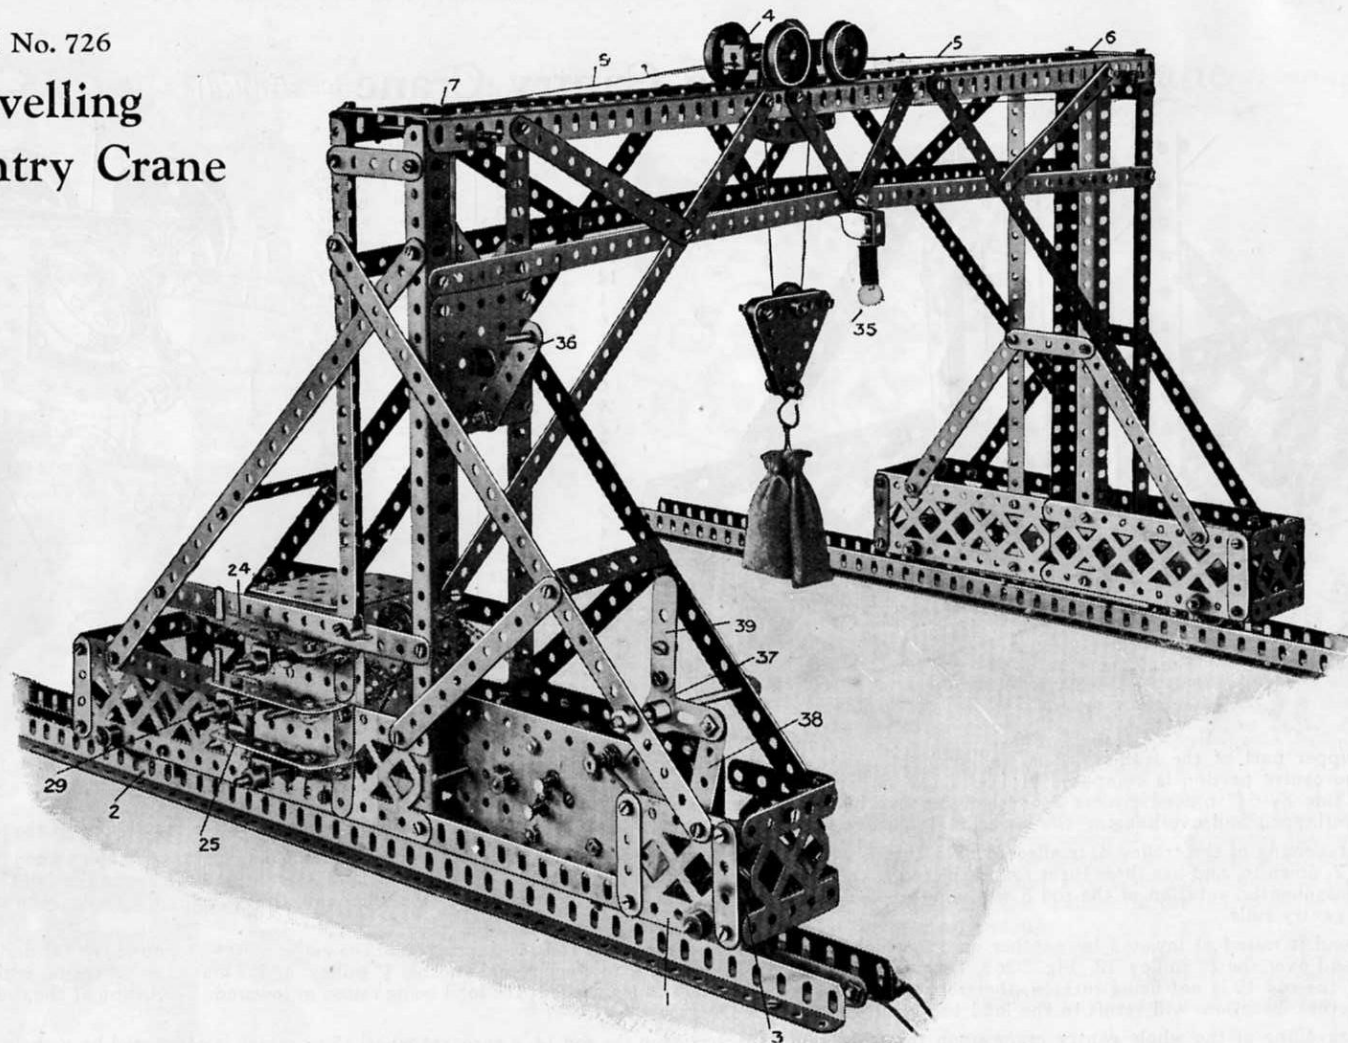


This Model can be made with MECCANO Outfit No. 7, or No. 6 and No. 6A.

189

Model No. 726

# Travelling Gantry Crane





## Model No. 726 Travelling Gantry Crane (continued)

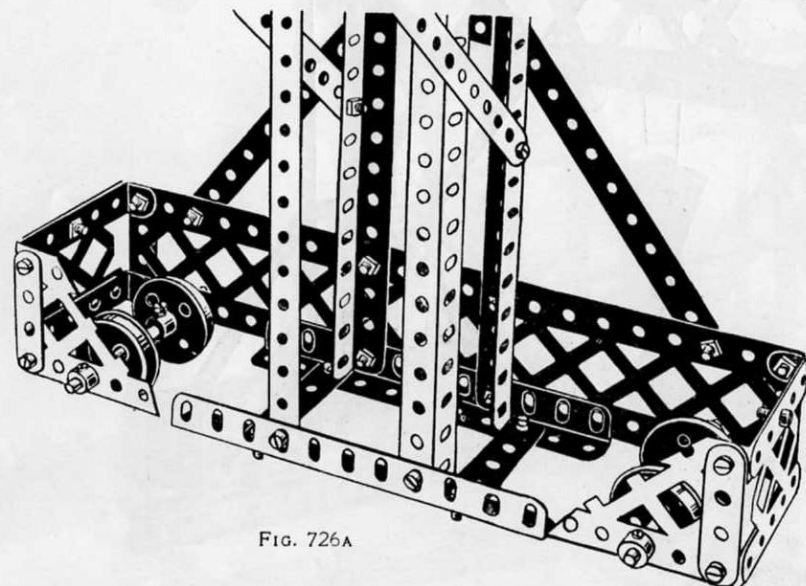


Fig. 726A

## Parts required:

12 of No. 1	3 of No. 26
12 " " 2	3 " " 27
6 " " 3	3 " " 27A
3 " " 4	11 " " 35
17 " " 5	149 " " 37
14 " " 6	10 " " 37A
1 " " 6A	38 " " 38
6 " " 7	3 " " 44
10 " " 8	9 " " 48A
2 " " 9	2 " " 53
6 " " 11	1 " " 57
4 " " 12A	30 " " 59
2 " " 15	1 " " 72
2 " " 15A	2 " " 76
11 " " 16	2 " " 90
1 " " 16A	26 " " 94
2 " " 17	1 " " 95
4 " " 18A	3 " " 96
12 " " 20	8 " " 98
8 " " 22A	6 " " 100
2 " " 23	2 " " 111
2 " " 25	1 " " 128

Electric Motor

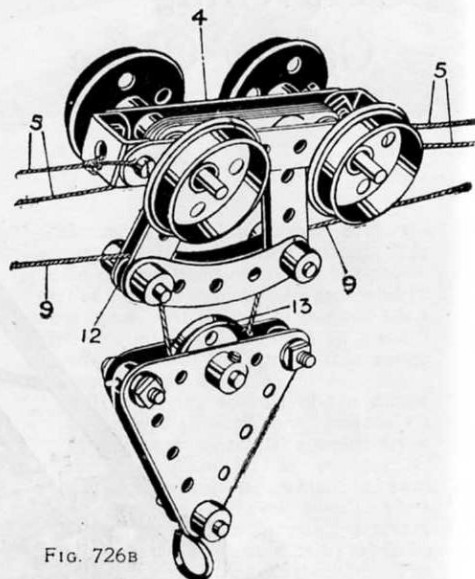


Fig. 726B

The upper part of the framework is well brought out in the illustration. It is to be noted that as regards the feet carrying the motor and the travelling wheels, the centre portion is composed of  $12\frac{1}{2}$ " angle girders at the lower edge, extended on one side by  $2\frac{1}{2}$ " braced girders 1, overhanging 4 holes, and on the other side by  $5\frac{1}{2}$ " braced girders 2 overhanging five holes. The other shorter foot on the gantry is shown in Fig. 726A, and is built up of  $5\frac{1}{2}$ " braced girders overlapped and overhanging the lower angle girders five holes on each side. The travelling wheels 3 are carried in the lower holes of the braced girders.

The traversing of the trolley 4, is effected by a cord 5 which passes from the far end of trolley 4, round a pulley 6, and is returned and passed over one of the 1" pulleys 7, down to, and has three turns round the rod 8, then passing up and round another of the pulleys 7, and is connected to the near end of the trolley, Fig. 726B. Consequently, rotation of the rod 8 will wind up one end of the traversing cord 5 and pay out the other end, thus causing the trolley 4 to travel to or fro along the gantry rails.

The load is raised or lowered by another cord 9 which is wound round the upper rod 10, thence round the guide pulley 11, round the third of the pulleys 7, Fig. 726, and over the  $\frac{1}{2}$ " pulley 12, Fig. 726B, beneath the 1" pulley 13, on the load block round another  $\frac{1}{2}$ " pulley, and is made fast on the far end of the gantry frame. If the rod 10 is not being rotated, therefore, the trolley 4 travels to and fro without the load being raised or lowered. Rotation of the rod 10, however, in one or other direction, will result in the load being raised or lowered.

The travelling of the whole gantry crane upon the wheels 3 is effected from the rod 14, a sprocket wheel 15 on which is connected by a chain 16 to another sprocket wheel 17 on the rod 18 of the travelling wheels, 726C. The rods 8, 10 and 14 are operated as follows: The motor spindle 19, Fig. 726D, drives by the chain 20 a 2" sprocket wheel 21 on a rod 22, on which is a  $\frac{1}{4}$ " pinion 23, Fig. 726C. The rods 10 and 8 are slideably controlled by the clutch operating handles 24,

This Model can be made with MECCANO Outfit No. 7, or No. 6 and No. 6A.

191

## Model No. 726 Travelling Gantry Crane *(continued)*

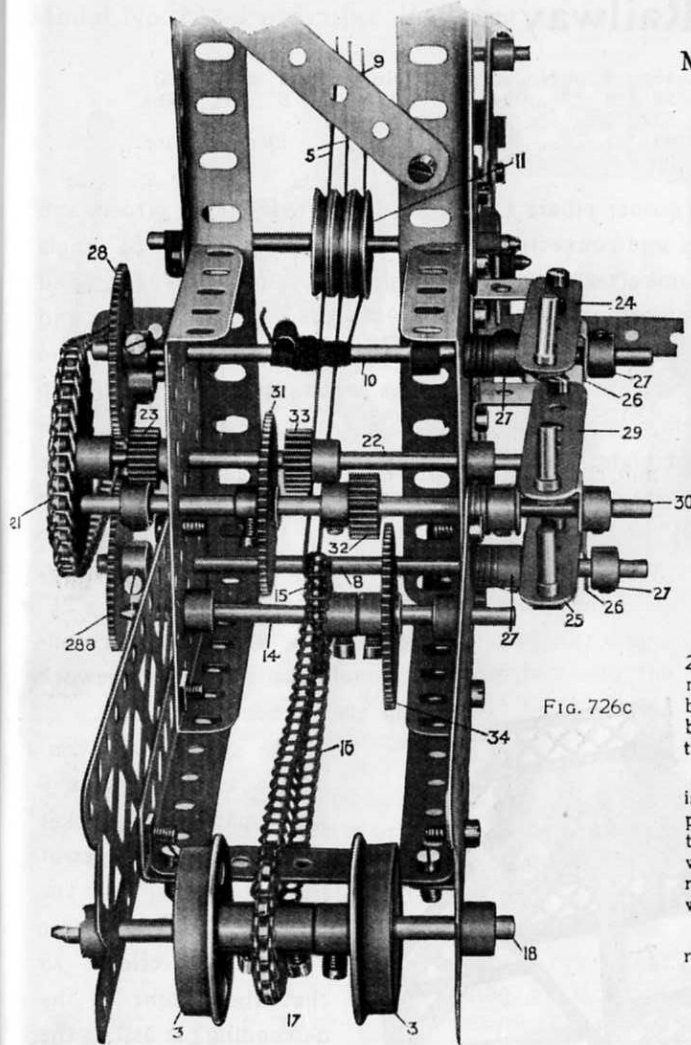


FIG. 726c

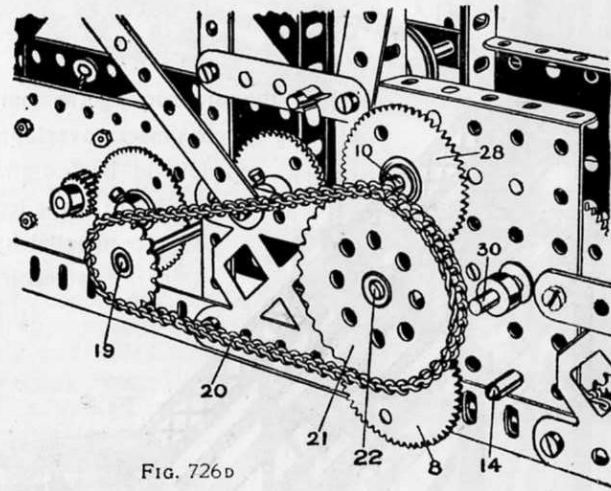


FIG. 726d

25, which are bolted and lock-nutted to double bent strips 26, engaging between collars 27 nipped on the rods. On the outer end of the rod 10 is a 57-toothed wheel 28, a similar wheel being secured on the outer end of the rod 8. By operating the clutch handles 24, 25, either or both of the gear wheels 28 or 28A may be brought into engagement with the  $\frac{1}{2}$ " pinion 23 and thus cause the load to be raised or lowered, or the trolley 4 to be traversed.

The third clutch handle 29 similarly controls the sliding movement of a rod 30, on which is secured a 57-toothed gear wheel 31 and  $\frac{1}{2}$ " pinion 32, and on the rod 22 is secured another  $\frac{1}{2}$ " pinion 33, while on the rod 14 is a further 57-toothed gear wheel 34. By moving the handle 29, therefore, the gear wheel 31 and the pinion 32 may be brought into engagement respectively with the pinion 33 and the gear wheel 34, thus providing a reduced gear train from the driven rod 22 to the rod 14, and as the latter is coupled by the chain 16 to the rod 18 of the travelling wheels 3 the whole gantry is caused to move to and fro.

The reversal of the motor is controlled by a bell crank 37, coupled by a  $2\frac{1}{2}$ " strip 38 to the reversing lever of the motor, a strip 39 being bolted to the bell crank as an extension handle.


A small electric globe 35 may be mounted on the crane, and controlled by switch 36. Fig. 726.

This Model can be made with MECCANO Outfit No. 7, or No. 6 and No. 6A.

## Model No. 727 Funicular Railway

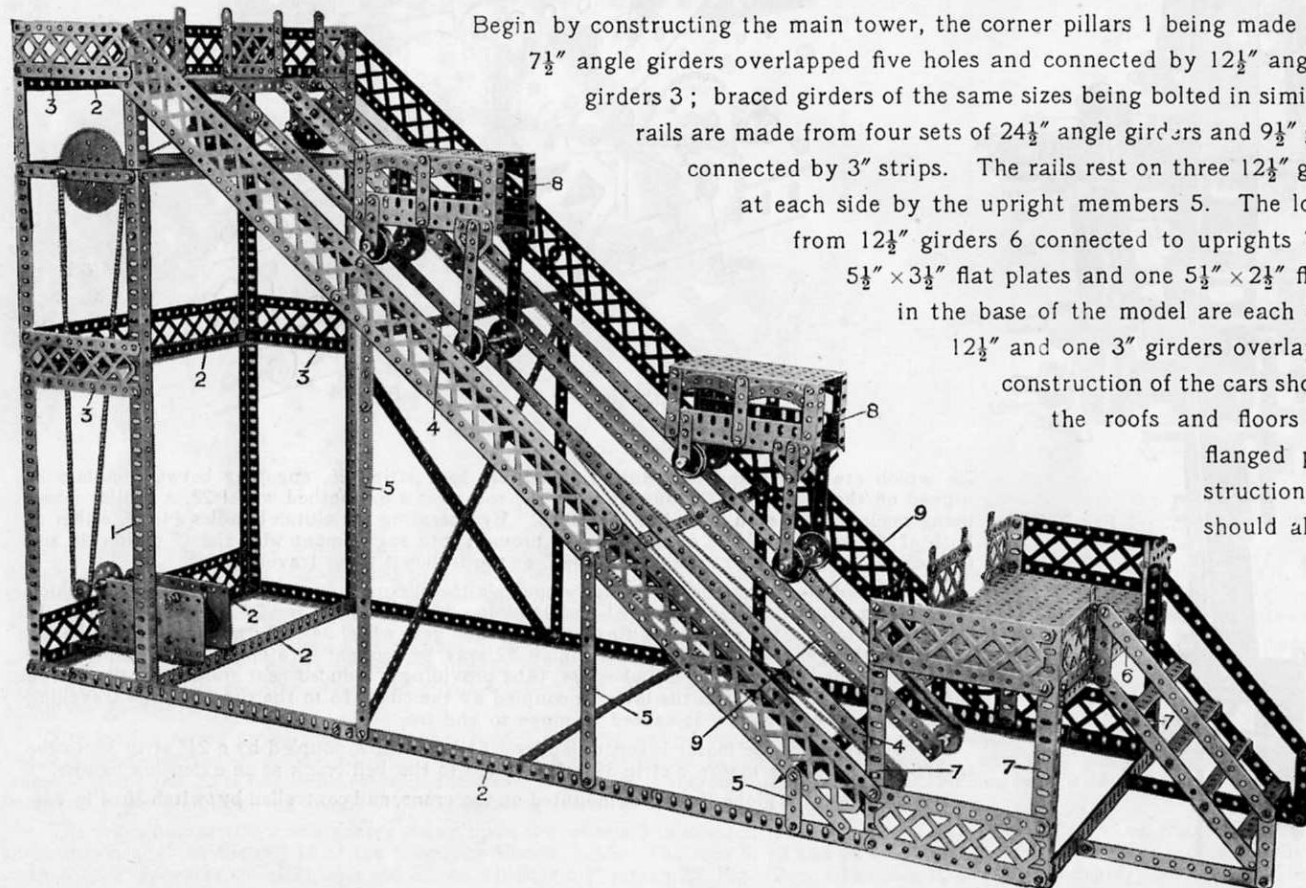Parts required:

9 of No. 1	18 of No. 5	4 of No. 8A	12 of No. 9D	2 of No. 17	7 of No. 48D	8 of No. 90	1 of No. 96A	4 of No. 103
6 " " 1B	6 " " 6	8 " " 8B	22 " " 12	8 " " 20	4 " " 52	4 " " 94	5 " " 97	8 " " 126A
4 " " 2	6 " " 7	4 " " 9	2 " " 13A	4 " " 26	6 " " 52A	2 " " 95	4 " " 98	
4 " " 2A	4 " " 7A	2 " " 9B	5 " " 16	3 " " 27A	19 " " 59	1 " " 95B	9 " " 99	Electric Motor
4 " " 4	13 " " 8	2 " " 9C	4 " " 16B	270 " " 37	2 " " 70	6 " " 96	8 " " 100	



Begin by constructing the main tower, the corner pillars 1 being made of  $18\frac{1}{2}$ " angle girders and  $7\frac{1}{2}$ " angle girders overlapped five holes and connected by  $12\frac{1}{2}$ " angle girders 2 and  $5\frac{1}{2}$ " angle girders 3; braced girders of the same sizes being bolted in similar positions. The inclined rails are made from four sets of  $24\frac{1}{2}$ " angle girders and  $9\frac{1}{2}$ " girders butted together and connected by 3" strips. The rails rest on three  $12\frac{1}{2}$ " girders 4, and are supported at each side by the upright members 5. The loading platform is built up from  $12\frac{1}{2}$ " girders 6 connected to uprights 7 and the floor from three  $5\frac{1}{2}$ "  $\times$   $3\frac{1}{2}$ " flat plates and one  $5\frac{1}{2}$ "  $\times$   $2\frac{1}{2}$ " flat plate. The side girders in the base of the model are each formed from one  $24\frac{1}{2}$ ", one  $12\frac{1}{2}$ " and one 3" girders overlapped two holes each. The construction of the cars should present little difficulty, the roofs and floors being made of  $5\frac{1}{2}$ "  $\times$   $2\frac{1}{2}$ " flanged plates, and the other constructional details of the framework should also present no trouble.

The cars 8, are connected to the chains 9 which pass over sprocket wheels 10, 2" diameter at the top and 1" at the bottom. The cars move in opposite directions so that the weight of the descending car assists the



These Models can be made with MECCANO Outfit No. 7, or No. 6 and No. 6A.

193

### Model No. 727 Funicular Railway (*continued*)


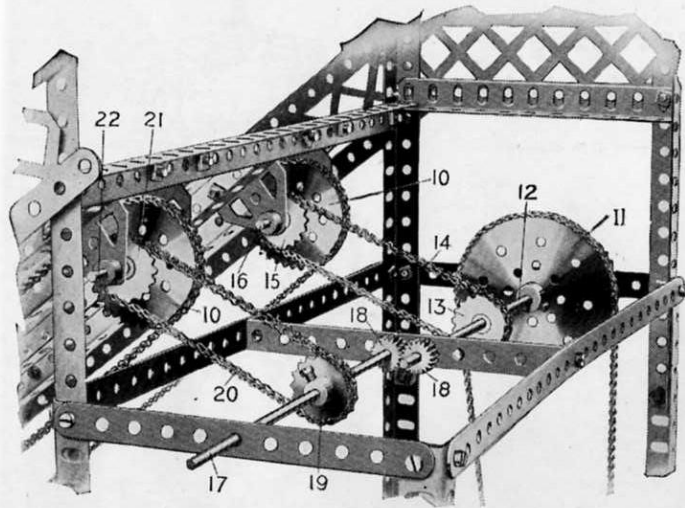


FIG. 727A

other car to ascend. This is effected by driving a 3" sprocket wheel, 11, Fig. A, from the motor, the 8" rod 12 of the sprocket wheel 11 carrying a 1" sprocket wheel 13 which is coupled by the chain 14 to a similar sprocket wheel 15 on the 3" rod 16. The rod 12 is coupled to another 8" rod 17 by a pair of  $\frac{1}{2}$ " pinions 18 in order to obtain a reversed rotation, and a 1" sprocket wheel 19 on the rod 17 is coupled by a chain 20 to another 1" sprocket wheel 21 on a 3" rod 22 which drives the chain of the other car. In this way, opposite movement of the two cars is always taking place. The cars, having reached their destinations, are returned by reversing the motor.

### Model No. 728 Ship Coaler

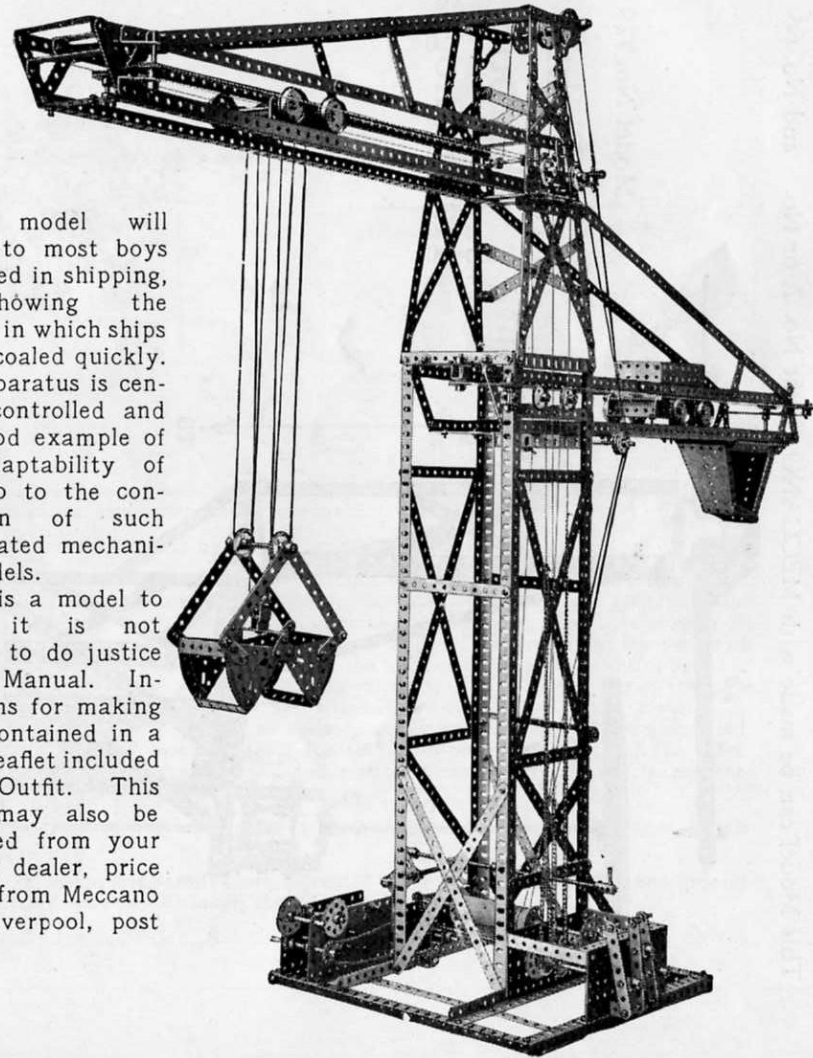

This model will appeal to most boys interested in shipping, as showing the manner in which ships can be coaled quickly. The apparatus is centrally controlled and is a good example of the adaptability of Meccano to the construction of such complicated mechanical models.

This is a model to which it is not possible to do justice in this Manual. Instructions for making it are contained in a special leaflet included in the Outfit. This leaflet may also be purchased from your Meccano dealer, price 1½d., or from Meccano Ltd., Liverpool, post free, 2d.




This Model can be made with MECCANO Outfit No. 7, or No. and No. 6A.

Model No. 729

## Twin-Elliptic Harmonograph

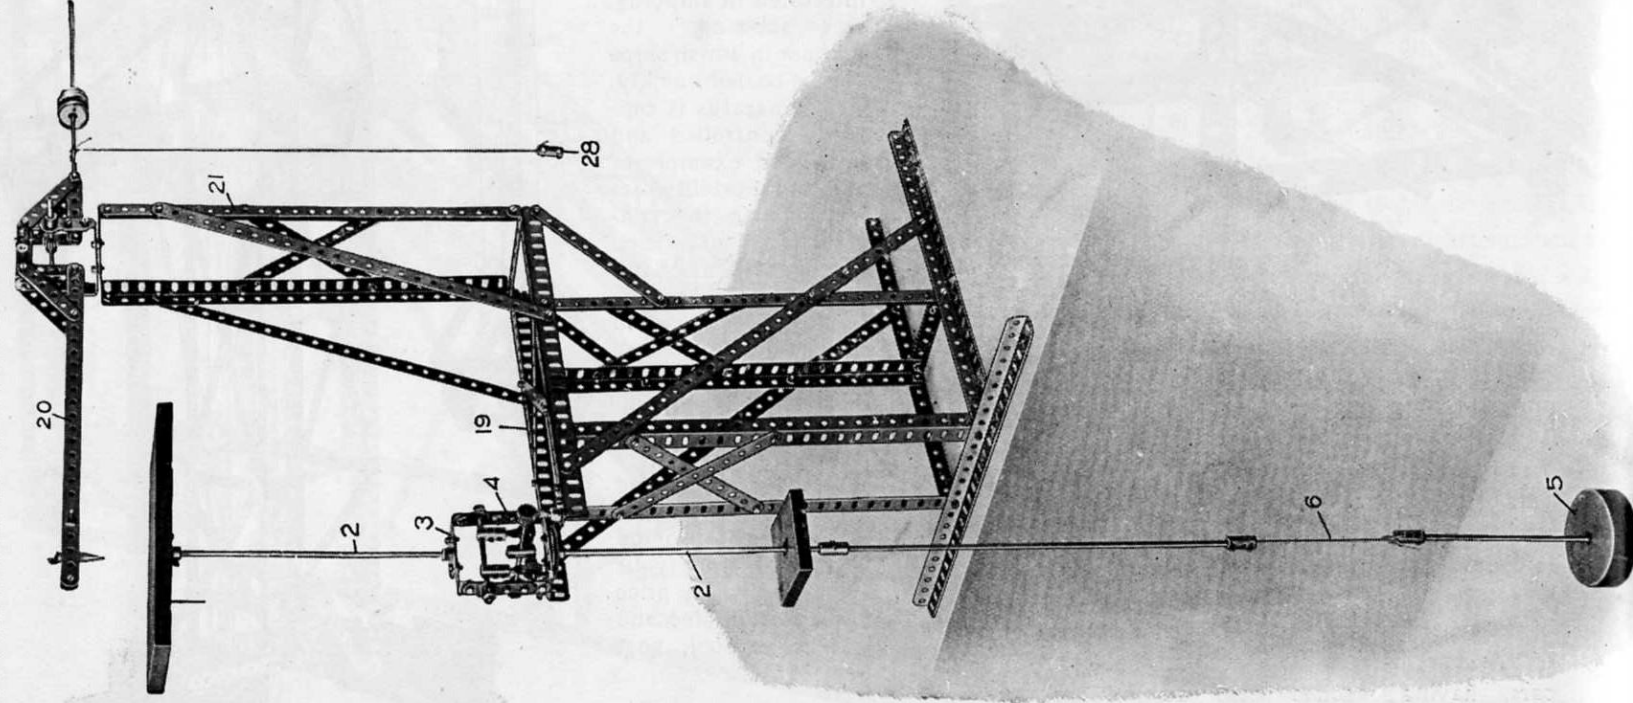Parts required:	
8 of No.	1
10 "	2
3 "	3
4 "	4
6 "	5
4 "	6
11 "	7
5 "	11
2 "	12
2 "	13
2 "	13A
1 "	14
3 "	16
2 "	16A
1 "	17
1 "	21
3 "	22
2 "	22A
2 "	24
6 "	26
86 "	37
2 "	37A
2 "	38
3 "	46
1 "	48B
4 "	59
6 "	62
9 "	63
6 "	65
1 "	107
2 "	111



a fra  
beari  
edges  
bolts  
crank  
The  
21. F  
to fo  
from  
weig  
penc

enga  
smoo  
pape

## Model No. 729 Twin-Elliptic Harmonograph *(continued)*

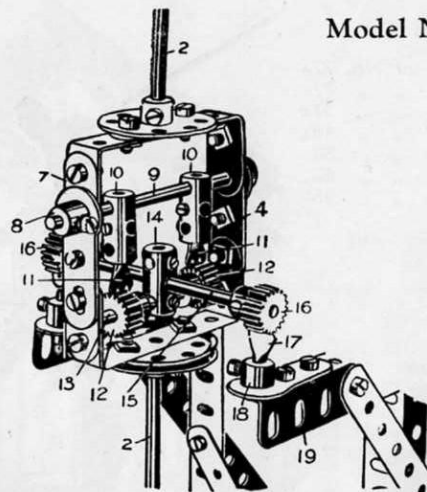


FIG. 729A

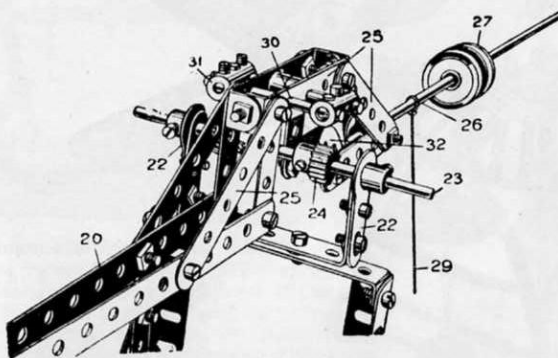


FIG. 729B

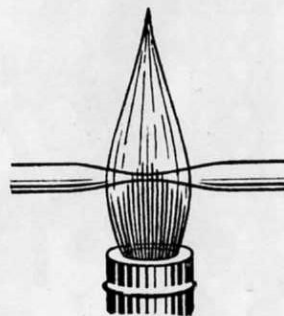


FIG. 729c

The table 1, upon which the paper for the design rests, is carried on a rod 2, the lower end of which is bolted to a bush wheel 3, which in turn is bolted to a frame 4, Fig. 729A, the lower rod 2 being similarly bolted to the frame 4 and carrying a somewhat heavy weight 5.

In order to obtain a flexible movement of the weight 5, the lower parts of the rod are coupled by a short length of string 6.

The frame 4 is built up as shown in Fig. 729A, of double angle strips  $2\frac{1}{2}$ " by 1", connected by  $2\frac{1}{2}$ " side strips 7, outside which are bolted cranks 8 to provide bearings for a rod 9 secured in the crank bosses. On the rod 9 are secured couplings 10 in the lower ends of which are mounted centre forks 11 forming knife edges engaging between the teeth of two  $\frac{1}{2}$ " pinions 12 fixed on a 2" rod 13, which is secured in a centre coupling 14 across which, in the centre hole of each, is bolted a  $3\frac{1}{2}$ " rod 15. On the outer ends of this rod 15 are two  $\frac{1}{2}$ " pinions 16 which rest upon centre forks 17 forming lower knife edges, secured in the bosses of cranks 18 carried on angle girders 19. Consequently, the frame 4 is balanced so as to swivel in two directions about the knife edges 17 and the knife edges 11. The ink pencil is gripped between the ends of two  $12\frac{1}{2}$ " strips 20, forming an arm which is pivotally supported as shown in Fig. 730. At the top of the arm 21, Fig. 729B, are bolted two cranks 22, in the bosses of which is secured a rod 23 carrying two pinions 24. The strips 20 are coupled by 3" and 2" strips 25 to form a yoke, in the rear of which is fixed a rod 26 on which is a balance weight 27, formed by a number of pulleys, and a further weight 28 is suspended from the rod 26 by cord 29. The balance weight is adjusted along the rod so that the pencil will just rest lightly on the paper on the table 1, and the extra weight 28, when hanging free, as in Fig. 729, just lifts the pencil clear of the paper. By lifting the weight 28 and resting it somewhere on the frame, the pencil is brought into light contact with the table 1.


In the yoke 25 are inserted two rods 30, each carrying couplings 31 in the centre holes of which are secured centre forks 32 forming knife-edges, which engage the  $\frac{1}{2}$ " pinions 24 about which the pencil arm swivels.

The pencil is made by drawing out a short length of  $\frac{1}{8}$ " glass tubing in a bunsen or methylated spirit lamp, about  $\frac{1}{4}$ " taper, Fig. 729c, and the end ground smoothly on a clean wet hone laid on the table; the tube is then filled with ink, which flows freely through the fine perforation in the point.

To operate the apparatus, if the weight 5 be given a swinging movement, the table 1 is oscillated, and the stationary pencil describes a diagram on the paper, which is varied according to the direction in which the weight swings.


## Model No. 730
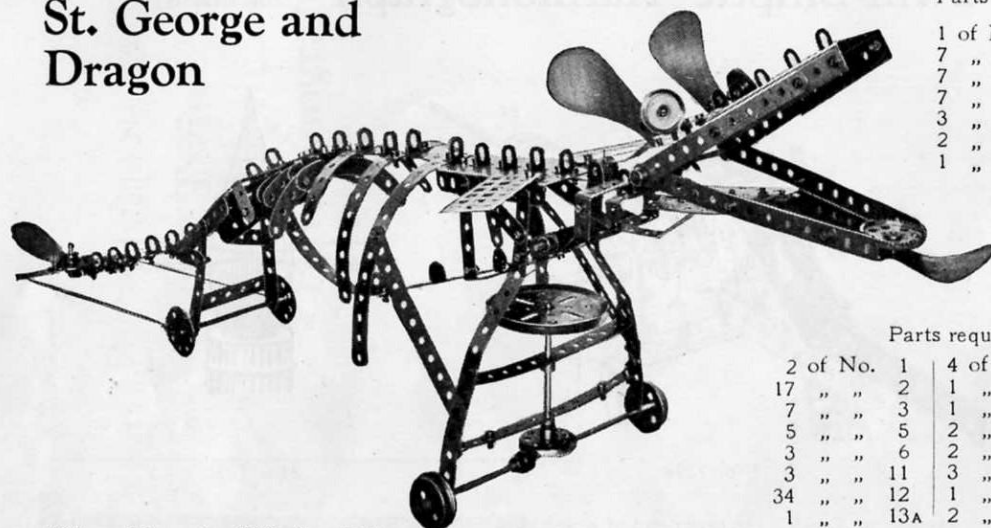
## St. George and Dragon



Parts required, St. George :


1 of No. 3	1 of No. 22A
7 " " 5	31 " " 37
7 " " 6	1 " " 37B
7 " " 10	2 " " 48A
3 " " 11	2 " " 53
2 " " 12	1 " " 62
1 " " 14	1 " " 95

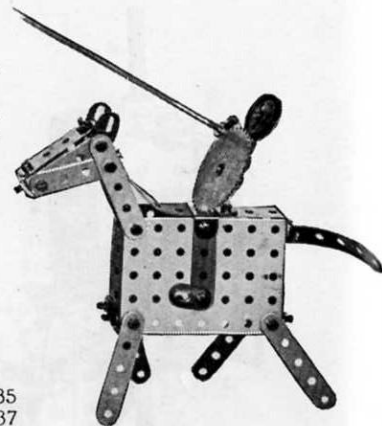

Parts required, Dragon :

2 of No. 1	4 of No. 16	2 of No. 35	
17 " " 2	1 " " 18A	126 " " 37	
7 " " 3	1 " " 19B	7 " " 38	
5 " " 5	2 " " 20	4 " " 41	
3 " " 6	2 " " 22	1 " " 43	6 of No. 59
3 " " 11	3 " " 24	3 " " 46	2 " " 61
34 " " 12	1 " " 26	9 " " 48A	2 " " 69
1 " " 13A	2 " " 28	4 " " 54	2 " " 72
			6 of No. 90
			2 " " 110
			2 " " 114

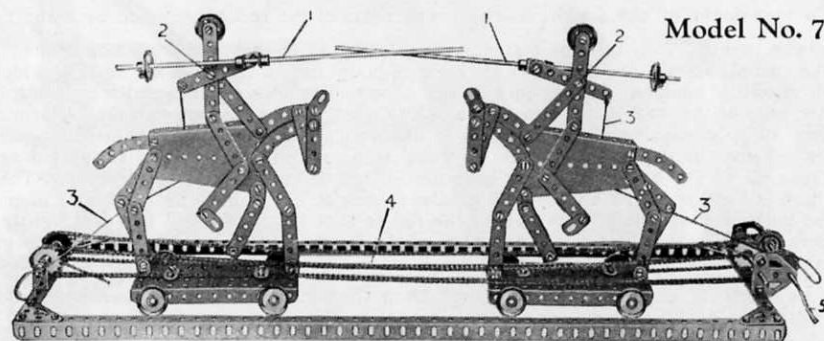This model requires little description. The jaws of the dragon work by means of a cord fastened to a  $3\frac{1}{2}$ " strip which is attached to the  $2\frac{1}{2}$ "  $\times$   $2\frac{1}{2}$ " flat plate forming the head. The cord is passed through a hole in the  $12\frac{1}{2}$ " strip, which forms the back-bone. It is attached at its other end to the periphery of a 3" pulley wheel, which is caused to rotate as the dragon moves along the ground. To make the tail wag, cords are fastened to each end of the pivoted  $3\frac{1}{2}$ " strip which carries the bush wheel and propeller blade forming the tail, and attached at the other ends to angle brackets bolted to the back wheels. As the model moves along the ground the tail wags in quite a realistic way.



## Model No. 731 The Tilters

Parts required:

2 of No. 3	2 of No. 31
4 " " 4	73 " " 37
22 " " 5	2 " " 37A
2 " " 7	4 " " 38
2 " " 8B	1 " " 46
10 " " 10	1 " " 47
2 " " 11	2 " " 52
10 " " 12	2 " " 54
2 " " 13	8 " " 59
1 " " 15A	6 " " 90
5 " " 16	2 " " 94
1 " " 19	4 " " 96
10 " " 22	2 " " 126A
2 " " 22A	4 " " 133

The lances 1 pivoted at 2 are raised into position by the cords 3 and the figures caused to advance together by the chains 4 on turning the handle 5.

The cords 3, instead of being tied where indicated in the illustration, should, after aim, be made fast to some part of the moving figures.

This Model can be made with MECCANO Outfit No. 7, or No. 6 and No. 6A.

197

## Model No. 732 Warehouse

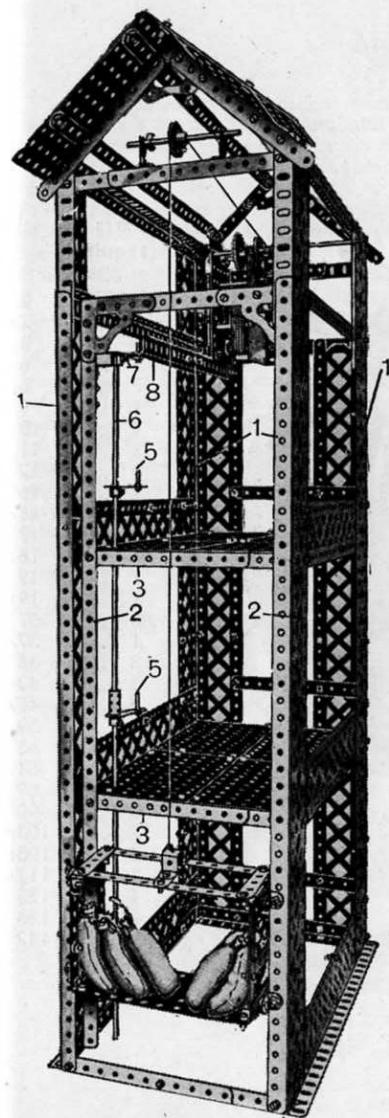


FIG. 732A

Commence this model by building the framework.  $24\frac{1}{2}$ " angle girders are used to form the corner uprights 1 with  $5\frac{1}{2}$ " angle girders overlapped eight holes at the top. Two  $24\frac{1}{2}$ " angle girders 2 are also used to carry the front portion of the warehouse floors, the latter being bolted to two  $5\frac{1}{2}$ " angle girders 3 overlapped eight holes and connected across to the two inner angle girders 2. Two similar  $5\frac{1}{2}$ " angle girders are bolted to the back of the framework, to carry the other end of each of the floors. The floor is formed of four  $5\frac{1}{2}$ "  $\times$   $3\frac{1}{2}$ " flat plates butted together and bolted in the centre to a  $5\frac{1}{2}$ " flat girder on the underside—the two outer ends being bolted to the angle girders 3. The horizontal side-strips are formed of  $12\frac{1}{2}$ " strips to which are bolted the braced girder strips.

Fig. A shows the construction of the cage. This is guided by bolt heads 4, at each side riding along the inwardly turned flanges of the angle girders 2. The bolts are attached to angle brackets, which are secured to a  $1\frac{1}{2}$ " strip, this latter being secured to the side-strips of the cage, spaced with three washers to take up the play between the cage and the upright girders 2.

Fig. B shows the position of the motor, and this may be started and stopped from the control crank handles 5, one on each floor of the warehouse. These crank handles are fixed on a vertical rod 6 composed of two  $11\frac{1}{2}$ " rods connected by a coupling. A crank 7 is secured to the upper end of this rod and is connected by a  $5\frac{1}{2}$ " angle girder and strip 8 to the operating lever of the motor.

$1\frac{1}{2}$ " brackets secured to the sides of the warehouse by strips form the bearings for the upper and lower ends of the vertical rod.

When the motor is wired up to the accumulator, the elevator is ready to be operated.

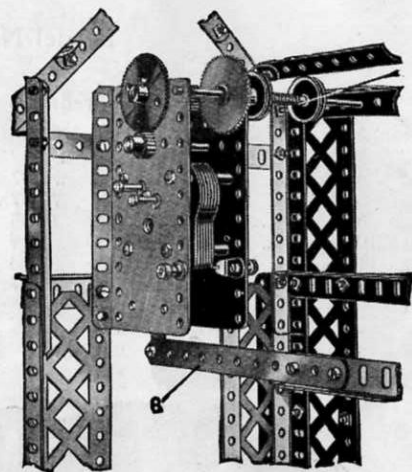


FIG. 732B

### Parts required:

18 of No. 1	2 of No. 13	1 of No. 59
21 " " 2	1 " " 14	4 " " 62
9 " " 5	1 " " 16	1 " " 63
1 " " 6	3 " " 22	3 " " 70
4 " " 6A	2 " " 35	18 " " 99
6 " " 7	240 " " 37	4 " " 100
6 " " 8	30 " " 38	2 " " 103
23 " " 9	1 " " 45	4 " " 108
16 " " 12	1 " " 46	4 " " 115
2 " " 12A	8 " " 52A	

Electric Motor



This Model can be made with MECCANO Outfit No. 7, or No. 6 and No. 6A.

## Model No. 733 Motor Cycle and Sidecar

### Parts required: Motor Cycle

2 of No. 2	1 of No. 15	1 of No. 23A	2 of No. 90	2 of No. 115
2 " " 3	1 " " 15A	2 " " 32	6 1/2 " " 94	1 " " 116
1 " " 4	1 " " 16	28 " " 37	1 " " 96	3 " " 120A
10 " " 5	5 " " 17	10 " " 37A	1 " " 96A	2 " " 126A
1 " " 6A	4 " " 18A	16 " " 38	1 " " 101	2 " " 142
2 " " 10	1 " " 18B	11 " " 59	2 " " 103G	
6 " " 11	2 " " 19B	8 " " 63	3 " " 111	
4 " " 12	1 " " 22	3 " " 77	3 " " 111A	

Small elastic band

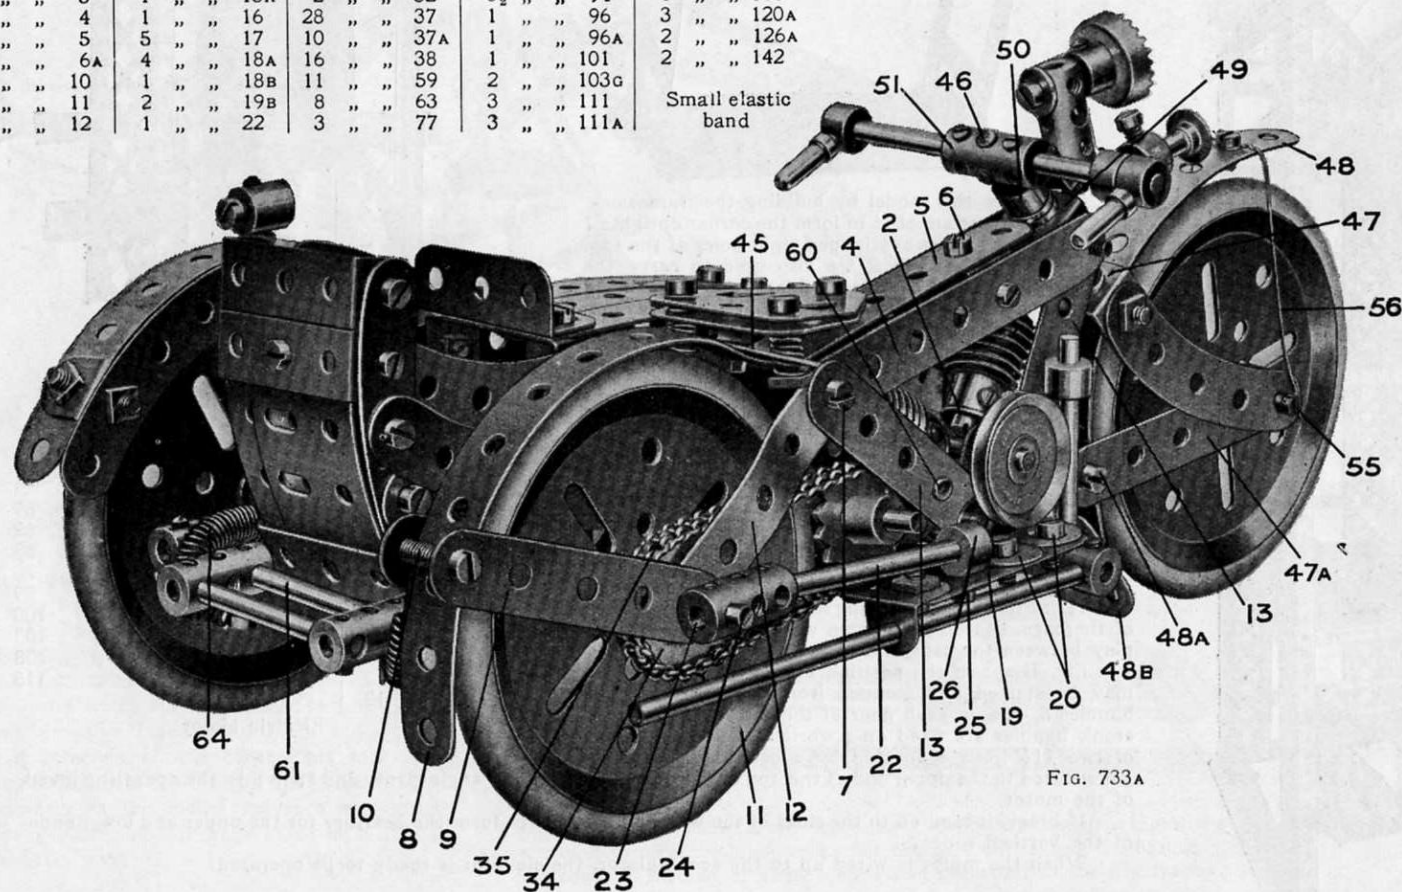


FIG. 733A

### Parts required: Sidecar

5 of No. 2	2
2 " " 2A	2
5 " " 3	5
5 " " 5	5
2 " " 6A	2
1 " " 9F	1
1 " " 10	1
2 " " 11	2
3 " " 12	3
2 " " 16	2
1 " " 16A	1
1 " " 17	1
1 " " 18A	1
1 " " 19	1
1 " " 19B	1
55 " " 37	55
1 " " 37A	1
3 " " 38	3
2 " " 43	2
7 " " 48A	7
4 " " 59	4
5 " " 63	5
1 " " 64	1
6 " " 89	6
8 " " 90	8
2 " " 103F	2
2 " " 103H	2
1 " " 111A	1
1 " " 125	1
2 " " 133	2
1 " " 142	1

and c  
const  
Mecc  
called  
consi  
fully  
l  
to th  
brack  
strip  
its en  
rear  
of a  
which  
upon  
remo  
are s  
secur  
plate  
near  
2 1/2"

## Model No. 733 Motor Cycle and Sidecar *(continued)*

This model is an excellent example of Meccano miniature engineering, and offers a remarkable testimonial to the adaptability of the system. Its construction will prove no light tax on the ingenuity of even long-experienced Meccano boys, and it is undoubtedly a case in which nimble fingers are called for!

The only item included in the model that is not a regular Meccano part consists of a small elastic band; this should be about  $1\frac{1}{4}$ " in length when fully extended.

Each engine cylinder consists of a worm wheel, secured by its set-screw to the shank of a bolt passed through a flat bracket 2 carried from a double bracket 3 (Fig. B). The tank consists of two  $3\frac{1}{2}$ " strips 4 (Fig. A) and one 3" strip 5 held together by double brackets at 6 and 7. A  $5\frac{1}{2}$ " strip 8 is bolted by its end hole to the end of the strip 5, and is bent round as shown to form the rear mudguard. It is clamped in position between two  $2\frac{1}{2}$ " strips 9 by means of a  $\frac{1}{2}$ " bolt 10. The driving wheel 11 is carried in the ends of  $2\frac{1}{2}$ " strips 12, which are bent slightly as shown in Fig. D, as also are the strips 9.

The V-shaped engine frame is built up from  $2\frac{1}{2}$ " strips 13 converging upon 1" triangular plates 14 (Figs. B and D). The side  $2\frac{1}{2}$ " strips have been removed in Fig. B in order to reveal some of the engine details; normally they are secured by the bolts 15, 16, 17 and 18. A 2" flat girder 19 (Fig. A) is secured to two angle brackets 20 bolted to the base of the outer 1" triangular plate. A similar flat girder 21 (Fig. B) is attached to the first girder 19 by means of bolts passed through the elongated holes of both girders.

A tie-rod provided on the right-hand side of the machine consists of a  $2\frac{1}{2}$ " rod 22 (Fig. A) nipped in the end of the coupling 23, in which the back axle

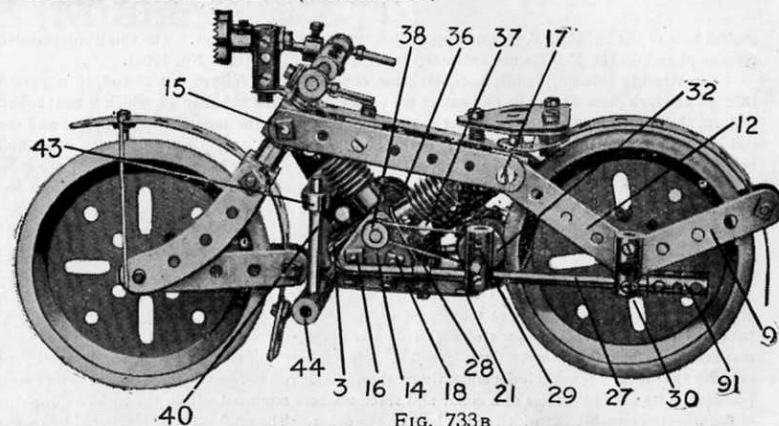


FIG. 733B

24 is allowed to rotate freely. A set-screw 25, carrying one washer, is passed through a hole in the flat girder 19, and entering the threaded bore of a collar 26, grips the rod 22 fast in position. Another tie-rod fitted to the left-hand side of the machine comprises a  $4\frac{1}{2}$ " rod 27 (Fig. B) secured to the flat girder 21 by means of a collar 28, in a similar manner to that just described. Two couplings 29 and 30 are mounted on the rod 27. Coupling 30 forms an additional support for the back axle, and the centre transverse hole of the coupling 29 is employed as a bearing for a 2" rod 31 (Fig. D). This rod 31 carries a  $\frac{1}{2}$ " fast pulley 32 (Fig. B) and a  $\frac{1}{2}$ " sprocket wheel 33 (Fig. D).

The back axle 24 is gripped by the set-screw of the driving wheel 11, and carries a 1" sprocket wheel 34 (Fig. A) which drives the  $\frac{1}{2}$ " sprocket 33 by means of a sprocket chain 35, composed of 39 links. The  $\frac{1}{2}$ " pulley 32 (Fig. B) is connected to the shaft of the flywheel 36 by means of a small rubber band 37, which passes round the groove of the pulley and round the flywheel shaft itself, being guided between a washer and collar 38. Hence, as the machine runs along, the flywheel is caused to revolve at considerable speed.

A 5" rod 39 and 2" rod 40 (Fig. D) represent the exhaust pipe. The rod 39 passes through the angle bracket 41, and is secured in the end of the coupling 42, representing the silencer; the rod 40 is secured in the centre transverse hole of the coupling 42, while its upper end is gripped by the set-screw of the collar 43. This screw, carrying a washer, passes through the centre hole of the strip 13 before entering the collar. The short exhaust pipe 40 is duplicated on the other side of the machine (see Fig. B); it should be noted that the coupling 44 in this illustration is connected to coupling 42 by means of a 1" axle rod.

The saddle is composed of two flat trunnions secured to the framework by means of three  $\frac{1}{2}$ " bolts. A  $1\frac{1}{2}$ " strip 45 (Fig. A), bolted transversely to the

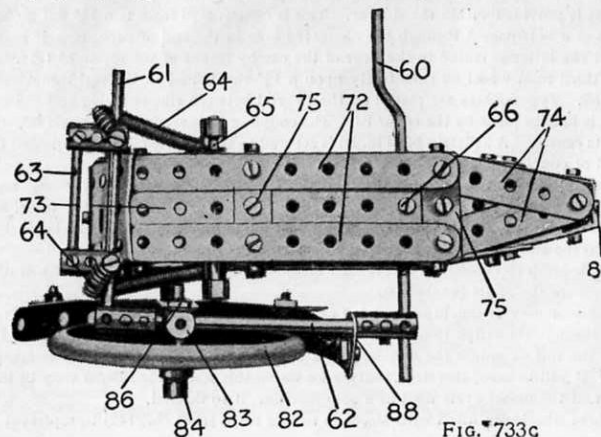


FIG. 733C

## Model No. 733 Motor Cycle and Sidecar (continued)

second hole of the  $5\frac{1}{2}$ " strip 8, forms supports for the rear saddle springs. The small compression springs placed on the  $\frac{1}{2}$ " bolts are extracted from spring buffers (Part No. 120a).

The steering column, handle-bars, etc., are constructed as follows: a 2" rod 46 is passed through the fork piece 47 and its end enters the centre hole of the  $5\frac{1}{2}$ " strip 48, which is bent round to form the front mudguard. A washer is then placed against the boss of the fork piece and the rod 46 is journaled through two double brackets 49, which are placed one within the other and bolted to the ends of the strips 4 and 13. Three washers, a collar 50, and coupling 51 are then placed in position on the steering column as shown. The handle-bars are built up from threaded pins, collars, and two  $1\frac{1}{2}$ " rods, carried from the coupling 51.

The head-lamp is composed of a  $\frac{3}{4}$ " contrate wheel 52 (Fig. D) secured to the shank of a  $\frac{3}{4}$ " bolt passed completely through the coupling 53. The latter is secured to a bolt passed through an angle bracket, which, in turn, is secured by a set-screw 54 to the collar 50.

The front wheel forks consist of 2 $\frac{1}{2}$ " strips, 47a (Fig. A) and 2 $\frac{1}{2}$ " curved strips, all of which are slightly splayed to allow free movement of the road wheel. The mudguard 48 is clamped between the strips 47a by means of a  $\frac{3}{4}$ " bolt 48a passed through their end holes, in a similar manner to the bolt 10 on the rear mudguard 8. The set-screw of the front road wheel is removed in order that it may revolve independently on the  $1\frac{1}{2}$ " axle rod 55. The wheel is held in a central position on its axle by means of a collar and three washers mounted within the forks on one side of the wheel to equalise the width of the boss on the other. The mudguard 48 is secured by means

of a tie 56. This consists of a Meccano heald (Part No. 101), the end holes of which are slipped over the axle 55 before the 2 $\frac{1}{2}$ " curved strips are placed in position. The heald is then doubled beneath the curved strip and taken over the strip 48, and thence down to the opposite end of the axle 55. It is secured to the mudguard by means of a bolt passed through its centre hole. A 1" triangular plate 48b bolted to the second hole of the strip 48 forms a "splash-guard."

The horn 57 (Fig. D) is constructed from the "ram" of a spring buffer, the screwed end of which engages the threaded bore of a collar 58 mounted on the handle-bars. A collar 59 with set screw added represents the operating handle.

### CONSTRUCTION OF THE SIDECAR

The undercarriage of the sidecar is built up from a crank handle 60 (Fig. C) and 3 $\frac{1}{2}$ " rod 61 connected by couplings and 3 $\frac{1}{2}$ " rod 62. Two couplings and a 2" rod 63 serve as a luggage carrier, while bolts inserted in the Couplings carry springs 64, between which the car is suspended. The springs are attached to the car by means of a 2" rod 65. A set-screw 66 passed through the bottom of the car enters the threaded bore of a collar on the crank handle 60, so holding the car in its correct position on its cradle.

Each side of the car is composed of the following parts (see Fig. D): 67; 2 $\frac{1}{2}$ " and 5 $\frac{1}{2}$ " curved strips overlapped two holes and bolted together; 68; 2 $\frac{1}{2}$ " curved strips and 3 $\frac{1}{2}$ " strips overlapped two holes and bolted together; 69 and 70; 5 $\frac{1}{2}$ " curved strips. The front ends of all the side members, with the exception of 68, are bolted to a corner bracket 71 in the nose of the car. The floor (Fig. C) is composed of two 4 $\frac{1}{2}$ " strips 72, a 5 $\frac{1}{2}$ " strip 73 and two 2 $\frac{1}{2}$ " strips 74, bolted to 1 $\frac{1}{2}$ " x  $\frac{1}{2}$ " double angle strips 75. The top (Fig. D) consists of three 3" strips 76, two 2 $\frac{1}{2}$ " strips 77 and one 1 $\frac{1}{2}$ " strip 78, also secured to 1 $\frac{1}{2}$ " x  $\frac{1}{2}$ " double angle strips. The back is built up from three 1 $\frac{1}{2}$ " double angle strips, bolted between the corner 2 $\frac{1}{2}$ " curved strips 80, and two 2 $\frac{1}{2}$ " flat girders slightly bent as shown and secured by a bolt 79. All four sides taper towards the nose of the car and are secured to two double brackets bolted together by the nut and bolt 81 (Fig. C).

A seat is provided within the sidecar. This is constructed from two 1 $\frac{1}{2}$ " flat girders secured, by means of a bolt passed through the elongated hole in the end of each, to a  $\frac{1}{2}$ " reversed angle bracket. The latter is bolted to the floor of the car by means of the screw 75 (Fig. C).

The third road wheel 82 runs freely upon a 1 $\frac{1}{2}$ " rod bolted in the top transverse bore of a coupling 83. Two washers are placed on the 1 $\frac{1}{2}$ " rod between this coupling and the wheel, while the latter is held in place by the collar 84. The coupling 83 is secured to the rod 62, which passes through its centre. A 2 $\frac{1}{2}$ " strip 85 (Fig. D) is secured to the  $\frac{1}{2}$ " bolt 86 (Fig. C) passed through the lower end of coupling 83.

The strip 85 serves to support the mudguard, which is constructed from 5 $\frac{1}{2}$ " and 2" strips overlapped two holes and bolted together. The mudguard is bent round the wheel as shown in Fig. D and carries two 2 $\frac{1}{2}$ " curved strips secured by angle brackets 87. A flat bracket 88 (Fig. C) is bolted to the end hole of the 2" strip, and engages the rod 62.

The side-lamp 89 consists of a threaded boss, screwed to the upturned shank of a bolt which serves to secure the angle bracket 90.

The sidecar may be quickly connected or detached from the motor cycle. The crank handle 60 passes through the strips 13 of the engine-frame (its extreme end is just visible in Figs. A and D), while the rod 61 enters the end hole of a coupling 91 (Fig. B), where it is gripped by the set-screw. It will be seen, therefore, that by loosening this screw, the sidecar may be immediately detached and the motor cycle used as a solo machine, if so desired.

All three wheels are fitted with Meccano rubber rings (Part No. 142) to represent pneumatic tyres,

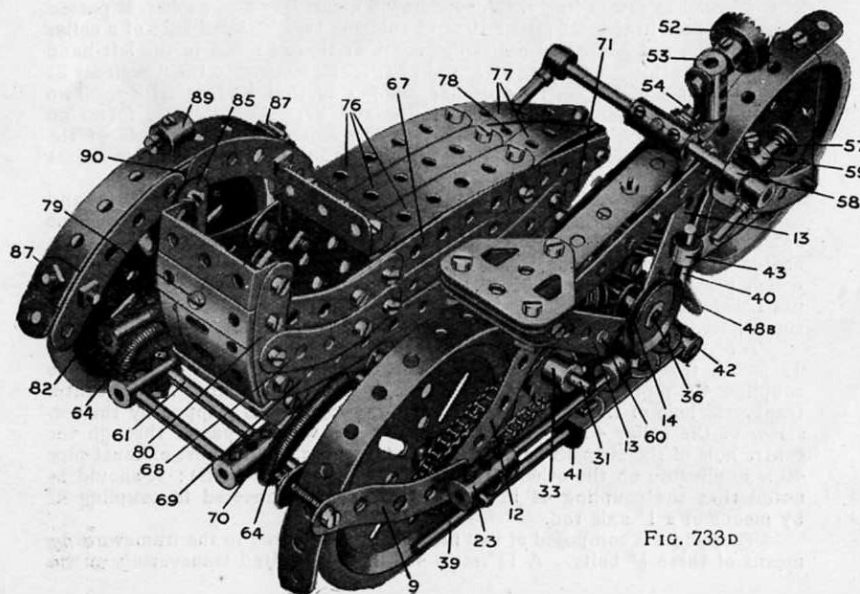


FIG. 733D




This Model can be made with MECCANO Outfit No. 7, or No. 6 and No. 6A.

201

## Model No. 734 Locomotive and Tender (Midland, 4-2-2)

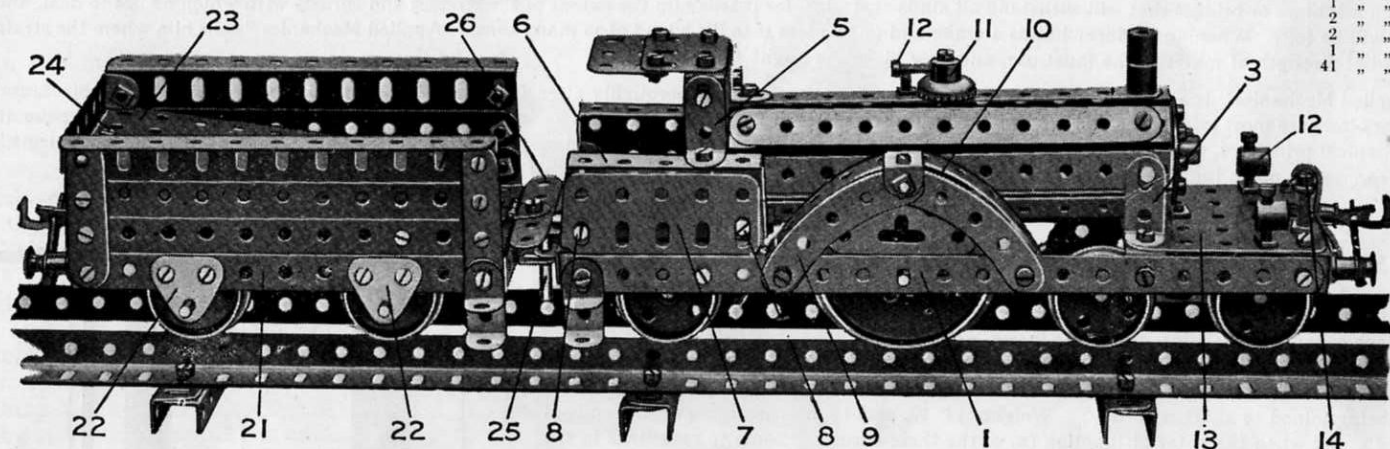Parts required:

2 of No.	1A	8 of No.	12B
13	2	3	16
1	5	3	18A
4	6	1	18B
1	6A	10	20
2	9	2	24
2	9D	1	29
1	11	131	37
41	12	11	38
		2	46
		1	48
		10	48A
		1	52
		1	53A
		6	58
		4	59
		2	64
		4	72
		2	77
		2	90
		3	103F
		2	103H
		4	109
		3	111
		1	111A
		5	114
		2	120A
		2	121
		2	126
		2	133
		2	137



This is a well-proportioned model of an old-style Midland "single-wheeler" locomotive. The engine frame is built up from two  $9\frac{1}{2}$ " strips 1 joined at the points 2 (Fig. 734A) by  $2\frac{1}{2}$ "  $\times$   $\frac{1}{2}$ " double angle strips, and further strengthened at each end by  $2\frac{1}{2}$ " angle girders. The boiler is composed of seven  $5\frac{1}{2}$ " strips bolted at either end to a bush wheel by means of angle brackets. It is supported by  $1\frac{1}{2}$ "  $\times$   $\frac{1}{2}$ " angle brackets 3, and an angle bracket secured to the lowest hole of the rear bush wheel is bolted at 4 (Fig. 734A) to the floor of the cab.

The cab roof consists of  $1\frac{1}{2}$ " flat girders bolted by angle brackets to  $1\frac{1}{2}$ "  $\times$   $\frac{1}{2}$ " brackets 5.  $2\frac{1}{2}$ "  $\times$   $1\frac{1}{2}$ " double angle strips 6 and flat girders 7 bolted together by angle brackets at 8 form the sides, which, in turn, are bolted by angle brackets to the footplate.

The wheel covers for the main drivers are each constructed from two  $2\frac{1}{2}$ " curved strips 9 and a  $5\frac{1}{2}$ " strip 10 bent to the same curvature. A corner bracket is secured in the centre as shown.

A safety valve in the centre of the boiler consists of a contrate wheel 11, secured by means of a  $\frac{1}{2}$ " bolt and carrying a further  $\frac{1}{2}$ " bolt 12. The smoke-stack is composed of two threaded bosses mounted on the shank of a  $\frac{1}{2}$ " bolt passing through the top strip of the boiler. Two lamps are carried on the front of the engine-frame and consist of threaded bosses 12 mounted on the upturned shanks of  $\frac{1}{2}$ " bolts secured in the  $2\frac{1}{2}$ "  $\times$   $2\frac{1}{2}$ " flat plate 13, and gripped in position by  $7/32$ " bolts inserted in the tops of the bosses. A piece of spring cord, secured to a  $\frac{1}{2}$ " bolt 14, represents the front vacuum brake pipe connection.

It will be noticed from Fig. 734A that the front bogie consists of two  $2\frac{1}{2}$ " strips 15, bolted to a double bracket 16. It is attached to the locomotive frame by means of a  $\frac{1}{2}$ " bolt, secured by two nuts on its end to the flat plate 13. A small compression spring (extracted from Part No. 120A) is placed on the bolt between the double bracket and the base plate. The rear trailing wheels 17 are mounted on a  $1\frac{1}{2}$ " rod passed through two trunnions 18 bolted to the under-side of the footplate. The

wheels are retained in their correct position by means of a Collar 19, spaced between two washers.

The driving wheels are built up from face plates and wheel flanges, and are secured to a  $3\frac{1}{2}$ " rod 20. They are spaced in the correct position in the centre of the frame by means of three washers placed between the boss of each face plate and the sides 1 of the engine.

A  $5\frac{1}{2}$ "  $\times$   $2\frac{1}{2}$ " flanged plate 21 forms the base of the tender and the sides are each built up from two  $5\frac{1}{2}$ " strips and one  $5\frac{1}{2}$ " angle girder. The back consists of four  $2\frac{1}{2}$ "  $\times$   $\frac{1}{2}$ " double angle strips. The wheels are carried on axles journalled in  $1\frac{1}{2}$ " triangular plates 22 bolted to the base plate 21. A  $4\frac{1}{2}$ "  $\times$   $2\frac{1}{2}$ " flat plate 23 is secured inside the tender by means of an angle bracket bolted to the back at 24, and a  $2\frac{1}{2}$ "  $\times$   $\frac{1}{2}$ " double angle strip at the other end of the plate.

The loco and tender are coupled together by means of a  $1\frac{1}{2}$ " rod 25, passed through two angle brackets. An extension of the footplate consists of a  $1\frac{1}{2}$ " flat girder and a  $2\frac{1}{2}$ " strip 26, bolted by means of a hinge to the tender.

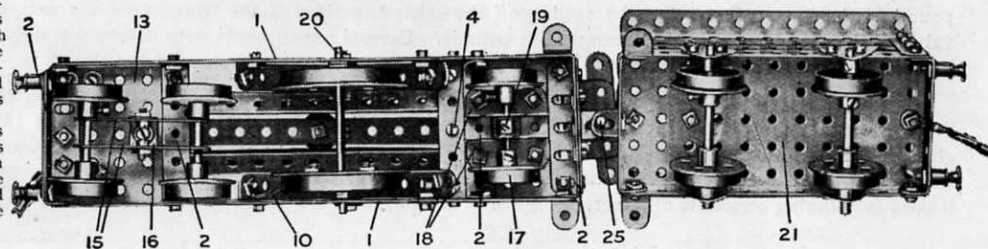


FIG. 734A



## Interesting Experiments in Applied Mechanics with Meccano

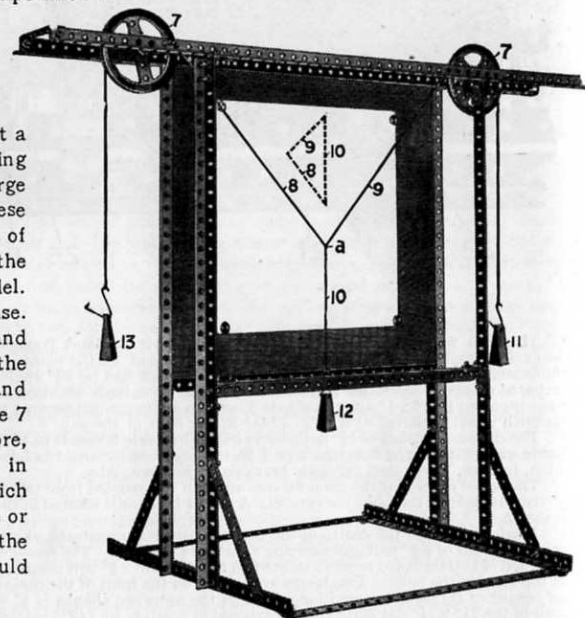
Few boys know what an important part the science of "Applied Mechanics" plays in everything which they see around them. It is this science that enables the engineer to design machines or bridges that will withstand all kinds of strains, for it tells him the extent of the stresses and thrusts with which he has to deal, and exactly where they will be felt. When an engineer builds a crane and guarantees it to lift a load of so many tons, "Applied Mechanics" tells him where the strain will come, exactly what strength of materials he must use, and how his crane ought to be designed.

Of course "Applied Mechanics" is a big subject, and one can only grasp its principles thoroughly after a lot of study; but it is a very fascinating subject, and some of its elementary laws are most interesting and not at all difficult to understand. We reproduce two models that illustrate the possibilities of Meccano in demonstrating mechanical principles, and further examples dealing with levers, pulleys, the inclined plane, etc., will be found in the "Standard Mechanisms" Manual. Any boy can derive much fun and learn a lot of useful points in mechanics by making these experiments.

### Model No. 735 Triangle of Forces

This model illustrates the principle of the "Triangle of Forces." Briefly, if three forces meet at a point and balance each other, and we know one of the forces, we may determine the other two by drawing a triangle, making each side parallel to the direction of one of the forces. To demonstrate this, two large pulleys 7 are carried on rods in the upper  $24\frac{1}{2}$ " girders of the model, and cords 8, 9, are passed over these pulleys, their ends being joined to another cord 10. Weights 11, 12, and 13 are then hung on the ends of the cords 8, 9, and 10, and when the point of junction (a) of the three cords has come to rest, lines in the direction of the cords are drawn on a sheet of paper pinned to a piece of board incorporated in the model. This board is not included in Meccano Outfits on account of its size, but it may be provided at little expense. The paper is afterwards removed and a triangle drawn, as shown in the illustration, with its sides 8, 9, and 10 parallel to the directions of the three cords. This triangle is shown in dotted lines. If the sides of the triangle are measured it will be found that they are in the same proportion as the weights 11, 12 and 13. For instance, if the weight 12 were 15 units and the weight 13 were 9 units, and the weight 11 were 7 units, the lengths of the sides of the triangle would be 15, 9, and 7 units. By this experiment, therefore, we demonstrate that when three forces meet at a point, and we know their direction and the value in grammes or pounds of one of the forces, if we construct a triangle, making that side of the triangle which corresponds to the known force equal to a number of units of length, each unit representing a gramme or pound of the known force, then by scaling off the other two sides of the triangle we can determine the value of the other two forces in grammes or pounds. Several experiments with different weights should be tried and triangles drawn, and the accuracy of the apparatus for different weights tested.

Little difficulty will be experienced in constructing the Meccano Demonstration Frame from this illustration. It may be well to mention, however, that the rear uprights, which consist of  $18\frac{1}{2}$ " angle girders, are secured to the sides of the board shown in the illustration by ordinary wood screws. The  $24\frac{1}{2}$ " girder at the top is secured in the same manner, as also is the  $12\frac{1}{2}$ " girder at the bottom. The board is used for pinning on sheets of paper, upon which the diagrams are drawn.




Parts required:

2 of No. 1	4 of No. 12A	3 of No. 57A
4 " " 2	2 " " 16	4 " " 59
2 " " 7	2 " " 19B	3 " " 66
2 " " 7A	36 " " 37	3 " " 67
4 " " 8	4 " " 38	8 " " 68
	2 " " 48A	

## Model No. 736
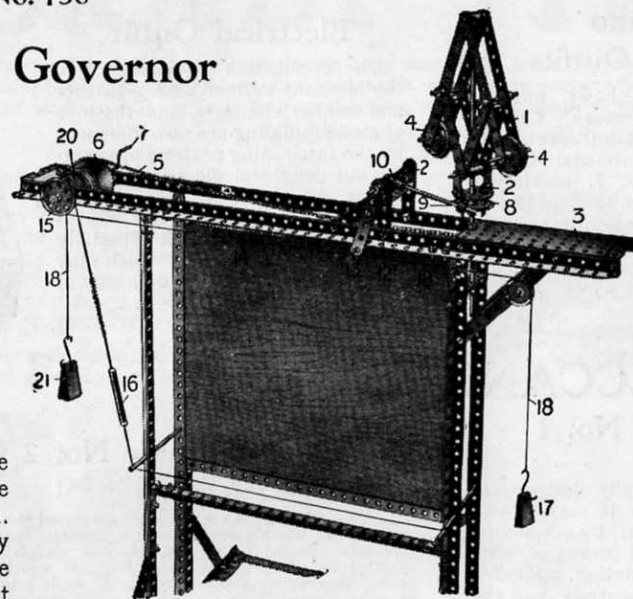
## Centrifugal Governor

In this model an apparatus is shown for demonstrating the controlling effect of a governor. A governor is a device which is fitted on an engine in order to make its speed constant. In the case of an engine driving a works, for instance, if all the machinery in the shop were running, the engine would be driving a heavy load and would be using a certain amount of steam. If a great portion of the machinery were stopped and the engine were allowed to take the same amount of steam, owing to the lightness of the load then on the engine it would race at great speed and probably be damaged. To prevent this engineers fit a governor device which, as the load on the engine is lightened, automatically shuts off the steam, or throttles it, and which, as the load comes again on the engine, permits it to take more steam. The governor thus arranges the steam supply to the engine to be suitable for the load which the engine bears and to drive it at a constant speed. Most governors are of the centrifugal ball type, that is to say, they have a pair of ball weights which are spun round by the engine. As the engine's speed increases, the ball weights fly out, and this flying out or centrifugal action is arranged to shut off the steam.



The governor 1, the construction of which is quite clear from the illustration, is mounted on a spindle 2 in a rectangular plate 3 fitted in the top girders. The flanged pulley wheels 4 represent the ball weights of the governor. Below the rectangular plate 3 and on the spindle 2 is a sprocket wheel 22 connected by the sprocket chain 5 to another sprocket wheel 6 on the cranked axle 7.

A bush wheel and a  $1\frac{1}{2}$ " pulley wheel 8 are fixed on the spindle of the governor a slight distance apart, and the head of a bolt in the collar 9 engages between the wheels 8. The collar 9 is connected by a coupling 10 to a rod 11 pivoted in the strips 12. The near end of the rod carries a strip 13, clamped between two cranks, to which is connected a cord 14 passed once round the  $1\frac{1}{2}$ " pulley 15 and connected to the spring 16. The cord 14 acts as a brake on the pulley 15, another cord 18 connected to the strip 13 carries a weight 17, and another cord 19, which is wound on the flanges of two reversed flanged and grooved wheels, is loaded with different weights 21 in order to conduct the experiments. The weights 21 correspond

to the driving force of the engine, and the governor controls this varying driving force by applying the brake which is the cord 14. Different weights 21 should be hung on the cord 19, and the cord then wound up to the top by the crank axle 7. The time taken for different weights 21 to fall should be noted, and if the apparatus has been properly adjusted the different weights 21 should take nearly the same time to fall to the floor. If heavy weights are hung on, the governor ball weights 4 fly out and raise the discs 8 which swing the strip 13 and apply the brake thus retarding the fall of the weights. The student should tabulate his results, using different weights and noting the variation in seconds taken for the weights to fall. The following are examples:—

Weight.  
75 grammes

Time in falling.  
12 Secs.

Weight.  
100 grammes

Time in falling.  
11 Secs.

Weight.  
200 grammes

Time in falling.  
10 Secs.

ables  
, and  
train

and  
o in  
ms "

57A  
59  
66  
67  
68

# MECCANO ACCESSORY OUTFITS



## Meccano Accessory Outfits

Our illustration shows one of the Meccano Accessory Outfits. As has already been explained, these Outfits connect the main Outfits from No. 00 to No. 7, making it possible for a boy who commences with one of the earlier Outfits to build up his equipment by easy stages, until he is the possessor of parts that cover the entire system.

## Electrical Outfit

The application of electricity to the Meccano system adds a further and wonderful charm, and the joys of model-building are now increased by the fascinating pastime of carrying out delightful electrical experiments.


The Meccano Electrical Outfit contains a number of specially designed electrical parts which may be used in conjunction with any of the regular Outfits.



# MECCANO MOTORS


## Electric Motor No. 1 (4 Volt)

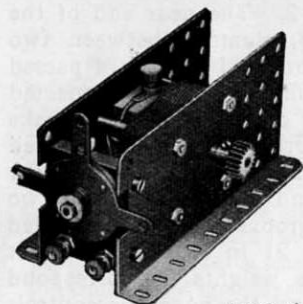The 4-volt Motor is specially designed to build into Meccano models. It may be run from a 4-volt Accumulator, or, by employing a suitable transformer, direct from the main. It is fitted with reversing motion, provided with stopping and starting controls, and the gearing is interchangeable.



## 4-Volt Accumulators

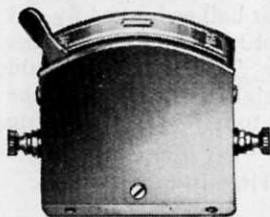These new and excellent types of Accumulators have been adapted to drive the Electric Motor No. 1. They have been subjected to the severest tests and have proved themselves to be the most suitable accumulators for use with any type of electric motor. They are non-spillable, have remarkable recuperative powers, and will continue to supply current when nominally exhausted.




## Resistance Controller

By employing this variable resistance the speed of the Meccano Electric Motor No. 1 (4 volt) may be regulated as desired. The controller is connected in series with the motor and accumulator, or with the motor and transformer if a transformer is used as the source of power. It will not regulate the speed of a high-voltage motor connected to the main.

## Electric Motor No. 2 (100-250 Volt AC or DC)

This Electric Motor may be employed for any purpose for which a small motor is suitable, but it is specially adapted for driving Meccano models. The side plates are perforated with standard equidistant holes, thus allowing the motor to be built into any Meccano model. The motor is specially designed for connection with the electric-light main. It is supplied for 100-120 volts or 200-250 volts (alternating or direct), and is fitted with 6 ft. length of flex, an insulated plug for connection with the motor terminals, and an adapter for connection with an ordinary lamp socket.

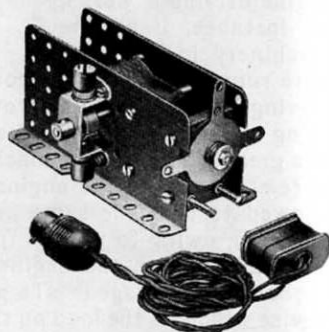A suitable resistance is required when the motor is run with a 200-250 volt current, and this is supplied by connecting a 60-watt lamp in series with the motor. A board on which are mounted a suitable lamp-holder (lamp not included) and a switch is provided separately.



## Clockwork Motor

How splendid it is, after spending hours in building a model, to be able to set it in motion with a motor, just as do real engineers! The Meccano Clockwork Motor is specially made for this purpose and is a fine piece of mechanism—simple, powerful, and reliable. It is fitted with starting and stopping levers, and has a reversing movement.



*For prices of the above see price list at end of Manual.*



# HORNBY TRAINS

**HORNBY TRAINS** are manufactured by Meccano Limited, and they are made from the finest materials obtainable. A most valuable feature of the Locomotives is that all the parts are standardised and any lost or damaged units may be replaced with new ones. Each Train is a beautiful piece of workmanship with perfect mechanism, ensuring smooth running. A guarantee of efficiency is furnished with each Locomotive.

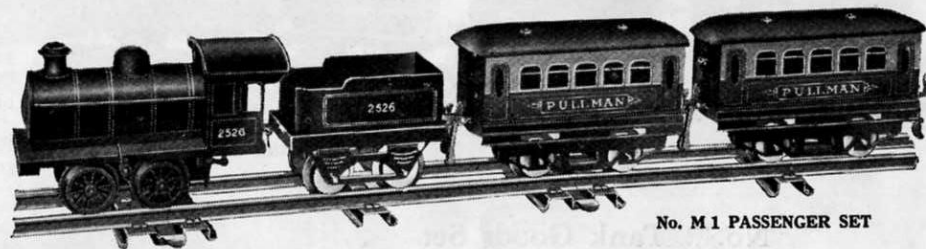
**A HORNBY TRAIN LASTS FOR EVER!**

## No. M 1 Passenger Set


This set contains Locomotive, Tender, two Pullman Coaches and set of Rails. One of the latter is a brake rail by means of which the train may be braked from the track. Richly coloured and well finished; fitted with brake mechanism; non-reversing. Gauge 0.

## No. M 2 Passenger Set

Similar in every way to the above excepting that it has three Pullman Coaches instead of two, and additional rails.



No. M 1 PASSENGER SET

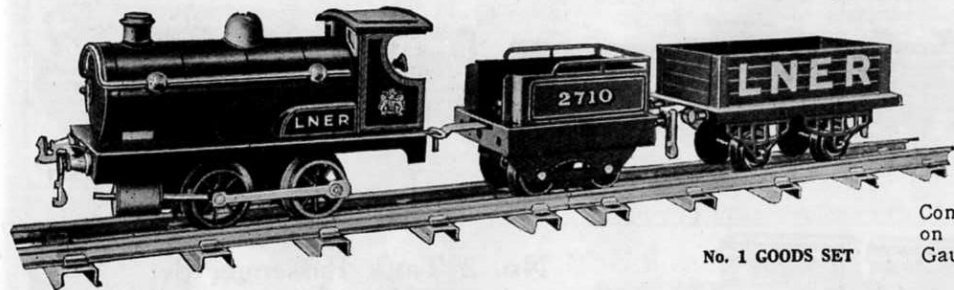

No. 1 GOODS SET

## No. 1 Goods Set

Each set contains Locomotive, Tender, and one Hornby Wagon, with Rails to form either a circle 2 ft. in diameter or an oval 2 ft. in width by 2 ft. 10 in. in length. One of the rails is a brake rail by means of which the train may be braked from the track. The Locomotive is fitted with reversing gear and brake mechanism. The Locomotives and Tenders of this set that are lettered to represent the L.M.S. and L.N.E.R. Companies' rolling stock are enamelled in black, while those modelled on the rolling stock of the G.W. Railway are enamelled in green. Gauge 0.

## No. 2 Pullman Set

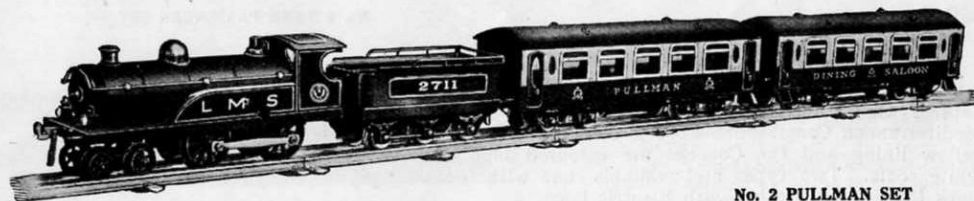
This set includes Locomotive and Tender of a larger type, measuring 17 in. in length. The Coaches are beautiful both in colour and finish. Each set includes Locomotive, Tender, and two Pullman Coaches, with set of Rails making a 4 ft. diameter circle. The rails include one brake rail by means of which the train may be both braked and reversed from the track. In colours to represent the L.M.S., L.N.E. or G.W. Railway Companies' rolling stock. The Locomotive is fitted with reversing gear and brake mechanism. Gauge 0.

## No. 2 Goods Set

This set contains Locomotive, Tender, and Rails as in No. 2 Pullman Set, and two Wagons. Gauge 0.

## No. 1 Passenger Set

This set is similar in every way to No. 1 Goods Set, except that it contains two Coaches in place of a Hornby Wagon. Gauge 0.




No. 2 PULLMAN SET

*For prices of the above see price list at end of Manual.*



# HORNBY TRAINS

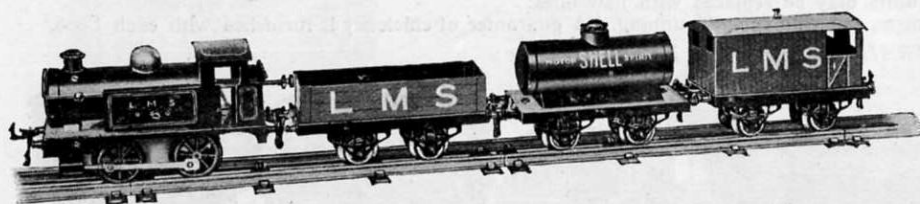

No. 1 TANK GOODS SET


## No. 2 Tank Goods Set

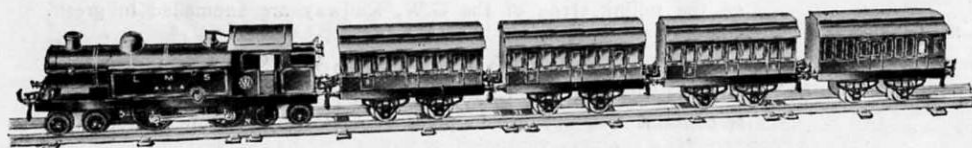This set contains a Hornby Wagon, a Petrol Tank Wagon, a No. 1 Cattle Truck and a Brake Van, with a set of Rails to form a circle 4 ft. in diameter. The rails include one brake rail by means of which the train may be both braked and reversed from the track.

Gauge 0, in colours to represent the L.M.S., L.N.E., or G.W. Railway Companies' rolling stock. The Loco is fitted with reversing gear and brake mechanism.




No. 2 TANK GOODS SET



No. 2 TANK PASSENGER SET

## The Riviera "Blue" Train Set

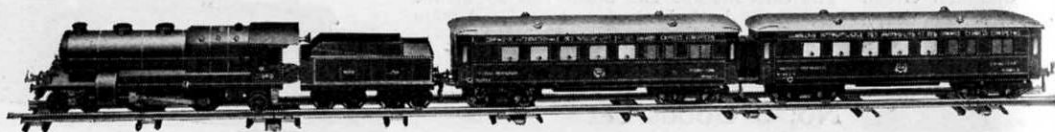These splendid Train Sets are models of the famous express that runs regularly between Calais and the Mediterranean Coast. The Loco is coloured brown with yellow lining and the Coaches are coloured blue with white roofs. Two types are available, one with Clock-work Loco and the other with Electric Loco.



## No. 1 Tank Goods Set

This set contains a No. 1 Hornby Tank Loco, Hornby Wagon, Petrol Tank Wagon, Brake Van and set of Rails to form either a circle 2 ft. in diameter or an oval 2 ft. in width by 2 ft. 10 in. in length. One of the rails is a brake rail by means of which the train may be braked from the track.

Gauge 0, in colours to represent the L.M.S., L.N.E. or G.W. Railway Companies' rolling stock. The Loco is fitted with reversing gear and brake mechanism.

## No. 2 Tank Passenger Set

This set contains a No. 2 Hornby Tank Loco and Rails as in the No. 2 Goods Set, but three Passenger Coaches and one Guard's Van are included in place of the Wagons and Vans.

Gauge 0, in colours to represent the L.M.S., L.N.E. or G.W. Railway Companies' rolling stock.

*For prices of the above see price list at end of Manual.*

# ROLLING STOCK AND ACCESSORIES

(HORNBY SERIES)



**BRAKE VAN**  
Finished in grey, with opening doors. Price 3/6



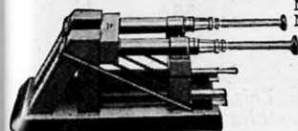
**\*No. 1 LUGGAGE VAN**  
With opening doors. Price 3/6




**SECCOTINE WAGON**  
Beautifully finished in blue, with opening doors. Price 4/-




**CRAWFORD'S BISCUIT VAN**  
Finished in red, with opening doors ... Price 3/6



**HYDRAULIC BUFFER STOPS**  
Price 5/-



**TELEGRAPH POLE**  
Price per pair 3/6

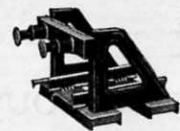


**SPRING BUFFER STOP**  
Price 1/-



**DOUBLE LAMP STANDARD**  
Four-volt bulbs may be fitted into the globes. Price 4/-



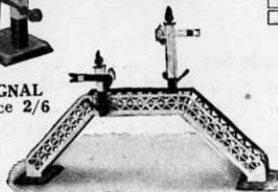**SIGNAL**  
Price 2/6



**FOOTBRIDGE**  
No. 1. With detachable Signals Price 6/-  
No. 2. Without Signals ... 3/6  
Signals only ... per pair 2/9



**ISLAND PLATFORM**  
Length 32½-in., height 6½-in., width 3-in. The ramps at either end are detachable, and if desired the platform may be connected to the main station. Attractively coloured in green, blue and white. Price 7/6

THE Hornby system consists of a complete range of Rolling-Stock, Train Accessories, and Rails, Points and Crossings, with which the most elaborate model railway may be constructed. Every component in the Hornby Series is well designed and carefully modelled on its prototype in real life.

Any boy may gradually build up a complete miniature railway by making use from time to time of the items included in the Hornby Series.



**\*TROLLEY WAGON**  
Finished in grey and red. Suitable for 2-ft. radius rails only ... Price 5/6



**RAILWAY STATION.** Excellent model, beautifully designed and finished. Dimensions: Length 2-ft. 9-in., breadth 6-in., height 7-in. Price 10/-



**TUNNEL**  
Realistic and finished in colours ... Price 7/6



**JUNCTION SIGNAL**  
Signal arms operated by levers at base. Very realistic model standing 14-in. in height. Price 5/6



**LATTICE GIRDER BRIDGE**  
Constructional type. Strong and well proportioned. Price 9/6



**\*REFRIGERATOR VAN**  
Enamelled in white, with opening doors. Price 3/9



**\*No. 2 LUGGAGE VAN**  
Finished in blue and green. Fitted with double doors. Suitable for 2-ft. radius rails only ... Price 5/9



**\*No. 2 CATTLE TRUCK**  
Splendid model fitted with double doors. Suitable for 2-ft. radius rails only ... Price 5/9



**No. 2 TIMBER WAGON**  
Suitable for 2-ft. radius rails only. Price 3/6



**\*BREAKDOWN VAN AND CRANE**  
Beautifully coloured in grey and black, with opening doors. Suitable for 2-ft. radius rails only ... Price 6/3

There are now over 60 items of Rolling Stock and Accessories in the Hornby Series, some of which are illustrated and described above. Send for a complete illustrated price list.

\*Lettered L.M.S., L.N.E.R. or G.W.

# Meccano Price List

## MECCANO OUTFITS

No. 00 Meccano Outfit .. .. .	3/6
" 0 " " " " " " " " " " " "	5/-
" 1 " " " " " " " " " " " "	8/6
" 2 " " " " " " " " " " " "	15/-
" 3 " " " " " " " " " " " "	22/6
" 4 " " " " " " " " " " " "	40/-
" 5* " " (Carton) " " " " " " " "	55/-
" 5* " Presentation Outfit " " " " " " " "	85/-
" 6* " Outfit (Carton) " " " " " " " "	105/-
" 6* " Presentation Outfit " " " " " " " "	140/-
" 7 " " " " " " " " " " " "	370/-

## ACCESSORY OUTFITS

No. 00A Meccano Outfit .. .. .	1/6
" 0A " " " " " " " " " " " "	4/-
" 1A " " " " " " " " " " " "	7/6
" 2A " " " " " " " " " " " "	8/6
" 3A " " " " " " " " " " " "	18/6
" 4A " " " " " " " " " " " "	15/-
" 5A* " " (Carton) " " " " " " " "	50/-
" 5A* " " (Wood) " " " " " " " "	80/-
" 6A " " " " " " " " " " " "	210/-
Meccano Clockwork Motor " " " " " " " "	7/6
" Electric Motor No. 1 (4 Volt) " " " " " " " "	15/6
" " " " " 2 (100-120 or 200-250 Volt) " " " " " "	32/6
Lamp Board (with lamp-holder and switch) " " " " " " " "	4/6
Resistance Controller " " " " " " " " " " " "	3/6
Meccano Electrical Outfit X2 " " " " " " " " " " " "	42/-
" Accumulator, 4 Volt 8 amp. " " " " " " " " " " " "	17/6
" " " " 4 Volt 20 amp. " " " " " " " " " " " "	25/-

\* Outfits Nos. 5, 5A and 6 are supplied in neat and well-made cardboard boxes (cartons) or in superior oak cabinets, with lock and key.

# Hornby Train Price List

No. M1 Passenger Set .. .. .	7/6
" M2 Passenger Set .. .. .	9/-
" M3 Goods Set .. .. .	15/-
Hornby No. 0 Goods Set .. .. .	17/6
" " 0 Passenger Set .. .. .	22/6
" " 1 Goods Set .. .. .	20/-
* " " 1 " " fitted for Hornby Control .. .. .	23/6
" " 1 Passenger Set .. .. .	25/-
" " 2 Goods Set .. .. .	32/6
* " " 2 " " fitted for Hornby Control .. .. .	37/6
" " 2 Pullman Set .. .. .	50/-
* " " 2 " " fitted for Hornby Control .. .. .	55/-

Hornby No. 1 Tank Goods Set .. .. .	22/6
* " " 1 " " " fitted for Hornby Control .. .. .	26/-
" " 2 " " " " " " " " " " " "	37/6
* " " 2 " " " " fitted for Hornby Control .. .. .	42/6
" " 2 Tank Passenger Set .. .. .	40/-
* " " 2 " " " " fitted for Hornby Control .. .. .	45/-
Metropolitan Train Set No. 1 (100-250 Volt, A. or D.C.) .. .. .	110/-
" " " " " 2 (4-Volt Electric) " " " " " " " "	95/-
* " " " " " 3 (Clockwork) " " " " " " " "	55/-
Riviera " Blue " Train Set No. 1 (4-Volt Electric) .. .. .	85/-
* " " " " " 2 (Clockwork) " " " " " " " "	70/-

\* All boys who make a hobby of Hornby Miniature Railway construction will welcome the latest development—the Hornby Control System. This system enables you to manipulate the Signals and Points, and to control the Trains entirely from the Signal Cabin. A folder is available entitled "The Hornby Control System" which gives full details. Ask your dealer for a copy.



[illegible]

[CONTINUED OVERLEAF]



## Contents of Outfits—continued

[illegible]

# INDEX TO MODELS

Description.	Model No.	Description.	Model No.	Description.	Model No.	Description.	Model No.
A Gay Start ... ..	718	Cable Railway ... ..	405	Crane, Travelling Jib ... ..	105 and 217	Gangway ... ..	25 and 209
Acrobat ... ..	246	Cake Walk ... ..	434	" Swivel ... ..	441	" Ferry ... ..	245
Aerocar ... ..	610	Candy Puller ... ..	225	" (see also Derricks)		" Turntable ... ..	204
Aeroplane ... ..	66	Carrier Tricycle ... ..	226	Croix de Guerre ... ..	436	Geometrical Apparatus ... ..	410
Aeroplane, Revolving ... ..	639	Cart ... ..	524	Crossbow ... ..	310	Giant Foundry Ladle ... ..	117
" (see also Monoplanes)		" Bullock ... ..	525	Cutting Machine ... ..	419	Go-Chair ... ..	18
Aeroplage, Seashore ... ..	238	" Luggage ... ..	2, 6 and 50	" Mechanical ... ..	250	Gondola ... ..	254
Aeroscope ... ..	710	" Manure-Distributing ... ..	514			Gong ... ..	48
Anchor ... ..	52	" Station ... ..	518			Gong, Automatic ... ..	413
Applied Mechanics, Experiments in		Catapult ... ..	435			" Dinner ... ..	240
" 736 and 737		Centrifugal Governor ... ..	736			Grab, Derricking ... ..	608
Arm Chair ... ..	28	Chair, for Wounded ... ..	249			Gun, Anti-aircraft ... ..	231 and 453
Armoured Motor Tricycle ... ..	542	" Arm ... ..	28			" Field ... ..	623
Automatic Weighing Machine ... ..	607	" Baby ... ..	228			" Field, and Carriage ... ..	516
Automobiles—see under Motors		" Deck ... ..	120			" Machine ... ..	612
		" Ducking ... ..	537			" Naval Quick-Firing ... ..	450
		" Go ... ..	16			" Quick-Firing ... ..	42
		" Invalid's ... ..	56, 123 and 538				
		" Rocking ... ..	512			Hammer, Drop ... ..	640
Baby Chair ... ..	228	Chinese Palanquin ... ..	309			" Double ... ..	214
Bagatelle Table ... ..	618	Clay-Modelling Machine ... ..	418			" Mechanical ... ..	51 and 242
Bale Lifter ... ..	443	Clock, Grandfather ... ..	720			" Treadle ... ..	421
Bale Press ... ..	430	Coal Cutting Machine ... ..	703			" Trip ... ..	451
Barrow, Coster's ... ..	16 and 523	Coal Sifter ... ..	222			Hand Car ... ..	503
Barrow, Wheel ... ..	3	Coaler, Ship ... ..	729			" Trolley ... ..	340
Battleship ... ..	53	Coaster ... ..	233			Harmonograph, Twin Elliptic ... ..	730
Beam Engine ... ..	609	Coffee Grinder ... ..	312			Hatchet ... ..	116
Beaming Frame ... ..	716	Conductor's Punch ... ..	438			Hay Tedder ... ..	227
Bed Tables ... ..	122 and 420	Cot ... ..	67			Heliograph ... ..	634
Belgian Water Wheel ... ..	502	" Swinging ... ..	329			Hoisting Block ... ..	29
Belows, Forge ... ..	134	Crane ... ..	625			Horizontal Engine ... ..	631
Big Wheel ... ..	606	" Automatic Weighing ... ..	627			Horse Rake ... ..	14
Boat Lowering Gear ... ..	717	" Double Action ... ..	129			Hot-Saw, Swinging ... ..	404
Boat, Ice ... ..	333	" Elevated Jib ... ..	401				
" Kowing ... ..	132	" Gantry ... ..	133 and 425			Ice Boat ... ..	333
" Sailing ... ..	61	" Girder ... ..	407			Inclined Delivery Chute ... ..	447
" (see also Submarine and Battleship)		" Hydraulic ... ..	723			Invalid's Chair ... ..	56, 123 and 538
Boring Machine ... ..	325	" Jib ... ..	36, 121 and 128				
Box Ball Alley ... ..	616	" Motor Breakdown ... ..	215			Jack ... ..	620
Breast Drill ... ..	409	" Overhead ... ..	118			Jaunting Car ... ..	611
Brewer's Dray ... ..	534	" Portable ... ..	603			Joy Wheel ... ..	2'6 and 615
Bridges: Cantilever Bridge ... ..	646	" Radial Travelling ... ..	630			Jumping Jack ... ..	247
" Drawbridge ... ..	642	" Railway Breakdown ... ..	317				
" Forth Bridge ... ..	721	" Railway Wagon ... ..				Kinetograph ... ..	311
" High-Level Bridge ... ..	221	" Swivelling ... ..	308			Knife Grinder ... ..	629
" Jack-Knife Bridge ... ..	619	" Revolving ... ..	722				
" Railway Footbridge ... ..		" Rotating ... ..	57 and 301			Lace Jennier ... ..	339
" and Signals ... ..	252	" Swivelling ... ..	39, 43 and 104			Ladder, Extending, on ... ..	244
" St. Malo Transporter ... ..		" Luffing Jib ... ..	415			Ladder on Wheels ... ..	210
" Bridge ... ..	626	" Swivelling Jib ... ..	114			Ladder, Step ... ..	507
" Swing Bridge ... ..	445	" Travelling ... ..	20 and 526			Ladder, Travelling ... ..	106
" Transporter Bridge ... ..	713	" Gantry ... ..	515 and 726				
Buffers ... ..	33						
Butter Churn ... ..	433						









# MECCANO

Hornby's Original System, First Patented 1901

PATENTS AND DESIGNS, GREAT BRITAIN

21,117/12	4,564/15	648,958	680,416	686,112
20,535/13	139,125	671,484	682,208	698,054
22,962/13	177,430	671,485	682,209	718,404
3,869/14	250,378	671,534	682,934	718,731
4,183/14	253,236	671,790	683,011	

Meccano is more than a Toy

**I**T is important to remember that when a boy is playing with MECCANO he is using engineering parts in miniature, and that these parts act in precisely the same way as do the corresponding engineering elements in actual practice. No other system of model construction can be correct, and other toys which attempt the same object by other methods must avail themselves of constructive elements which are not correct engineering elements. Consequently, though a boy may succeed in building playthings with them, they are merely toys and nothing else, and his mind, as regards proper mechanical construction and methods, is distorted instead of instructed. He thus learns wrong principles, and when his ambition tempts him to invent or construct more elaborate models, he will find that he cannot do so because of the deficiencies of his non-mechanical system.

No Outfit is genuine unless it bears the Trade Mark MECCANO