

# MECCANO

TRADE MARKS 296321, 501113, 76, 12633, 10274, 55/13476, 569/13, 884/25, 2913, 80, 124, 336, 4174, 91637, 83171, 157149, 32822, 200639, 209733, 214061, 214062, 12892, 29034, 33316, 1818, 16737, 383/13, 5848, 50204, 10/13258, 23836, 18982, 20063/925, 9048, 5549, 2189, 16900, 72288, 2389, 41812, 5403, 7315, 18066, 139420, 491933-4-5-6, 29041, 26877, 6595, 404718, 410379, 55096, 12240

HORNBY'S ORIGINAL SYSTEM-FIRST PATENTED 1901

# INSTRUCTIONS

FOR OUTFITS

Price 1'9

00 to 4

Copyright by MECCANO LIMITED, LIVERPOOL, throughout the world

No. 31.4

ENGLISH LUTTION

# MECCANO

# The Finest Hobby in the World for Boys


The Meccano system is composed of over two hundred and fifty different parts, mostly made of steel or brass, each one of which has a specific mechanical purpose. These parts combine to form a complete miniature engineering system with which practically any mechanical movement may be reproduced in model form. More can be accomplished with Meccano than with any other constructional toy, for no other system has such possibilities. The genius is in the parts and you can commence to build models as soon as you get your Outfit home. A screwdriver, provided in the Outfit, is the only tool necessary.

There is no limit to the number of models that can be built with Meccano—Cranes, Clocks, Motor Cars, Ship-Coalers, Machine Tools, Locomotives—in fact everything that interests boys. The most wonderful feature about the system is that it is real engineering in miniature; it is fascinating and delightful and it gives you a satisfaction beyond anything that you have ever previously experienced.

# Model-Building with Meccano

Make the simple models first—they will provide hours of fun—and then try to improve them. Every model can be made in a dozen different ways. It is important to screw up all the nuts and bolts tightly to ensure that your models will be strong and firm when they are completed.

Every keen and inventive Meccano model-builder should obtain copies of the special Manuals "How to use Meccano Parts" and "Meccano Standard Mechanisms." In the former the principal uses of Meccano parts are outlined, while the latter shows a large number of real engineering mechanisms, built of Meccano parts, that can be incorporated in various models. You can obtain copies of these Manuals from your dealer, or direct from Meccano Ltd., Old Swan. Liverpool.

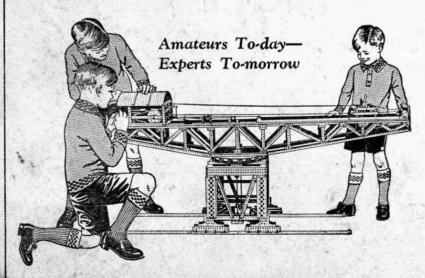


# How to Build up Your Outfit

Meccano is sold in ten different Outfits, numbered 000 to 7. All Meccano parts are of the same high quality and finish, but the larger Outfits contain a greater quantity and variety of parts, making possible the construction of more elaborate models. Each Outfit from No. 00 upwards may be converted into the one next higher by the purchase of an Accessory Outfit. Thus, a No. 00 may be converted into a No. 0 by adding to it a No. 00A. A No. 0A would then convert it into a No. 1, and so on. In this way, no matter with which Outfit you commence, you may build it up by degrees until you possess a No. 7 Outfit. It is important to remember that Meccano Parts may be bought separately at any time in any quantity from your Meccano dealer.


# Meccano Service


The service of Meccano does not end with selling an Outfit and an Instruction Manual. When you want to know something more about engineering than is now shown in our books, or when you strike a tough problem of any kind, write to us. We receive over 200 letters from boys every day all the year round. Although all kinds of queries are put to us on all manner of subjects, the main interest is, of course, engineering. The wonderful knowledge of engineering matters possessed by our staff of experts is unique. This vast store of knowledge, gained only by many years of hard-earned experience, is at your service. We want the Meccano boy of to-day to be the famous engineer of to-morrow.


### All these Models can be built with MECCANO Outfit No. 00

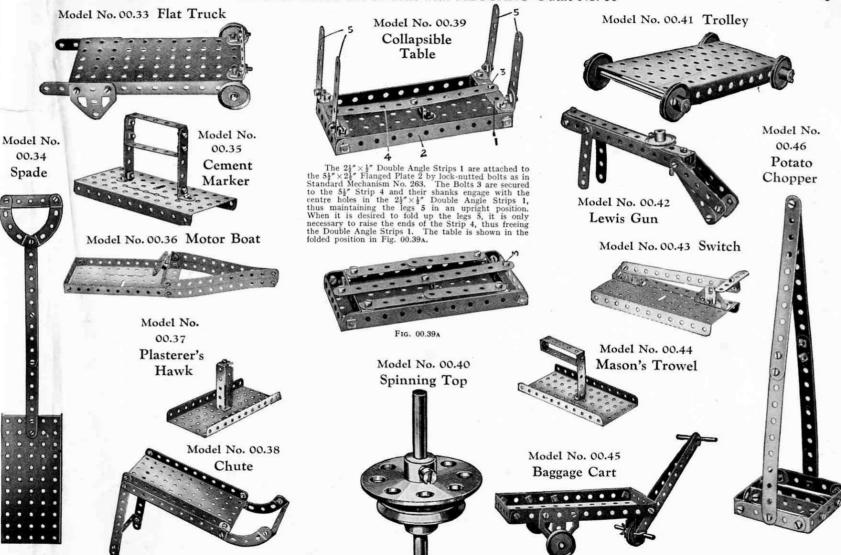


#### All these Models can be built with MECCANO Outfit No. 00

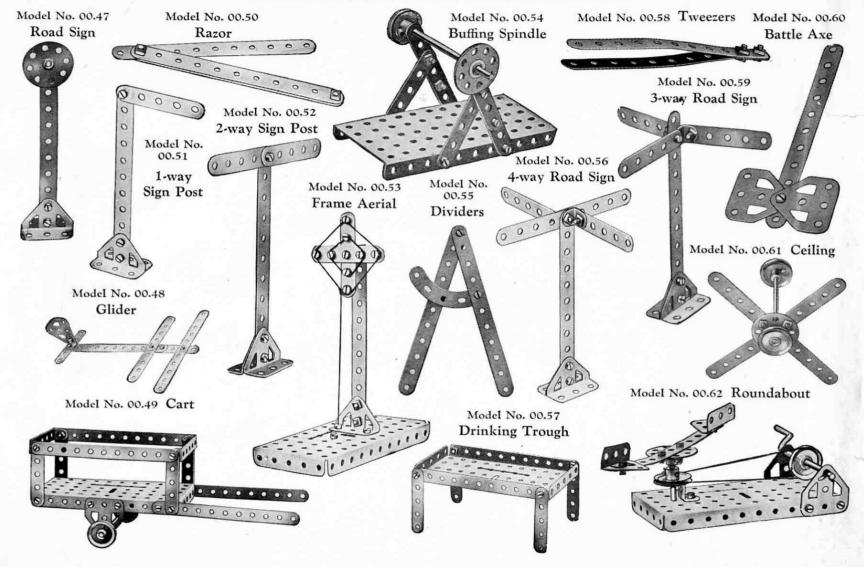


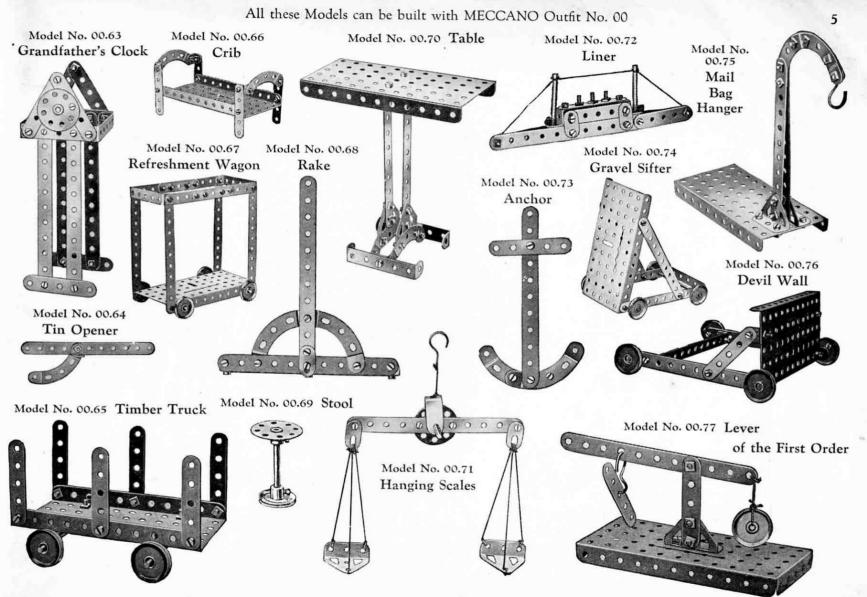


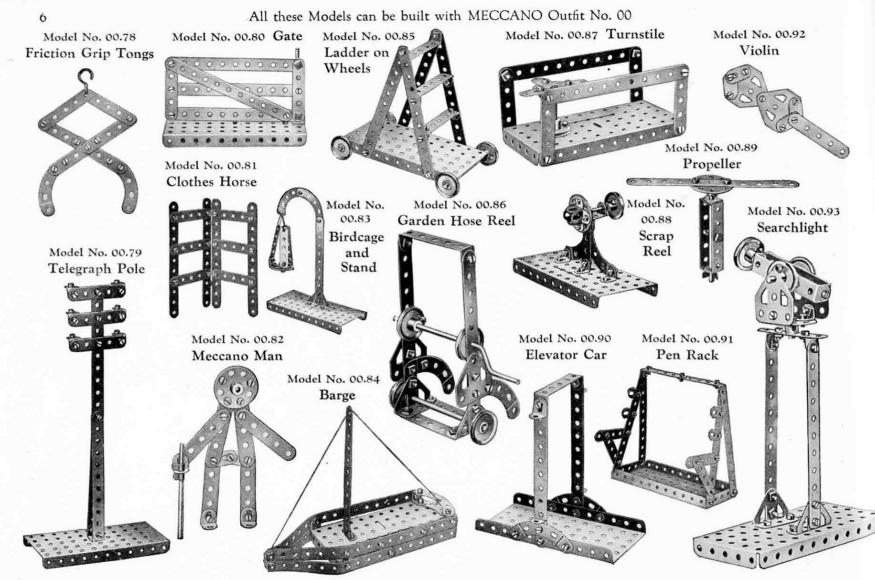

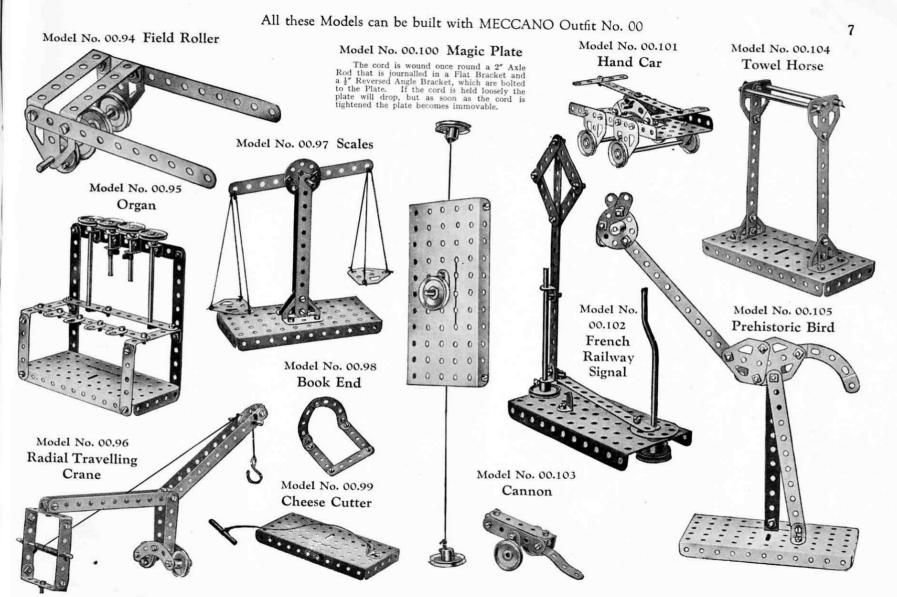



Timber Wagon

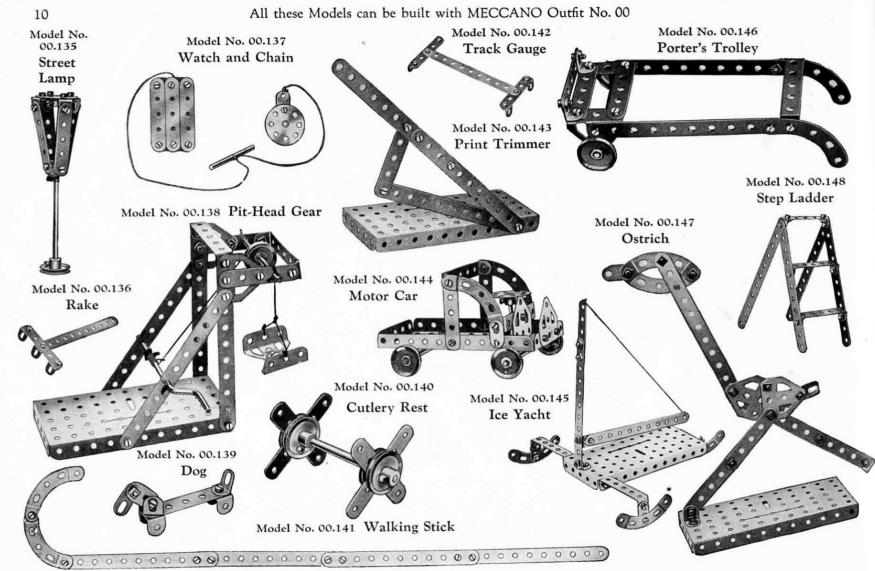


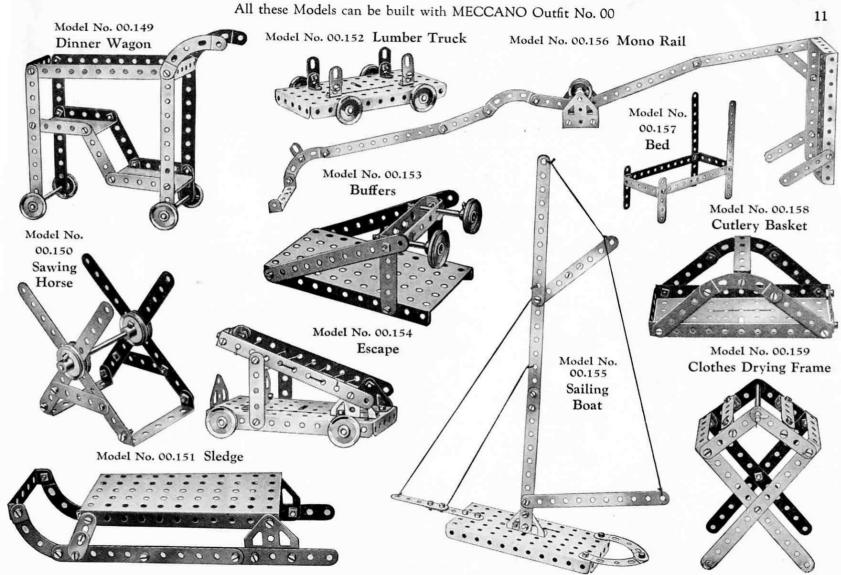

#### All these Models can be built with MECCANO Outfit No. 00

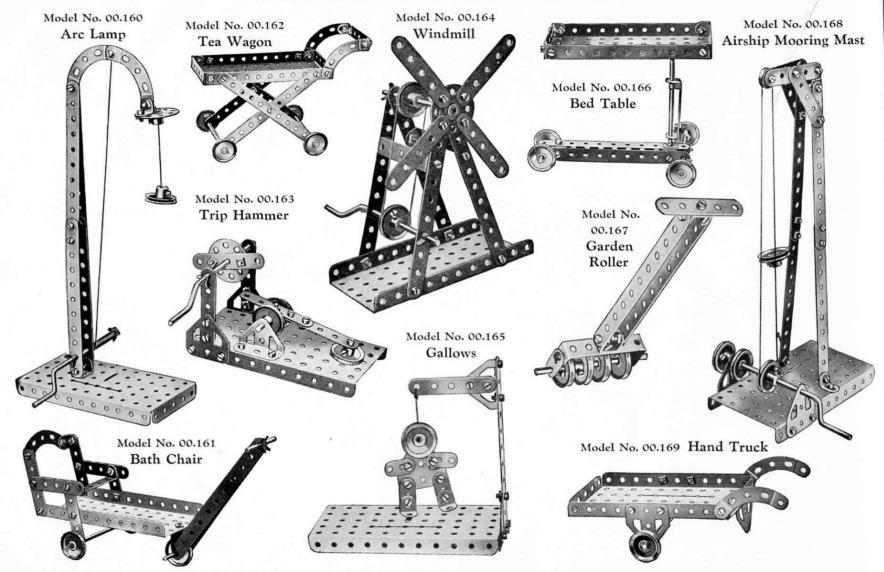


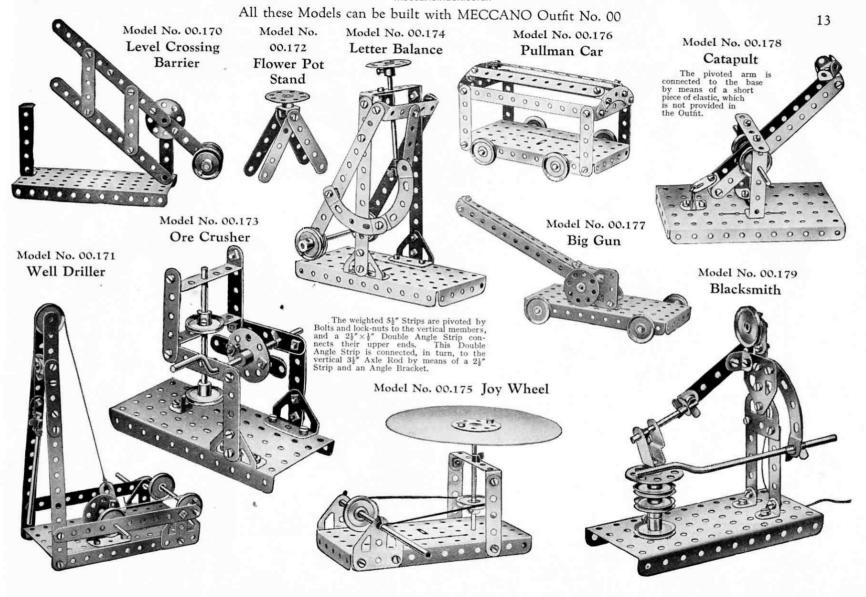


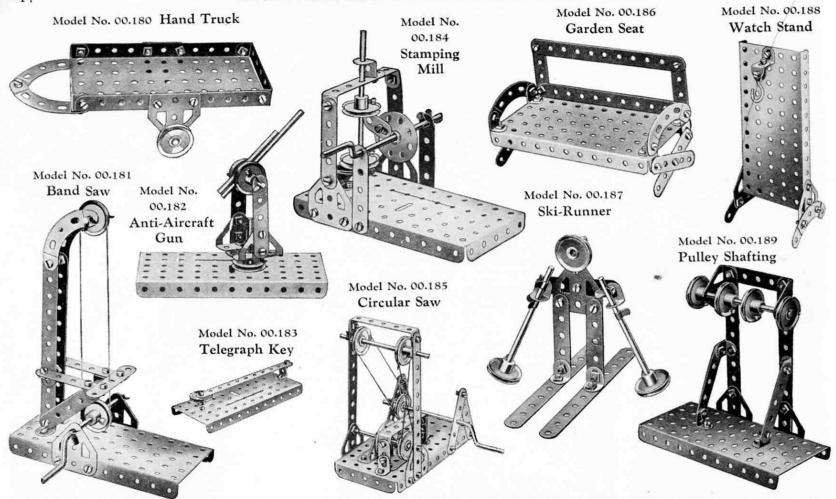


#### HOW TO CONTINUE

This completes our examples of models that may be made with MECCANO Outfit No. 00. The next models are a little more advanced, requiring a number of extra parts to construct them. The necessary parts are all contained in a No. 00A Accessory Outfit, the price of which may be obtained from any Meccano dealer.

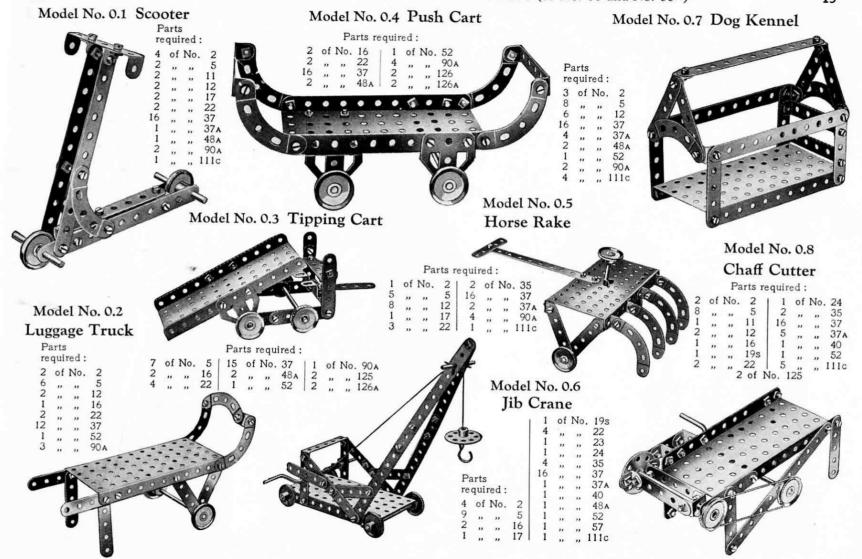


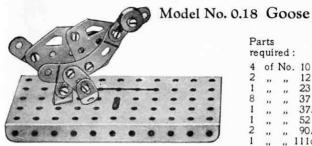


# Model No. 0.22 Lazy Tongs

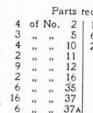

# Model No. 0.23 Battleship

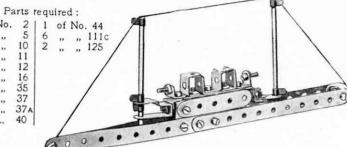

# Model No. 0.19 Strong Man

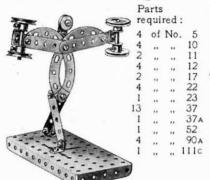

# Model No. 0.20 Aeroplane

Parts


required:



Parts	rec	uire	i i

4	of	No.	2	8	of	No	. 37
3	"	**	0	1	,,	,,	111c
2	.,	**	12	2	,,	,,	125
1		**	24	1	**	,,	126A


Model No. 0.24 Gymnast

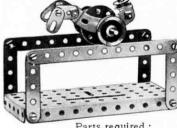


-	
	required

			20000000				
2	of	No.	2	1 1	of	No.	24
4	,,	,,	5	12	,,	,,	37
4	,,	,,	10	1	,,	,,	37 A
1	,,	,,	12	1	"	,,	52
1	,,	,,	16	1	,,,	211	90 A
2	,,	,,	22	1	,,	,,	1110
1	,,	,,	23	F			


Model No. 0.25 Rocking Horse

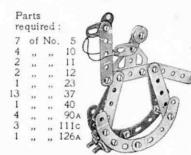

Model No. 0.26

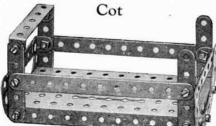

# Model No. 0.21 Cattle Truck

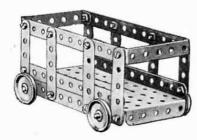


required:


Parts




required: 48A 52

Parts

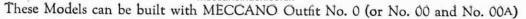

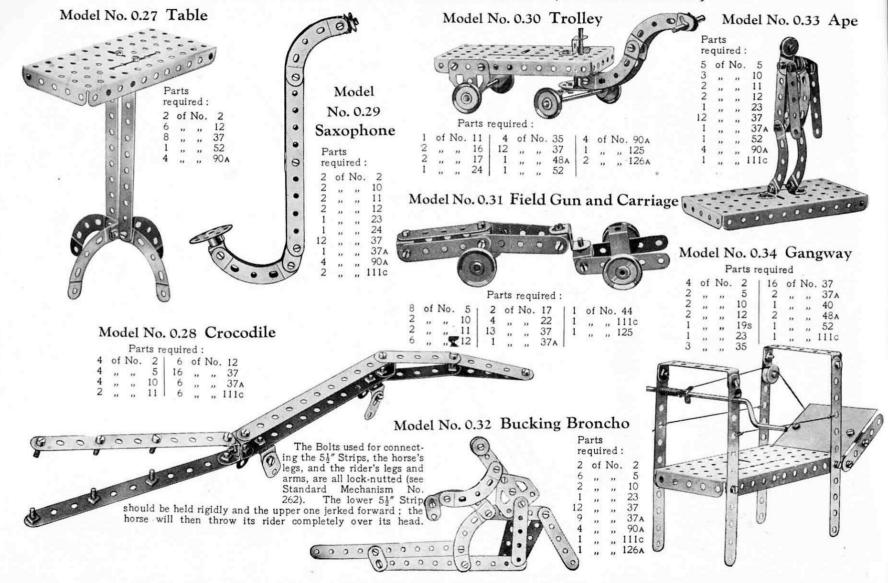


# Model No. 0.35 Tramway Car

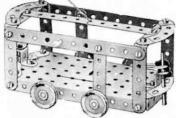


		Pai	rts re	quir	ed	:		
3	of	No.	2	16	of	No.	37	
6	**	**	5	6	**	,,	37A	
2	11	**	10	2		,,	48A	
2	200	**	16	1	))	11	52	
2	,,,	.,	17	4	22		90 A	
4	,,	**	22	6	,,	,,,	111c	
6	11	"	35	2	**	.,	125	

# Model No. 0.36 Motor Boat

re	qui	red:	9					
2		No.		1	of	No.	23	
2	"		5	7	1)	22	37	
3	**	,,	10	1			37A	
1	**	"	11	1	,,	**	111c	

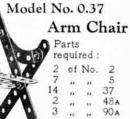

# Model No. 0.38 Torpedo Boat

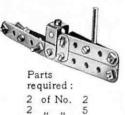


	dar		•
2	of	No.	2
2	,,	,,	5
3	,,	**	10
2	**	,,	11
2	"	"	12
1	"	"	17
11	"	**	37
4	**	11	37A
5	**	**	111c

# Model No. 0.40 Gramophone




# Model No. 0.43 Prehistoric Armadillo

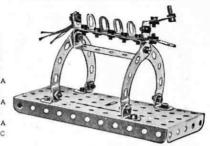

Model No. 0.44 Motor Cycle and Side Car

## Model No. 0.39 Piano

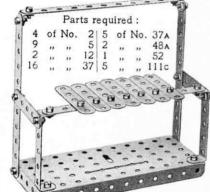

# Model No. 0.41 Milk Maid

							6	3					
	arts qui	red:		•		4	V.C	0	2	0	3		
5	of	No.	5		`	10	-	Val	1		1		
	,,	,,	10		1			ak	10				
3		22	11		1			i k	0)				
4	"	**	12					0	-	tis.	100		
2	,,	**	12 22 23 37	-	100			0	严	塘		-	
	**	.,,	23	CH	1			-	ı.	層			
4	,,	"	37	-				10	1	H			
1	**	3)	37A					8		10	A.		
1	**	**	40					Щ		-	à-	-	-
1	**	,,	52			-	76	16		-	30	5-	
1	,,	.,,	90 A		-			10-			500		
1	ns	,,	1110	1	1		• •			-			

#### Parts required

		P	arts	requi	rea		
1	of	No.	5	10	of	No.	37
4	"	33	10	1	,,	,,	37A
2	,,	**	11	1	,,	,,	44
3	**	"	12	3	,,	**	90 A
1	**	,,	16	1	**	**	111c
3	2.0	"	22	1	.,,		125
1	"	**	23	1	11	.,	126a


## Model No. 0.42 Sword


Parts required:

4 of No. 2 | 10 of No. 37 | 3 of No. 90A







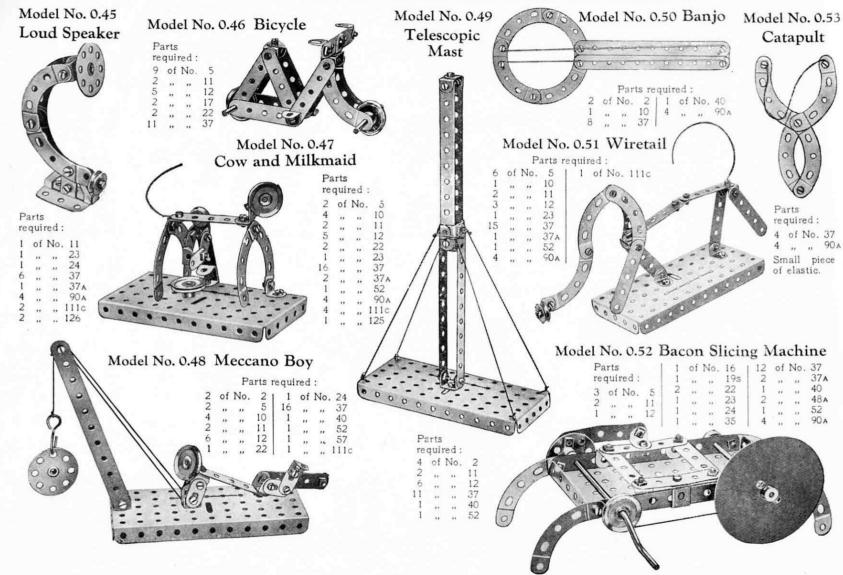

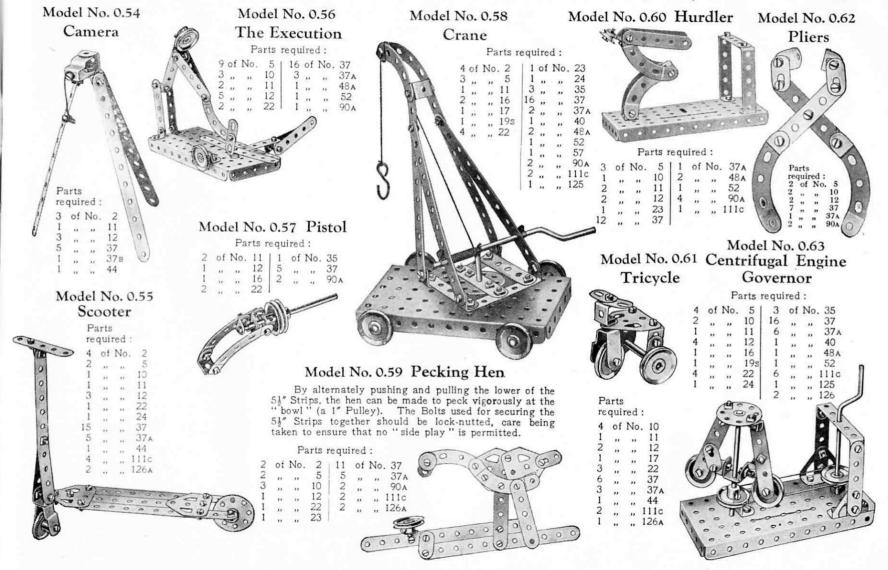

#### Model No. 0.64 Wrestlers

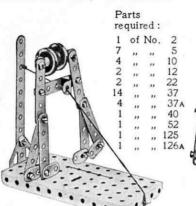

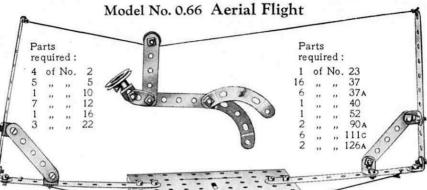

000000000000

# Parts required: 4 of No. 5

Model No. 0.70




# Model No. 0.65 A Chase


Parts required .

		I a	1 13 1	cqui	rea	•	
1	of	No.	5	16	of	No.	37
1	,,	,,	10	1	,,	,,	37A
2	,,	,,	11	1	,,	,,	52
7	**	**	12	4	,,	,,	90 A
1	**	**	22	2	,,		111c
1	,,	,,	23	2	,,	**	126a



# Model No. 0.68 Galvanometer

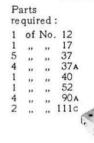

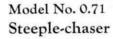

of	No.	5	1	of	No.	37
,,	,,	10	1	**	**	484
	,,	12	1	,,	,,	52
	.,	23	4		,,	90 A
	**	37	1	,,	,,	1110
160	•		1	**	.,	1264



**Bullock Cart** 


Model No. 0.67

3	of	No.	2	12	of	No.	37A
9	,,	,,	5	1	,,	,,	40
1	,,	.,,	16	1	,,,	**	52
2	,,	,,	22	2	,,,	3.5	111c
16	,,	**	37	2	,,	,,	126A







				code			
2	of	No.	5	113	of	No.	37
1	,,	,,	11	1	,,	,,	52
1	,,	,,	17	4	,,	,,	90.
1			24	2			126.

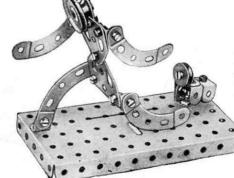




#### These Models can be built with MECCANO Outfit No. 0 (or No. 00 and No. 00A) Model No. 0.72 Pen Rack Model No. 0.76 Coast Guard Model No. 0.78 Snake Parts required: 0000000 Parts required: No. 2 | 8 of No. 37 Model No. 0.79 Clock Parts required: 3 of No. 12 | 1 of No. 37A .. 23 1 .. .. 1 of No. 111c Model No. 0.73 Boxer Model No. 0.80 Windmill Model required: Parts 2 of No. 11 No. 0.75 required: Fan Model No. 0.77 Parts required: Break-Down Crane Parts required: 13 of No. 37 Parts required: 9 of No. 5 | 2 of No. 37A 1 of No. 111c Model No. 0.74 Horseman's Fall Parts Model No. 0.81 Frog required: of No. 5 Parts required: of No. 5 | 10 of No. 37 1 ,,

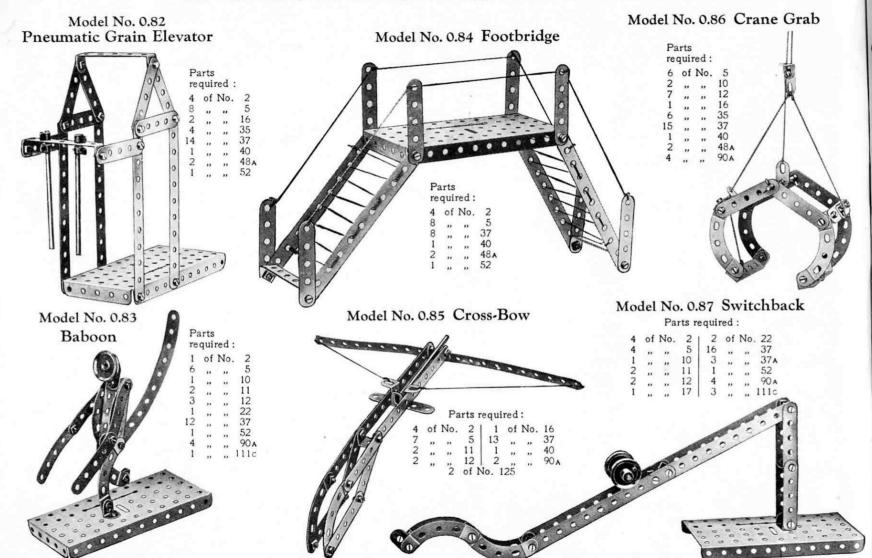

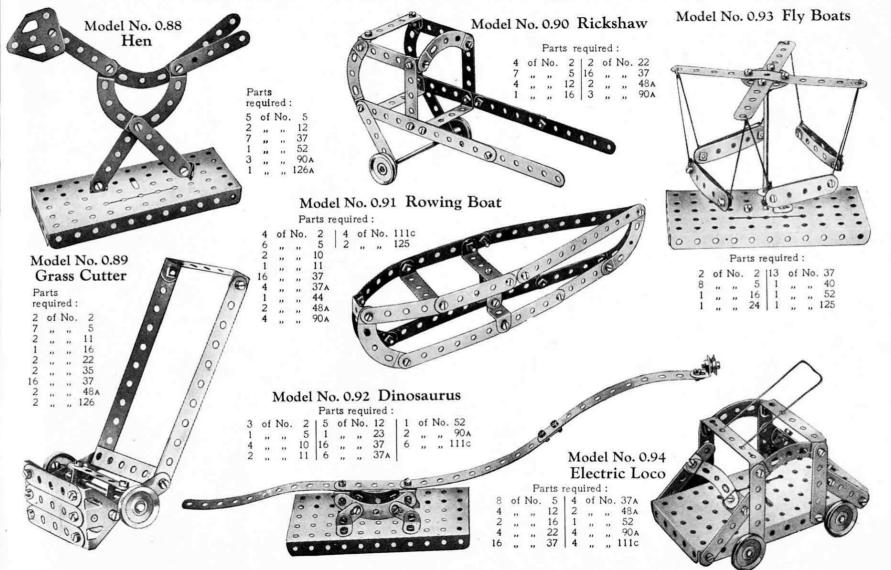

# Model No. 0.95 Trolley

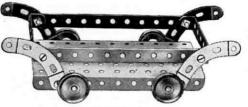

#### Parts required:

2	of	No.	2	18	of	No.	37
2	,,	,,	16	1	,,	,,	48A
4	,,	,,	22	1	,,	,,	52
		4	of	No.	907	A	

# Model No. 0.96 Pen Rack




# Model No. 0.97 Walking Man

Parts required:


5 of No. 5 3 ,, 10 2 ,, 12 1 ,, 22 7 ,, 37

## Model No. 0.98 Pump

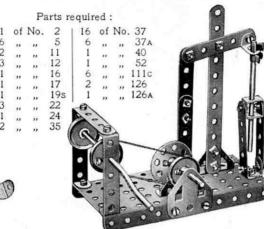


The connecting Strip is pivoted by Bolts and Nuts at one end to the Bush Wheel and at the other end to the cross beam. The latter is pivoted by the same means to the upright.


# Model No. 0.99 Aerial Ropeway

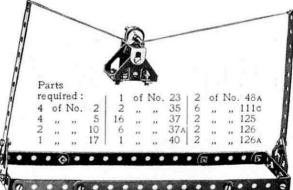

# Model No. 0.100 Luggage Truck

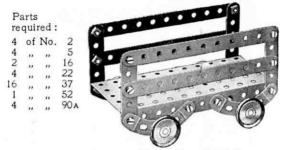

# Model No. 0.101 Drafting Table

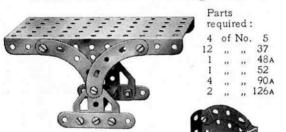


# Model No. 0.102 Arm Chair


Parts required:
2 of No. 2
4 " " 5
12 " " 37
1 " " 488
1 " 52
3 " " 904



#### Model No. 0.103 Rattle

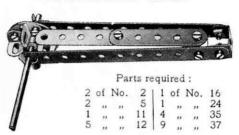

# Model No. 0.104 Shearing Machine

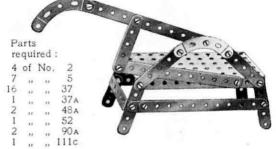


# Model No. 0.105 Anchor



# Model No. 0.106


		arts	
	red :	qui	re
2	No.	of	4
11	,,	,,	2
12	,,	,,	8
22	,,	,,	1
37	22	22	16
37A	,,	,,	6
48 A	,,	,,	2
52	,,		1
90A	***	,,	4
111c			6

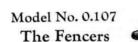

#### Parts required:

	8	of	No.	5	116	of	No.	37			
		,,	,,	10	4	,,	,,	37	Α.		
	26224	"		10 12 16	1	'n	,,	52			
	2	,,		16	4	,,		1110			
	2	,,		22	2 2			125		-	11
	4	,,		35	2	,,	,,,	126.	A	4 6	R.EG
C									-	V80h	48 min
										a . 19	100
1								الگ		3	1
	_										
	A										2 5
			2						•	( ) ( ) ( ) ( ) ( )	200
		9			_					( C -	A. C. C.
上が		4			4						1 . S. S
		4	et		4				•		1 . S. S. S. S.
		9	e.		4						V. S.
		7							•	2	1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1
		5			-				•	2	1 S S
6		5									10 mm

#### Model No. 0.108 Machine Gun

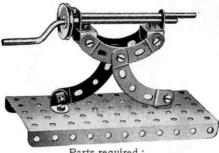

#### Parts required:

2	of	No.	11	1	of	No.	22
4	,,	,,	12	12	,,	,,	37
1	**		16	1	,,,	,,,	52
1	**	,,,	19s	4	,,	115	90

# Model No. 0.109 Single Sheave Pulley Block



Parts required: 2 of No. 5 | 7 of No. 37A 1 ,,, 23 | 1 ,,, 57 3 of No. 111c


# Model No. 0.110 Tea Wagon



# Parts required: 8 of No. 5





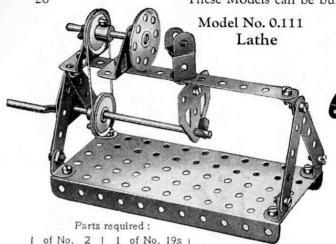

1	of	No.	2	1 1	of	No.	19s	1				á
4	,,	,,	5	2	,,	,,	22	1	of	No.	40	
2	,,	,,	11	1	,,	,,	24	1	,,	,,	52	
7	,,	,,	12	3	,,	,,	35	2	,,	,,	126	
1	,,	,,	17	16	,,	,,	37	2			126A	



# Model No. 0.113 Viaduct




Parts

# Parts required:

8	of	No.	5	1	1	of	No.	52
10	,,	,,	37	1	4	,,	No.	90 A


# Model No. 0.114 Pulley Block

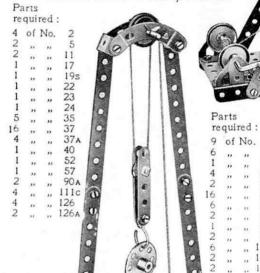


	Part	s r	eq	uir	ed	:
n.f	No	2	1	2	06	7


4	01	No.	2	1 2	01	No.	35
5	12	11	5	16	.,		37
1	**		10	6		**	37 A
2	**	"	11	1	,,	,,	40
1	**	,,	16	2	**	,,	48 A
1	**	22	17	1	,,	,,	52
1	,,	,,	19s	1	,,	,,	57
3	,,	,,	22	6	,,	,,	1110
1			23	2			125

# 2 of No. 126 Model No. 0.116 Dump Car

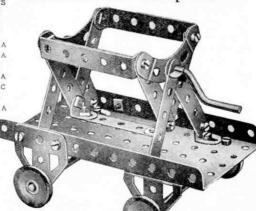


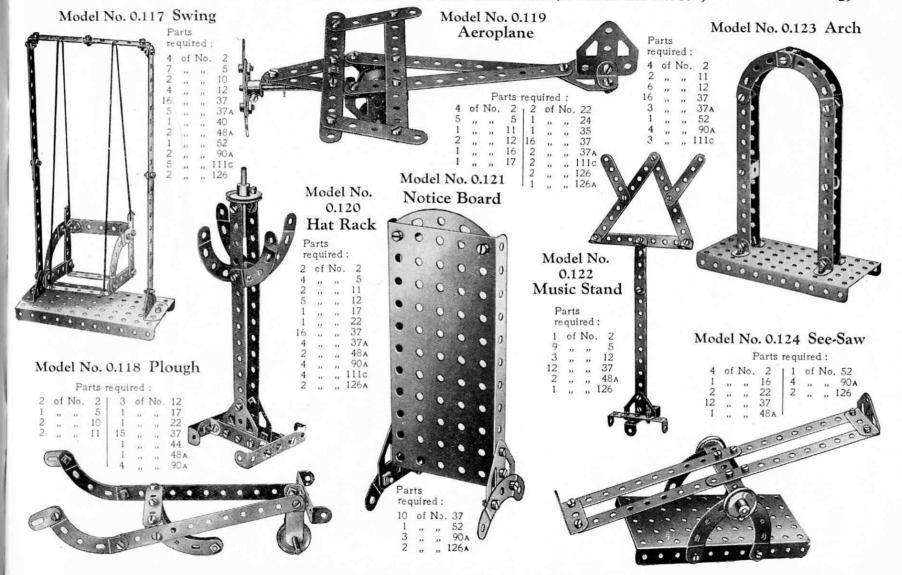


# Model No. 0.125 Drilling Machine

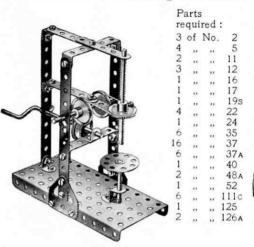

#### Model No. 0.127 Scales

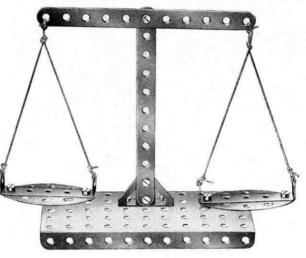

#### Model No. 0.129 Cot

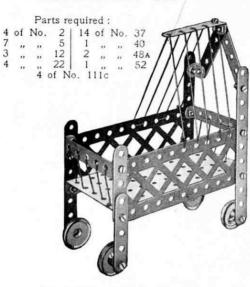

# Model No. 0.126 Counter Scales

	Parts	required:	
1 2 2 1	of No. 2 ,, 10 ,, 12 ,, 17	7 of No. 37 1 ,, 44 1 ,, 52 2 ,, 126	Co
60		0000	
0.			
000	, , ,		••••

#### Parts required:

2	of	No.	2	2	of	No.	48A
9	,,		37	1	,,	,,	52
1	,,	,,	37A	4	,,	,,	90 A
1			40	1			126

# Model No. 0.128 Single Sheave Pulley Block




#### Parts required


1 of No. 23 12 ,, ,, 37A 1 ,, ,, 57 4 ,, ,, 111c 2 ,, ,, 126A

# Model No. 0.130 Couch

#### Parts required:

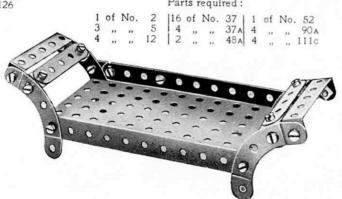


# Model No. 0.131 Rock Drill

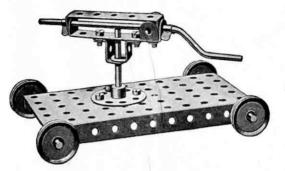

#### Parts required:

1	of	No.	11	4	of	No.	22	2	of	No.	48A
		- 22	16	1	**	- 11	24	1			52
1		"	17	2	,,	**	35	2	**	,,	125
1			19s	5			37				


#### Model No. 0.132 Well Windlass

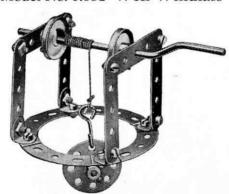


Parts required:

6	of	No.	5 12 19s	2	of	No.	22	1	of	No.	40
4	.,	,,,	12	1	,,	,,,	24	1	,,	,,	57
1	,,,	,,	19s	12	,,	,,	37	4	**	,,	901


#### Model No. 0.133 Prancing Horse

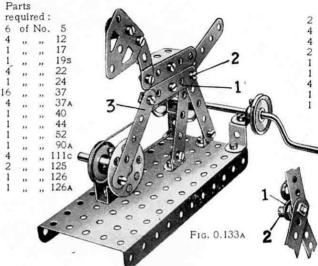


The Strip 1 forming part of the body is free to move about the Bolt 2, but two Nuts on the latter secure the rear legs and tail rigidly together. The arrangement of the various Strips about this Bolt 2 is shown more clearly in Fig. 0.133A. The Strip 3 is free to move at each end about pivots formed from Bolts and Nuts.

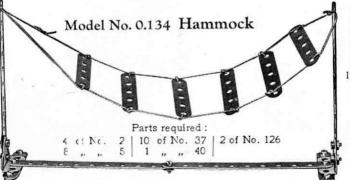


# Model No. 0.135 Swivelling Crane

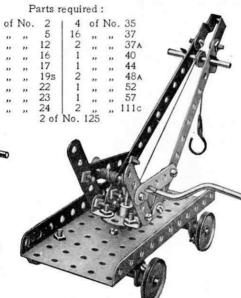



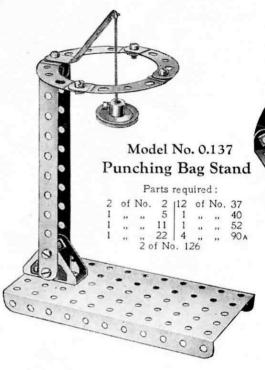

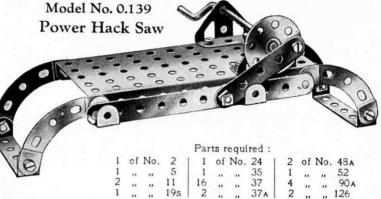



# Model No. 0.141 Junction Signal

3 7 2 2 2 2 2 1 4	of	No.	2 5 10			n	י יפ	9
7	"	,,	5			11	2	
2	"	,,	10	6	1	- 11	3	
2	"	,,	12	12		- 11	3	
2	"	**	17	1	2	_ 11	2	
2	"	**	22	VB	V		>	
1	"	,,	23	阘	16	91	1	
4	"	,,	11 12 17 22 23 35	巡		- 1		
16	"	"	37	1		TO:	3	
5	"	1	37 <sub>A</sub>	(G)	7	100	1	
1			40	1	\ \	10	4	
1 5 1	,,	,,	52		\			
5	**	,,	111c		1	•		
1	,,	,,	126 A		\	0		
			1	•	Y	C		
			A A		I	N		
		-			9	闄		
			<b>177</b>		1		•	


# Model No. 0.142 Battleship

#### Parts required :

3	cf	No.	2	1	of	No.	24
1	,,	,,	11	16	,,	,,	37
4	,,	,,	12	2	,,	,,	37A
1	**	,,	15	2	,,	.,	48A
2	,,	,,	16	1	,,	,,	52
4		.,,	22	4	,,		90 A
		2	of N	0. 1	110	3	


#### Parts required:

4	of	No.	2	1	of	No.	35
2	,,	**	5	16	,,	,,	37
4	,,	,,	10	6	,,	,,	37 A
1	,,	•	11	2	,,	,,	48 A
1	,,	,,	16	1	,,	,,	52
1	**	,,	17	2	,,	,,	90 A
3	.,	,,	22	6	**	,,	111c
1	.,		24	1		.,	125
		2	of I	No. 1	26		

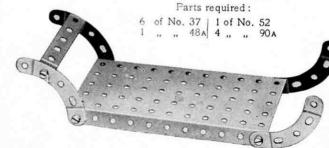


Model No. 0.138 Sled


# Model No. 0.143 Bench Lathe

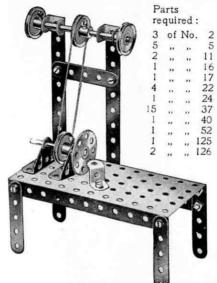


# Model No. 0.145 Sulkey

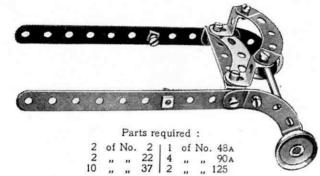


# Model No. 0.146 Horizontal Engine

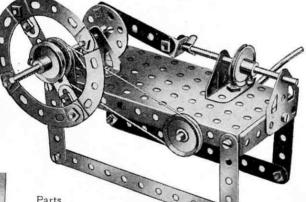

# 1

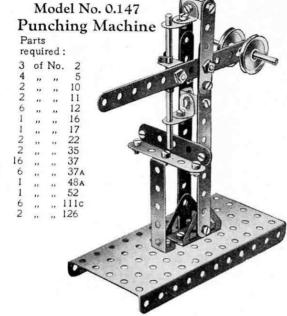


# Model No. 0.148 Bath Chair

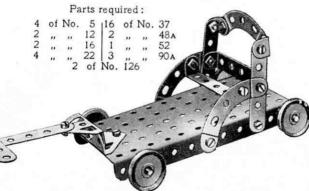

# Model No. 0.144 Bench


Parts required:

2 of No. 2 | 1 of No. 52 8 ,, 37 | 4 ,, 90A

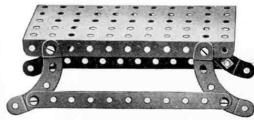

#### Parts required:


									B			
2	of	No.	2	4	of	No.	. 22		W	ע	_	
6	,,	,,	5	1	,,	,,	24	1	of	No.	. 52	
2	,,	,,	10	3	,,	,,	35	4	,,	,,	90A	
1	,,	"	12	16	,,	33	37	5	,,	.,	111c	
2	,,,	,,	16	5	"	,,	37 <sub>A</sub>	2	,,	,,	126	
1	"	,,	19s	1	,,	"	40	2	,,	,,	126A	

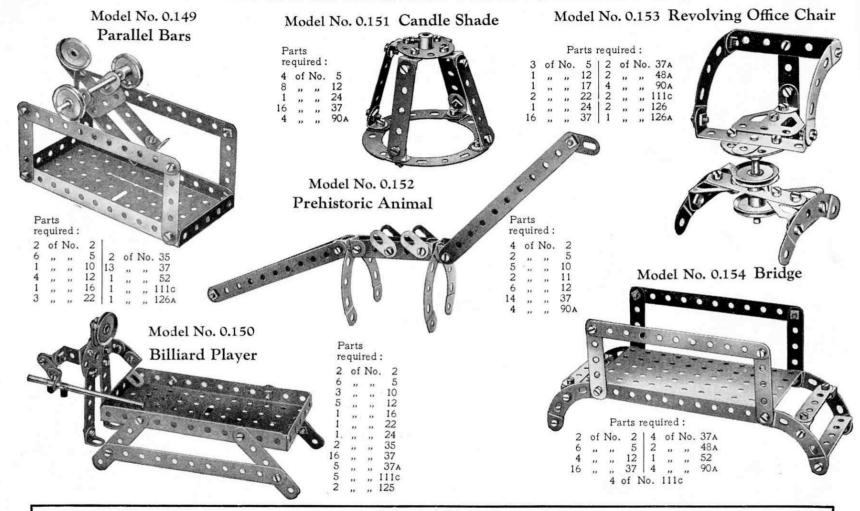

#### HOW TO CONTINUE

This completes our examples of models that may be made with MECCANO Outfit No. 0 (or No. 00 and No. 00A). The next models are a little more advanced, requiring extra parts to construct them. The necessary parts are all contained in a No. 0A Accessory Outfit, the price of which may be obtained from any Meccano dealer.

# Model No. 1.1 Jockey Pulley

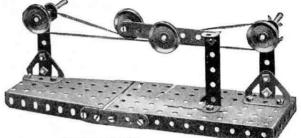


#### Parts required:

1	of	No.	3	12	of	No.	35	1	of	No.	52
4	,,	,,	5	20	,,	,,	37	1	,,	,,	54
2	,,	,,	17	1	,,	,,	37A	2	,,	,,	111c
4	,,	,,	22	1	,,	,,	40	2	,,	,,	126
				1	,,	,,	37 37a 40 48a				


The weight of the pivoted 3½" Strip, augmented by the 1" fast Pulley Wheel, causes the jockey pulley to press on the belt. Hence the latter is kept always taut.

# Model No. 1.2 Triangle of Forces

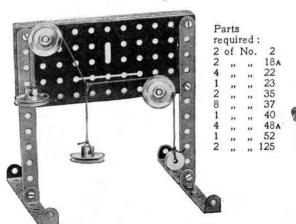


The suspended weights represent three forces acting on a central point. If a triangle is drawn with its sides respectively parallel to the three converging cords, i.e., parallel to the directions of the three forces, the lengths of the sides will be found to be proportional to the respective magnitudes of the forces.

# Model No. 1.5 Belt Gear Right-angle Drive Transmission

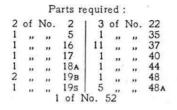

Model No. 1.3 Band Brake

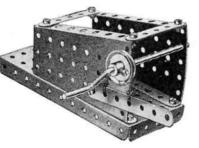


Parts required :

1	of	No.	3
2	,,	,,	5
1	,,	,,	19s
1	,,	"	22
1	,,	,,	35
9	**	"	37
1	,,	,,	37A
1	,,	,,	40
1	,,	,,	52
2	**	"	54


Model No. 1.6 Bacon Slicer

Parts required:

6	of	No.	5	2	of	No.	22
2	,,	,,	10	1	,,	,,	35
1	,,	,,	16	10	,,	,,	37
1	,,		19B	1	,,	,,	40
1	333	,,,	19s	1	,,		52
		- 2	of !	No.	125		

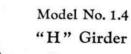

Parts required: 6 of No. 2 2 ,, 10 8 ,, 12

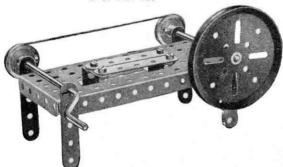




# Model No. 1.9 Compound Triangulated Truss

Model No. 1.14 Belt Gear


For Reversing Motion of Driven Shaft

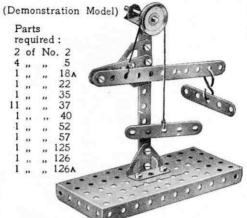


The fulcrum is at one end, the power at the other and the load lies between the two.

# Parts required: 2 of No. 1 7 " " 2 7 " " 37

Model No. 1.10 Howe Truss

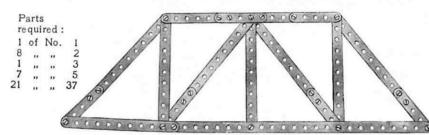

Model No. 1.11 Triangulated Truss

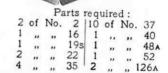

# Model No. 1.8 Lever of the Third Order

Third Order
(Demonstration Model)

Parts
required:
2 of No. 2
4 " " 5
1 " " 18A
1 " " 22
1 " " 35
10 " 37
1 " " 40
1 " " 52
1 " " 57
1 " " 125

The fulcrum is at one end, the load at the other and the power lies between the two.



Model No. 1.12 45° Set-Square


Parts required:
3 of No. 2 | 1 of No. 3
5 of No. 37

Model No. 1.13 60°

Parts required:
2 of No. 2
1 " " 3
2 " " 10
5 " " 37


# Model No. 1.15 Belt Gear

For Driving Shafts at Right Angles

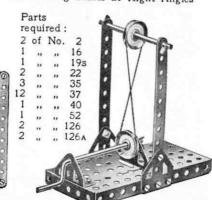

# Model No. 1.16 Pulley Block

Demonstration Model: 1 Fixed and 3 Movable Sheaves. Theoretical Mechanical advantage: 8 to 1

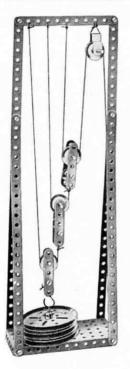

#### Parts required:

4	of	No	. 1	3	of	No.	19B	
3	,,	,,	2	4	,,	,,	22	
6	,,	,,	5	15	,,	,,	37	
2	,,	,,	11	1	,,	,,	40	
2	"	,,	12	1	,,	,,	44	
2	,,	,,	17	1	,,	,,	52	
2	12.0	112211	18A	1			57	

# Model No. 1.17 Pulley Block

Demonstration Model: 3 Fixed and 2 Movable Sheaves. Theoretical Mechanical advantage: 5 to 1

4	of	No.	arts			No.	191
270				177	0.		
7	"	**	2	4	,,	**	22
6	,,	,,	5	6	,,	,,	35
2 2 2 2 2	,,	,,	10	22	,,	,,	37
2	,,	,,	12	1	,,	,,	40
2	,,	,,	16	1	,,	,,	44
2	,,		17	1	,,	200	52
2	,,		18A	1		,,	57



Model No. 1.18 Pulley Block


Demonstration Model:

1 Fixed Sheave and 2 Suspended Blocks.
Theoretical Mechanical advantage: 4 to 1




4	of	No.	arts 1				19в
1	,,	,,	3	3	,,	,,	22
4	.,,	,,	5	10	,,	,,	37
2	,,	,,	11	1	,,	,,	40
1	,,	,,	17	1	,,	,,	44
2	,,	,,	18A	1	27	,,	52


#### Model No. 1.19 Belt Gear

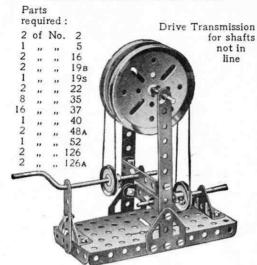

# Model No. 1.20 Belt Gear

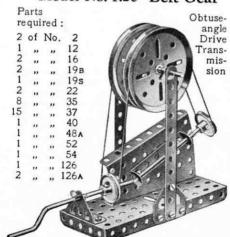

#### Model No. 1.21 Invalid Chair

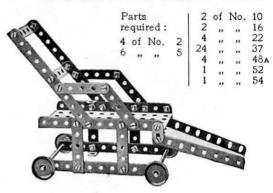


#### Model No. 1.22 Letter Balance

#### Parts required:

6	of	No.	2	4	of	No.	22	12	of	No.	48A
3	,,	,,	5	1	,,	,,	24 37 37 <sub>A</sub> 38	1	,,	,,,	52
1	,,	,,	10	26	,,	,,	37	2	,,	"	111c
1	,,	,,	12	4	,,	,,	37A	2	,,	,,	126
2	,,	,,	18A	2	,,	,,	38	2	,,	,,	126A
1	,,	,,	19в	1	,,	,,	44				




#### Model No. 1.23 Ticca Gharry

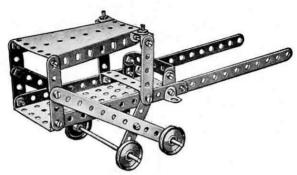

#### Parts required:


4	of	No.	2	6	of	No.	12	22	of	No.	37
6	,,	,,	5	2	,,	,,	16	1	,,	,,	52
2	,,	,,	10	4	,,		22	1	,,	,,	54

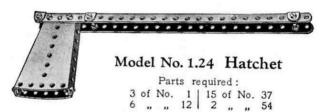

# Model No. 1.25 Truck with Sides

Parts required: 4 of No. 2 4 " " 5


4 " " 5 2 " " 16 4 " " 22 12 " " 37 4 " " 48A 1 " " 52

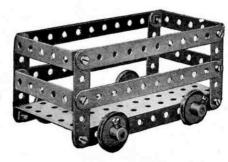

# Model No. 1.26 Mechanical Saw


Parts	required	

1	of	No.	2	1 1	of	No.	17	4	of	No.	38
3	,,	,,	5	1	,,		19s	1	,,	,,	40
1	,,		10	3	,,	,,,	22	1	,,	,,	44
1	,,	,,	11	1	,,	,,	24	4	,,	,,	48A
4	,,	,,	12	3	,,	,,	35	1	,,	,,	52
1	,,		16	22	,,	,,	37	2	**		125
								1	,,	,,	126A

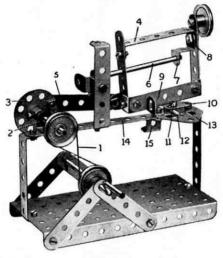


The Strip 9 represents the saw. The Crank Handle drives, through a belt 1, a short Rod journalled in a Double Bracket 2 and carrying a Bush Wheel 3. The latter imparts a reciprocating motion to the saw frame 4 through a 2½" Strip 5 loosely mounted on Bolts secured to the Bush Wheel and to an Angle Bracket bolted to the saw frame. This frame slides on a 3½" Rod 6, which acts as a guide, passing through the frame and supported in a Reversed Angle Bracket 7 A Washer is placed on the Bolt 8 behind the Bracket 7. A vice to secure the objects in position for cutting consists of a Flat Bracket 10 mounted on a Bolt 11, a few turns of which causes the Flat Bracket to grip the object 12. The Bolt 11 enters a Nut held between the Flat Trunnion 13 and 5½" Strip 14, which are spaced apart for the purpose by Washers placed on the two Bolts holding the Trunnion in position. The saw frame rests on the stop 15 when not in use. A 1" Pulley secured to the top of the frame acts as a weight and helps to steady the saw.

# Model No. 1.27 Dinner Wagon

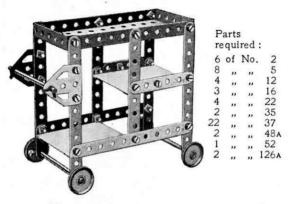


The two lower platforms are constructed out of pieces of ordinary cardboard, their outer edges resting on 2½" Double Angle Strips and their inner edges on Angle Brackets.

# Model No. 1.28 Tip Wagon

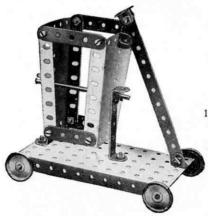

1	of	No.	2
4			5
	"	"	11.75
5	,,	,,	12
3	,,	**	16
4			22
2	"	"	35
	"	"	
14	,,	,,	37
2	,,		48A
1	355	0.00000	52
-	,,	"	
2	"	***	54

#### Model No. 1.29 Aeroplane

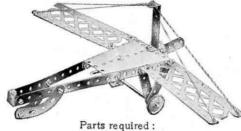


2	of	No.	2	2	of	No.	16	1	of	No.	48A	
5	,,	,,	5	2	,,	,,	22	1	,,	,,	54 90 A 100	
1	,,	,,	11	1	,,	,,	24	2	,,	,,	90A	
6	,,	,,	12	21	,,	,,	37	2	,,	,,	100	
				1			40					

#### Model No. 1.30 Timber Drag



4 of No. 2 | 2 of No. 16 | 8 of No. 37 2 ,, ,, 11 | 4 ,, ,, 22 | 4 ,, ,, 48A

#### Model No. 1.31 Lawn Mower

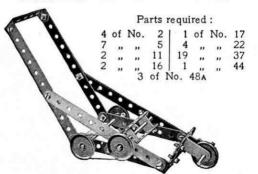


#### Model No. 1.32 Tandem Car





#### Parts required:

4	of	No.	2	4	of	No.	19в
8	,,	,,	5	26	,,	,,	37
2	,,	,,	12	5	"	"	48A
2	"	"2	of I	Vo.	126	Α"	32


#### Model No. 1.33 Mechanical Hammer

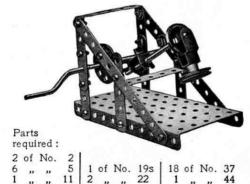

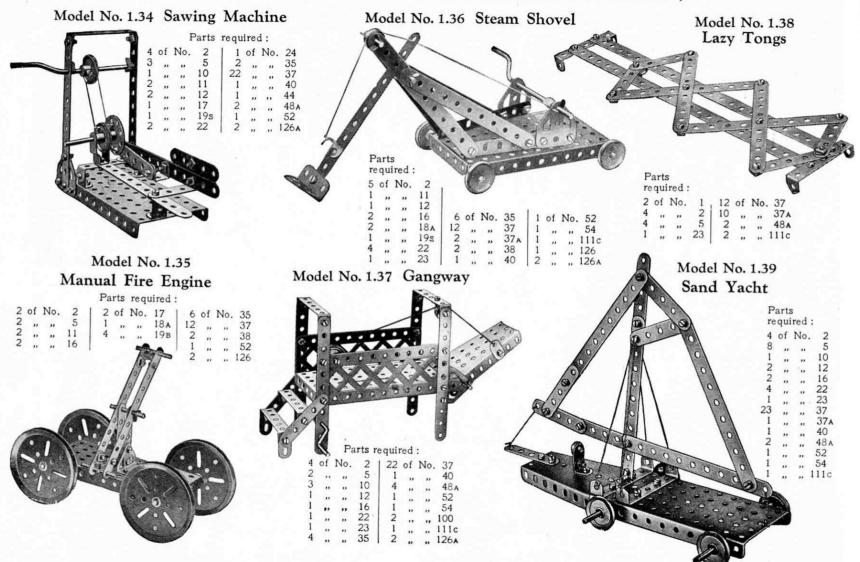

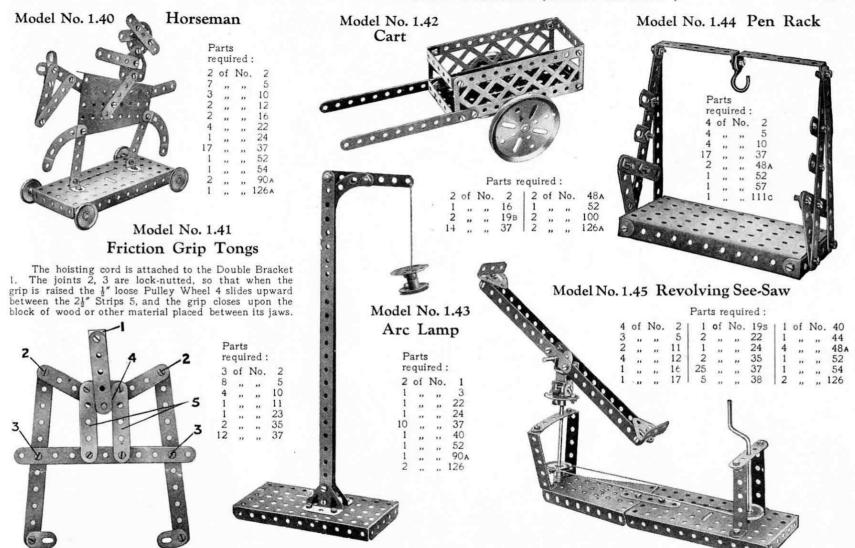


#### Model No. 1.46 Deck Chair

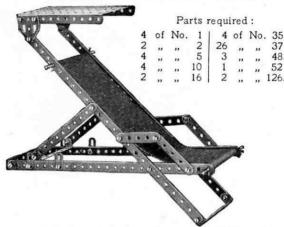


#### Model No. 1.47 Potter's Wheel

Parts required:

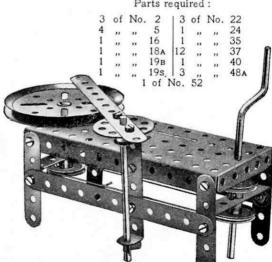


# Model No. 1.48 Luggage Cart

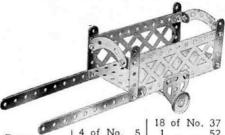


400	Br.				18	of	No.	37
Parts	4	of	No.	5	1	,,	,,	52
required:	4	,,	,,	12	2	,,	,,	90 A
The state of the s	1	,,	**	16	2	,,	,,	100
2 of No. 2	2	,,	**	22	2	,,	,,	126A


Parts required:

# Model No. 1.49 Elevator

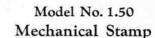

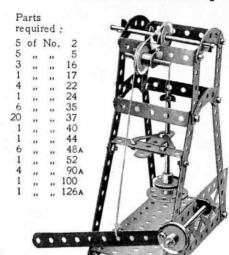

#### Model No. 1.51 See-Saw

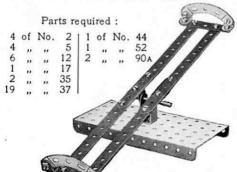




# Model No. 1.52 Umpire's Seat

re	qui	red:	
6	of	No.	2
7	,,	,,,	5
2	,,	,,,	10
4	,,	"	12
24	**	,,	37
3	**	***	48A
2	**	**	90A
2	,,	,,	126


# Model No. 1.53 Submarine

Parts required:


				cqui			
4	of	No.	1	12	of	No.	35
5	,,		10	28	,,	,,	37
2	,,	,,	11	3	,,	,,	37A
8	,,	,,	12	2	,,	**	38
23	,,	,,	17	1	,,	,,	48
	,,	**	22	1	,,	,,	48A
1	**	,,	24	2	,,	,,	125
				2			124

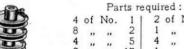


Trunnions are bolted to the side 12½" Strips, and a Bolt passed through their inner extremities secures a ½" Reversed Angle Bracket and an Angle Bracket. The former is attached to the upper 12½" Strip while the Angle Bracket is connected by means of a Flat Bracket and a further Angle Bracket to the lower Strip.

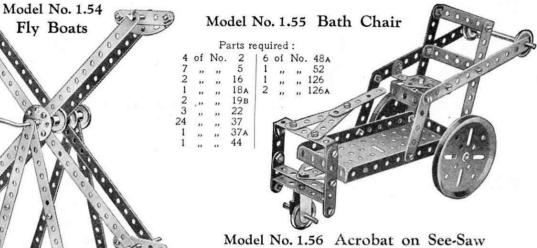


The 1" Rod 1 is journalled in the end holes of two  $5\frac{1}{2}$ " Strips 2 and in the Flat Trunnion 3 which joins them. It is held in position by two Spring Clips, placed on either side of the  $5\frac{1}{2}$ " Strips 2.

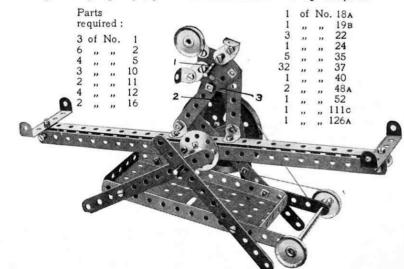


These Models can be built with MECCANO Outfit No. 1 (or No. 0 and No. 0A)

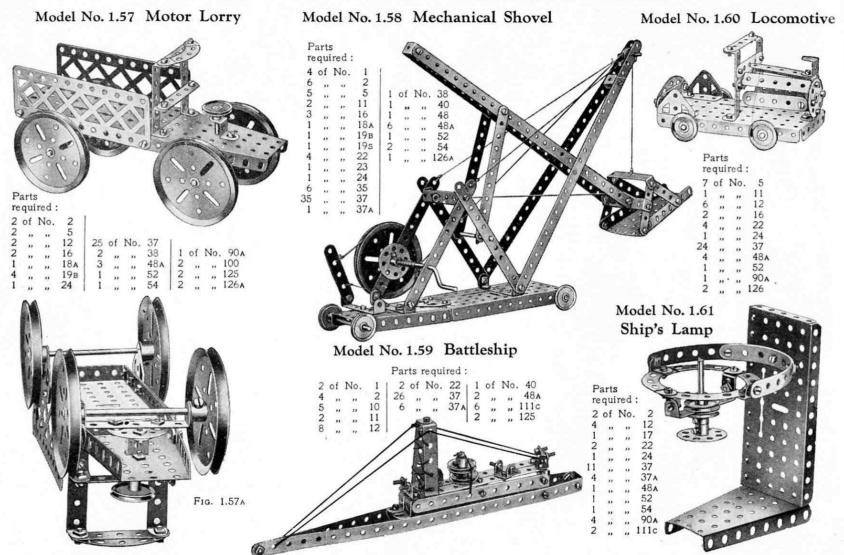

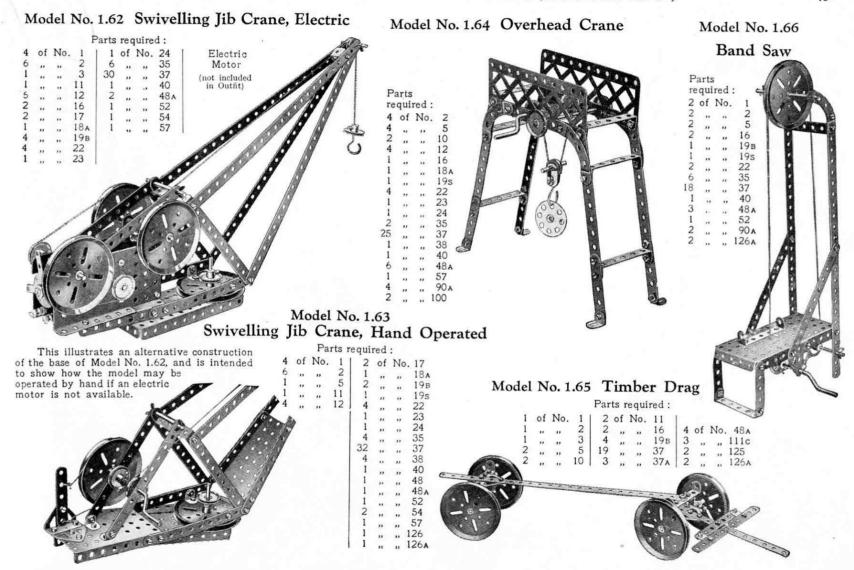


# Model No. 1.67 Butter Churn

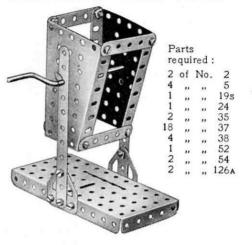


4 of No. 22

Parts required:

# Model No. 1.69 Cable Railway

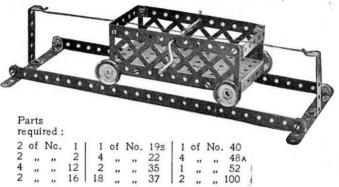

# Model No. 1.72 Man and Boy

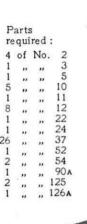


# Model No. 1.70 Candle Stick

2	of	No.	11
4	,,	,,	12
1	,,	,,	19
4	,,	,,	37
1	,,	"	111
1	,,	,,	125



# Model No. 1.71 Machine for Tracing a Locus

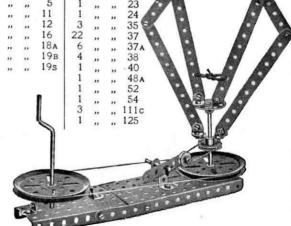

Model No. 1.68 Inverted Centrifugal Governor

Parts required

		Pa	irts re	qui	rea		
1	of	No.	2	4	of	No.	35
1	,,	,,	5	4	,,	,,	37
1	,,	.,	11	3	,,	,,	37A
1	,,	**	12	4		,,	38
1	,,	**	17	1	,,	,,	54
1	,,	**	18A	2	,,	,,	111c
ļ	**	**	24	1	**	"	125

The  $5\frac{1}{2}$ " Strip is pivoted to the  $2\frac{1}{2}$ " Strip by means of a Bolt and two Nuts, and the  $2\frac{1}{2}$ " Strip is similarly pivoted to the Sector Plate. By revolving the  $2\frac{1}{2}$ " Strip about its pivot, the vertical  $1\frac{1}{2}$ " Rod can be made to trace a locus. If the positions of the  $1\frac{1}{2}$ " Rod and


the 5½" Strip are altered, several different loci may be traced. Machines of this type are of advantage in assisting in the design of engine connecting rods.

Model No. 1.75

Signal

Parts required:


# These Models can be built with MECCANO Outfit No. 1 (or No. 0 and No. 0A)

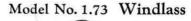

Parts


required:

126A

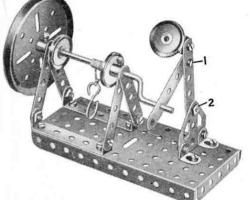


The figure at the right of the model is arranged to work to and fro when the Crank Handle is rotated. The Bolts 1 and 2 are both secured by two nuts as in Standard Mechanism No. 262.

# Model No. 1.74 Lorry Crane

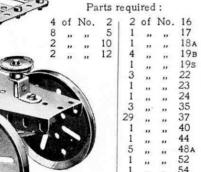


# Model No. 1.76 Aeroplane

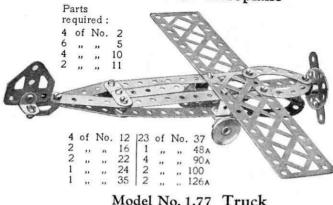


#### Model No. 1.77 Truck




# Model No. 1.78 Mountain Transport

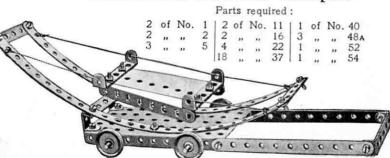

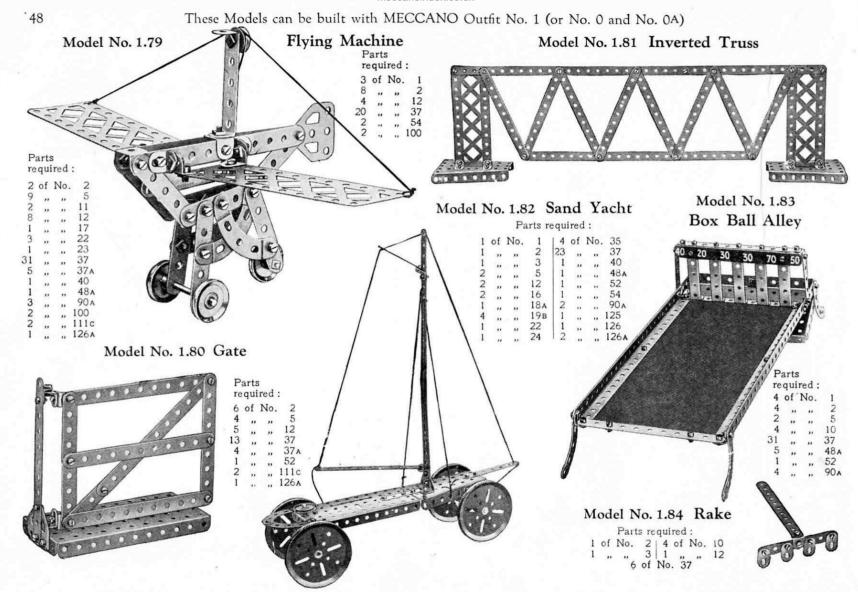


# Model No. 1.85 Bow Girder

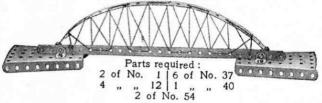


# Model No. 1.86 Double-Action Pump


The 5½" Strip 1 is attached to the 1" Pulley Wheel 2 by means of two Angle Brackets, through the lower of which passes the Set-Screw that secures the Pulley to its 2" Rod. Two Washers are placed beneath the head of the Bolt joining the Angle Brackets in order to prevent its shank from binding on the boss of the Pulley 2. The joints 3, 4, 5, 6, 7, are all lock-nutted, the remainder of the joints being quite rigid. When the Strip 1 descends, together with the first pump, the incidental distortion of the parallelogram 3, 4, 7, 4 causes the second pump to rise. Similarly, when the first pump rises, the second descends.

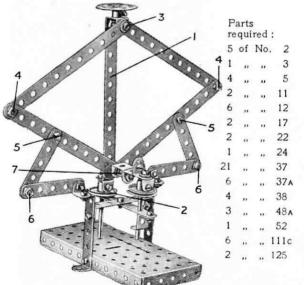

# Model No. 1.88 Tower Wagon

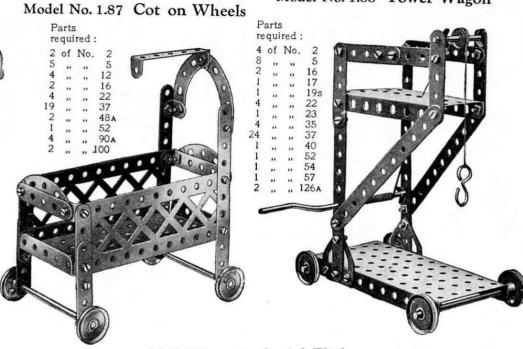

#### Model No. 1.89 Aerial Flight

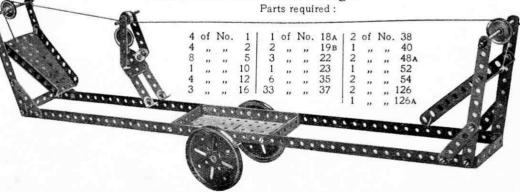

Model No. 1.93

# Model No. 1.90 Gong

# Model No. 1.92 Roundabout





Begin to build this model by making the platform from a Flanged Plate and  $12\frac{1}{2}$  Strips. The drive from the Pulley on the Crank Handle is taken to a 1" Pulley, fast on the vertical 2" Rod, another similar Pulley being secured to this Rod beneath the Plate.

The arms are formed of four  $5\frac{1}{2}$ " Strips bolted to a Bush Wheel fast on the 2" Rod.

#### Parts required:

4	of	No.	1	13	of	No.	22
4	,,	,,	2	1	,,	,,	24
6	,,	.,	5	6	,,		35
4	,,	,,	10	22	,,	,,	37
2	,,	**	16	1	,,	,,	40
1	,,	.,	17	4	**	,,	48A
1	,,	,,	19s	1	,,	.,	52
		2	of 1	10.	54		

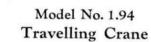

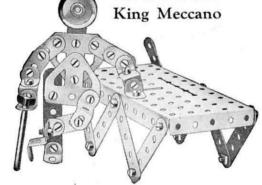


# Parts required:

# Model No. 1.91 Emery Wheel


				1 ai	13 1	equi	cu.				
1	of	No.	17	1	of	No.	22	10	of	No.	37
1 2	,,	,,	18A	1	,,	,,	24	1	,,	,,	40
2	,,	,,	19в	2	,,		35	1	,,	,,	48A
								1	,,	,,	52
								1	,,		111c
		THE ST	dh .	CONT.	-			2	**	**	125
	3			<b>G</b> R				2	,,	**	126A
	8		2	5		3			p	of e	mery r
			- 100	-			- 1	2	" 1		

#### Parts required:

1 of No. 3	1	of	No.	35
9 ,, ,, 5	30	,,	,,	37
5 ,, ,, 10	1	**	,,	52
8 ,, ,, 12	1		,, 1	11c
1 ,, ,, 17	2			25
1 " " 22	2	**	,, 1	26A

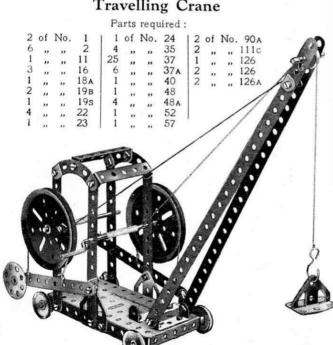

Doute

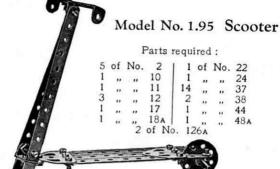

#### Model No. 1.96 Ballista

This is a model of an ancient engine of war, resembling the crossbow. The 3½" Strip 1 is bolted firmly to the Double Angle Strip 2, which is prevented from turning by the addition of Angle Brackets as shown. A Double Bracket 3

slides on the Strip 1 and is secured to a piece of cord. On rotation of the Crank Handle 4, the Strip 1 is pulled backward until the Double Bracket 3 slips off its end. The Strip then flies forward and strikes the missile, which consists of a 2" Rod placed ready in the Double Bracket 5.

7/	-	90
Parte	required	

4	of	No.	1	12	of	No.	16	1 1	of	No.	40
4	,,	**	2	1			18a	1			44
1	,,	**	3	3	,,		19B	4			48A
2	,,	"	11	1	,,	.,,	19s	1	**	,,	52
2	"	**	12	4	,,,		22 37	1	**	***	90A
				121	,,	,,	37	2	,,	,,	126A


# Model No. 1.97 Tight-Rope Walker

The cord on which the "Meccanitian" runs is endless and passes over the 1" fast Pulleys at each end of the model. One of the Pulleys is secured to a Crank Handle, by means of which the model may be operated. The Meccanitian runs on the upper half of the endless cord, the lower half being attached to one of his feet.

	equ	ired	:								
4	of	No.	1								-
4	,,,	,,,	2	2	of	No.	17	2	of	No.	38
1	,,	**	3	1	222		19s	1	,,	,,	40
5 3 4	,,,	,,	5	4	,,	**	22	2	,,		48A
3	,,	,,	10	1	**	**	23	1	,,	,,	52
4	,,,		12	6	,,,	,,	35	2	,,	**	54
2	.,,	,,,	16	34	-	**	37	1	**		126A

# Model No. 1.98 Double-Action Piston Connection

			arts i					
2	of	No.	1	1	of	No.	23	
6		,,	2	1			35 37 37 <sub>A</sub> 48 <sub>A</sub> 52	
1	**	,,	3	36	"	"	37	
5	,,	,,	2 3 5 10	36 5	,,	,,	37 A	
4	,,	,,	10	4		,,	48 A	
2	,,	.,	11	1	,,		52	
3	"		12	i	"	"	90 4	
1 5 4 2 3 2		**	19в	3	"	"	90a 111c 126a	NAME OF THE PARTY
1	"	"	19s	3 2		**	1264	
	**	"	. /5	-	,,	**	IZUA	
								M H DEMONSTR
								A A COURT OF THE PARTY OF THE P
							A	ALL PINCE
				*******	W 1	E BO	000	
		0			00.0		(0)	
		27		www.0555	SP-SS	PRO	DIC	
		(U	6.30			Contract of		C C C C C
		No.						
								7 (1) (1) (1) (1) (1) (1) (1) (1) (1) (1)

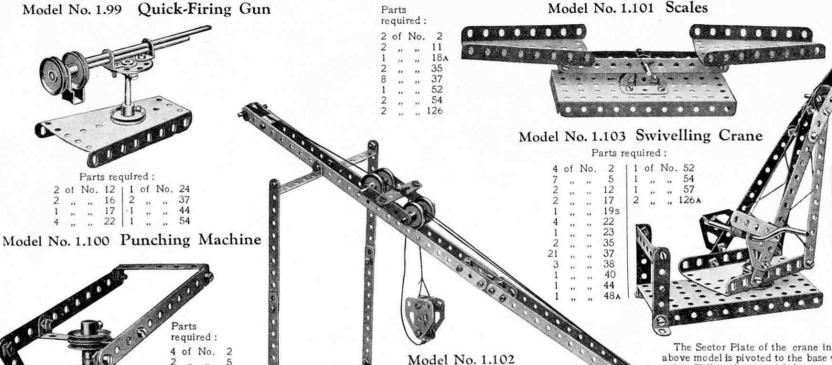


Extended Ash Tip


Parts required: 2 of No. 18A |

The trolley is operated by means of a cord that is wound round the 11 Axle Rod carrying the Bush Wheel, both ends of the cord being secured to the trolley. The bucket is suspended from a cord that winds on to the Crank Handle, and it is tipped by lowering it until a short cord that is attached to the bottom of the bucket and to the trolley, becomes taut. Further lowering causes the bucket to swing over.

The Sector Plate of the crane in the above model is pivoted to the base with a fast Pulley above and below.

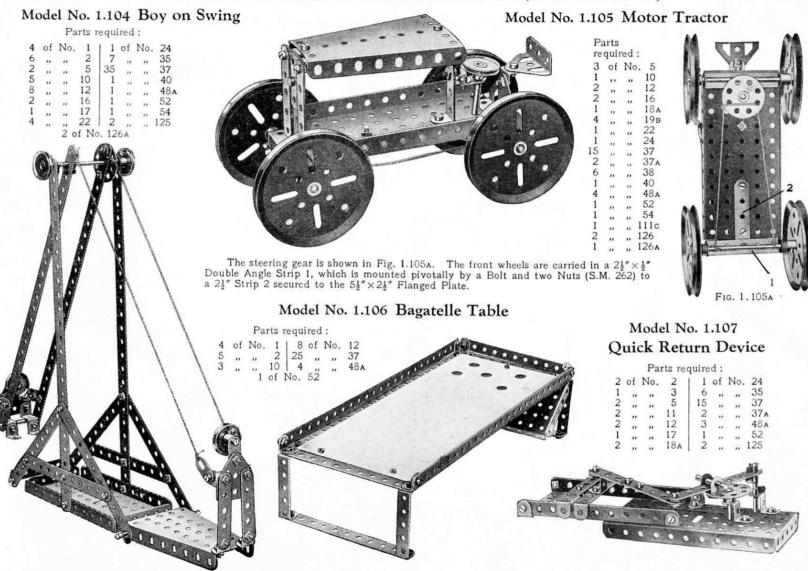

# Model No. 1.108 Rowing Boat

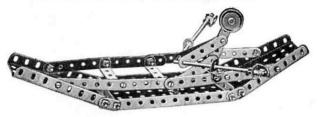

Parts required:

4 of No. 2 | 4 of No. 35 4 ,, 5 | 24 ,, 37 4 ,, 10 | 3 ,, 48A 7 ,, 12 | 1 ,, 52 2 ,, 16 | 2 ,, 54 1 ,, 22 | 1 ,, 111c

Model No. 1.109 The Wrestlers

# Model No. 1.110 Weather Vane

#### Parts required:

3	of	No.	1	14	of	No.	37
2	,,	**	2	1	,,	,,,	52
1	,,	,,	11	1	,,	,,	54
2	,,	,,	12	1	,,	,,	111c
1	,,	**	24	2	,,	,,	126

#### Model No. 1.111 Violin and Bow




#### Parts required:

4	of	No	2	1	of	No.	12	1	of	No.	40
1	O.		5	1	-		18A	1			54
i	"	"	11	2		,,	12 18 <sub>A</sub> 35	1	.,		126
	,,	"	5150	5	**		37				

# Model No. 1.112 Beam Engine

The connecting Strip 1 is attached pivotally by a Bolt and two Nuts (Standard Mechanism No. 262) to one end of the beam 2 and to the Bush Wheel 3. The Strip 4 is similarly connected to the other end of the beam 2 and to the Double Bracket 5 attached to the piston rod. The short rod carrying the flywheel 6 is journalled in a 2½" Strip supported by the Trunnion 7 and in a Reversed Angle Bracket bolted to the 2½" Strip.

P	arts	:		
re	qui	red :		
6	of	No.	2	
1 3 2 3 2 1 1 1 8	,,	,,	2 3 5	1-
3	,,	,,		
2	,,	**	11	. //
3	,,	**	12	6
2		,,	16	// Shi
1	,,	,,	17	1 1866
1	,,	,,	19в 24 35	Boots
1	,,		24	The same
8	**	,,	35	100
20	,,		37	
4		.,,	37 A	7
1		.,	48	3
1	,,	,,	52	
2	,,	.,	125	
20 4 1 1 2 1	,,	,,	126	-

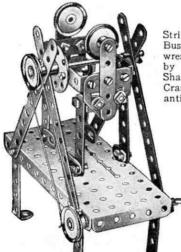


Two  $2\frac{1}{2}'' \times \frac{1}{2}''$  Double Angle Strips, one of which is bolted to the Bush Wheel, form the arms of the wrestlers. The legs are all pivoted by means of Bolts and lock-nuts. Sharp irregular movements of the Crank Handle will result in amusing antics by the wrestlers.

#### Parts required:

4	of	No.	2	1	of	No.	19s
6	,,	,,	5	4	,,		22
4	,,	,,	10	1			24
4	,,	,,	12	3			35
1	,,	,,	16	24	,,	.,	37
				5	**		38
Ø,	۸ _	-		1	,,	,,	40
,				6	,,	,,	48A
				1	,,	.,	52
				2 2	,,	,,	111c
				2	,,	,,	126A




#### Model No. 1.113 Cum Bak

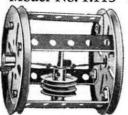

re	qui	red:	
1	of	No.	18A
2	,,	200	19B
2	,,	,,	22
1	,,	"	23
1	,,	,,	35
8	,,	"	37
4	"	**	48A


A short length of elastic is doubled and stretched between the centres of the 3" Pulley Wheels. A weight, consisting of two 1" fast Pulley Wheels and a 1½" Rod, is suspended from it in the middle of the drum. When the Cum Bak is rolled along any smooth level surface, the elastic becomes twisted and stores up sufficient energy to return the drum to its starting point. If the mechanism is concealed by a thin cardboard covering, the model will cause much amusement by its mystifying behaviour.

# Model No. 1.114 Tower Wagon

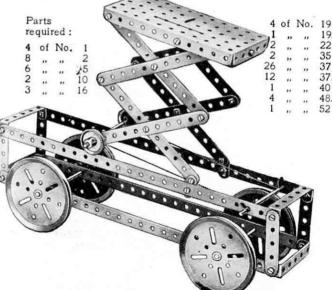


# Model No. 1.115


# Flip Flap

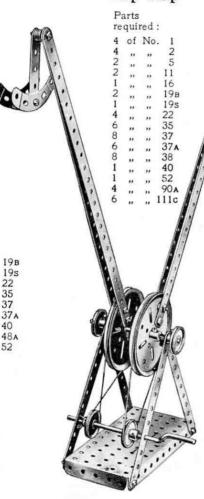


#### Model No. 1.116 Bellows

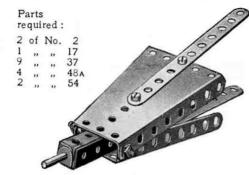


# Model No. 1.117 Mobile Crane

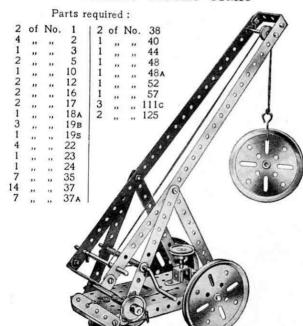

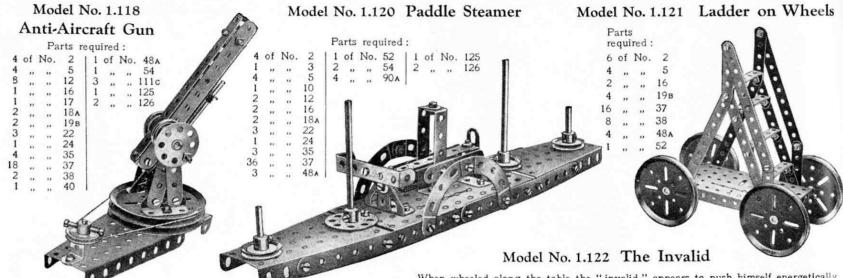

# Model No. 1.119 Meccanograph

Parts required: 2 of No. 17 5 of No. 35

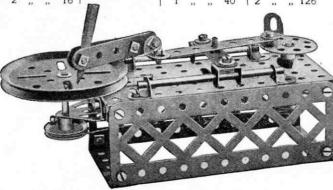

Parts required:

When wheeled along the table the "invalid" appears to push himself energetically along. His neck is a Flat Bracket: his right (or propelling) arm consists of one Angle

Bracket and one 1" Reversed Angle Bracket, and his left arm-the hand of which is bolted loosely to the chair-is formed by three Angle Brackets. The chair is composed principally of two Sector Plates and four 51" Strips, and it runs on three 1" Pulley Wheels-one in front and two at the back. One of these (not visible in the illustration) drives by cord another 1" Pulley Wheel, the shaft of which also carries a Bush Wheel 1. As will be seen, a 21" Strip is pivoted at one end to this Bush Wheel and at the other end to a second 21" Strip 2, which, rocking about an axle journalled through its centre hole, is again pivoted to the invalid's hands.

Model No. 1.126 Gramophone

2 of No. 90A

2 " "111c

#### Model No. 1.123 Bow and Arrow


Parts required: 1 of No. 1 | 1 of No. 16 1 of No. 40




#### Model No. 1.124 Rotating Crane

The running wheels of this crane are journalled in Double Angle Strips bolted to the base plate and secured at an angle by means of Flat Brackets. The rear of the Base Plate is supported on a Double Bracket. The jib is bolted loosely to the supporting 5½" Strips and is connected by 2½" Strips to the Sector Plate which pivots about its supporting bolts. By moving this Sector Plate the elevation of the jib may be altered as desired. The movement is controlled by a Double Angle Strip mounted on the Crank Handle and connected pivotally to the plate by means of a 2½" Strip. A Reversed Angle Bracket bolted to an upright Double Angle Strip in the rear of the model serves to restrict the movement of the Sector Plate

#### Parts required:

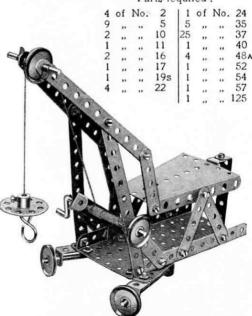

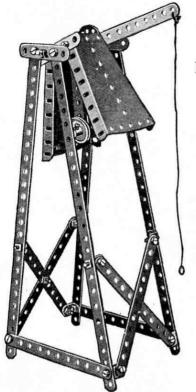

Parts required:


of No. 10

# Model No. 1.127 Band Brake

Model					Pa	rts	requ	ired:				
No. 1.125	1 2	of	No.	2	1 2	of	No.	19s	1 1	of		40 52
Fire Alarm	1	,,,		12	10	"	,,	22 35 37	2	,,	,,	54 111c


4	of	No.	1
7	,,,	,,	2
1		.,	3
3	,,	,,	5
8	,,	n	12
1	,,	,,	16
1	**	**	22
1	,,	**	24
4	**	**	35
27	,,		37
2		**	54


14-1-1

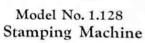





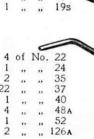


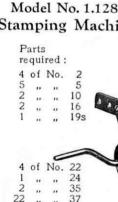


#### Model No. 1.129 Electric Elevator


#### Model No. 1.130 Mounted Cowboy


#### Model No. 1.132 Coaster

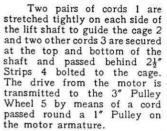

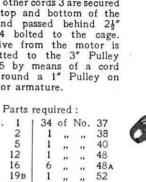


Electric Motor (not included in Outfit)

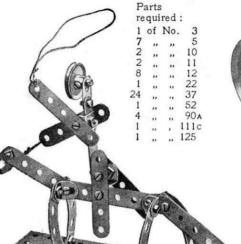

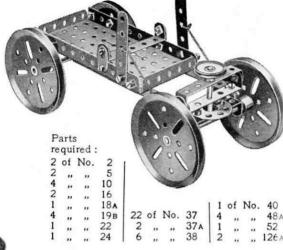



Model No. 1.131

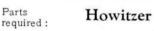





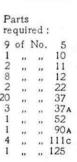

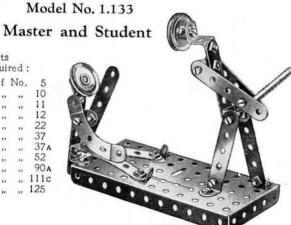


# Model No. 1.134 Travelling Crane

The jib 1 is pivoted to the Flat Trunnions 2. which are bolted at 3 to Angle Brackets secured to a Bush Wheel. The latter is nipped to a 2" Rod 4 passing through the Plate 5 and further supported in a Double Angle Strip 6. A Washer and Spring Clip mounted on the Rod 4 below the Strip 6 secure the crane to the carriage. The jib is supported by means of cords 7 tied to 21" Strips 8, the holes of which engage the shank of a bolt passed through the Sector Plate 9, and its elevation may be altered by inserting this bolt in different holes in the Strips 8. The cord 10 of the brake lever is wound once round the Crank Handle, between two Washers.

#### Model No. 1.135 Bicycle


# Model No. 1.137 Gymnast

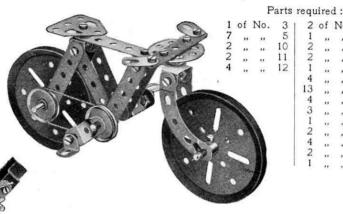

2	of	No.	17
1	,,	,,	18A
2 2	,,	**	19B
2	,,	***	22
1	,,	**	24
4	,,	**	35
13	**	,,	37
3	.,	**	37 A
3	,,	.,,	38
	**	**	40
2	**	**	90A
4	**	.,	1110
2 4 2	220	20	125
1	,,	.,	126A

# Model No. 1.136 Luggage Truck

#### Parts required:

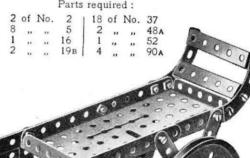


Parts	required	:

4	of	No.	2	1	of	No.	19s	1	of	No.	40
7	,,	,,	5	4	**	-01	22	1	,,		44
1		.,	10	1		**	23	3	,,		48 A
2			12	5	"	**	24 35	1	"		52 54
2		,,	16	27	"	"	37	li	**	"	57
2	"	"	17	6	"	"	38	2	"		126A




One of the 21 Strips representing the arms of the gymnast is bolted to a Bush Wheel secured on a 31" Rod. When the Crank Handle is rotated the gymnast turns complete somersaults in a very amusing manner. The gymnast's "arms" must be pivoted to the Angle Brackets forming his shoulders by means of Bolts and Lock-Nuts.

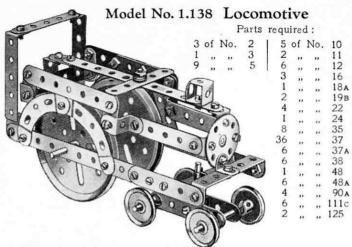

The bogie is connected pivotally to the locomotive body by means of a  $1\frac{1}{2}$ " Rod journalled in a Double Bracket, which is secured in the centre of the bogie, and in a  $2\frac{1}{2}$ "  $\times \frac{1}{2}$ " Double Angle Strip that is secured between the main side frames. Two Spring Clips between the Double Angle Strip and Double Bracket space the bogie at the correct distance.

#### Model No. 1.139

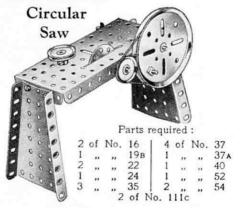

Model No. 1.140 Treadle Grindstone


of	No.	2
,,	.,	3
,,	**	5
,,	;,	12
,,	,,	16
,,	,,	19B
,,	**	22
,,	,,	24
**	,,	35
**	**	37
**	**	37A
**	**	40
		48A
		quired: of No. """ """ """ """ """ """ """ """ """ "


# Model No. 1.141 Quick-Delivery Chute Parts Model No. 1.142 Mechanical Gong

required:

2 of No.

A Flat Bracket is connected pivotally to the base at 2 and is clamped rigidly to a 1" Pulley Wheel secured to the Rod 4. The latter passes through the 1½" Double Angle Strip 3 and carries at its upper end another Pulley to which is rigidly secured the striking arm 5. The Double Angle Strip 3 is pivoted to the Bush Wheel 1.

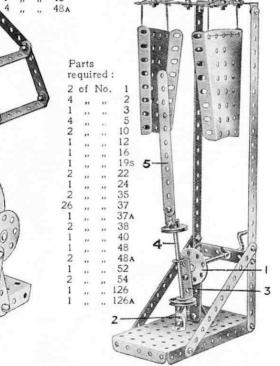

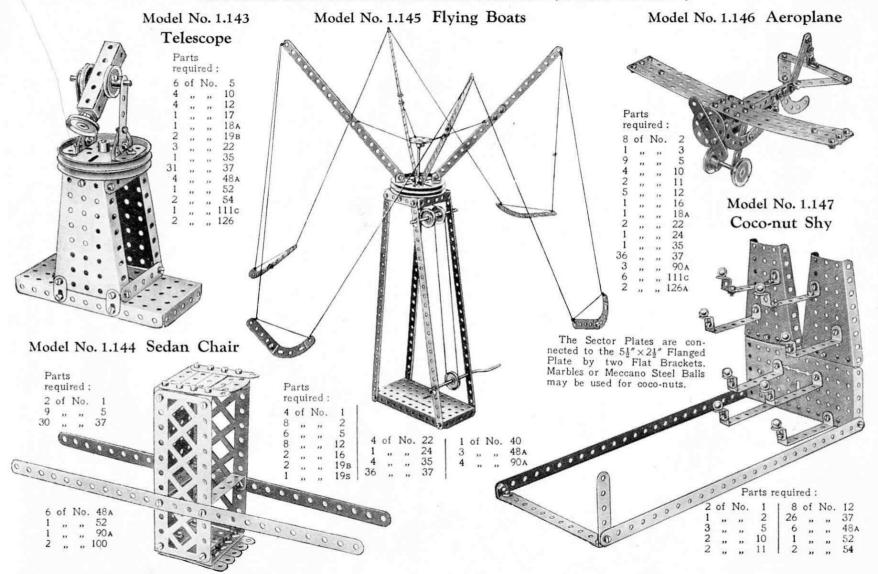

Model No. 1.150

Tappet Valve

Model

Demonstration

# These Models can be built with MECCANO Outfit No. 1 (or No. 0 and No. 0A)

#### Model No. 1.148 Double Draw Bridge Parts required .

ŀ	of	No.	1	1 1	of	No.	19s   22 35	2	of	No.	38
)	,,	,,	2	2	,,	,,	22	1	,,		40
	,,	,,	16	8	,,	,,	35	6	,,	,,	48A
				1 16			37	2		-	126.

#### Model No. 1.151 Motor Cyclist and Pillion Rider Doute as suited to

				1 0	11 12	requ	med					
4	of	No.	2	12	of	No.	17	12	of	No.	48A	_
9	,,	,,	5	4	,,	**	22	2	,,	,,	90A	
4	,,	,,	10	1	,,		24	2	,,		125	0/13
2	,,	,,	11	2	,,	,,	35	2	"		126A	
8	,,	,,	12	30	,,		37		**	,,		6
1			16									


# Model No. 1.149

#### Coaster

The figure 1 is loosely attached by lock-nutted Bolts 2 to the Sector Plate 3 and is connected to the Bush Wheel 4 by the pivotally-attached 21" Strip 5. The 11 Rod carrying the Bush Wheel 4 is journalled in the Cranked Bent Strip 6, the I" fast Pulley 7 being connected to the road wheel by a cord as shown.



I			
1			
1			
1			
1			
- 5			

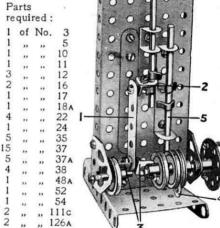


required:

of No. 1


Model No. 1.152

Chinese Windlass


The upper end of the Strip 1 is connected pivotally by a Bolt and two Nuts to the crosshead bracket 2. The crankshaft is built up as follows: Two Angle Brackets 3 are each secured rigidly to the boss of a Pulley Wheel and are connected to each other by a &" Bolt carrying three Nuts. The Nuts are screwed tightly against the Brackets, sufficient space being left between the inner pair to enable the connecting Strip 1 to turn freely. The valve Rod 5 is operated by the Flat Bracket 4 that is clamped between two further 1" Pulleys on the crankshaft in such a way that its protruding end serves as a cam.

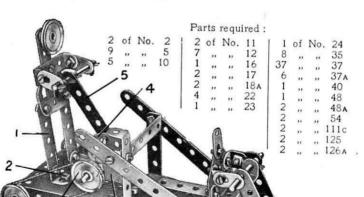


# Model No. 1.153 Pile Driver

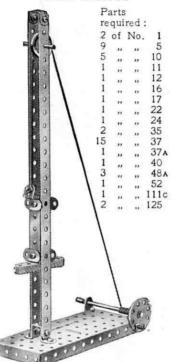


The winding cord is passed round the Pulley at the top of the model and is fastened to an Angle Bracket that is hooked under the protruding portion of a Flat Bracket bolted to the top of the driving head. When the Angle Bracket reaches the Pulley at the top it is pushed out a little, thus releasing the driving head.

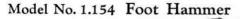

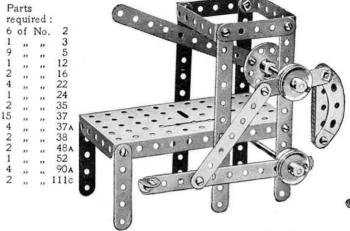


The treadle lever is connected pivotally to a 3½° Strip by a Bolt and two Nuts. The upper end of this Strip is similarly connected to a 2½° Strip that is clamped tightly between two Pulleys on the hammer Rod. Pressure on the treadle causes the hammer to descend on the work. When the treadle is released a weight pulls the hammer back to its original position.

#### Model No. 1.155 Heavy Duty Scales

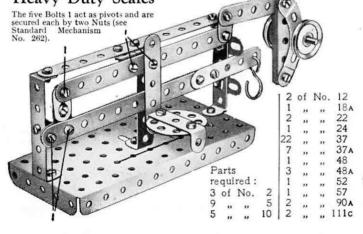



#### Model No. 1.156 Horse Rake

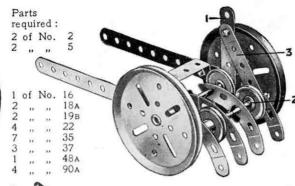

The 2½" Strip 1 pivots about the wheel axle. A 2½" Strip 3 is connected by a Bolt and two Nuts to the Strip 1 and the Shaft 2, which consists of two 1½" Rods, passes through its other end. On pulling the lever 1 towards the shafts the rake is lifted from the ground.

Model No. 1.157 Gravity Conveyor

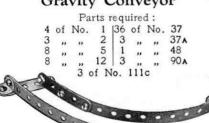

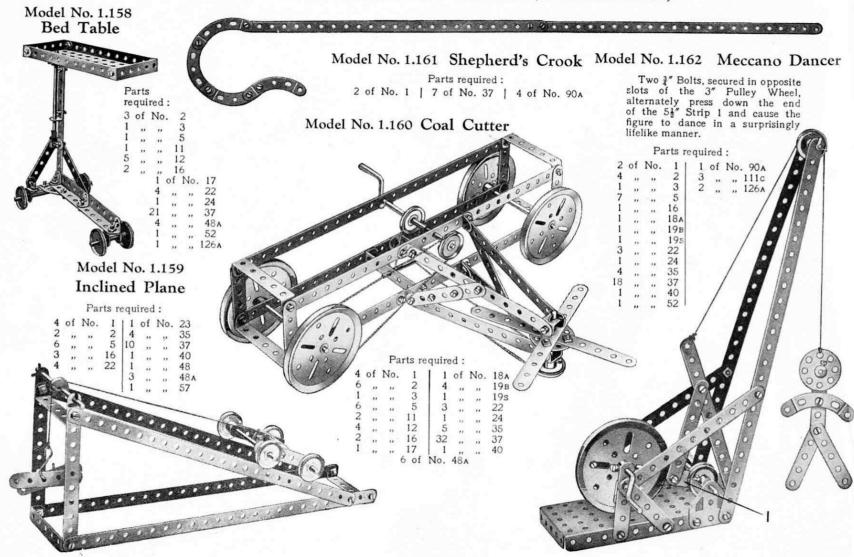


Parts required .

#### Model No. 1.163 Eccentric Dancers


#### Model No. 1.165

#### Model No. 1.166 Drop Stamp

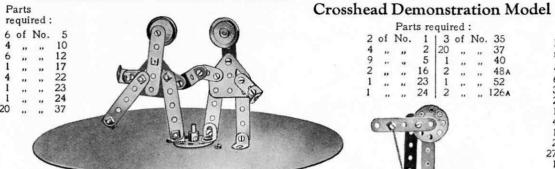


4	of	No. 48A		
2	,,	" 111c		
1	,,	,, 125	0	0
2	**	" 126a		


#### Model No. 1.164 Bellows

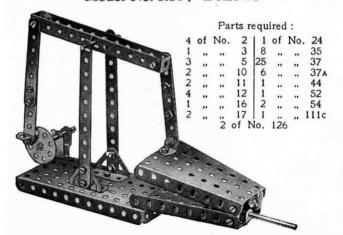

		Par	is re	quii	rea		
2	of	No.	1 2 5	1 3	of	No.	
4	,,	,,	2	20	**	,,,	37
9	**	.,	5	1	,,	,,	40
2	,,	,,	16	2			48A
1			23				52
1			24	1 2		,,	126A
	**	**		1 -	"	"	
			0000			0	L
		:	0.0		•	0	
			0 0 0	_			)


This is an apparatus for determining the forces that act at the crosshead of a reciprocating engine. The upper inclined length of cord represents the connecting rod and the lower, or vertical portion, the piston rod. The pull on the third cord indicates the pressure exerted on the slide bars of the engine due to the angularity of the connecting rod.

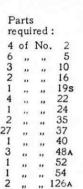

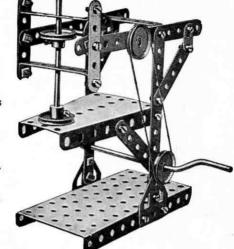


#### Model No. 1.167 Blacksmith

#### Parts required:

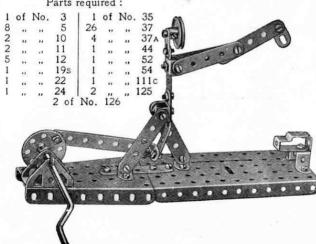

# Model No. 1.168 Try-Your-Strength Machine


Parts required: 4 of No. 126 126A

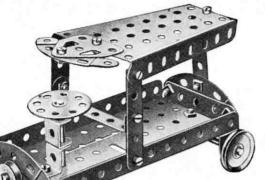

#### Model No. 1.171 Motor Van

#### Parts required .

3	of	No	5	1 17	of	No.	37
	0.		(0.003), (3	1.	01	140.	
1	"	**	11	1	**	**	40
1		**	12	3	.,	**	48A
2	**	.,	16	1	,,	**	52
1		.,	17	1			54
4		**	22	3	,,		90 A
1	**	.,	23	1	**		111c
1	.,		24	1			125
1		.,	35	1			126A

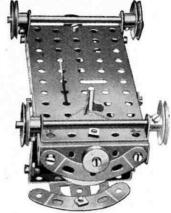


The steering mechanism is shown more clearly in Fig. 1.171a. A length of cord is given two or three turns round the steering column, and is held in position by a Spring Clip, its ends being tied to a  $2\frac{1}{2}$ "  $\times$   $\frac{1}{2}$ " Double Angle Strip. The latter is pivoted to the  $5\frac{1}{2}$ "  $\times$   $2\frac{1}{2}$ " Flanged Plate of the lorry by means of a Bolt and two Nuts (see Standard Mechanisms Manual, Detail No. 262).


FIG. 1.171A

# Model No. 1.170 Boat

# Parts required: 4 of No. Parts required:


# Model No. 1.172 Revolving Hammerhead Crane

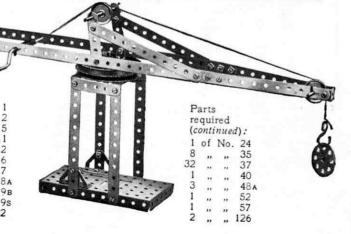

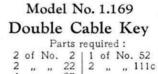






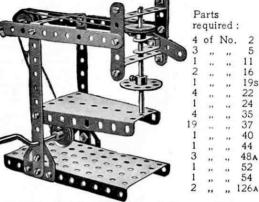

# Model No. 1.175 Motor Tractor

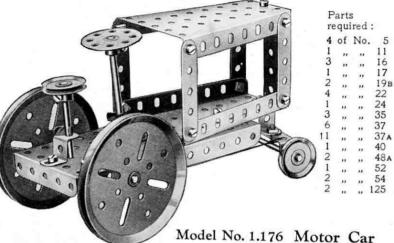

Model No. 1.174 Racing Motor Car


Parte	required	
1 alto	required	

-			0240		100	02727	227/2011					260	500 C		1110	uci i	10.	T . T	10	TAT	OLL	JI	Co	·L
3	of	No.	2	25	of	No.	37			The : te	ering	olumi	1 lis i	Ourn	halle	in on	A	~1_	D	1				
4	,,	,,	5	3			38	181	à	51" × 21" FI	anged	Plate '	and	n +h	aneu	in an	All	gie .	brac	ket 2	DO	ited	to	the
4			10	1	(100	-	44	11000		5½"×2½" Fl	Ruch	Wheel	, and	in th	e sec	ona n	ole o	t th	e 2½	$" \times \frac{1}{2}"$	Do	uble	a An	gle
2	-		11	4		**	49.		100	Strip 4. A	Dusii	w nee	o, sec	urea	to t	he lov	ver e	nd	of th	he ste	erin	Ig c	olur	nn.
8	,,	"	12	1	,,	"	126A			13 COMMECTED	I DY LV	vo sno	rr leng	The c	I CO	d to	0 000		1 214	1 1 //	-			
2	**	33	1/	1	**	"	120A	100		Dulip Carry	ms rue	ironi	AXIA	1.1	10 5	rin ic		-+	J 4-	1 mar		74	-	
2	"	"	10				/	1	100	Angle Strip	6 by 1	means	of a E	Bolt :	and M	Juits (	Stan	dar	M b	achan	iom	NI.	200	Die
1	,,	**	19s				41	1000		M .										echan	115111	140	. 20	2).
4	**	,,	22			1		0	10	1					I	Parts :	requi	ired	:					
1			23					//		, L	4	of No.	21	3 of	No	16	1 25	- 1	NT-	0.7				
1			24		3		3/10				7		5	4	140.		25	01	INO.		4	ot	No.	48A
4	.,	3.0	35		ĭ	4	and	0		No a	1	" "	10	. "	"	19в	2	"	"	37a	1	,,	**	52
•	**	"	00 1	1	. 4	æ	V.		1/2			" "	10	1 ,,	**	22	4	"	**	38	2		100	54
				0			0	127			1	" "	11	1 ,,	,,	24	1	**		40	1	**	"	111c
	1		. /		1		11	1	0/							~	=	-			l i	"	"	125
-	4//		1/0	4	O		Section 1									2	>31	1			1 :	11	"	123
- 4	100	. 100	7 /	100	200	sergeral h. P.	STREET, SQUARE										and the second		A CONTRACTOR		1 1			1/0

The Double Angle Strip 1 carries the front road wheels and is bolted pivotally to the 5½" Strip 2, whilst the rear axle is journalled in two Angle Brackets rigidly secured to the Strip 2. A Cranked Bent Strip 3 represents a seat. The steering wheel consists of a ½" Pulley 4 bolted to an Angle Bracket.

#### Parts required .

1		No.	5	3			16	25	of	No.	37	4	of	No.	48A
	**	,,		7	**	**	19в	2	"	"	37a	1	,,	"	52
	"	**	10	1	"	**	22	4	22	,,,	38	2	,,	,,	54
	"	22	11	1	**	**	24	1	,,	,,	40	1	,,		111c
							2-	S		_		1	1)		125
							-	1		(S)	_	1	.,	**	126

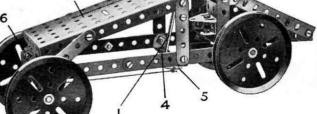


Model No. 1.177 Windmill Pump




#### Parts required :

2	of	No.	1	4	of	No.	35
9	,,	,,	5	24	,,	,,	37
9233	,,	**	10	4	,,	,,	37A
3	,,	,,	12	3		**	38
	,,,	,,	16	1	,,	,,	40
1	,,	,,	19в	2	**	,,	48A
1	**	,,	19s	1	**	,,	52
4	,,	,,	22	2 2	,,		111c
1	**	**	24	2	**	,,	126A

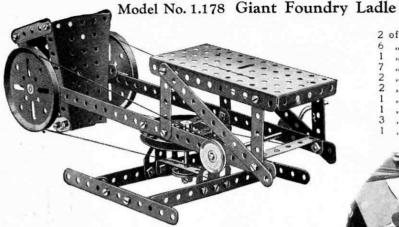


The ladle pivots about a 31" Axle Rod carrying a 3" Pulley at each end in addition to a Bush Wheel and a 21" Strip. The two latter parts are bolted to the side flanges of the Sector Plates and the Bush Wheel is nipped in position on the Rod. The pivot about which the superstructure turns is shown in Fig. 1.178a.

#### Model No. 1.179 Boat Steering Gear

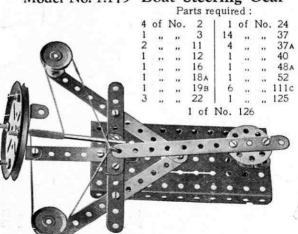


# Parts required: 3 of No. 22

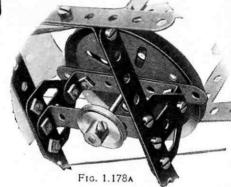



# Model No. 1.180 Gyroscope


The 5/32" Bolt 1 is gripped by the Set-Screw of the Bush Wheel. The lower end of the Rod 2 of the gyroscope enters the boss of the Bush Wheel and rests on the shank of the Bolt 1.

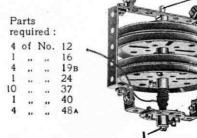

# Model No. 1.181 Elevated Jib Crane

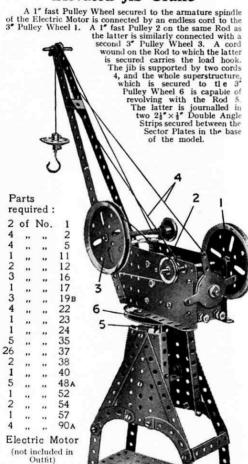

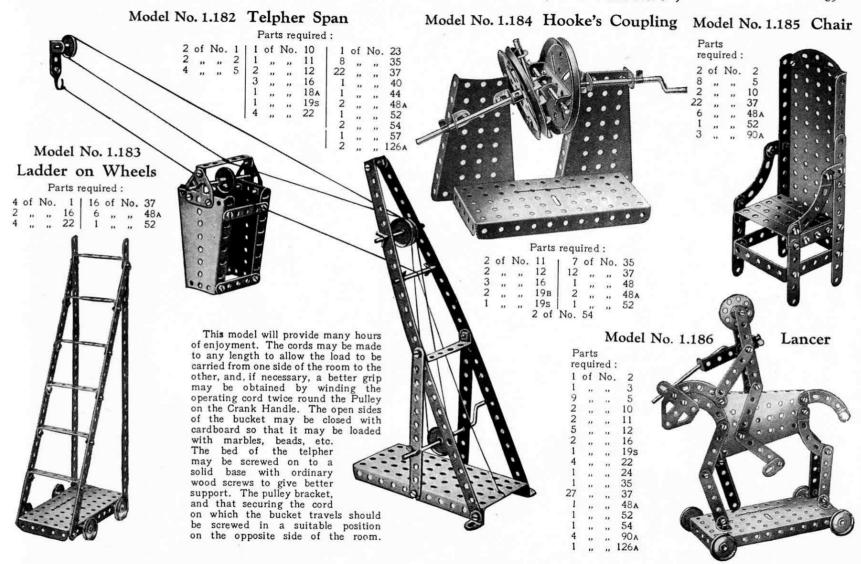


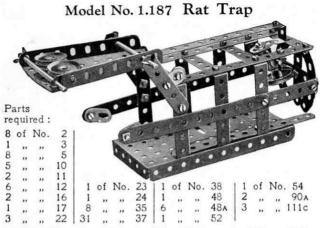


The "bait" consists of a 1" fast Pulley and a  $\frac{1}{2}$ " loose Pulley suspended by means of a cord from a Double Bracket. The latter is bolted to a  $1\frac{1}{2}$ "  $\times \frac{1}{2}$ " Double Angle Strip that is free to turn on a 2" Rod journalled in a pair of Angle Brackets. A Flat Bracket bolted to the Double Bracket engages a second Double Bracket on the end of a  $5\frac{1}{2}$ " Strip that is bolted to the door of the cage. If the "bait" is touched, the heavily-weighted door falls into place, and is prevented from re-opening by catches formed from Flat Brackets secured to  $5\frac{1}{2}$ " Strips that are bolted to the trap by their extreme ends and act as springs.


#### Model No. 1.188 Toast Rack

Parts required:

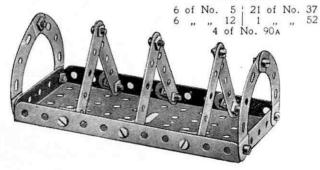

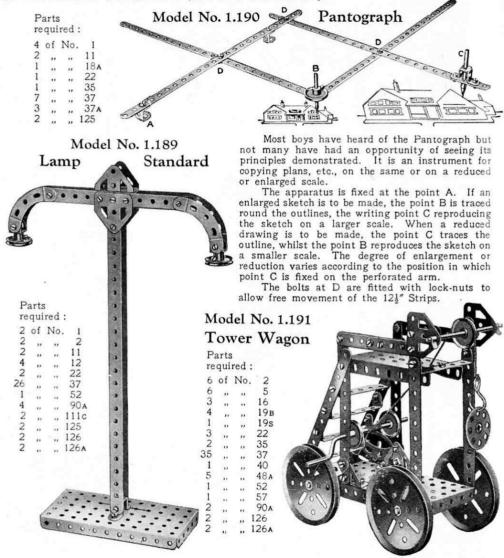

### Model No. 1.192 A Sudden Appearance

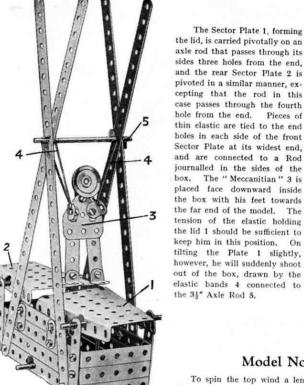


Parts required:


4	of	No.	1	1 8	of	No.	35
4	,,		2	29	,,		37
8	,,	,,	5	4	.,,	.,	48A
5	**	**	10	1	**	"	52
4	335		12	2			54
4	**	**	16	1			111c
1	"	**	22	1 1	**		26A
	A	shor	t ler	igth .	of e	elasti	ic

Model No. 1.193

# Eiffel Tower

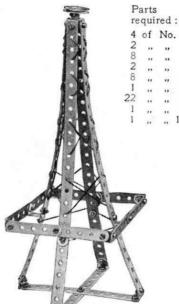

### Model No. 1.195 Drill

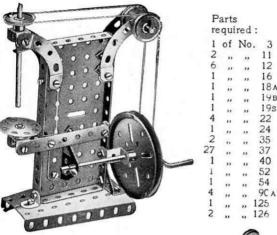

Model No. 1.196 Revolving Tricyclist

### Model No. 1.194 Top


To spin the top wind a length of cord round the rod, as shown, place on a smooth surface and give the cord a sharp pull. When the cord is clear of the rod remove the 5½" Strip and the top will continue to spin for a considerable period.




1	of	No.	2	1	of	No.	37
1	,,	,,	2 16 19B	1	,,	**	40
1	**	,,	19B	1	,,	,,	125




3	of	No.	2	1	of	No.	24	
3			5	5	,,	,,	35	
3	55		10	25			37	
1		**	11	1		,,	44	
5	,,		12	2			48A	
1			16	1			52	
2	.,	**	17	2			125	
1		"	195	2	850		126	
4	"	"	22	1			126A	

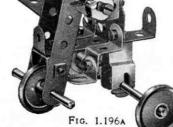

### Model No. 1.197 Guillotine

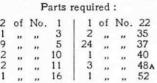

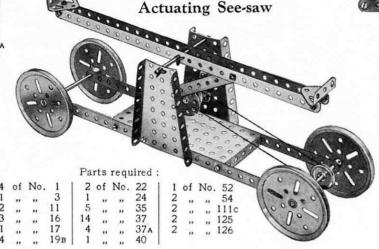

Model No. 1.198

- 50	arts	red :	
16	qui	ieu.	
10.00	of	No.	2
1	,,	.,,	3
3	,,	**	5
1	,,	**	10
2	,,	,,	11
2 2 2	,,	,,	16
2	,,	**	18A
1	,,	,,	19в
3	,,	,,	22
1	,,	,,	24
6	,,	,,	35
16	,,	,,	37
2	,,	,,	37A
1	,,	,,	52
1	,,	,,	111c
2	,,	,,	125
1			126

# Model No. 1.199 Wire-Rope Maker

Coat Hanger


Parts required:
1 of No. 1 | 2 of No. 5 | 1 of No. 57
2 ,, ,, 2 | 6 ,, ,, 37 |


### Model No. 1.201 Automatic Drill

Cord is passed round the Pulley on the drill spindle 4 and thence over the Pulleys 3 and round the shaft of the Pulley 1. The lever 2 (a 3½ "Strip) is pivoted by a Bolt and two Nuts at its inner end to an Angle Bracket, and the latter is bolted to a 1½ "Double Angle Strip which, in turn, is bolted between the vertical 2½" Double Angle Strips. The arm of the lever engages between two Washers on the drill spindle, and on pressing the lever, the drill spindle with its 1" Pulley is forced downwards,

thus tightening the Cord, which then transmits the drive to the drill spindle. Immediately pressure on the lever is released, the drill comes to rest. 2


Model No. 1.200

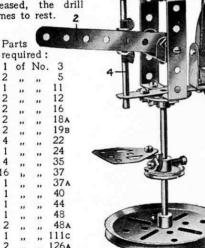


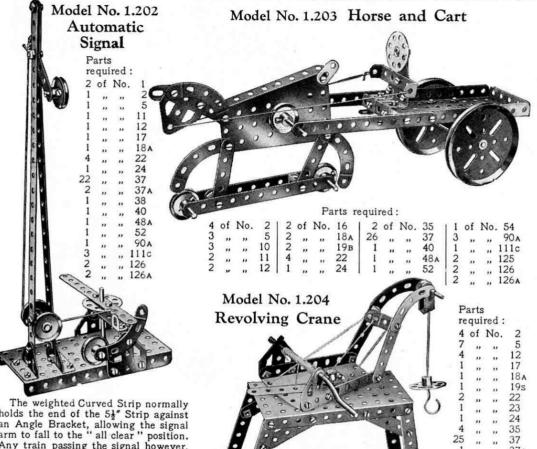


holds the end of the 51" Strip against an Angle Bracket, allowing the signal arm to fall to the "all clear" position. Any train passing the signal however. strikes the opposite end of the 51" Strip, and by means of the cord shown raises the arm to indicate "danger." The Curved Strip moves to allow the end of the 51" Strip to pass over it, and is returned to its original position by reason of its weighted end. The signal then remains at "danger" until the mechanism is re-set.

### Model No. 1.205 Patent Luffing Crane

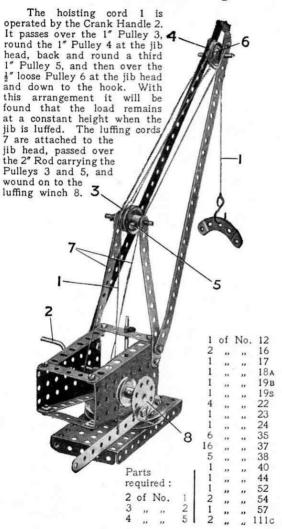

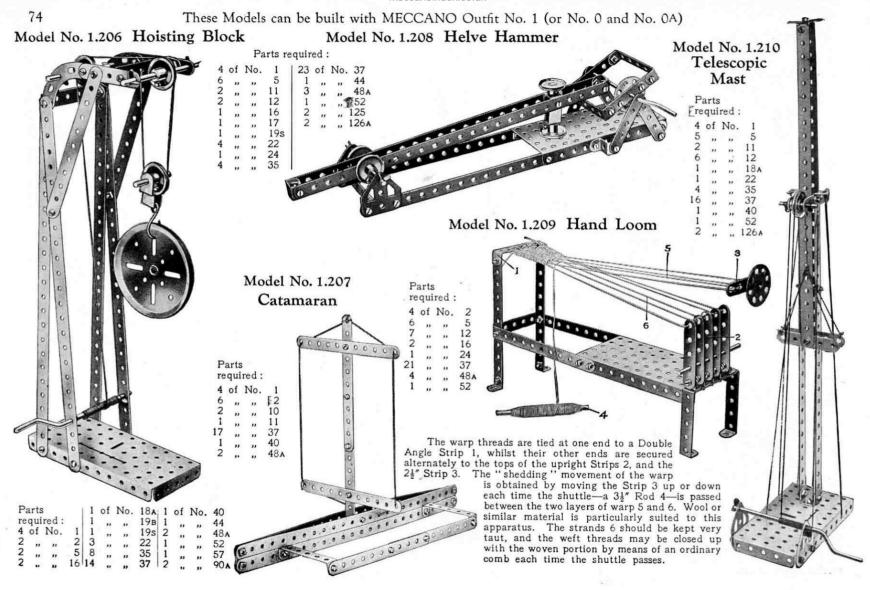


### Model No. 1.211 Motor Lorry

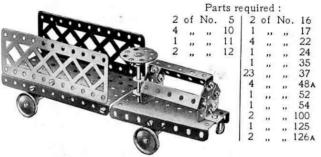


### Model No. 1.212 Disappearing Meccanitian

The bottom of the box-like portion of the model consists of a  $5\frac{1}{2}'' \times 2\frac{1}{2}''$  Flanged Plate; three  $5\frac{1}{2}''$  Strips bolted to upright  $2\frac{1}{2}''$  Strips form each side and each end consists of three  $2\frac{1}{2}'' \times \frac{1}{2}''$  Double Angle Strips. The lid 1, which is mounted pivotally on an Axle Rod 2, consists of two Sector Plates bolted together. Elastic bands are tied to the sides of these Plates and connected to Rod 3 passed through the bottom of the box. The "Meccanitian" 4 also is connected to this Rod by pieces of elastic. On pressing the end of the rear Sector Plate the lid opens sufficiently to allow the figure to be drawn inside and then snaps back into place. A Cranked Bent Strip 5 is bolted at the back of the figure and rests against the edge of the Sector Plate.

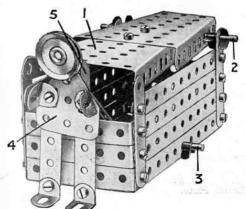

		red :	_
17.0	of	No.	2
6	,,	. ,,	5
1	**	***	10
4	,,	**	12
2	**	**	16
1	**	,,	22
6		,,	35
23	,,	,,	37
1	,,	,,	44
4	,,	,,	48A
1	,,		52
2	,,		54
1	,,	,,	111c
1	,,		126A


### Model No. 1.213 Dignity and Impudence

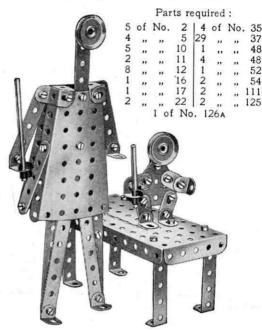


### Model No. 1.214 Field Roller

				Par	ts 1	equi	red:				
2	of	No.	1	1	of	No.	16	16	of	No.	48A
3	,,	,,	5	2		,,	19B	2	,,	,,	90 A
6	,,	.,	12	30	,,	,,	37	2	,,	,,	126




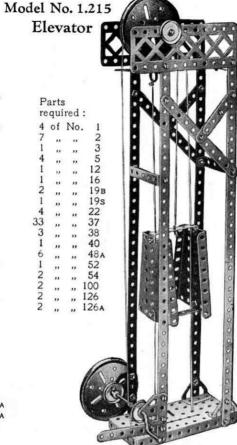

Two cords stretched between the base plate of the model and the upper structure are passed through holes in the Double Angle Strips of the cage to form guides. A further cord is tied to the upper Double Angle Strip, and after being led over the 3" Pulley at the head of the model is tied to the shaft of a Crank Handle.

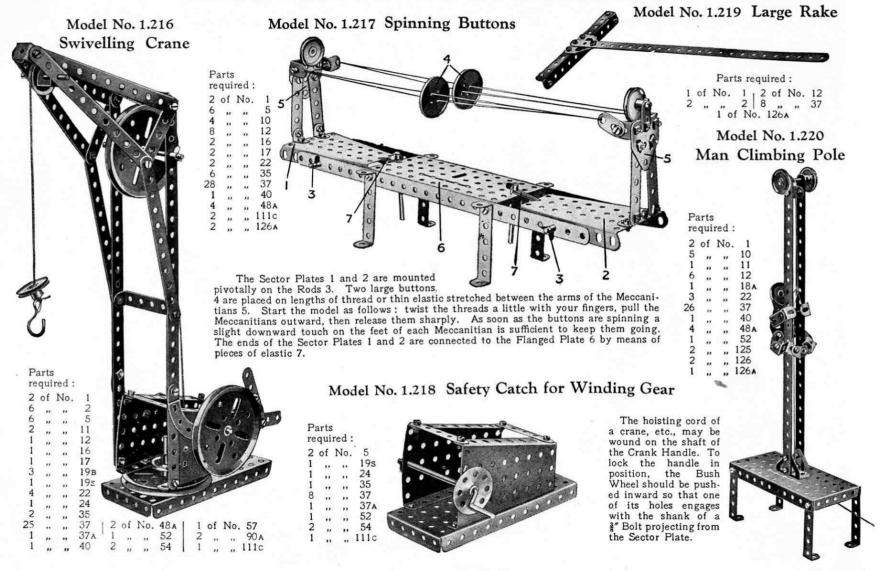

### Model No. 1.221 Seismograph

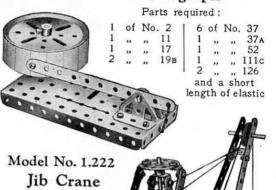

Jib Crane
Parts
required:
4 of No. 1

1 " " 5 2 " " 11 3 " " 12 1 " " 16 2 " " 17

1 ,, ,, 19s 4 ,, ,, 22 1 ,, ,, 24 3 ,, ,, 37


1 ,, ,, 48 1 ,, ,, 52 2 ,, ,, 54 1 ,, ,, 57 ph

### Model No. 1.223 Centrifugal Governor

	arts			
re	qui	red	:	
2	of	No	. 5	THE COURT
	,,	,,	10	6
2 6	"	,,	11	-2
6	,,	,,	12	2
1	,,,	,,	16	- 3
1	,,	,,	19B	3
1	"	"	19s	4
4	"	"	22	4
1	"	"	24 35 37	
3 18	"	"	35	5
18	**	,,	37	3 0 0
6	"	22	37A 38	
4	"	"	38	
1	"	"	40	/10
2	"	"	111c	
2	"	"	126	

The 3" Pulley Wheel is bolted to the  $5\frac{1}{2}$ "  $\times 2\frac{1}{2}$ " Flanged Plate as shown, and the Rod 6 is free to rotate in its boss. The Bolts 1, 2, 3, are provided with lock-nuts. When the engine to which the governor is attached works at too great a speed, the 1" fast Pulley Wheels 4 fly outward and lift the two Double Brackets 5. In actual practice this movement is utilised to close the engine valves and so reduce speed.


### Model No. 1.224 Stone-Sawing Machine

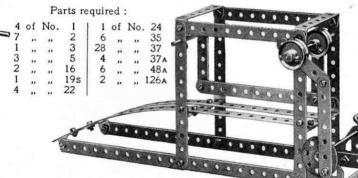

### Model No. 1.225 Elevated Crane


		Pa	arts re	equi	red	:				-	10
2	of	No.	1 2	16	of	No.	48A			-4	4
8	"	,,	2	1	"	,,	52				Γ
8	"	"	5	2	,,	,,	54				
1 2 1 3 1 4	"	***	11 16	1 4	"	"	57		1		
1	,,	"	18 <sub>A</sub>	2	"	"	90A			14	
3	**	"	19B	2	,,	"	126 126 <sub>A</sub>	/	19	19	
1	"	"	19s	-	"	"	120A	//	V	N	
4	"	"	22				1	//	1	7	
1	,,	,,	23				/				
1	,,	,,	24				//		H		A
3	"	**	35			/	/A	7	N	6	7
36	200	**	37			/	/A		H		
3	**	**	38		/	8111 	131		B	12	0
1	"	"	40	١	/	/			19		0
		7		/		//	//	1	J	V	Lol
			-	/-		H	/	6	1		
		4		1	/	B/		0			
			V.Z	1	//	7/		101			
-	5.	a	1	n-/		_		19			
	1	八腦	7.	7		0	OVE	77		-1	
	A			Œ	贕		1	0	/	•	
	W.	n/B			<b>B</b>		37				
	1/4	100	50			60					
	10			31	1						
	7					1/	10	_	\		
	6		1	3.	à 1.	1/-	• 1			2	
	~				4	1/1/	• •	A		1000	
	5-		0		3	1.	V.	0			
			-04	-		10	-	701			
	4-			9	10		6		À		
		,	A S	4	9	0 0		Y	Q		
		4		1	10	_					
					7		0				
		,		VE		50	200	200	10		
			0.600	5 C	90	00	000	9			
		6	1		0	10					
			6	3	ø		3				
	TI.			W							

The base of the swivelling portion of the crane consists of a 3" Pulley Wheel 1, which has a 3\frac{1}{2}" Axle Rod nipped in its boss. The Rod is journalled in two 2\frac{1}{2}" Double Angle Strips 2 and 3 secured between the Sector Plates 4. The brake cord 5 passes round the 3" Pulley as shown, and is tied to one of the holes in the Bush Wheel 6. The cords 7 serve merely to support the weight of the jib.

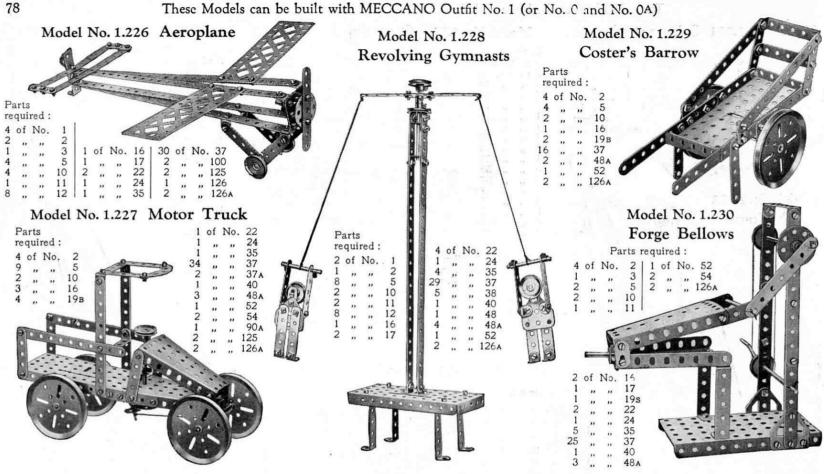

### HOW TO CONTINUE


This completes our examples of models that may be made with MECCANO Outfit No. 1 (or No. 0 and No. 0A). The next models are a little more advanced, requiring a number of extra parts to construct them. The necessary parts are all contained in a No. 1A Accessory Outfit, the price of which may be obtained from any Meccano dealer.

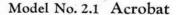


Parts

required:

12 of No. 2

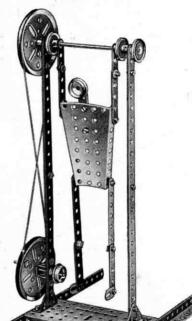

### Model No. 2.2 Turnstile

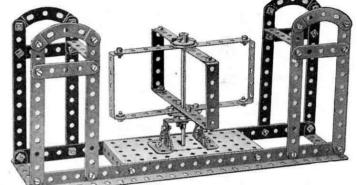

# Meccanitians Parts required:


		Pa	rts re	qui	red	:		
5	of	No.	1	1	of	No.	38	
1	,,	,,	5	1	,,	,,	52	
ó	**	,,	10	2	,,		111c	
3	23	11	12	2	,,	"	126A	
l	"	,,	16	1		-		
2	"	"	17	3000		A	20)	
	**	"	19s			1		
1	**	"	22			De la companya di	$\sim$	
			24	1	- 4	<b>.</b>	101	

Model No. 2.4


Revolving

### Model No. 2.3 Coal Sifter

The  $5\frac{1}{2}$ " Strip I is pivoted to the Angle Bracket 2 by a bolt and two Nuts. The Angle Bracket in turn is bolted to the Flanged Plate, which is suspended in such a way that it is free to swing to and fro. The other end of the  $5\frac{1}{2}$ " Strip is pivoted to the Bush Wheel 3.

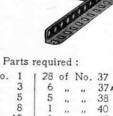

4	of	No.	1	1 28	of	No.	37
2	,,	,,	3	6			37 A
2 5 2 2	,,	,,	5	5			38
2	,,	**	8	1	**	**	40
2	,,	.,	10	1	,,		45
2 2 3	,,	,,	15	1	,,		52
2	,,	**	19в	1	,,	,,	54
2	,,	,,	20в	2	,,	,,	62
3	,,	"	22	1	,,	,,	115
		2	of !	Vo.	126		

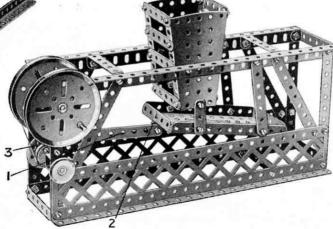

Pa	arts			
re	qui	red:		
9	of	No.	2	
92824		.,	2 3 5	
8	240	-	5	4
2	1607	60.	6A	- 4
4	,,	,,	8	A
,	**	**	13	4
1		12	12	201
1	**	"	16	40)
1	**		17	1
1 2 2 1 2 54	**	,,	19B	(c c
2			22 24 35 37	1011
1		**	24	Inthe
2	•••	"	35	
51	"	"	27 4	ELD
04	"	**	37	W-4 35-34
6	33	**	37 A	
8		220	38	
1	788		40	
1			45	
6		55	48 A	
6 1 2 2	**	***	52	
2	**	***	54	
2	**	**	52 54 99	
2	**		99	

Model No. 2.5


Easel

### These Models can be built with MECCANO Outfit No. 2 (or No. 1 and No. 1A)


### Model No. 2.6 Smoothing Iron

### Parts required:

4	of	No.	2	1 20	of	No.	37
2	,,	,,	3	2	,,	,,	38
6	,,	,,	10	1	,,	,,	48A
4	,,	,,	11	2	,,	,,	54
2		250	10				124.

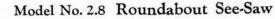



				Pa	rts	requ	irea:				
2	of	No.	6A	2	of	No.	19B	6	of	No.	48A
4	,,	,,	8	1	,,	,,	24	2	,,	,,	54
4	,,	,,	10	2	,,	**	35	2	,,	,,	90A
4	,,	,,	12	34	,,	,,	37	4	,,	**	11c
1	,,	,,	16	4	,,	,,	37A	2	,,	**	26
1		. ,,	18A	6	,,	,,	38	2	**	., 1	26A

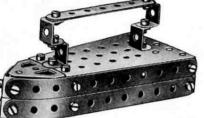

### Model No. 2.7 Mat Frame

The Strips 1 are hinged to the frame in the following manner. Two Cranks 2 with their bosses facing inward are bolted to the Strips 1 and two Angle Brackets are secured to the frame. A Rod is then pushed through the holes in the Angle Brackets and secured in the bosses of the Cranks. A Double Bracket fastened to the ends of the Strips 1 carries a Threaded Pin, which fits in the holes in the Flat Trunnions 3. By removing this Pin, the frame may be folded flat.

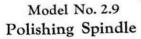


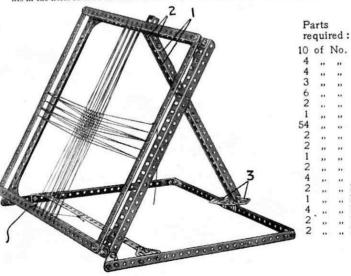

Parts required:

15A

required:

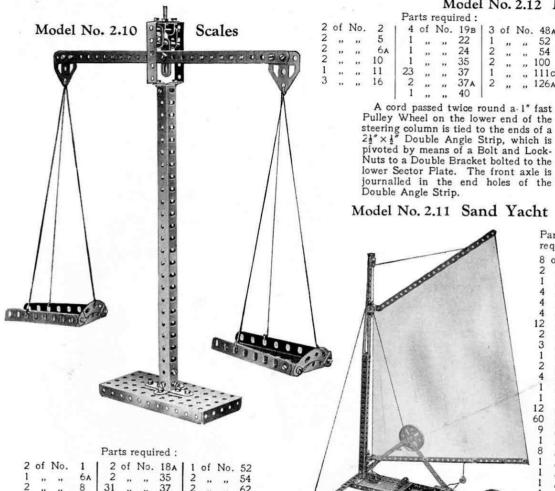


" " 115


# Model No. 2.12 Motor Truck 3 of No. 48A


Parts required:

> 125 126

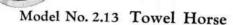


D	arts	2		1 4	of	No.	. 12	
		red:		2	,,	200	22A	
				28	"	,,	37	
6	of	No.	1	2	,,	,,	37A	
4	,,	,,	2	8	,,	,,	38	
2	,,	**	8	4	,,		90 A	
4	,,	,,	10	2			111c	

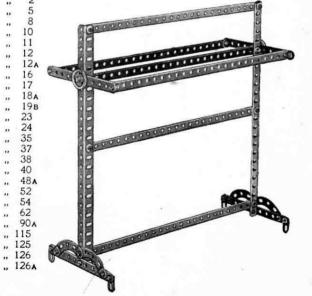

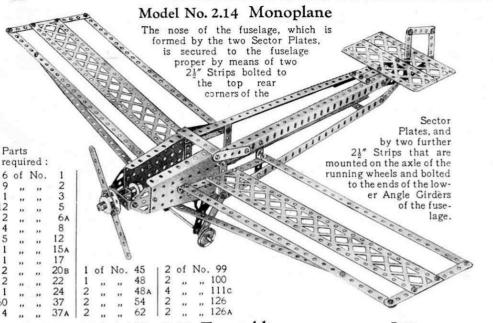


### Model No. 2.15 Turntable

The two sides of the revolving portion are joined in the middle by two pairs of 2½" Strips, each pair being overlapped three holes and bolted to the 3" Pulley Wheel 1. An Axle Rod secured in the latter is journalled in the bottom plate 2 and retained in position by a 1" fast Pulley Wheel beneath the plate.

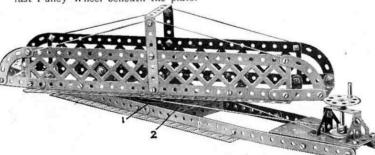

		red No.	
2	,,	,,	3
8	,,	,,	5
4	,,	**	8
1	**	**	17
1	,,	,,	18A
1	**	**	19в
3	,,	**	22
1	"	**	24
45	**	9.9	37
4	,,	**	37A
4	"	**	38
1	,,	"	48
7	**	**	48A
	"	**	52 54
2		"	90 A
2	,,	,,,	90A
4	"	"	
4	**		111c

### Model No. 2.16 Elevator

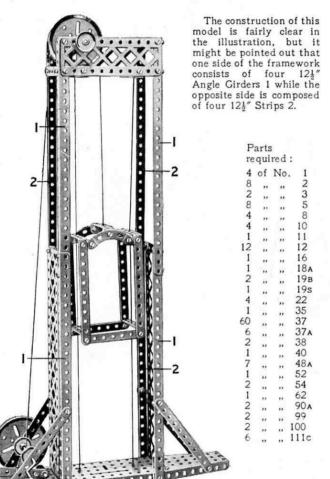


### Model No. 2.17 Roundabout


### Parts required:

2 of No. 15

### Model No. 2.18 Gondola



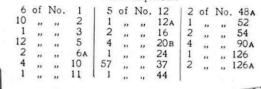

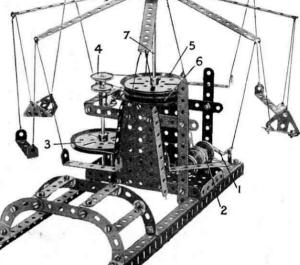

When the Crank Handle is turned, the drum 2 (formed by butting together two 3 Flanged Wheels) turns the 3" Pulley Wheel 3 by means of an endless cord. The 1" fast Pulley Wheel 4 similarly turns a second 3" Pulley Wheel 5 resting on another 3" Pulley Wheel 6 (see Fig. 2.17a). The end of the Axle Rod 7 is quite free to revolve in the boss of the lower 3" Pulley Wheel 6.



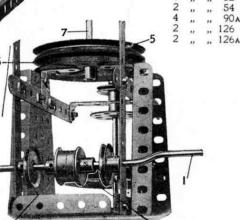


FIG. 2.17A


Model No. 2.19 Tipping Motor Wagon


The front Axle Rod is journalled in a  $2\frac{1}{2}$  "Double Angle Strip 1 which in turn is bolted to a Double Bent Strip 2. The Double Bent Strip is pivoted to the Sector Plate by a Bolt and two Nuts. Cord passing over a 1" Pulley Wheel attached to the Rod 3 is fastened to the ends of the Double Angle Strip 1, and by rotating another pulley, which represents the steering wheel, the road wheels are deflected.

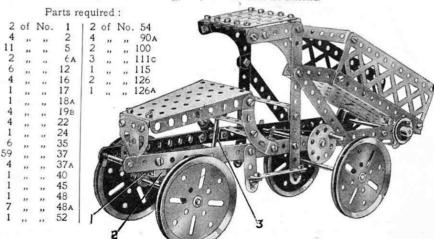

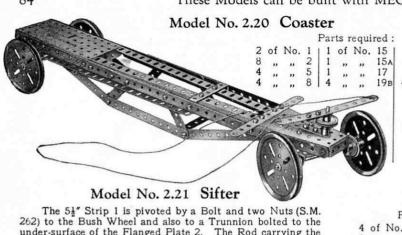

under-surface of the Flanged Plate 2. The Rod carrying the Bush Wheel is journalled in one of the side girders and through a Double Bent Strip.

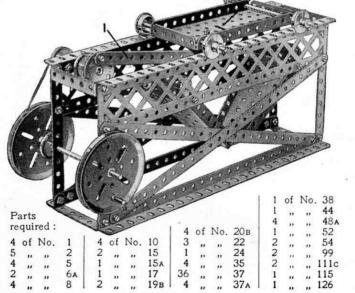


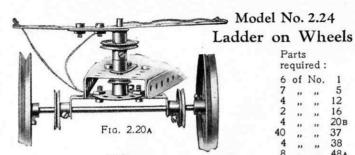

Model No. 2.22	Tricycle
Parts required :	

		1	arts i	equ	nec								100	0
4	of	No.	2	12	of	No	. 37	A					40 .	
	,,		5	1	,,	,,	111	C				-	TO C	
2	,,	,,	10	1	,,	,,	126	A		S	3/6		<b>CONT</b>	
6232	,,	**	11			-			21		40	-		1
2	**	,,	12		1			20		Cont.	9	- 4		
1	**	.,,	16		100		LÆ	1.6		1		- 4		
1	**	**	18A		IIC.		7. +		WEEKS IN			1		
3 2 15	**	"	19в 35 37		18		11	7		<b>a</b>		1	1	M
15	"	"	37		W		11			-			100	
13	**	"	37		-	State								
							u		10	7				
							4			/				


Model No. 2.23 Spinning Top

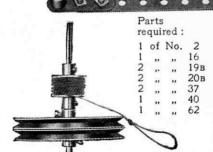


The drum on which the cord is wound consists of two 3" Flanged Wheels butted together. While the cord is being pulled, the top is held steadily on some smooth surface by means of the handle shown above. The handle is then lifted off, allowing the top to spin freely.



Parts required:

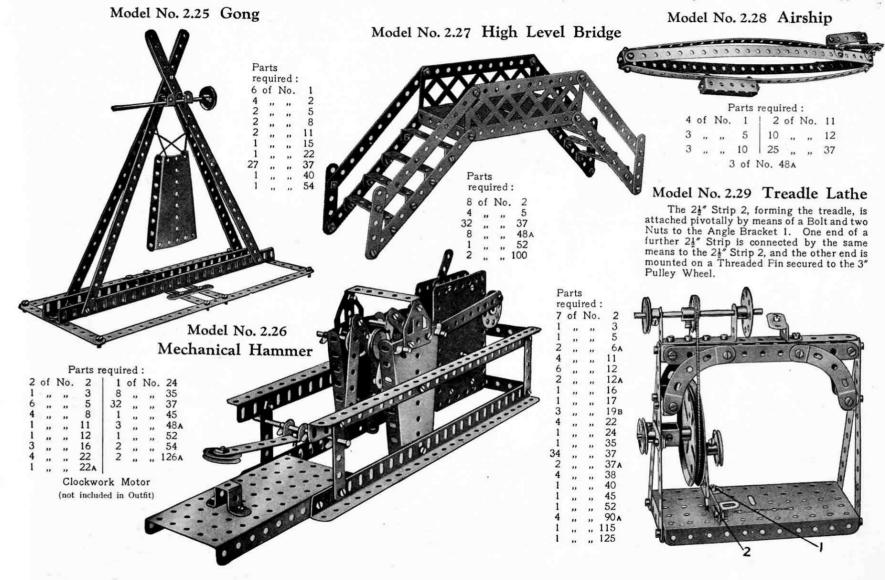


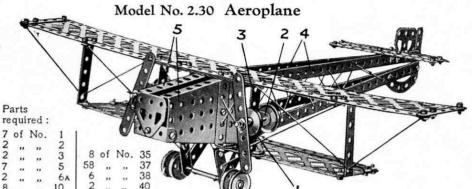

Each engine is represented by a ¶" Flanged Wheel 1 and a 1" ast Pulley Wheel secured to a 2" Rod journalled in a Double Bracket 2, which is botted to the 2½" ×½" vertical Double Angle Strip 3. The 12½" Strips 4 of the fuselage proper are bolted to the two Sector Plates 5, and also by means of Angle Brackets to the wings. The tail plane consists of two 5½" Strips to which a similar Strip, representing the movable portion of the plane, is attached by means of Flat Brackets.

### Model No. 2.31 Motor Lorry

The driving spindle of the Clockwork Motor is removed and in its place is inserted a  $3\frac{1}{2}$  Rod forming the rear axle, the special Pinion inside the Motor being secured to this Rod, of course, instead of to the driving spindle. The steering is operated by a Bush Wheel on a vertical  $3\frac{1}{2}$  Rod journalled in a Double Bent Strip. Cord is wound round the lower part of this Rod and its ends are secured one to each end of a Double Angle Strip carrying the front axle. A Crank is botted to this Double Angle Strip and carries a short Rod that is journalled in the boss of a further Crank bolted to

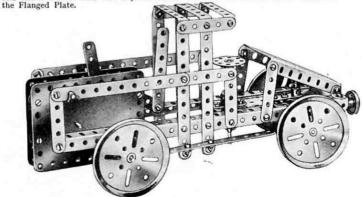


# 

Parts


### Model No. 2.32 Try-Your-Strength Machine


The Bush Wheel 1 is secured to a short Axle Rod 2, the lower end of which rests on a pair of Angle Brackets 3 bolted to the ends of four 5½ Strips 4. The Strips 4 are pivoted as shown (Fig. 2.32A) on a 1½ Rod 5, and on their opposite ends rests a ½ loose Pulley Wheel 6. When the Bush Wheel 1 is struck, the 5½ Strips fling the Pulley Wheel 6 upward, but the wheel is guided by the vertical 12½ Strips 7. The weight of the Strips 4 then causes the Bush Wheel to resume its original position.

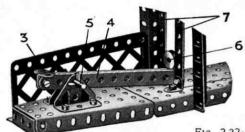


					oda.	···	•	
	6	of	No.	1	2	of	No.	10
	6	,,	**	2 3 5 6A	10	,,	,,	12
	1 2 2 4	,,	**	3	2	,,	,,	18A
	2	,,	**	5	1	**	,,	23
	2	,,	23	6A	1	,,	,,	24
	4	**	,,	8	3	,,	,,	23 24 35
				-	60	,,	,,	37
			4	9/	3 60 6 4	,,	,,	37A
			A	Z-	4	,,	,,	38
	,	1		1 /2	1	,,	,,	45
á	1	A	=/ .		1	,,	,,	48
ő	a.	4	7,1		1	,,	,,	48A
ť	3	1	ا مذا		1	,,	,,,	52
d	4	d			2	**	,,	54
	9	100	CHEST	-	3			90.

Parts required :

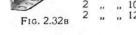

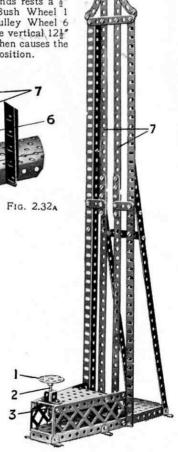


### Model No. 2.33 Performing Meccanitian

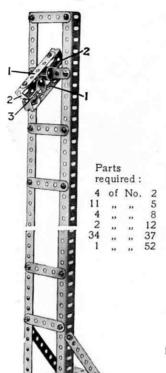


The Meccanitian consists of two 21" Strips 1 to the ends of which two 5½" Strips 2, bent as shown, are bolted. The slot 3 should be passed over the top strip of the ladder, when the device will fall "head over heels" to the bottom.

### Model No. 2.34 Baby Chair

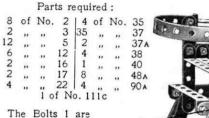


all secured pivotally (see S.M. Nos. 262 and 263), and the height of the chair may be adjusted by fitting any hole in the Strip 2 over the shank of a Bolt that is secured in an Angle Bracket bolted to the Double Angle Strip 3.


### Model No. 2.35 Square-topsail Schooner

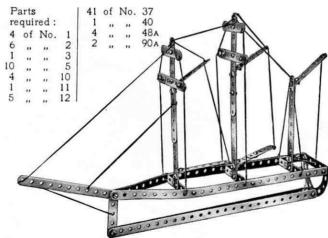


### Model No. 2.36 Hay Tedder

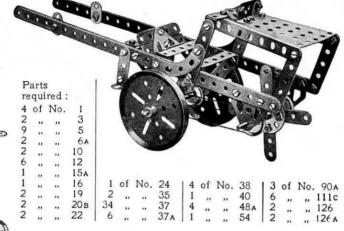


### Model No. 2.37 Stamping Mill

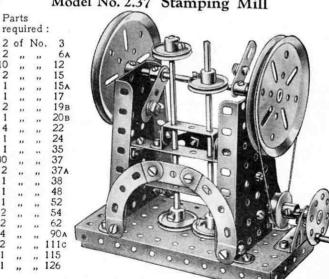

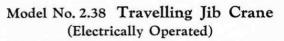

The swivelling structure is bolted to the 3" Pulley Wheel 1, which rests on a second 3" Pulley bolted to the travelling base. A short Rod secured to the boss of the upper Pulley is free to rotate in the boss of the lower one. The Electric Motor 2 controls the hoisting gear and the arrangement of the drive will be clear from the photograph. The jib is luffed on operation of the Crank Handle 3, the cord of which passes round the Axle Rod 4 in the jib, then round the Rod 5 in the base, back round the Rod 4 and is finally secured to a Flat Bracket on the Rod 5.

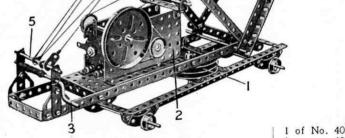

				Pa	arts	requ	ired:					1	**	,,	48 48 A
10	of	No.	1	1 2	of	No.	12	4	of	No.	20 B	1	"	,,	52
9	,,	,,	2	2	,,	.,	15	4	,,		22	î	,,	"	57
2	,,	,,	3	1	,,		15A	1	,,	,,	23	4	"	"	90A
2	"	**	5	2	,,	**	16	1	••	**	24	5	,,	,,	111c
2	,,	,,	6A	1	,,		17	14	,,	"	35	2	,,	,,	126A
4	"	"	8	1	**	**	18a 19	60	"	**	37 37 A	Ele	ectr	ic	Motor
1	"	,,	10	4	**	"	19B	14	"	"	38	(n	ot ir	clu	ded in

### Model No. 2.39 Travelling Jib Crane (Hand Operated)

This shows a section of Model No. 2.38 fitted for hand operation, No. 2.38 fitted for hand operation, thus dispensing with the necessity of the Electric Motor. In this case the hoisting cord is operated by the hand wheel 6, the Rod of which is controlled by a band brake 7. The end hole of the lever of the latter is pivotally mounted on the Rod 8. pivotally mounted on the Rod 8. The luffing movement of the jib is effected by the Crank Handle 9. The operating cord passes round the Rod 10 attached to the jib, then round Rod 11 in the base of the model, again round Rod 10, back round Rod 11,

and once more round Rod 10. The end of the cord is then tied to a Flat Bracket on the Rod 11.



Par	ts rec	quir	ed:	:				1	of	No.	19	1	of	No.	48	
No.	1	13	of	No.	10			4	,	, ,,	19B	7	,,	,,	48A	
	2	1	,,		11			4	,	,	20в	1	,,	,,	52	
"	3	1	,,	"	15			4	,	. ,,	22	2	,,	,,	54	
"	5	1	,,	,,	15 <sub>A</sub>	1	10	1	,	, ,,	23	1	,,	,,	57	
,,	6A	5	,,	,,	16	In	11	1	,	, ,,	24	1	,,	,,	62	
,,	8	2	,,	,,	18A	601	الرو	12	,	, ,,	35	4	,,	,,	90A	
200		SHOOT	22	200		12	100	57	,	, ,,	37	1	**	**	111c	
					6	-100		1	,	, ,,	40	1	,,	"	115	

Model No. 2.40 Schneider Trophy Seaplane

### Parts required:


6	of	No.	2	34	of	No.	37
12	,,	,,	5	3	.,	,,	37A
2	,,	,,	6A	6	,,		38
2	,,	,,	11	2	.,	,,	111c
12	,,	,,,	12	2		,,	126
		1	of N	0. 1	26		

### Model No. 2.41 Candy Puller

### Model No. 2.42 Carrier Tricycle

		Pa	rts re	quire	ed:		
6	of	No.	2	36	of	No.	37
2	,,	,,	8	4	,,	,,	38
6222	,,	"	12	1	,,	,,	40
2	,,	,,	15	4	,,	,,	48A
2	,,	,,	17	1	.,	,,	52
11.7	,,	,,	19в	2	,,	,,	54
4		,,	22	2	,,	**	62
1	**	,,	24	4	,,	,,	90A
2			25				



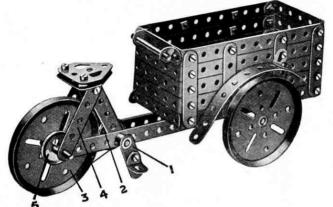

Each pedal of the tricycle consists of an Angle Bracket pivotally attached to a Crank 1 by means of a Bolt and two Nuts (see S.M. No. 262). The Cranks are secured to a 1½" Axle Rod carrying a 1" fast Pulley Wheel 2. A cord passes round this Pulley and around the 3" Pulley Wheel 3, which is spaced away from the 2½" Strips 4 by a 1" fast Pulley Wheel 5. The Double Bracket 6 (Fig. 2.42A) is attached pivotally to the lower framework by a Bolt and Lock-Nuts (S.M. 263).

	arts	red:	
	•	No.	
12	01	140.	5
2	,,		11
6	,,	,,	12
1	,,	,,	16
1	***	**	17
2	**	22	18A
2	"	**	19в 22
45	"	"	37
5	"	"	37A
1	,,	,,	40
8	,,	"	48A
1	,,	"	52
2	"	**	62

" " 111c " " 126A


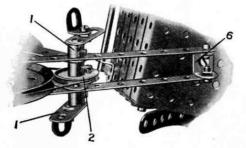


FIG. 2.42A


		M	lode	No.	2.43	· All		,	Wir	ndmil	1
	of	red: No.	1 2 3 5 8	8	6	Y					
44 11 11 11 12 11 44 22 11 11 60 44 77 22 24 42 44 22	of """"""""""""""""""""""""""""""""""""	., 1	12 15 15 16 18 19 19 20 22 22 4 35 37 37 37 40 48 40 48 40 00 11c 26	4-3-2		and annual of				-7	
				5			0 (1)0	10 200			

The operating cord 1 is given a complete turn round the pair of \( \frac{3}{6} \) Flanged Wheels 2. It is then led round the 1" Loose Pulley 3, over the 3" Pulley 4, then down and round the \( \frac{3}{6} \) Flanged Wheels secured to the Crank Handle 5. The vane 6 is rotated by a cord which passes round a 1" fixed Pulley 7 secured to the shaft of the Flanged Wheels 2.

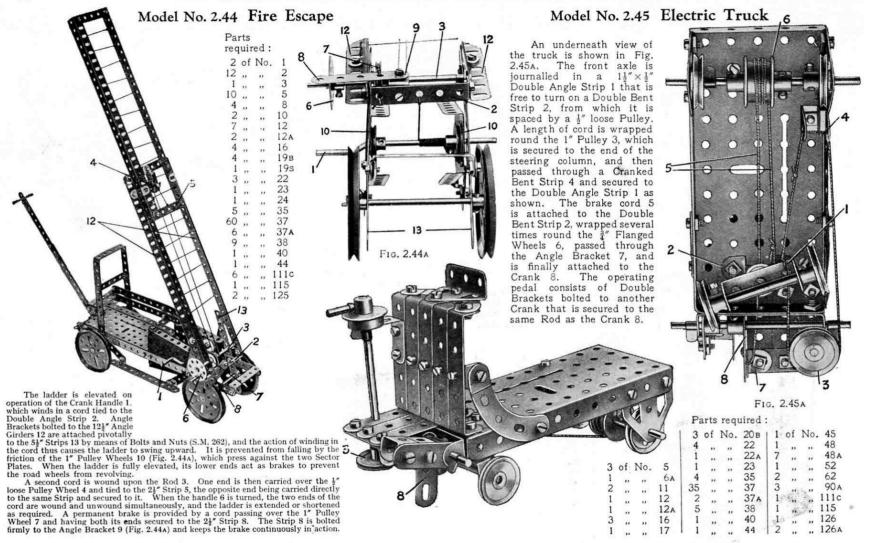

### Model No. 2.46 Pit Head Gear

(Electrically Operated)

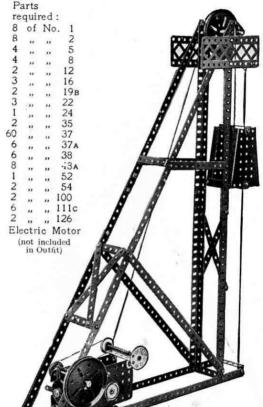


### Model No. 2.48 Steam Lorry

				P	arts	requ	nred:				
	of	No.	3	4	of	No.	20B	1	of	No.	52
0	,,,		5	3	,,	**	22	2	,,	,,	54
2	,,	**	10	1	,,	"	22A	1	,,	,,	62
3 3	**	"	11	1	"		24	3	,,	33	90a
3	**	"	12	5	**	"	35	2	,,		100
3	"	"	16	60	"	"	37	4	**		111c
1	"		17	5	"	**	37A	1	**		125
2	"	**	18a 19b	1	"	**	45	2	"	**	126a
4	"	**	178	8	**	**	48A				

### Model No. 2.47 Pit Head Gear (Hand Operated)


Parts required:

6	of	No.	1	4	of	No.	22	12	of	No.	54
7	,,	,,	2	1	,,	,,	23	2	,,	,,	62
3	,,	,,	5	1	,,		24	2	,,	,,	99
4	,,	,,	8	3	,,	"	35	2	,,	,,,	100
4	,,	,,	11	60	,,	,,	37	6	,,	,,	111c
6	,,	,,	12	6	,,	,,	37A	1	,,	,,	115
4	,,	,,	16	8	,,	,,	48A	2	,,	,,	126A
4	"	,,	19в	1	,,	,,	52		-		

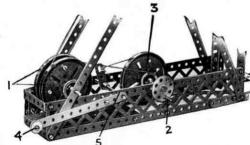

This is an alternative construction of the base of Model No. 2.46, and shows how the Electric Motor may be dispensed with if necessary.

Two 3" Pulley Wheels I are bolted together by four Double Brackets to form a drum on which the hoisting cord is wound. The cage is raised or lowered on operation of the handle 2, which is connected to the winding drum by an ordinary belt drive. The cage is prevented from overhauling by a hand brake that acts on the groove of a third 3" Pulley Wheel 3. The brake normally is applied by the weight of the ½" loose Pulley Wheel 4, which is secured to the end of a 5½" Strip that is bolted to the crank 5.

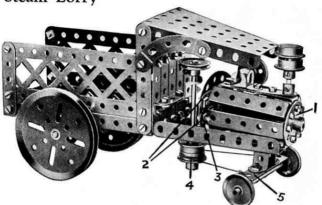



The boiler of the engine is built up of  $2\frac{1}{2}'' \times \frac{1}{2}''$  Double Angle Strips bolted to the Bush Wheel 1, and to two  $2\frac{1}{2}''$  Strips 2, which are joined together by Flat Brackets 3. A  $2\frac{1}{2}''$  Curved Strip (small radius) is bolted to the upper Strip 2. A cord is passed completely round two  $\frac{2}{4}''$  Flanged Wheels 4 secured to the steering column, and its ends are tied to the  $2\frac{1}{2}'' \times \frac{1}{2}''$  Double Angle Strip 5. The Double Bent Strip bolted to  $\frac{1}{4}$ the Strip 5 is pivoted by a bolt and two nuts to the Sector Plate.

### Model No. 2.49 Revolving Truck

Parts required:


1	of	No.	16 [	2	of	No.	22a 35 37	1	of	No.	52
2	,,,		17	4	,,,		35	4	.,	,,	125
2	.,	**	22	6	,,	,,	37	1			

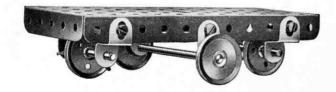

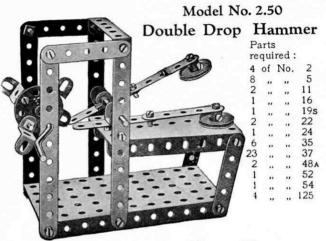

### Model No. 2.51 Motor Van


The Axle Rod 1 is journalled in a  $2\frac{1}{4}$  " $\times \frac{1}{4}$ " Double Angle Strip 2. The latter is bolted to a Double Bent Strip that is pivoted to the Flanged Plate 3 by a Bolt and two Nuts. Steering is effected by a cord attached to the ends of the Double Angle Strip 2 and passed round a 1" Pulley Wheel fastened to the lower end of the steering Rod.

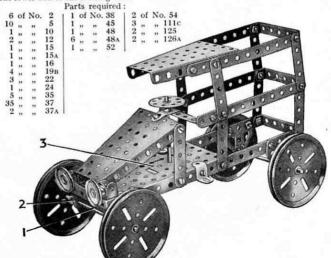

# 5 2 9 12 7

Fig. 2.52A


### Model No. 2.52 Derrick

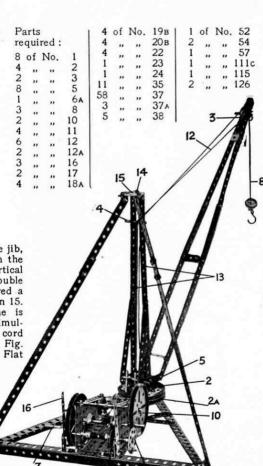

The 3" Pulley Wheel 2, which supports the jib, is free to turn on a short Axle Rod secured in the boss of the lower 3" Pulley Wheel 2a. The vertical 12½" Strips 13 are bolted at their tops to a Double Bracket, to the centre hole of which is secured a Bolt 14 that is free to turn in the Flat Trunnion 15.

The swivelling movement of the crane is carried out by turning the handle 1, which simultaneously winds and unwinds the ends of a cord passing round the 3" Pulley Wheel 2 (see Fig. 2.52A). The cord 12, which is tied to the Flat Bracket 3 at the head of the jib passes over the 2" Rod 4, under a similar Rod 5, and between two vertical 2" Rods 6, which act as guides, and is finally wound on to the Crank Handle 7. Hence on operation

of the latter the jib is raised or lowered. The cord 8 also passes round the Rods 4, 5 and 6, and is wound on to the Rod 9. Operation of the handle 10 raises and lowers the hook. The cords 8 and 12 are prevented from unwinding by bandand-pulley brakes 16.

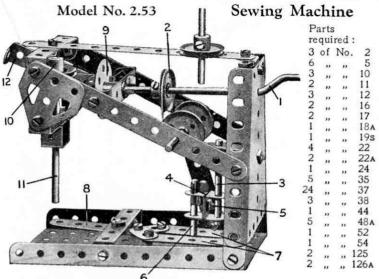



The handle 1 carries a 1" Pulley 2, which drives by means of a cord a similar Pulley on a 2" Rod 3 journalled in a Cranked Bent Strip bolted to the Sector Plate. Two Double Brackets 4 are secured together by a Bolt 5, the shank of which presses very tightly on the Rod 3. This locks the Double Brackets in position, and they revolve with the Rod 3. The outer Double Bracket carries a 1½" Rod 6, the end of which lies between two Strips 7, arranged at a short distance apart from each other and bolted to two Flat Brackets. These are secured to a further Strip 8 bolted pivotally to a transverse Double Angle Strip. As the shaft 3 rotates, the Rod 6 slides between the Strips 7 and so rocks the Strip 8 from side to side to represent the shuttle.


The Bush Wheel 9 carries two Angle Brackets placed together in the form of a Double Bracket, with their elongated holes overlapping, and in such a position that an imaginary line drawn through their opposite round holes, would cross the centre of the Bush Wheel. A Flat Bracket is bolted to the inner Angle Bracket in a line with the Crank Handle and forms a lever which engages 1" Pulley 10 mounted on a vertical sliding Rod 11. This Rod is journalled in a Double Angle Strip bolted between the lower holes of the two Flat Trunnions and is further supported by two ½" Reversed Angle Brackets secured to the Angle Strip. As the Bush Wheel rotates, the Flat Bracket imparts to the Rod 11 a movement corresponding to the action of the needle.

The outer Angle Bracket on the Bush Wheel strikes once in every revolution the end of a Double Angle Strip 12. This is pivotally mounted by a Bolt passed through its second hole from the Bush Wheel end to the centre hole of the Flat Trunnion on that side of the model. The resulting movement of the Strip 12 represents the apparatus that pays out the cotton from the reel.

### Model No. 2.54 Anti-Aircraft Gun

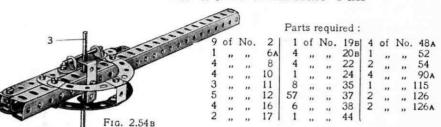

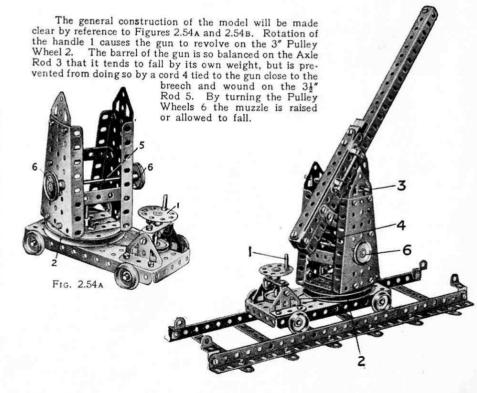

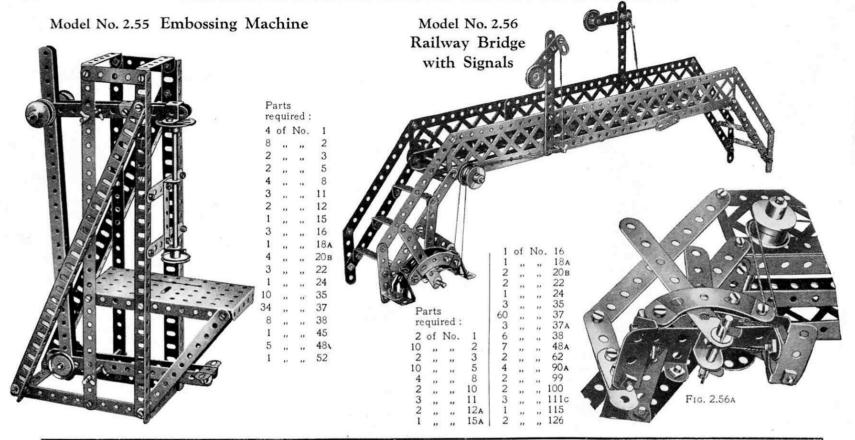


### HOW TO CONTINUE


This completes our examples of models that may be made with MECCANO Outfit No. 2 (or No. 1 and No. 1A). The next models are a little more advanced, requiring a number of extra parts to construct them. The necessary parts are all contained in a No. 2A Accessory Outfit, the price of which may be obtained from any Meccano dealer.


### Model No. 3.1 Drilling Machine

### Model No. 3.2 Strip-Bending Machine

Model No. 3.3 Letter Balance

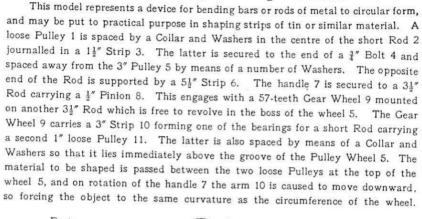

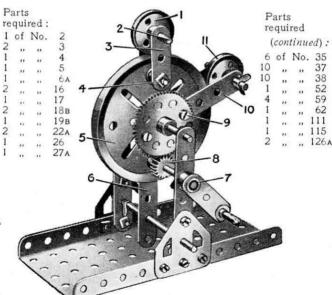

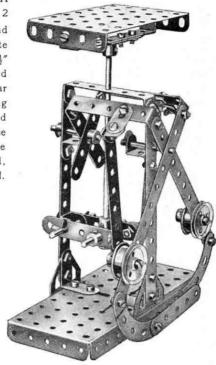



Parts required :


	,,	No.	4 5	1 2		No.	19в	1	of	No.	46
- 2	,,	,,	5	2							
2				1757	**	,,	20в	2	**	,,	48A
2	,,	,,	10	1	,,	**	21	4	,,	,,	59
2	,,		11	4	,,	"	22	2	"	**	62
1	,,		12	2	"	**	22A	1	"	**	63
1	,,		15	3	**	"	24 35	1	,,		111
2	,,	• • • • • • • • • • • • • • • • • • • •	15A	21	"		37	1	"		115
2		",	17	1	"		40	3	"		125 126a
-	**	"			22	"	10	2	"	**	120A

Parts required:


4	of	No.	2	2	of	No.	18A	1 1	of	No.	53
2	,,	**	3	2	,,	,,	20в	4			59
5	,,	,,	5	2	,,	,,	22A	1	2)	,,	62
2	***	,,	10	4	,,	"	35	1	,,	,,	63
1	**	,,	11	37	**	,,	37	2	**	,,	90A
4	.,,	**	12	6	**	,,,	37A	2	,,	,,	111
2	,,	,,	12A	2	"	"	48A	4	,,	,,	111c
1	,,	,,	15	1	,,	,,	48в	2	,,	,,	125
2	n	,,	17	1	,,	,,	52	2	,,		126A

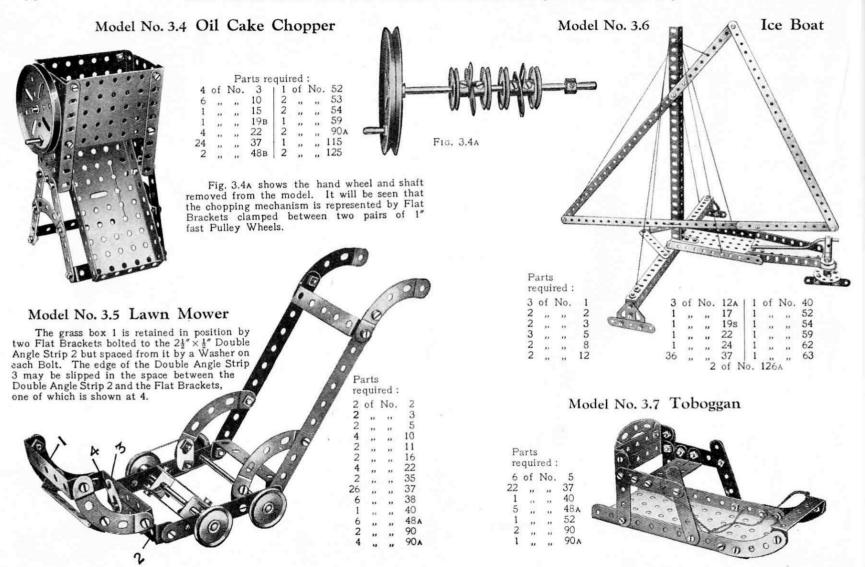

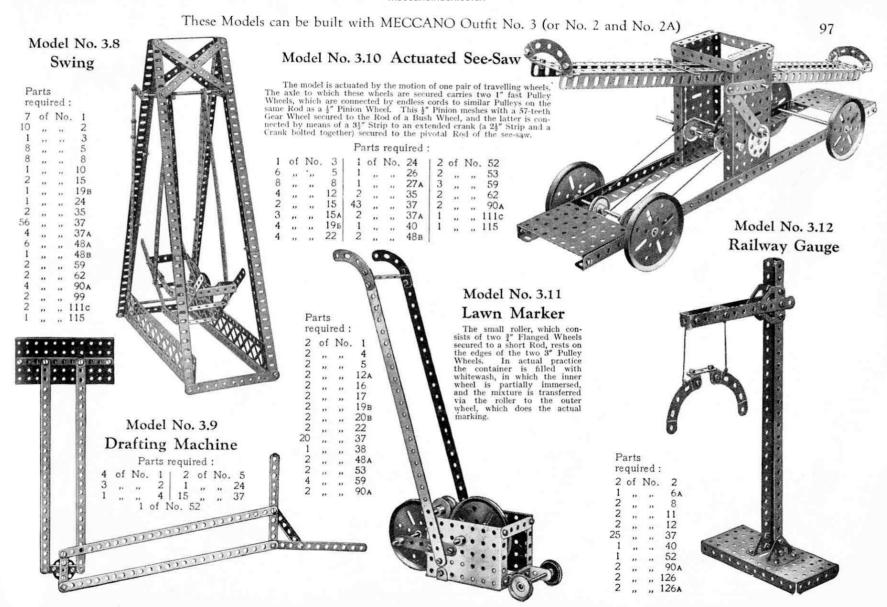

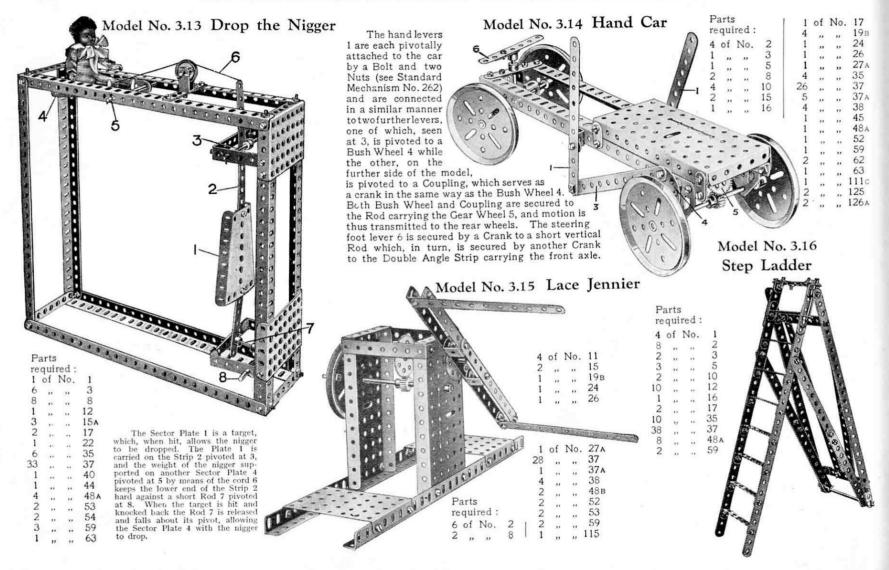


### Model No. 3.17 Vertical Steam Engine

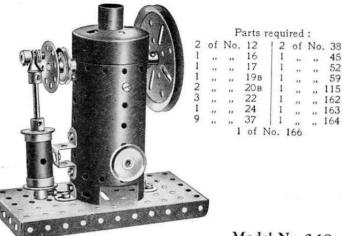


Model No. 3.18 Steam Road Roller

3	of	No.	53									
4	,,,	,,	59									
1	"	,,	62									
4		**	90A		1	08	100					
1	**		126		138	<b>100</b>	5/15	10				
1	100	**	126A					0				
1		29	162			1	•		1	10		
1	11	"	164	n	3			31		0		
			6			3				100		-000
				U.)		0					-	000
			Z)	111	O D	- 100			46	7	0	000
		20	- 12			17	-			21	0	0
				-					1		1.14	0
	1				0			0)	0		1.5	0
	1/4	-		116	3	1	H	$\sim$	V		1/2	100
1	16	. 0		116	10	18		13		1	100	1
1		D (							0	0	20	
1					0	<b>国主教</b>		00			0	
1	K		tell			21	6	4				
	18:		8			4/						
	4		0	0	した	7						
			A									
				1	-							

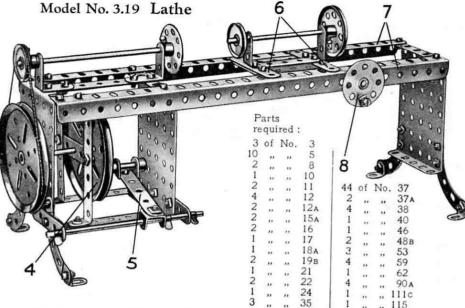


The arrangement of the treadle is shown in detail in Fig. 3.19A. The Crank 1 is provided with a Flat Bracket, the round hole of which coincides with the elongated hole of the Crank, and receives the short Rod 2. The Crank 1 is free to turn about a Threaded Pin 3, secured to the 3" Pulley Wheel 4, and once the latter is set in motion it can be kept in rotation by working the treadle 5. The Strips 6 of the saddle (Fig. 3.19) are duplicated and their ends form slots to receive the flanges of the Angle Girders 7. The hand wheel 8 is a dummy one, but if desired it may be arranged to operate the saddle by an endless rope device.

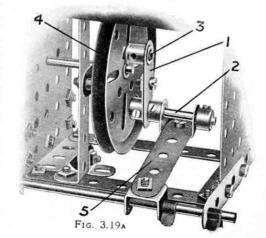

125 126A


> Parts required:

2 of No. 2

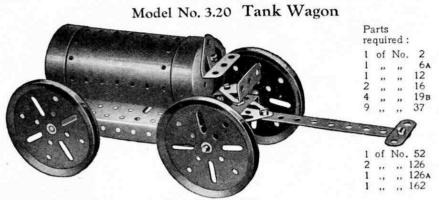


### Model No. 3.21 Flax Cleaner

The six  $3\frac{1}{2}$ " Strips forming the rotating frame are fastened to a Bush Wheel that in turn is attached to the Rod 1. The  $3\frac{1}{2}$ " Strips are braced by six  $2\frac{1}{2}$ " Strips. The drive is transmitted from the operating shaft by means of endless cords. Two separate cords are used in order to secure a more positive drive.

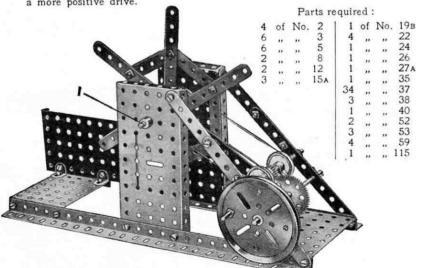

### Model No. 3.22 Newton's Disc


This model demonstrates that the colours of the spectrum, which are most simply produced by directing a ray of white light through a prism, can be re-combined to form white light. The cardboard disc is divided into equal sectors, and the seven colours of the spectrum—red, orange, yellow, green, blue, indigo, and violet—are painted on separate sectors. If the disc is rotated at a high speed by means of the hand wheel and the gears shown, the disc appears to be of a greyish-white colour.

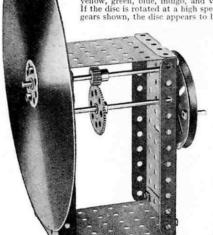


### Parts required:


2	of	No.	15	10	of	No.	37
1			19в	1	,,	,,	38
1			24	2	,,		52
1	**		26	2		.,	53
1		.,	27A	2	.,	,,	59
		1	of N	0. 1	15		

Model No. 3.23 Auto Dial Press

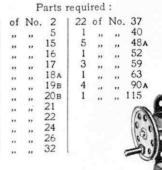

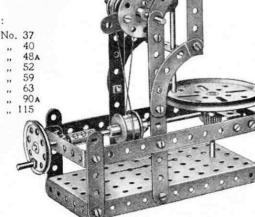


### Model No. 3.24 Hand Trolley

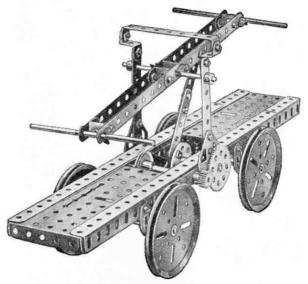


### Parts required:


4	of	No.	2	1	of	No.	18 <sub>A</sub>	1	of	No.	40	
3	,,,		3	4	,,	29	19в	1	,,	**	45	
2	,,	,,*	5	2	,,	. ,,	22	1	"	,,	48в	
4	,,	,,	8	1	,,	**	24	2	,,	,,	52	
8	,,	,,	10	1	**		26	3	,,	,,	59	
4	,,	,,	11	1	,,		27A	4	,,	,,	90A	
2	,,	**	15A	6	**		35	2	,,	,,	125	
4	,,	,,	16	40	,,	,,	37	2	,,	,,	126A	

The connecting arm is pivoted at its lower end to the Bush Wheel and at its upper end to the hand lever, a bolt and two nuts being used to pivot the arm in each case. The drive is transmitted to a 1" Pulley Wheel on the axle of the road wheels by means of a crossed belt passing round another 1" Pulley that is secured to a Rod connected via a 3:1 gear ratio to the 1½" Rod carrying the Bush Wheel. This Rod is journalled in a 3½" Strip fastened to the side Angle Girder, and also in a Double Bent Strip secured to the inside of the Girder.

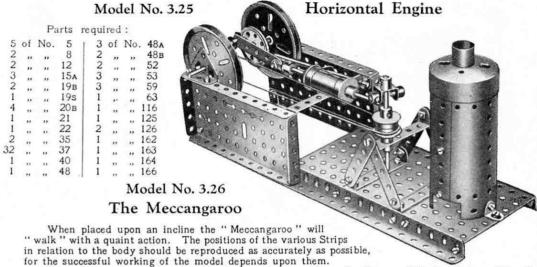

The animal rocks about a short Rod secured between the rocker-frame which does duty as "legs." This frame consists of two 3½" Strips 3 bolted at their upper ends to Cranks in which the short Rod is secured, and at their lower ends to two 2½" large radius Curved Strips 4, which are

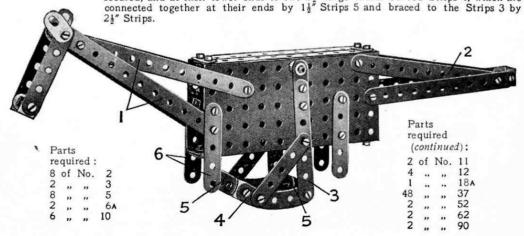

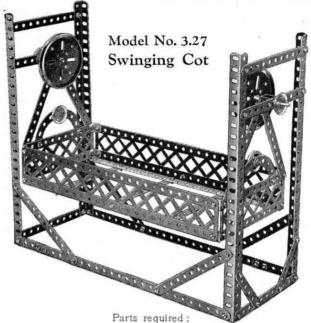

2	of	No.	1	6	of	No.	8	2	of	No.	22	2	of	No.	45
17	,,	,,	2	8	,,	,,	12	2	,,	,,	22A 37 37A	4	,,	,,	90 A
2	,,	,,	4	2	,,	,,	17	64	,,	,,	37	2	,,	,,	99
2		**	5	2	,,	**	19в	2	,,	.,	37A	2	,,	,,,	100
												2			111c


### Model No. 3.28 Horse Sleigh

Parts required:

3	of	No.	2	13	of	No.	37	1	of	No.	57 90 126 a
4	**	,,	5	1	,,	,,	48A	2	,,	,,	90
1			23	1			52	1			126A



### Model No. 3.29 Pit Head Gear

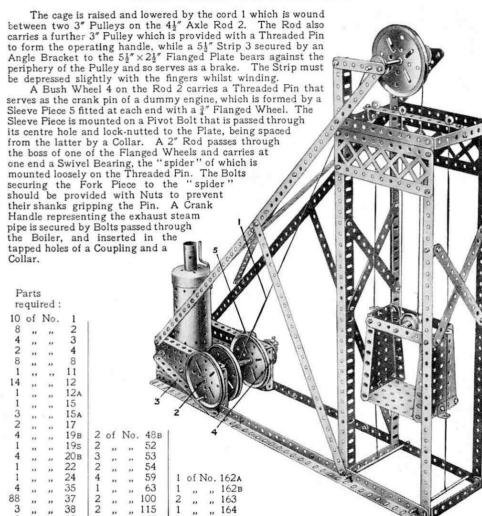

### Model No. 3.30 Rattle

### Parts required:

4	of	No.	2	6	of	No.	37	
2	,,	**	12	1	,,	**	48B	
2	**	**	15	4	,,		59	
2	,,	**	26	1	,,	**	63	

### Model No. 3.31 Knife Grinder

The body is a 21 "Strip, which is bolted at its lower end to a 14" × 1 Double Angle Strip 1 and is held upright by a 1 Reversed Angle Bracket 2 secured to the Double Angle Strip. Both the latter parts are free to turn about a 3½" Axle Rod, and the Double Angle Strip is connected pivotally with the treadle 3 by means of a  $2\frac{1}{2}$ " Strip. The treadle, in turn, is conneeded pivotally with the crankshaft by two further nected pivotally with the crankshaft by two further 2½" Strips, each of the Bolts 7 being secured by two Nuts as in Standard Mechanism No. 262.

The Collar 4 is mounted loosely on a ½" Bolt secured rigidly to the Crank 5, and forms a handle by means of

which the model may be set in motion. The grinding wheel 6 is driven from the 3" Pulley Wheel by an endless belt.

Par	ts	req	ui	red	:	
No.	2	- 1	9	of	No.	37
	3	2	1			30


4	of	No.	2	19	of	No.	. 37A
4	,,	,,	3	1	.,	.,	38
4 4	,,		5	1	**	***	40
4	- 21		10	1			46
1	21	***	11	1		,,	48
1	,,	,,	12	2		,,	48A
1	,,	**	15A	1		**	48в
3			16	1			52
1		.,,	19в	4			59
2	,,	,,	20в	2	,,	.,	52
1	,,	,,	23	2 2			90A
3	,,	,,	35	1			111
7	**	,,	37	1	,,	"	125

### Model No. 3.32 Railway Breakdown Crane

	Parts required:	
	11 " " 2 6 " " 8 1 " " 16 1 " " 23 2 " " 46 2 " " 56 2 " " 17 1 " " 24 3 " " 56 2 " " 17 2 " " 18 1 " " 27 2 2 " " 56 2 " " 56 2 " " 18 2 1 " " 19 2 1 " " 32 1 " " 56 2 " " 56 2 " " 12 2 " " 19 2 6 " " 35 3 " " 56 3 " " 56 2 " " 19 2 6 " " 35 3 " " 56 3 " " 56 2 " " 19 2 6 " " 35 3 " " 56 2 " " 19 2 6 " " 35 3 " " 56 2 " " 19 2 6 " " 35 3 " " 56 2 " " 19 2 6 " " 35 3 " " 56 2 " " 19 2 6 " " 35 3 " " 56 2 " " 19 2 6 " " 35 3 " " 56 2 " " 19 2 6 " " 35 3 " " 56 2 " " 19 2 6 " " 19	7
	8   1 , , , 15   1 , , , 19s   84 , , , 37   4 , , , 90   4 , , , 20s   6 , , , 37a   1 , , , 111   1 , , , 112   8 , , , 38   6 , , , 111   4 , , , 22   1 , , , 40   1 , , , 116   1 ,	l c 5 5 5 6
3	2 , 126 1 , 147	
	The pivotal arm 1 consists of a 5" Rod, to the ends of which are secured a small and a large Fork Piece, the latter being	
No. 37A  38  40  46  48  48A  48B  52  52	pivoted to the Double Bracket 2 by means of a § Bolt.  The hoisting cord controlling the Hook 3 passes under a 3½ Rod 4 and is wound on a Crank Handle 5. The cord 6, which raises the jib, is operated by a second Crank Handle 7. It passes over the 1" loose Pulley Wheel 8, round the ½" loose Pulley 9 (which is mounted on a Pivot Bolt) and is then led back again and tied to a Flat Bracket on the 1½" Rod that carries the Pulley 8. Each Crank Handle 5, 7 is provided with a permanent band-and-pulley brake to prevent the jib or the load on the Hook 3 from falling when the handles are red-pale 7. The method of rotating the crane about its pivot is as follows:  The hand wheel consisting of a Bush Wheel fitted with a Threaded Pin is fastened to a 3½" Rod journalled in two 1" × 1" Angle Brackets which are bolted to the 2½" × 3½" Flanged Plate. This Rod carries a Worm Wheel that meshes with a 57-teeth Gear Wheel fastened to a 2" Rod. The support for this Rod is formed by a Double Bent Strip. Connection between this Rod and the body of the crane is made by means of a 1" Pulley Wheel, a3" Pulley Wheel fastened to the barg of	
" 52 " 90a " 111 " 125	the crane, and a crossed belt joining these two wheels. On rotation of the hand wheel the jib of the crane is, therefore, slowly rotated.  The 3" Pulley to which the swivelling portion of the crane is attached, slides on the rim of a second 3" Pulley secured to the base of the model by means of \$\frac{3}{8}\ Bolts. These Bolts have Washers on their shanks to prevent damage to the rim of the Pulley.	

on their shanks to prevent damage to the rim of the Pulley.

### Model No. 3.33 Fire Escape

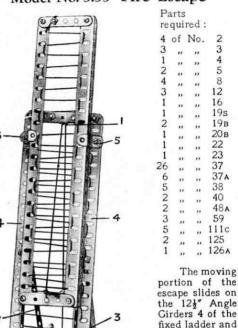


portion of the escape slides on the 12½" Angle Girders 4 of the fixed ladder and is guided by two 1" Reversed Ängle Brackets 5. The cord for extending the ladder passes over the ½" loose Pulley 1 and is wound on the

Crank Handle 2. The Pulley 1 revolves freely on a 3" Bolt that is secured by two Nuts to an Angle Bracket bolted to the 31" Strip.

A 3" Strip, weighted with a 3" Flanged Wheel 6 to form a brake lever, is pivoted by a 3" Bolt to the 5½" Strip 7, and a piece of cord is passed round the 1" Pulley 3 on the hoisting shaft, and tied to the Strip. The pressure of the weighted lever is sufficient to keep the ladder raised in any position.


### Model No. 3.34 Auto Swing Boat

The connecting Strip 1 is attached pivotally at one end to a Threaded Pin secured to the Bush Wheel 2 on the driving spindle of the motor, and at the other end by means of Bolt and Lock-Nuts to a Crank 3 mounted on the shaft 4, which operates the swing boat.

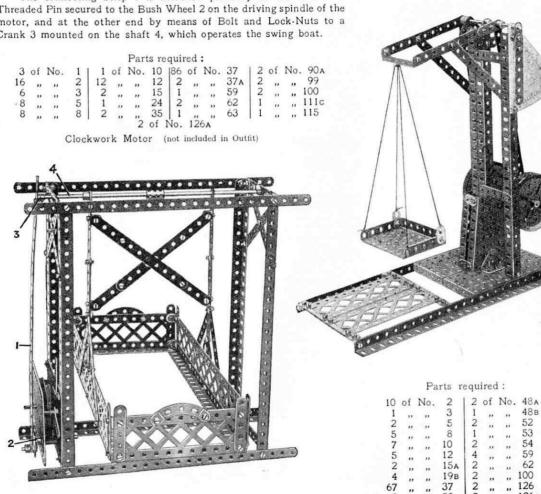


Model No. 3.35 Scales

### Model No. 3.36 Car Lifting Apparatus

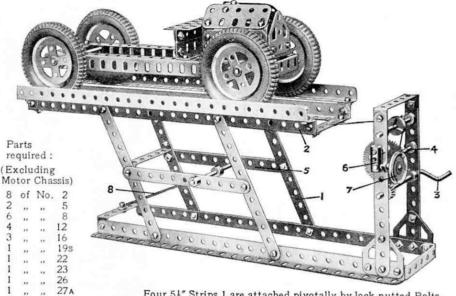

Four  $5\frac{1}{2}$ " Strips 1 are attached pivotally by lock-nutted Bolts to the  $12\frac{1}{2}$ " Angle Girders, which form the base of the model, and to the carrier 2, which receives the car. The Crank Handle 3 carries a  $\frac{1}{2}$ " Pinion meshing with a 57-teeth Gear on the Rod 4, which forms a drum for a length of cord attached to the carrier. The Rod runs freely in the transverse hole of a Coupling 6 that is secured to the upright Strip by a  $\frac{3}{8}$ " Bolt. A Threaded Pin carries the 1" Pulley 7 and its shank is inserted in the tapped hole of the Coupling, so that when the Pulley is rotated clockwise the Pin nips the Rod. The carrier 2 is returned to its original position by a length of elastic or Spring Cord 8.

### Model No. 3.37 Pastry Designer

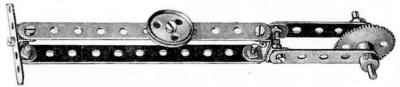



115

., 126A


P	arts		
re	qui	red:	
2	of	No.	2
3	,,	.,,	5
3	27	22	11
1	,,	**	17
1	,,	,,	22A
1	**	,,	27A
9			37

### Model No. 3.38 Two-Cylinder Vertical Steam Engine

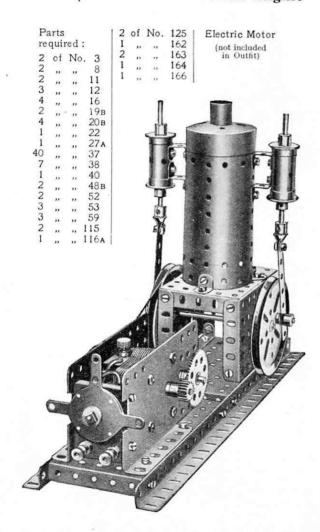

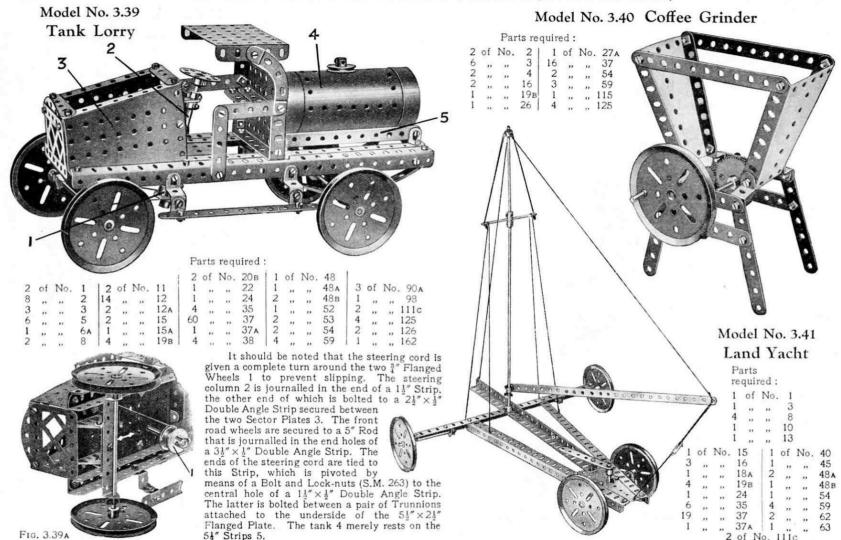


### Model No. 3.42 Roundabout

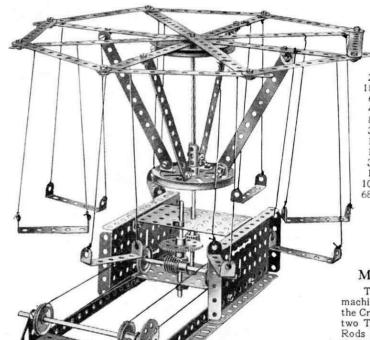

### Model No. 3.43 Swing Boat

Parts required:

2	of	No.	1	1 5	of	No.	37A
18	,,	,,	2	8	,,		38
6	,,	,,	3	1	,,	,,	45
8 3	,,	"	5	3	**	,,	48A
8	,,,		8	1	,,	,,	52
	,,	68	12	4			59
1	.,	**	15	2	,,	**	62
1	,,	,,	15A	1	,,	,,	63
3	,,	"	16	1	,,	,,	98
1	,,	2)	22	2	.,	,,	99
10	,,	**	35	2	,,	,,	100
68	**	,,	37	4	,,		111c

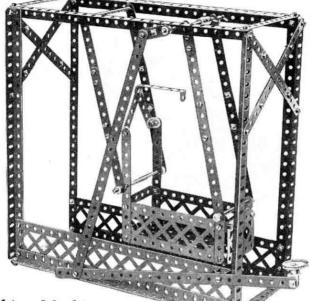


### Model No. 3.44 Flex Making Machine


The two wires to be twisted are fixed at one end of the machine to a Hook 1 which is attached by an End Bearing to the Crank Handle. At the other end the wires are looped over two Threaded Pins fixed by Collars to the spring controlled Rods 2. The  $3\frac{1}{2}'' \times 2\frac{1}{2}''$  Flanged Plate 3 carrying a  $3\frac{1}{2}''$  Rod is free to slide in the built-up channel girders, and as the Crank Handle is turned it is pushed ahead of the twisting wires, so keeping the finished flex even. As the wires shorten through twisting, the Rods 2 slide longitudinally, extending the Spring.

Parts	required:

					dani	·u.		
	3	of	No.	5	2	of	No.	35
	1	"		6A	32	,,	,,	37
	4	,,	"	8	2	,,	**	38
	4	**	**	12	1	- 22	200	40
	2	25		15A	1	**		43
	1	29		16	1		.,	45
	1	**	10	19s	2 3	**	**	48A
					2	22	235	52
	1	1	1	3	3	,,	**	53
	133	2		To lo	1	,,	"	57
_	飅	-			3	,,	**	59
	19	-	-		2	,,	23	115
	100				1	20	200	166

	arts	red:					9/	36	of	No.	37 40
4	of	No.	1	12	of	No	19в	8	2.5	32	48A
2	,,		2	4			22	2	,,	**)	52 52
2	"	"			**	**	11/2/17/00	-	**	**	
2	,,	**	8	1	,,	2.2	24	3	**	**	53
8	,,	,,	12	2	,,		26	2		.,	59
1	**	**	15	1		.,	27A	1	,,		63
3	,,	**	15A	1	,,	**	32	1	**		115
1	,,	,,	16	2	,,	21	35	2	,,	,,	126A

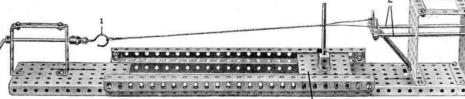

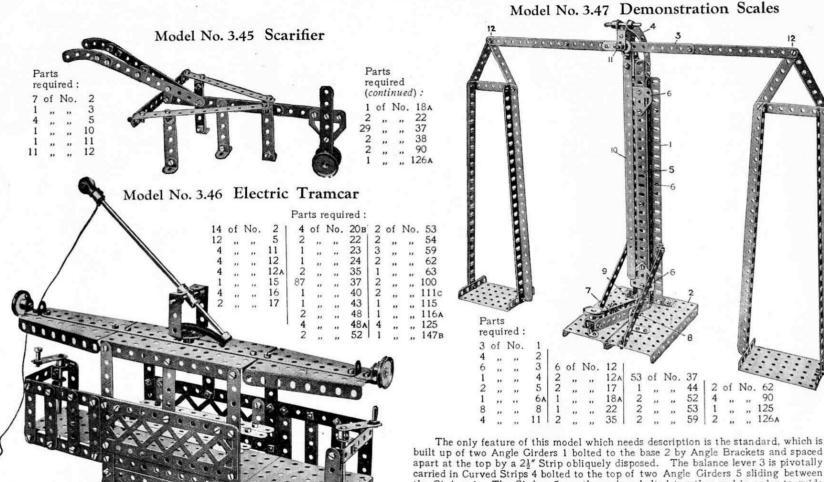

The only feature of this model which needs description is the standard, which is built up of two Angle Girders 1 bolted to the base 2 by Angle Brackets and spaced apart at the top by a 2½" Strip obliquely disposed. The balance lever 3 is pivotally carried in Curved Strips 4 bolted to the top of two Angle Girders 5 sliding between the Girders 1. The Girders 5 are themselves bolted together and in order to guide them as they slide vertically two Flat Trunnions 6 and two 1½" Strips are bolted at the front and rear. The balance is raised by depressing the lever 7 pivoted at 8 and pivotally connected at 11 to the vertically sliding Girders 5. The indicator 10 is bolted to a Crank at the rear, the boss of which is fitted on the pivot Rod 11. The connections at 12 are lock-nutted to allow free action.

### Model No. 3.48 Fire Truck

The front axle is journalled in a  $2\frac{1}{2}$ " Double Angle Strip that is pivoted through its centre hole to a Double Bent Strip secured to the Flanged Plate 15. Steering is effected from the Pulley 13 secured on a  $3\frac{1}{2}$ " Rod that is passed through the  $3\frac{1}{2}$ "  $\times 2\frac{1}{2}$ " Flanged Plate 16, and held in position by Collars. On the lower end of the Rod is a Bush Wheel 14, which is connected to the pivoted Double Angle Strip by cords tied to opposite holes in the Bush Wheel and to the ends of the Double Angle Strip.

The lower part of the escape is mounted pivotally on Bolts 10 passed through the upturned ends of a  $2\frac{1}{2}'' \times 1''$  Double Angle Strip that is bolted to a  $3\frac{1}{2}'' \times \frac{1}{2}''$  Double Angle Strip which, in turn, is supported on two vertical  $2\frac{1}{2}'' \times \frac{1}{2}''$  Double Angle Strips. The upper or moving portion of the escape slides between the  $12\frac{1}{2}''$  Angle Girders 9 and is held freely in position by the Nuts of the Bolts 11.

The ladder is extended from the Crank Handle 2 (Fig. 3.48A) that is journalled in a  $2\frac{1}{2}'' \times \frac{1}{2}'''$  Double Angle Strip bolted to a  $5\frac{1}{2}'''$  Strip that, in turn, is bolted across the flanges of the Sector Plates. A Cord 7 is wound on to the Crank Handle and one of its ends is tied to a  $2\frac{1}{2}'''$  Strip that spans the inner end of the  $12\frac{1}{2}''$  Strips forming the sides of the extending ladder.

Its other end 7A is then led towards the outer end of the fixed ladder, round a ½" loose Pulley held on a Bolt in the centre hole of a 2½" Double Angle Strip that spans the outer ends of the 12½"


Girders 9, and finally is tied to the same 2½" Strip to which the end 7 is already attached. Thus by turning the handle 2 the escape is pulled inward or outward.

The Crank Handle I carries a ½" Pinion 3 that engages a 57-teeth Gear 4 secured to a Rod 12. A Cord 8 is wound a few turns round the Rod 12 and is then led to the 2½" Strip 5 where it is secured. By turning the Crank Handle the Cord is wound in, thus raising the pivoted escape.

On turning the handle in the opposite direction.

the escape is lowered by its own weight.

Parts required:

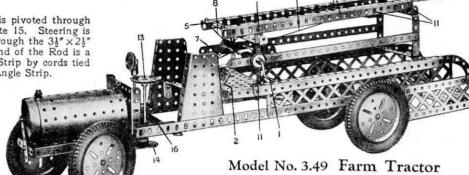

The seat (a  $1\frac{1}{2}$ " Pulley) is secured on a Threaded Pin and attached to a pair of  $2\frac{1}{2}$ " Curved Strips. The latter are secured to two  $5\frac{1}{2}$ " Strips fixed in the bottom row of holes of the motor plates. A  $2\frac{1}{2}$ " Strip is pivoted to the Motor reversing lever by means of a Reversed Angle Bracket, and is supported by a  $1\frac{1}{2}$ " Strip which is attached pivotally to the Motor.

rd.					Parts	require	d.				
ges ind 2½″ dle	2 5 1 2	of N	0. 2 , 5 , 6A , 10	4 of 5 " 1 " 2 "	No. 11 , 12 , 15 , 16		of No.	19B 20A 21 22	1 " 28 " 7 " 5 "		32 37 37 38
pe. on,			0 10 0	0		1 2		24	1 " 4 " 2 " 1 " 1 " 1 " 1 " 1 " 1 " 1 " 1 " 1	" 6 " 6 " 11 " 11	484 59 33 904 11 11c 15 25
	1000	1		•	• (0)	00000	000000		Clo	ckworl Iotor includ Outfit	k
	100	0	<i></i>		00	0000			8	)	



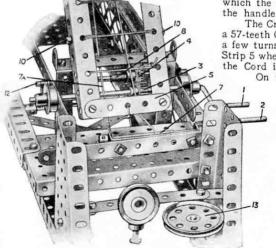


FIG. 3.48A

### Model No. 3.50 Pile Driver

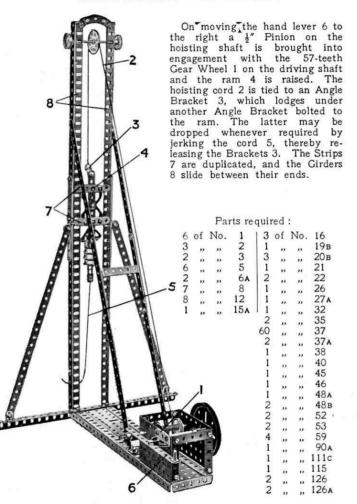


### Model No. 3.51 Railway Wagon Swivel Crane

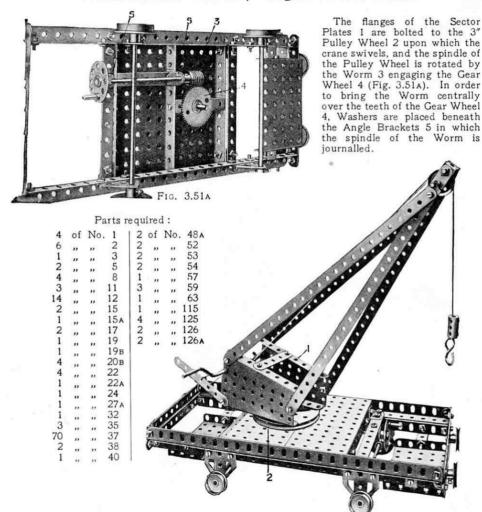


### Model No. 3.52 Hand Punch

Pa	rts	re	quii	red	:
No	2	1	21	of	1


4	of	No.	2	21	of	No.	37
1	,,	,,	5	3	,,	,,	37A
2	,,	,,	61.	1	.,	,,	43
4	,,	,,	11	1	,,,		59
4	,,	"	12	1	**	,,	62
1	,,	,,	18A	2	,,	,,	90
		1	of N	0. 1	110	:	

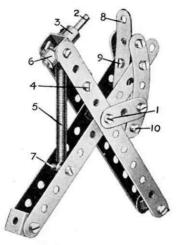

Two pairs of  $5\frac{1}{2}$ " Strips are connected loosely towards their centres by means of Nuts and Bolts 1. The punch 2 consists of a  $1\frac{1}{2}$ " Rod secured in the boss of a Crank 3, which is bolted to a Double Bracket secured at 4. A Spring 5 serves to open the handles after the punch has been used; it is placed on the Rod 2 and held in position by means of a Collar 6, while its other end is attached to a  $\frac{3}{8}$ " Bolt 7 passed through one pair of  $5\frac{1}{2}$ " Strips. After passing through the paper the punch enters the end hole of a 3" Strip 8. The latter is bolted at 9 to a Double Bracket, while its other end passes beneath a similar bracket at 10.

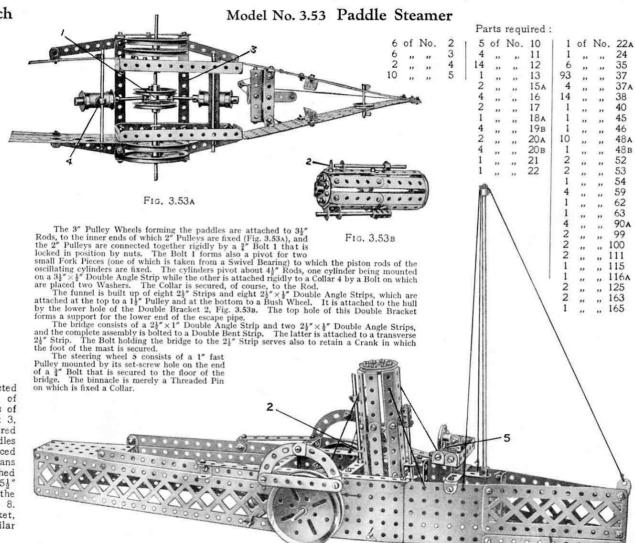

### Model No. 3.54 Kinetograph

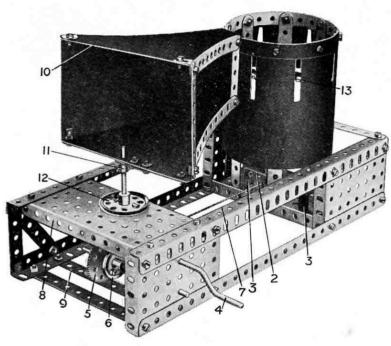

Parts required:

1	of	No.	1	1	of	No.	15A	12	of	No.	38	
17	,,	,,	2	2	,,	,,	16	1	,,	,,	40	
6	,,	,,	3	1	,,	,,	19s	1	**	,,	45	ÎΙ
1	••	,,	4	1	.,,	,,	21	1	,,	,,	46	
3		,,	5	2	,,	,,	22	1	,,	,,	48A	12
4		,,	8	1	,,	,,	24	2	,,	,,	52	12
4 2 12		,,	11	1	.,	**	26	3	,,	,,	53	
		,,	12	1	,,	,,,	27A	4	**	**	59	
2	11	,,	121	60	**	**	37	2	**	,,	62	¥ L

Most Meccano boys probably are aware of the principles of the Kinetograph, but for the benefit of those who have not seen one in action, we may mention that it is a device which imparts an appearance of animation to a series of pictures, each differing slightly from the other and passed in rapid succession before the eyes. In this respect it resembles the remarkable principle upon which the modern cinematograph is based.

In constructing the Meccano model the following details will prove useful:—The drum consists of a 12½° Strip bent to form a circle, with its ends overlapping one hole, and bolted to eight vertical 5½° Strips forming the sides. Two pairs of opposite 5½° Strips are connected by 3½° Strips and Angle Brackets bolted in the third holes from their lower ends. The 3½° Strips cross at right angles to one another and are bolted in the centre to a Bush Wheel, in the boss of which is secured a short Rod forming the pivot of the revolving drum. This Rod is journalled in a Double Bent Strip bolted to a 2½°×1° Double Angle Strip 2. This, in turn, is secured to the base of the model by two 1°×1° Angle Brackets 3. A further bearing for the short Rod consists of a Crank bolted to the base of the model.

The drum is rotated from the Crank Handle 4, on which is mounted a ½ Pinion engaging a 57-teeth Gear Wheel 5 secured to a 3½ Rod carrying a Pulley Wheel 6. The latter is connected by means of a cord 7 to a similar wheel nipped to the vertical spindle of the drum. Bearings are provided for the inner ends of the Crank Handle and 3½ Rod by a Double Angle Strip bolted between the Plate 8 and 5½ Strip 9. The sighting box 10 is built up from a framework of Strips and is secured by means of a Crank 11 to a short vertical Rod rigidly mounted in the boss of the 1½ Pulley 12. The four sides of the framework 10 are covered with some black material; stiff black paper suitable for this purpose may be obtained from any stationers. The drum is enclosed in the same way, but the covering paper should be cut in a strip measuring 12½ ×4½ and pierced with slots spaced 1½ apart (from centre to centre) so that they fall exactly between the upright 5½ Strips. The slots should measure 1½ ×½ The slots should measure 1½ ×½ The slots should measure

The type of drawing suitable for use in this model is shown in Fig. 3.54a, and the dimensions indicated therein should be followed carefully. No doubt Meccano boys will be able to devise numerous amusing pictures of a similar kind for themselves. The strip of stout white paper carrying the sketches is inserted in the bottom of the drum, as indicated at 13. The model is now ready for operation. Placing the frame 10 over the eyes, the line of vision is directed through the narrow end, where the Strips are held apart by means of Double Brackets, and through the slots in the drum. The latter should be rotated rapidly by operating the handle 4, and as it revolves, the little dog shown in Fig. 3.54a will be seen jumping over the fence with a most realistic and amusing action.



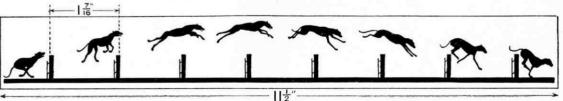



Fig. 3.54A

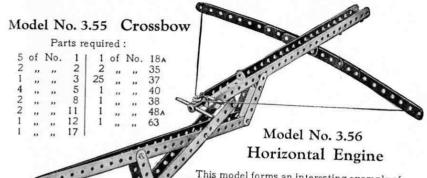


This model forms an interesting example of the use of the Meccano Boiler, Sleeve Piece and other new parts. The  $2\frac{1}{2}$ " Strip 1, forming the connecting rod, is attached to the  $1\frac{1}{2}$ " Pulley Wheel by means of a Threaded Pin. The latter is fastened in one hole of the  $1\frac{1}{2}$ " Pulley Wheel, and two Washers are placed upon it between the Strip 1 and the wheel. The connecting rod is held in place by a Collar locked to the end of the Threaded Pin. The Boiler is attached to the framework by means of two  $2\frac{1}{2}$ "  $\times \frac{1}{2}$ " Double Angle Strips attached by their centre holes to the side of the Boiler opposite the chimney. When the Boiler is placed in the position shown, the whole is secured by bolting the Double Angle Strips to the side Flanged Plates.

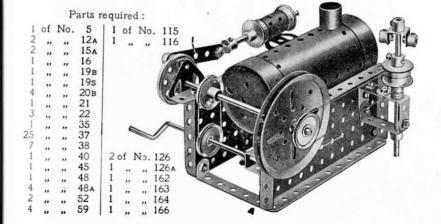

### Model No. 3.57 Tower Wagon

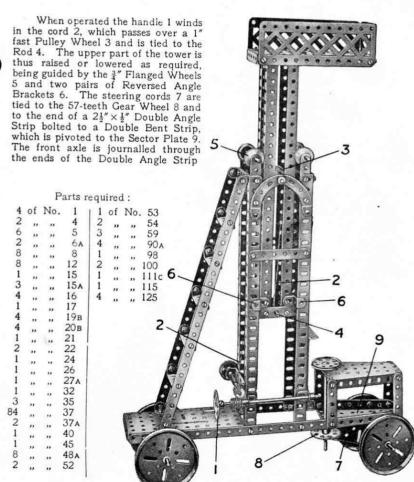

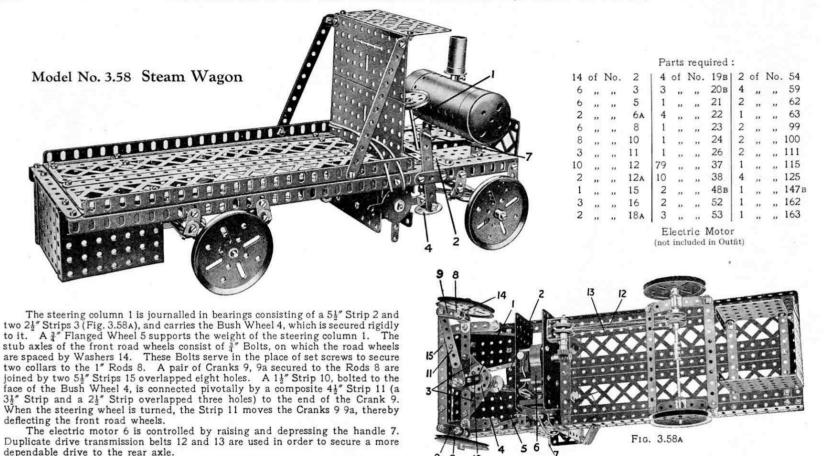

### HOW TO CONTINUE

This completes our examples of models that may be made with MECCANO Outfit No. 3 (or No. 2 and No. 2A). The next models are a little more advanced, requiring extra parts to construct them. The necessary parts are all contained in a No. 3A Accessory Outfit, the price of which may be obtained from any Meccano dealer.

# Model No. 4.1 Periscope




### Parts required:

16 of No.

plates.


# Model No. 4.2 Steam Winch

" N A 1" Pinion secured to the armature of the Electric Motor turns a 11" Contrate Wheel I mounted on an 8" Axle Rod, to the opposite end of which is secured a Worm Wheel 2. The drum 4 of the winch consists of two 3" Flanged Wheels and is secured to the end of a 31" Rod, which carries a 1" Pinion that is driven by the Worm 2. The cylinder is composed of a Sleeve Piece, secured by two Nuts and Bolts to the end of a 21/2" Flat Girder 5, and two 3" Flanged Wheels. The piston rod is attached pivotally to the connecting rod by means of an End Bearing 3, and the crank pin 6 is formed by a Threaded Pin secured to the Bush Wheel. The Boiler is secured in place by two Angle Brackets bolted to its base and to the 51" × 21" Flanged Plates forming part of the engine bed. It will be noted that the 1"x1" Angle Bracket supporting one end of the 8" Rod is spaced away from the Motor by a Flat Bracket, in order to obtain proper clearance for the Contrate Wheel 1.

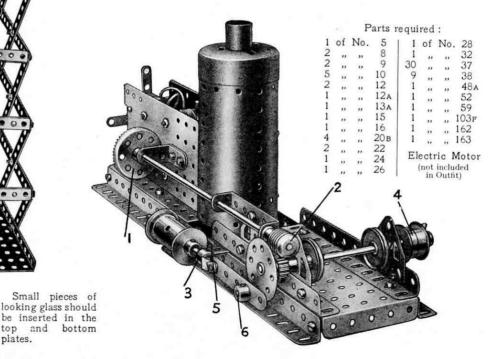

Model No. 4.3


# Band Saw

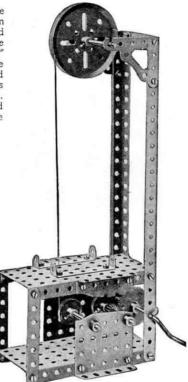

Parts required:

,,		5				27A
		0	4	,,	,,	35
**	,,	8	26	,,	,,	37
,,	,,	16	1	,,	**	40
,,	,,	19	2	**	,,	48A
,,	,,	19в	2	,,	,,	52
,,	,,,	22	2	,,	,,	53
,,	11		4	"	,,	59
	" " "		" " 19 " " 198 " " 22 " " 26	", ", 19 2 ", ", 19B 2 ", ", 22 2 ", ", 26 4	", ", 19 2 ", ", 19B 2 ", ", 22 2 ", ", 26 4 ",	" " 19 2 " " " " " " " " " " " " " " " " " "


# Model No. 4.4 Elliptical Lathe

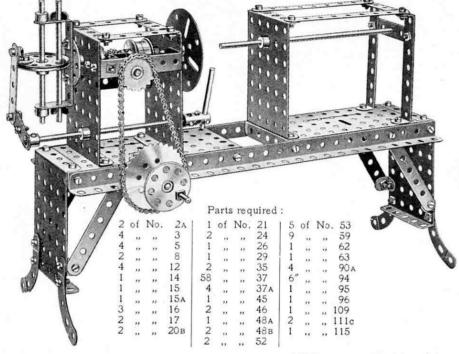


# Model No. 4.6 Swing Saw

	rts		ž					1	3			
rec	qui	red: No	1 2 5 8 9 14 16 17 22 26 27 A 35 37 48 48 A 5 53 59 63 99 6126 126 A		5	1					7	
			159 Motor ded	V		·	Ŋ.		A	1 700		8

# Model No. 4.5 Distance Indicator

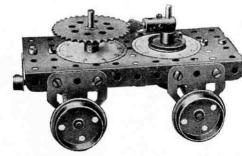



1	of	No.	4	16	of	No.	37
4	,,	**	10	1	21	,,	37
42122421	,,	**	12	3	**	,,	38
1	,,	,,	15	1	,,	,,	52
2	,,	.,	16	3		,,	59
2	**	**	17	2		**	62
4	**	**	20в	1	,,	,,	63
2	,,	,,	26	1	. ,,	,,	65
1	,,	,,	28	1	,,	,,	95
1	,,	,,	32	1	,,	,,	96

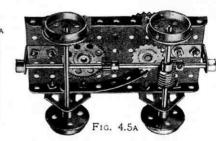


(Model No. 4.6)

A ½" Pinion secured to the armature spindle of the Electric Motor engages with a 57-teeth Gear Wheel 1, the shaft of which carries two 1" Pulleys that transmit the drive by belts to the operating Rod 3. Two driving belts 6 and 7 are used side by side to obtain a more positive grip. The framework 4, carrying the Circular Saw 5, is free to swing about the Rod 3.

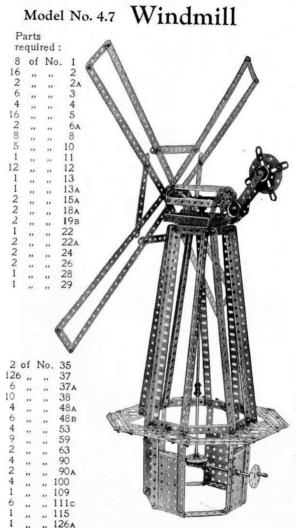

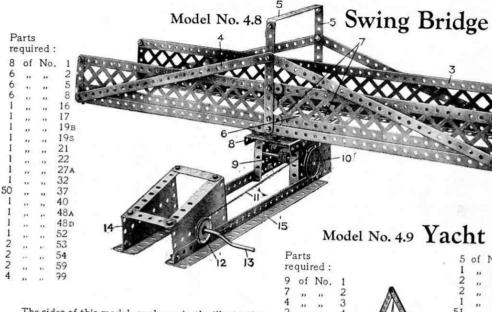


The sides of this model, as shown in the illustration, are made of the Braced Girders 1 secured to the upright Strips 2 and reinforced by the inner Strips 3. Other diagonal Strips 4 brace the side Girders to the top structure 5 forming a stay for the sides 1. The swing base of the bridge is composed of a 3" Pulley Wheel 6 which is bolted to two cross 5½" Strips 7 which in turn are secured to the main base side Girders. The bridge swings on the Perforated Plate 8 on a short Rod, on the lower end of which is secured a Gear Wheel engaged and driven by a Worm 9 on the spindle of which is the grooved Pulley 10 driven by the Cord 11 which is operated from the smaller grooved Pulley 12 on the Crank Handle 13. The Crank Handle is journalled in two Sector Plates 14 secured to the base Angle Girder 15.

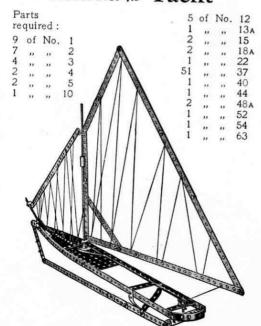


# Model No. 4.10 Inclined Delivery Chute

The cage 1 is raised from the hand wheel 2 by means of an endless Cord 3 which passes over the upper  $1\frac{1}{2}$ " Pulley 4. A Cord 5 winding on Rod 6 between two 1" fast Pulleys raises or lowers the cage. The truck 7 is raised or lowered along the inclined rails 8 by a Crank Handle 9, a Cord 10 being wound on the Rod 11, passing over a Pulley 12, and connected to the truck 7. When the truck reaches the end of the inclined rails 8 it rests upon two  $5\frac{1}{2}$ " Strips 13 pivoted at 14, the weight of the truck depressing these pivoted Strips and tipping the load.

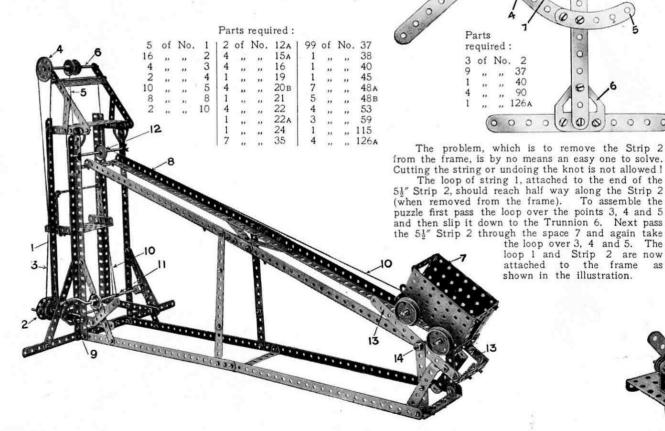


# Model No. 4.11 Puzzle


# Model No. 4.12 Three-arm Signal

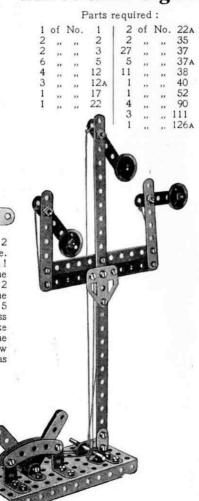

# Model No. 4.13 Breast Drill

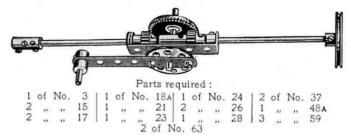

# Model No. 4.14 Trotting Car

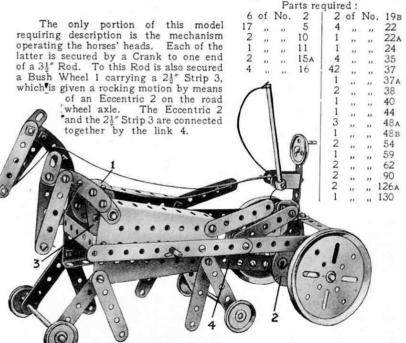

# Model No. 4.15 Warehouse

The Cord 1 that raises and lowers the elevator passes from the top of the car 11 over the 1" loose Pulley Wheel 4 and the 11" Pulley 5, and is wound between two 1" fast Pulley Wheels on a 3" Axle Rod 2, which is driven from the Electric Motor via a Worm Wheel. a 57-toothed Gear Wheel, a 3" Contrate Wheel, and a 1" Pinion. The elevator car is counterbalanced by a weight 9= 3, consisting of a Fork Piece, fourteen 21" Strips, and a Collar, which is connected to the car by a Cord 10 passing over a 1" fast Pulley Wheel (behind the Wheel 5) and the 1/8" loose Pulley Wheel 6.


The elevator car is guided by a pair of vertical Cords 7, which pass through holes in the  $2\frac{1}{2}'' \times \frac{1}{2}''$  Double Angle Strips 8 as shown, and the weight 3 is similarly guided by the cords 9.

### Parts required:

		Pa	arts re	qui	red	:		
6	of	No.		1 5	of	No	. 48A	
19	,,		2 5	1	,,	,,	48p	
18	,,		5	1 2	"		52	
2	,,	,,,	6A	1	,,,		53	
6	,,	,,	8	6	,,	,,	59	
4	,,	,,	9	6 2 2	,,	,,	90 A	
4	,,		10	2	,,	,,	99	
16	,,		12	6	"		100	
1	**		14	6 2 2	,,	,,	108	
1 2 2 1 3 2	**		16	2	,,	,,	111	
2	**	**	17	4	,,,	,,	111c	
1	**	,,	21	1 2	,,		116	
3	,,	"	22	2	,,	- 71	126A	
2	**	,,	23	1	,,		160	
1	11	**	26	F		ric	Motor	
1		,,,	27A				ided in	
1	,,		29			Outi		
1	.,,	,,	32					
2	,,,	,,	35				17.00	-
126	,,,	,,	37				THE REAL PROPERTY.	用
6	,,,	**	37A				DICE	腱
1	,,	"	38				Jestin	ů.
1	,,	,,	40				F. S.	H
1		-50	46				Caro	O

Parts


required:

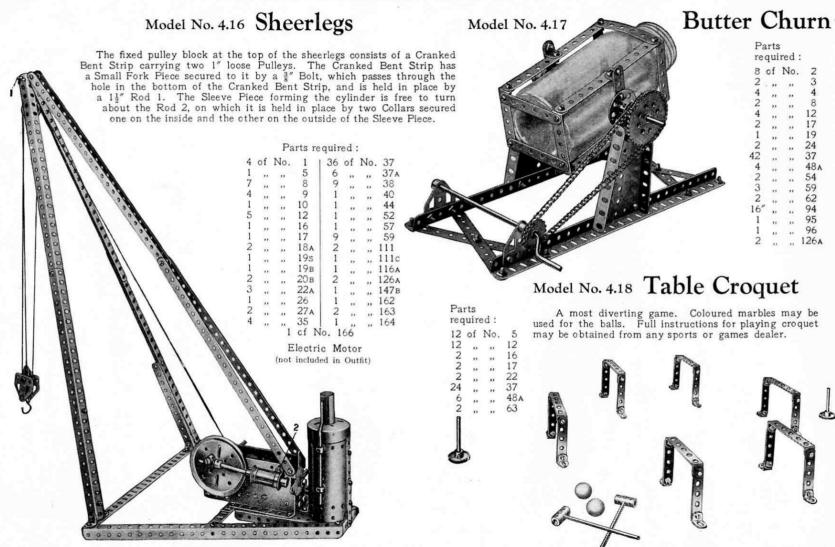

# Model No. 4.19 Speed Indicator

A Crank fitted with a Threaded Pin to form a handle is secured on a  $3\frac{1}{2}''$  Rod carrying a 57-teeth Gear that meshes with a  $\frac{1}{2}''$  Pinion 1 on a  $1\frac{1}{2}''$  Rod. The latter Rod carries a Contrate Wheel and is journalled in one of the holes of a  $5\frac{1}{2}''$  Strip and a Double Bent Strip 2. A Pinion on the vertical 8'' Rod which carries the governor is in engagement with the Contrate.

The  $2\frac{1}{2}$ " Strips forming the governor arms are lock-nutted to Angle Brackets which in turn are secured rigidly to Bush Wheels. The upper Bush Wheel is secured to the Rod, while the lower wheel 3, which is free on the Rod, is connected to a  $1\frac{1}{2}$ " Pulley 4 by  $\frac{3}{8}$ " Bolts, but spaced therefrom by Nuts on the shanks of the Bolts. The  $\frac{3}{4}$ " Bolt 5 is passed through the end tapped hole of the Coupling and locked in position by a Nut so that its shank protrudes into the space between the Bush Wheel and Pulley. As the weights of the governor fly outward under centrifugal force the Bush Wheel and Pulley unit 3 rises, carrying with it the Bolt 5 and its Coupling and so actuating the pointer (a 2" Rod 7). The extent of the movement of the latter over the graduated scale indicates the speed at which the vertical shaft rotates. A Spring secured to the  $5\frac{1}{2}$ "  $\times 2\frac{1}{2}$ " Flanged Plate is fixed by the Bolt 6 in such a manner that the pointer tends to return to its original position as the motion decreases.

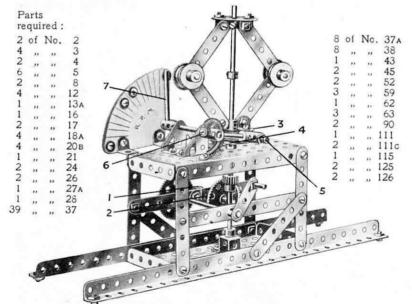



# Model No. 4.20 Conductor's Punch

This is just the thing for your younger brother! He only needs a strap with which to hang it over his shoulder to make him into a conductor. The


Parts required:
3 of No. 5
1 ,, 11
1 ,, 15a
1 ,, 22
9 ,, 37
2 ,, 38
1 ,, 43

2½" Strip at the bottom is spaced by two Washers away from the body of the punch to allow the ticket to pass in to be punched. The punch Rod is passed completely through the Spring. The lower end of the latter presses against the Double Bracket and the upper end against a Collar secured to the Rod.

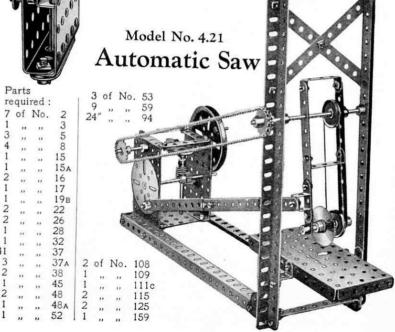


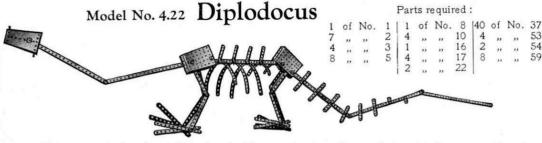

This representation of a prehistoric animal is a most extraordinary effort sent in by a young French boy to compete in one of the big Meccano Model-building Competitions. We could scarcely class it as an engineering model, but any boy with a brain clever enough and an imagination lively enough to conceive and construct such an animal as this from Meccano parts deserved a good prize, so we awarded him one. Screw the Nuts and Bolts up tightly because the Diplodocus looks most dejected when he droops.

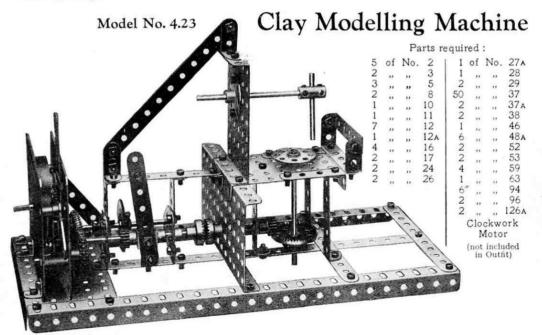

# Model No. 4.24 Bale Press

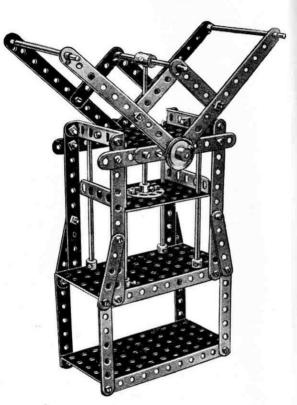


### Parts required :

				Pa	rts	requ	ired:				
10	of	No.	2	1	of	No.	24	2	of	No.	52
4	**	"	3	8	,,	,,	35	2	2.2	,,	53
8	,,	**	5	44	**	,,	37	4	**	,,	59
4	**	,,	15	14	,,	,,	37A	1	**	,,,	63
1	,,	**	15A	2	.,,		38	2	**		111
2	,,	**	17	2	**	,,	48A				

### Model No. 4.25

# Weather Vane

		Part	s re	quire	ed:		
7	of	No.	1	54	of	No.	37
11	,,	,,,	5	2	,,	**	38
8	,,	,,	10	2	22	200	52
4	,,	,,	11	1	**	. ,,	54
17	199	,,	12	2	,,	"	59
1		22	14	1	,,		109
1		**	24	1			126A

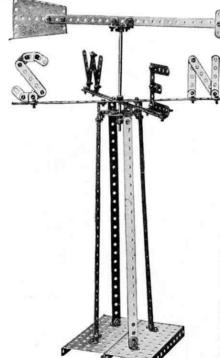

Model No. 4.26 Geometrical Apparatus

This most ingenious model for transforming a circular movement into a rectilinear movement was designed by M. Pierre-Th. Dufour, who used it in his Thesis (presented to the Faculty of Science in Paris) to obtain his degree of Doctor of the University of Paris. He required an instrument which would transform a circular movement into a movement rigorously

rectilinear and he states in his published work that he was able to do this "with the aid of Meccano parts, which permit of making experiments so easily in mechanisms of the most varied types."

The point F is fixed, and is situated at a distance from the fixed point E, equal to AE, the two arms FB and FD being together equal to the four sides of the lozenge ABCD. The trajectory of the point C is then at right angles to EF. It will be found that whilst the point C is moving in a straight line at right angles to EF, the point A is describing a circle round the fixed point E.


Every Meccano Boy should make up this very interesting model and experiment with it.

that ccano easily


tiance arms sides point found 2 of No. 1 | 1 of No. 17 to 1 line 5 , , , 2 | 16 , , , , 37 ling a 2 , , , , 3 | 1 , , , 5 | 7 , , , 59 very 4 , , , 11 | 1 , , , , 62

# Model No. 4.27 Cable Railway

The reversing lever 1 is pivoted near its centre to a Reversed Angle Bracket and at its lower end to a  $2\frac{1}{2}''\times1''$  Double Angle Strip 2. This Strip is kept in place on the Rod 3 by two Collars. The two  $\frac{3}{4}''$  Contrate Wheels are fastened on this Rod in such a position that one or other can be brought into gear with a  $\frac{1}{4}''$  Pinion secured to the Rod 4 by moving the reversing lever. This Rod 4 is journalled in one of the side plates of the gear box and in a  $3\frac{1}{2}''\times\frac{1}{2}''$  Double Angle Strip bolted between Plate 5 and the Strips.

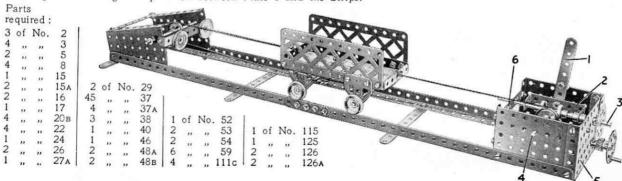


# Model No. 4.28 Motor 'Bus

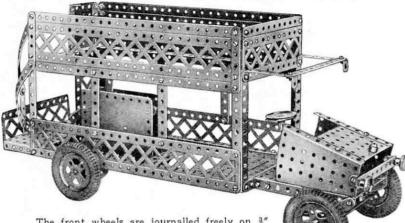

The front wheels are journalled freely on  $\frac{3}{4}''$  Bolts secured in Couplings that pivot on Bolts lock-nutted in the end holes of the front axle (see Fig. 4.28a). The track rod is connected by

Swivel Bearings to the ends of Rods 1 and 2, which are secured in the inner transverse holes of the Couplings. Connection is made, in the manner shown, with a Crank 3 on the bottom end of the steering column, and the Rod 2.

The front springs are represented by a pair of  $2\frac{1}{2}$  small radius Curved Strips, to which the axle is attached by means of  $\frac{1}{2}$  X Angle Brackets, the axle being spaced therefrom by a Collar on each Bolt.

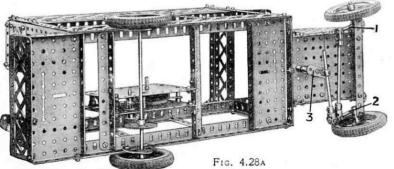


# Parts required: Clockwork Motor (not included

in Outfit)


Model No. 4.29


# **Automatic Gong**

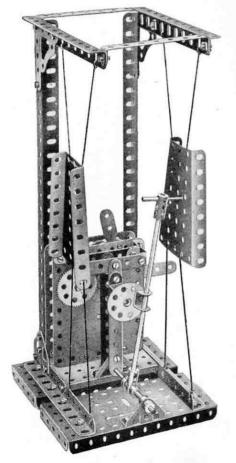

	of	No.	
2	,,	,,	5
2	.,	,,	8
4	**	**	9
3	,,	**	11
1	,,	,,	12
1	,,	**	14
1	,,	,,	16
1	,,	**	17
1	,,	,,	18a
1	,,	,,	24
1	,,	**	26
1	,,	**	27A
15	,,	,,	37
2	,.	**	37A
2	,,	**	38
1	23	,,	40
1	**	**	45
2	,,	**	48в
2	,,	,,	52
1	**	,,	53
2	,,,	,,	54
4	,,	,,	59
2	.,	.,,	63
2	**	**	108
1	**	**	111c
2	,,	,,,	125
2	**	"	126
2	**	**	126A
(		ckw	

# Model No. 4.30 Searchlight

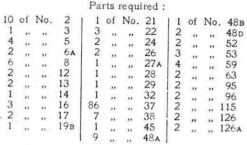

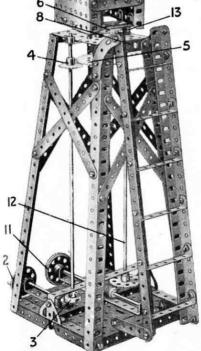

The elevation of the searchlight 1 is controlled by the hand wheel 2, the motion of which is transmitted by means of a 1" Pinion and 3" Contrate Wheel 3 and 1" Sprocket Wheel 4 to a 2" Sprocket Wheel 5. The latter is secured to a vertical Rod that is free to revolve in the boss of a second 2" Sprocket Wheel 6 bolted to two 21" × 1" Double Angle Strips, which, in turn, are secured in the base of the rotating frame 7. This vertical Rod is journalled in a Double Bent Strip that is bolted beneath the Plate 8 to form an additional support, and it carries at its upper end a  $\frac{1}{2}$ " Pinion that engages with the  $1\frac{1}{2}$ " Contrate Wheel 9. The motion of the Contrate 9 is transmitted to the pivotal Rod of the searchlight by means of the Pulleys and belt 10. The searchlight is rotated by the second hand wheel 11, the drive from which is transmitted through Worm gearing to the vertical Rod 12, the upper end of which carries a 1" Sprocket Wheel 13, that engages with the 2" Sprocket Wheel 6.


# Model No. 4.31 Alternating Swing



### Parts required:

3	of	No.	1	8	of	No.	8	3	of	No.	37A	1 4	of	No.	90
8	,,	"	2	- 4	**		12	10	**		48A	4		227	90 A
2	"	**	4	2	"	"	14	2		**	48 D	3	**	**	99
2	**	"	5.	1 2	,,,		24	2	**	· ·	54	1	100	.,	111c
2	,,	**	6A	72	99	**	26	9	"	**	59	1	"	22	115
				112	22	2.0	3/	2	**	**	62				

Clockwork Motor (not included in Outfit)

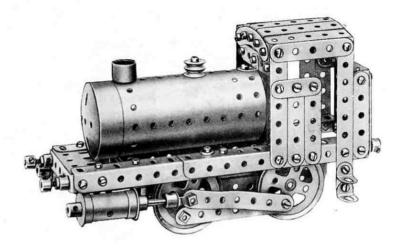

### Model No. 4.32


# 0-4-0 Shunting Locomotive


The superstructure is shown in detail in Fig. 4.32a. Each of the two side members is built up from two  $5\frac{1}{2}''$  Angle Girders overlapping five holes. The cab roof is composed of five  $2\frac{1}{2}'' \times \frac{1}{2}''$  Double Angle Strips bolted to two  $2\frac{1}{2}''$  Curved Strips and is attached to the frame of the cab by Angle Brackets. The front of the cab is composed of three  $2\frac{1}{2}''$  Strips connected together so as to form three sides of a square and bolted to the Boiler by an Angle Bracket. The cylinders 2 are bolted to the side members by means of two Flat Brackets 3 which are bent slightly outward.

Each side of the frame that carries the wheels is composed of two 5½" Strips overlapping seven holes and one 5½" Strip attached by Flat Brackets 4 as shown in Fig. 4.32B.

The coupling Rods 7 are attached to the front pair of Wheels by Bolts and lock-nuts and to the back pair by  $\frac{3}{3}$ " Bolts and lock-nuts. The connecting Rods 8, which are bent slightly as shown, are attached at one end to the Bolts 9 and at the other are connected to End Bearings, which carry the  $1\frac{1}{2}$ " Rods forming the piston rods.

To assemble the model, the Bolts 5 are passed through the centre holes of the  $2\frac{1}{2}$ " Strips 6, and through the Boiler, and are then secured by their Nuts (the Washers shown being used to space the Strips 6 from the  $1\frac{1}{2}$ " Double Angle Strips).

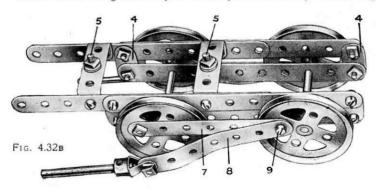


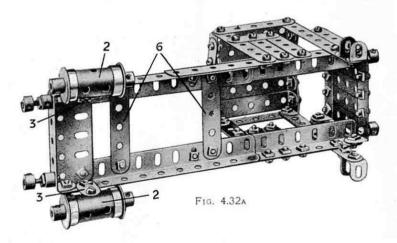

### Parts required:

								of course							
6	of	No.	2	10	of	No.	12	10	of	No.	. 38	1	of	No.	116a
2	,,	**	2A	4	,,	**	17	7	**	,,	48A	1	,,	**	162
6	,,	,,	3	4	,,	,,	20 A	6	,,	,,	59	2	,,	,,	163
18			5	4	,,		20в	2	,,	,,	90	1	,,	,,	164
2	,,,	,,	6A	2	,,	**	23	1	,,	,,	103F				
	,,	,,	9	85	,,	23	37	2	,,	**	111				
6	,,	"	10	15	,,	**	37A	5	,,	**	111c				


# Model No. 4.33 Tipping Motor Wagon

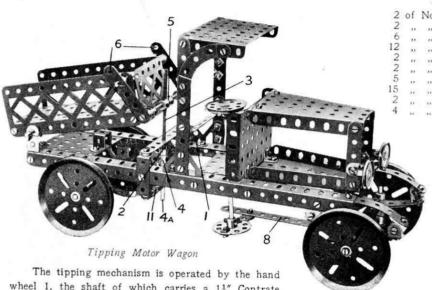


The tipping mechanism is operated by the hand wheel 1, the shaft of which carries a  $1\frac{1}{2}$ " Contrate Wheel that engages with the  $\frac{1}{2}$ " Pinion 2. The  $3\frac{1}{2}$ " Threaded Rod 3, to which the Pinion 2 is secured,

is journalled in one end of a Coupling 4 and passes through the central threaded bore of a second Coupling 5, which is mounted between the ends of two short Rods that are free to turn on Bolts passed through  $2\frac{1}{2}$ " Strips 6. These Strips 6 are attached pivotally to the body of the lorry. The short Rod 4A passes through the  $3\frac{1}{2}$ " Strip 11 and is secured in the lower end of the Coupling 4, the centre transverse hole of which forms a bearing for the Rod of the hand wheel 1.


The steering gear is shown in Fig. 4.33a. The  $2\frac{1}{2}$ " Strip 7 is pivoted to the Strip 8, but is secured rigidly at right-angles to the Crank 9. The Crank 9a is made to move simultaneously with the Crank 9 by means of the tie-rod 10. The front road wheels are mounted on  $\frac{3}{4}$ " Bolts secured in Collars 12.

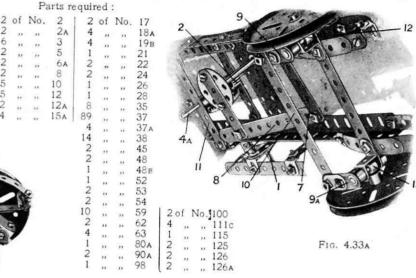

# Model No. 4.34 Sextant and Theodolite

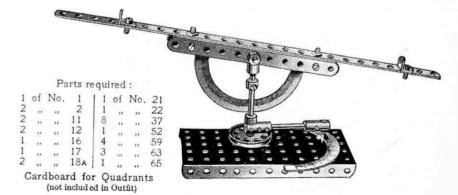


# Model No. 4.35 Potato Chopper

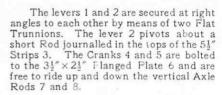


### Parts required:

8	of	No.	2 1	4	of	No.	37A
3	.,	,,	5	4			38
3 2 2 4	.,		6A	1	,,	**	43
2		**	8	4	,,	**	48A
4			9	2		**	48p
10	**	**	12	2		**	52
4			12A	1	**	**	53
2	**	11	14	10		**	59
1		.,	17	2	**	**	62
1	**	.,	18A	2	**	.,	1110
7.3		21	37	2	**	**	126
		2	of N	lo. 1	26	4	
1			-				

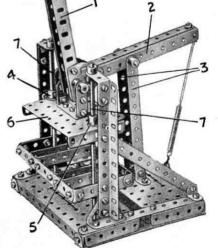

# Model No. 4.36 Mechanical Cross Bow

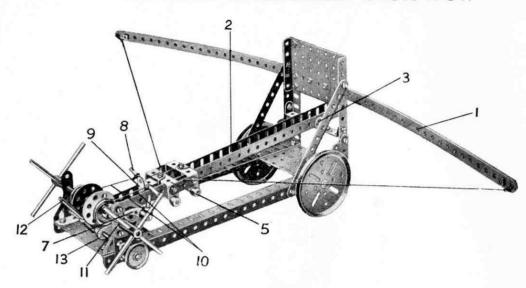

This model represents a large military weapon of the type used before the invention of gunpowder. It is built on the principle of the crossbow. Each side of the bow 1 is composed of three 121" Strips bolted together, the centre being strengthened by three 2½" Strips. The trough 2, which is formed from two 121 Angle Girders, is held loosely between a pair of Angle Brackets 3, and its rear end is secured to a Double Bent Strip bolted to the 34" x 24" Flanged Plate. The carriage 5 is composed of four 1" x 1" Angle Brackets joined by a pair of 11 Strips and guided by two 1 " x 1 Angle Brackets. A Double Bracket is bolted to one of the latter, and carries in its turn a Flat Bracket 9. When the handles are turned in an anti-clockwise direction. the Cords 10 draw the carriage back, and are prevented from unwinding by the Pawl 7 engaging a 1 Pinion Wheel 11. When the lever 12 is depressed, the ends of a pair of 21" Strips bolted to Cranks 13 lift the 2" Rod 8 off the Flat Bracket 9. This releases the carriage, and the projectile (a marble) is shot out of the trough 2 with considerable force.

### Parts required:

6	of	No.	1	53	cf	No.	37
7242114	.,	**	5	2	,,	**	37A
2		,,	6A	5		,,	38
4	,,	**	8	1		**	40
2	**	21	9	1	21	**	45
1	**	**	10	1	**	**	48
1			11	1	,,	**	48B
4	**		12	3			53
4	11		12A	4			59
1	11		15	2			62
3			15A	2 3 2 2			63
4	- 1		16	2	**		108
4			17	2			111
4134424		**	19B	1			115
4			22	2			126
2		**	24	1			126A
1			26	1			147A
		1	of N	0. 1	471	3	


# Model No. 4.37 Stephenson's "Rocket" Locomotive

The chimney is attached at its lower end to two Trunnions 1 that are bolted to the front of the boiler. A 11 "Strip 2 held in place by a 1 "x 1 " Angle Bracket closes in the space between the Trunnions at the bottom, and a 1"x1" Angle Bracket 3 performs a similar function at the top.

The trailing wheels are secured on an axle that is journalled in  $2\frac{1}{4}$ " Strips attached to the bottom extremities of the  $2\frac{1}{4}$ " Strips 4. The rearmost ends of the horizontal Strips are secured by Flat Brackets. The upper ends of the Strips 4 serve as mountings for the cylinders, which are secured rigidly thereon by 3" Bolts, on each of which are four Washers between the cylinder and the Strip.


	Parts required:	
8 of No. 2 4 " " 3 2 " " 4 11 " " 5 1 " " 6A	2 of No. 9	22A 1 of No. 109 37 1 , , , 111 37A 5 , , , 111c 38 1 , , , 116A 40 2 , , , 126 48A 1 , , , 162 52 2 , , , 163 57 1 , , , 164 59 1 , , , 166
n n n n 3		

# Model No. 4.38 Girder Crane

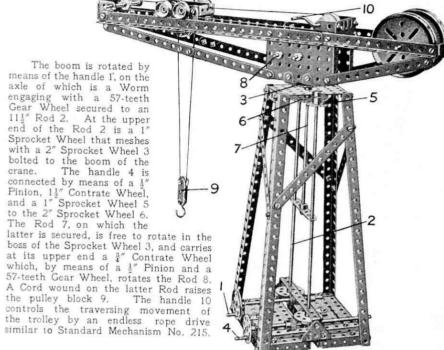

### Parts required:

							21 10 11	-qui	cu						
12	of	No.	2	1 4	of	No.	16	2	of	No.	27A	, 2	of	No.	48p
2	22	**	3	. 3	20	- 22	17	1		- 0	28	2			52
2 2 2	2.5	31	5	4	,,	11	19в	1	11	22	29	3	"		53
	23	-m	6A	1	.,	2)	19s	1	**	71	32	1	"	,,	57
6	**	21	8	4	,,		20в	8	,,,	22	35	9			59
6 2 9 2 2	**	**	9	1	**	.,	21	76		**	37	2		**	90 A
9	**		10	1			22	5		**	37A	2	99	"	95
2	99	100	12A	2		2.5	22A	2	33		38	2	0		96
2	2.5	9.0	13		**	500		1	44		40	2			103F
1	11	11	13a	2	300	900	23	2		**	46	4	**		1115
1	23	2.5	14	2	17	* 1	24	2	7.0	23	48	2	**	77	115
1	1)	11	15A	2	11	**	26	4	11		48A	2	,,	0.00	126

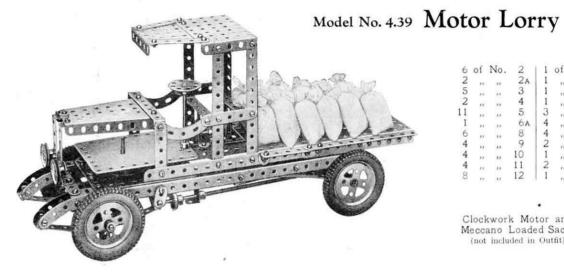


### Parts required:

6	of	No.	2	1	of	No.	13A	1	cf	No.	29	16	of	No.	63
2	**	**	2A	1	,,	**	15	95		**	37	4	,,	,,	90
5	,,,	.,	3	1	,,	,,	15A	14	.,	**	37A	2	,,	,,	90 A
2	**	,,	4	1	,,	**	16	15			38	2	**	**	111
11	**	**	5	3	,,	,,	17	1	112	21	48	6	,,	,,	111c
1	**		6A	4	**	,,,	18A	2	,,,	27	48A	1	**	**	115
6	**		8	4		.,	20 A	3	.,	**	48в	1	,,	,,	116A
4	,,	,,	9	2	**	.,,	22	5		,,,	53	1	**		125
4	,,		10	1	,,		24	1	,,		54	4	**	"	142A
4	**	,,,	11	2			26	10	22	333	59	1	.,	**	147B
8	**	**	12	1			28	1	.,	**	62	2			165


Clockwork Motor and Meccano Loaded Sacks (not included in Outfit)


The front wheels are mounted on 3" Bolts, which form the stub axles and are secured in Couplings 1 (Fig. 4.39A). Each of the latter carries in its centre transverse hole a 11 Rod 2, which is passed through the end holes of two 41 ref. Strips laid one upon the other, and loosely clamped in place by Collars. The end transverse holes of the Couplings hold the Rods 3 and 4 which are connected pivotally together at their ends by Swivel Bearings and two short Rods joined by a Coupling. A 2" Rod 5 is held in another Coupling on the Rod 4 and is connected by means of a Swivel Bearing and 31 Rod to a Crank on the lower end of the steering column. A Pivot Bolt is passed through the end transverse hole of the Coupling on the 31 Rod and is secured to the Crank by two Nuts.

The bonnet is attached pivotally to the body by Bolts 6 and lock-nuts so that it may be raised to allow the winding key of the Motor to be inserted. The shanks of the Bolts 10 enter the top holes of the 21 Double Angle Strips in the front of the chassis, but they are not secured to the Strips.

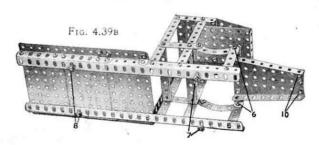

The complete body shown in Fig. 4.39B can be detached from the chassis (Fig. 4.39A) by undoing the &" Bolts 7 and 8, which are passed through holes in the Angle Girders of the chassis and spaced therefrom by Washers. The Bolts 7 are inserted in the hole marked 9 (Fig. 4.39A) and the corresponding hole in the other side Girder, whilst Bolts 8 are passed through the end holes but one of the two side Girders.

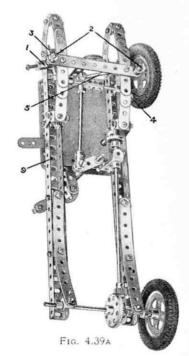

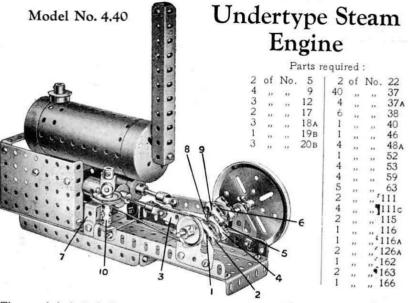


The crankshaft is built up of four Couplings joined together by \$\frac{3}{4}"\$ Bolts. A \$\frac{3}{4}"\$ Bolt 1 is passed through the centre threaded hole of the Coupling 2 and screwed up as tightly as possible. The connecting Rod 3 is now slipped on and spaced by two Washers, one on each side of the Strip, after which the Coupling 4 is screwed on to the Bolt 1 so that the connecting Rod revolves easily in the intervening space. A \$\frac{3}{4}"\$ Bolt 5 is next screwed into the Coupling 4 until it strikes the end of Bolt 1. The second crank is assembled in the same way—that is, a \$\frac{3}{4}"\$ Bolt is passed through the centre threaded holes of two Couplings—but two Washers are placed at 6 and a \$\frac{3}{4}"\$ Bolt is inserted in the Coupling 9 in the same way as the Bolt 5 in Coupling 4. A \$\frac{3}{4}"\$ Bolt is now passed through the inner transverse hole of Coupling 9 and through the corresponding hole in Coupling 4, and is gripped securely by the set-screws of both Couplings. The whole crankshaft is held rigid by the \$\frac{3}{4}"\$ Bolts, for the head of Bolt 5 engages with the hole in the end of Coupling 9 whilst the head of Bolt 8 engages the end of Coupling 4.


Two 2" Rods are used for the ends of the crankshaft, one carrying a 3" Pulley to represent a flywheel and the other a 1" Pulley round which a length of cord is passed which takes the drive to a 1" Pulley on the centrifugal governor. The latter is built up from a Large Fork Piece with Collars attached by means of \$\frac{3}{6}\text{" Bolts, to represent the governor weights. The Fork Piece and 1" Pulley are attached to a \$1\frac{1}{2}\text{" Rod that turns in the top of the Coupling 9, which is secured on a Threaded Pin and attached to the base by an Angle Bracket.

The cylinders are composed of two Sleeve Pieces, each fitted with one \$\frac{3}{4}"\$ Flanged Wheel, and are bolted to a  $2\frac{1}{2}" \times 1"$  Double Angle Strip 7.

# Model No. 4.41 Bale Lifter

The bale platform 1, consisting of a  $2\frac{1}{2}" \times 5\frac{1}{2}"$  Flanged Plate, is raised by a Crank Handle 2, operating a Pinion 3 which engages with a 57-toothed Wheel 4 on a Rod 5. This Rod carries the Cord 6,

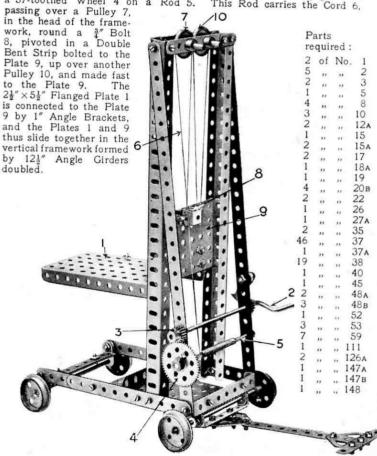

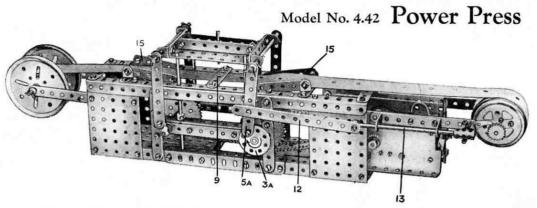


The model shown in the illustration represents a type of automatic press used in factories for stamping out small metal parts. Although the model does not stamp out steel parts, it will cut neat round holes at equal distances in a strip of paper with great rapidity.

The drive from the Electric Motor is transmitted via the ½" Pinion on the armature shaft to a 57-teeth Gear on the Rod IA, and from another ½" Pinion on this Rod to a second 57-teeth Gear on the Rod I. Two I" Sprocket Wheels on the latter Rod are connected by Sprocket Chain to 2" Sprocket Wheels on the "crankshafts" 2. One crankshaft is formed from a 3½" Rod and two Bush Wheels 3, 3A, and the other from a 3½" Rod carrying two Couplings 4 placed at exactly similar angles. Four Strips 5, which form connecting links between the "die platten" 6 and the crankshafts, are lock-nutted to the Bush Wheels and attached pivotally to the Couplings by ¾" Bolts. They are pivoted to the die platten by means of two 4½" Rods and retained in place by Spring Clips.

The  $3\frac{1}{2}$  " $\times 2\frac{1}{2}$ " Flanged Plate forming the die platten is strengthened with two  $3\frac{1}{2}$ " Strips 7 bolted to the Plate by Double Brackets. The die 8, a  $1\frac{1}{2}$ " Rod, is secured rigidly to the platten by means of a Crank. Two  $2\frac{1}{2}$ " Strips 9 bolted to the frame of the model and spaced apart by Washers form the "sink," through which passes the paper strip. Guides 15 are provided to keep the material in correct alignment.

The feed drum is composed of two Boiler Ends attached to the Rod 10 by means of

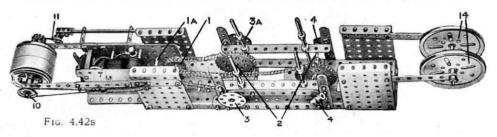

### Parts required:

		-	5 (55)					
8	of	No.	2	1	of	No.	43	
2	,,	,,	2A	1	**	,,	46	
6	11	,,	3 5	2	,,,	,,	48	
18			5	2 2 5			48A	
	33	2.9	8	2	**	"	52	
2	2.5	**		-	33	"		
4	,,	33	9		**	**	53	
2	,,	***	11	10	,,	,,	59	
1	,,	**	15	1	,,	,,	62	
2 4 2 1 5 5 2	,,	,,	15A	3	.,	,,	63	
5	**	,,	16	30° 2 2 2	,,,	,,	94	
2	**	**	17	2	,,	.,	95	
1	,,	,,,	18A	2	,,	,,	96	
2	"	**	19в	2	,,		111c	
2	,,	,,,	20 A	1	,,		147A	
2	,,	,,	24	1	11		147B	
1 2 2 2 1	,,	,,	26	1	,,		148	
2			27 A	2	- 15		162A	
	23	33			"	"		
13	"	**	35	E	ect	ric I	Motor	
20	**	,,	37			inclu	ded	
19	**	,,	38		in	Outfi	t)	


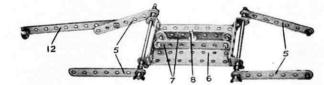


Fig. 4.42A

two 2" Pulleys. At one end of this Rod is affixed a 1" Pulley on which works a spring-controlled brake, and on the other end is attached a Ratchet Wheel that engages with a Pawl 11, which is retained in constant engagement by means of a piece of Spring Cord or elastic. The Pawl is attached to a  $4\frac{1}{2}$ " Rod 13 by means of a Coupling and the Rod is pivotally connected by a  $5\frac{1}{2}$ " Strip 12 to the Strip 5a.

The arrow on the Bush Wheel 3A shows the direction of travel, this being very important as the feed drum must only turn when the die platten is at the top of its stroke. The paper to be stamped is first wound on to the drum 14, then passed through the guides 15 and through the guide 9 and its end is stuck to the feed drum at the other end of the model.


# Model No. 4.43 Motor Breakdown Crane

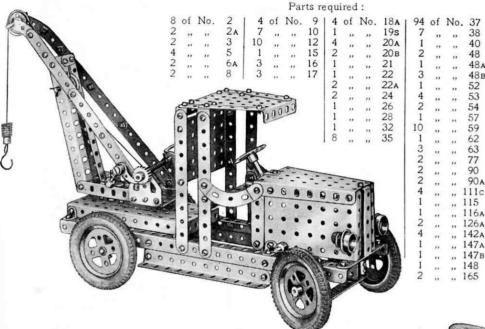


Bearings for the steering column 1 (Fig. 4.43a) are formed by a Flat Bracket and Coupling 2. A  $3\frac{1}{2}$ " Rod passes through the centre transverse hole of the latter and carries a  $1\frac{1}{2}$ " Contrate Wheel which is spaced by means of three Washers from the Coupling. The teeth of the Contrate are engaged by a  $\frac{1}{2}$ " Pinion on the Rod 1. The Crank 3 carries a Flat Bracket bolted so that its round hole is over the elongated perforation of the Crank, and a bolt passed through both is screwed into the tapped bore of a Collar on a 2" Rod. This Rod is attached pivotally to the inner end of a stub axle by means of a swivel bearing formed from a Collar and Small Fork Piece.


The front road wheels rotate freely on the  $1\frac{1}{2}$  Rods, and are held in position by Collars. The Couplings 4 are pivoted by means of  $\frac{3}{4}$  Bolts to the extremities of two  $4\frac{1}{2}$  Strips that are bolted together face to face to form the front axle. Two  $1\frac{1}{2}$   $\times$   $\frac{1}{2}$  Double Angle Strips 5 secure the  $4\frac{1}{2}$  Strips to the side Girders of the model.

# Model No. 4.44 Opisometer

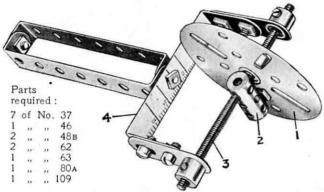


This instrument can be put to practical use for measuring curved lines, the perimeter of bodies, map routes, etc. The Face Plate 1 is free on the Screwed Rod 3, but is attached by a Bolt to a Coupling 2, the end transverse tapped hole of which engages with the thread of the Rod. The scale 4 may be graduated by running the Face Plate along a line of given length and marking its position in relation to the scale for every inch. The Screwed Rod is of course immovable, being gripped by the set-screws of the two Cranks.

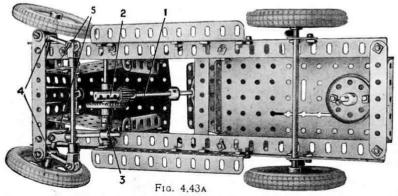

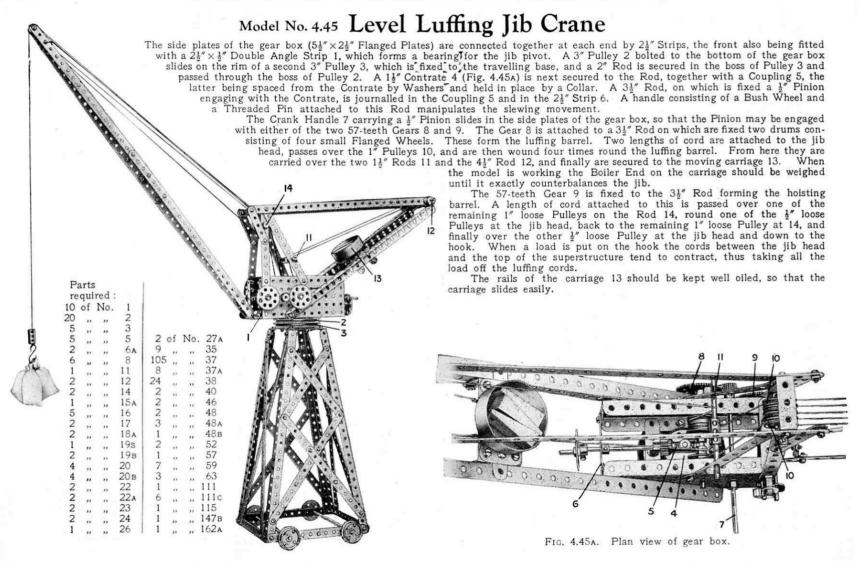



# Model No. 4.46 Naval Quick-firing Gun

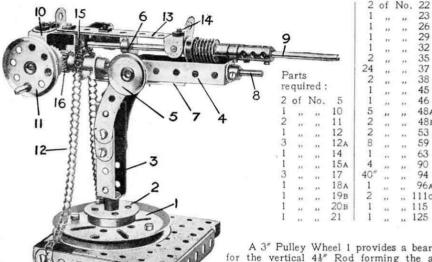


A 3" Pulley Wheel 1 provides a bearing for the vertical 4½" Rod forming the axis about which the gun pivots. The Rod is secured to the base by a Flanged Wheel 2 and a 1" Pulley Wheel attached to it beneath the larger Wheel 1. Two Double Angle

Strips 3, spaced apart by a Double Bracket, are mounted upon this vertical Rod and held in place by a Collar secured to its upper end. Two 21 Curved Strips overlapped 4 holes are bolted to each of the Double Angle Strips 3, and their upper holes form bearings for a short Rod passing through the ends of further Double Angle Strips 4, and carrying a hand wheel 5. Two Spring Clips are mounted on this Rod inside the Strips 4 to secure it to the pivoting portion of the gun, the elevation of which may be altered on turning the Wheel 5. The Strips 4 are bolted to the end of a Double Angle Strip 6, and the same Bolt secures an Angle Bracket which in turn is bolted to the Double Angle Strip 7. The Rod 8 passes through the end holes of the Strips 4 and 7 and is held in place by two Collars. On the top of the Strip 6 is bolted a 31" Double Angle Strip 13, the upturned ends of which form the sighting apertures. The Bolt 14 secures a Double Bracket and an Angle Bracket, the latter together with one of the holes in the Strip 6 forming bearings for the barrel 9. A 1"x1" Angle Bracket 15, bolted beneath the Strip 6, and the end of the Strip 7 provide bearings for the short Rod carrying a 3" Sprocket Wheel and 1" Pinion 16. Two 1" x 1" Angle Brackets 10 form bearings for a 2" Rod carrying the hand Wheel 11. This Rod is fitted with a 3" Contrate Wheel which engages with the Pinion 16. On rotation of the Wheel 11, the small Sprocket Wheel actuates the Sprocket Chain 12 which represents the cartridge belt.

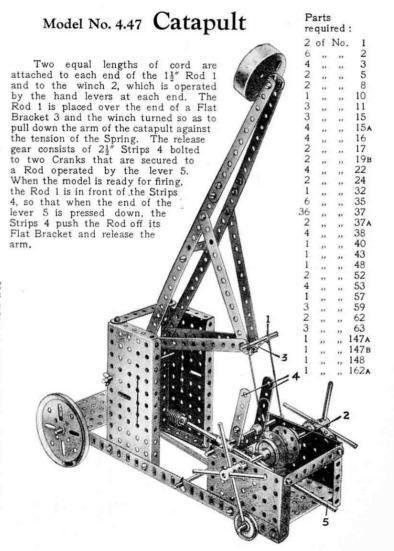

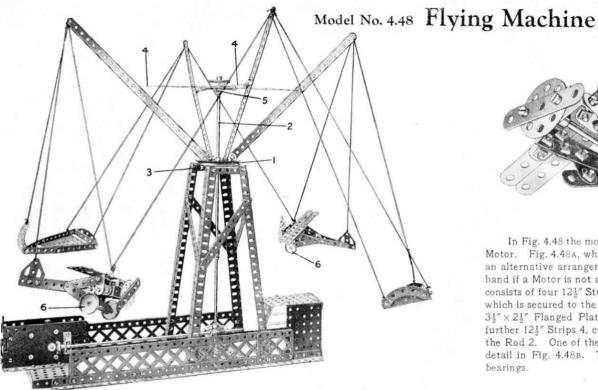

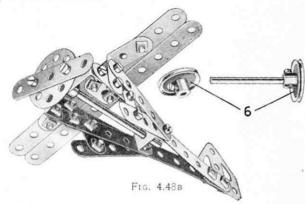

In Fig. 4.48 the model is shown equipped with a Meccano Electric Motor. Fig. 4.48 a, which shows the base of the model only, indicates an alternative arrangement by which the model may be operated by hand if a Motor is not available. The revolving portion of the model consists of four  $12\frac{1}{2}''$  Strips bolted to the 3'' Pulley Wheel 1 (Fig. 4.48) which is secured to the main vertical shaft 2 and rests directly on the  $3\frac{1}{2}'' \times 2\frac{1}{2}''$  Flanged Plate 3. The  $12\frac{1}{2}''$  Strips are supported by two further  $12\frac{1}{2}''$  Strips 4, crossed and bolted to a Face Plate 5 secured to the Rod 2. One of the aeroplanes attached to the model is shown in detail in Fig. 4.48B. The Wheels 6 are shown removed from their bearings.

### Parts required:

6	of	No.	1	4	of	No.	12A	1	of	No.	27A	3	of	No.	53
16		,,	2	2	**		13	1	,,,	**	29	2		**	54
2	,,		2A	1	.,		14	1	**	**	32	3		**	59
11		**	5	2	*		16	122			37	1	22	,,	€3
1		,,	6A	2		**	17	2	**	,,	37A	4	**	**	90 A
6		.,	8	1	,,	,,	19в	2	.,,	**	40	1		**	98
3		,,	9	1		.,	21	1	.,	**	46	2	,,	,,	99
6	**	**	10	4		,,	22	2	**	**	48	1	.,	**	109
3	**	**	11	2	,,		24	6		2.5	48a	2		**	111c
2		,,	12	1	.,	,,,	26	2	,,	,,	52	2	,,	,,	126
		E	lectric	M	oto	r (not	includ	ed in	Out	fit)		2	,,	**	126A


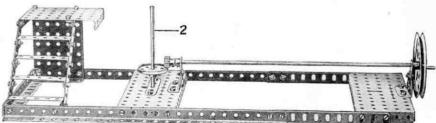


FIG. 4.48A

Model No. 4.50 Ancient Motor Car

Model No. 4.49

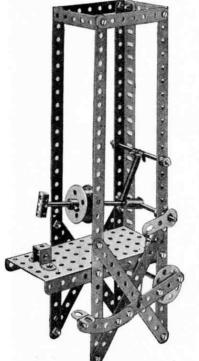

This model performs very amusing antics, all its movements being derived Treadle Hammer from a Clockwork Motor in the chassis. When the Motor is set in motion the model wobbles violently along the floor, while the driver seems to be endeavouring to keep it in a straight line and the passenger (who seems to have fallen on to the floor!) appears in constant danger of being thrown completely out of the car!


A 1/2" Pinion on the Motor shaft engages with the 11/2" Contrate Wheel I attached to the back axle 2. The latter is journalled in two 21" Flat Girders bolted to two 51" Angle Girders to which the Clockwork Motor is attached. Two Couplings 3 are fixed to each extremity of the Rod 2, and the road wheels are attached to their centre threaded holes by Threaded Pins. The Couplings are set at an angle of 180 degrees to one another and so cause the car to wobble in a most peculiar manner when it is running.

A 57-teeth Gear 4 is fixed to a 41" Rod 5 that carries at one end a Bush Wheel. This is connected to the front wheels by a link built up of  $3\frac{1}{3}$ " and  $4\frac{1}{3}$ " Strips and attached by an Angle Bracket 7 to the 21" Double Angle Strip 8 that forms a bearing for the front axle. This results in the front road wheels being turned alternately from side to side. The 114" Rod forming the pivot for the steering should be kept fairly loose to allow for the rolling of the chassis.

A 41" Strip 6 is lock-nutted to the Double Angle Strip 8 at one end and at the other to a Crank 9 which is fixed to a 34" Rod. This is journalled in the holes of the Clockwork Motor and at its top a Bush Wheel is secured. The driver is attached pivotally to the Bush Wheel by an Angle Bracket and 21 "Strip, so that when the Motor is in motion he steers quite realistically. The passenger at the back is attached to the frame by a Spring clamped between two 11" Strips.



			9.			and or					
2	of	No.	1	3	of	No.	16	1	of	No.	45
4	,,		2	2			20в	1	>>	- 20	48,
3	**		3	1	,,	,,	24	1	77		52
1	. ,,	2.7	5	2	"	**	35	5	,,	,,	59
2	,,,	297	8	23	**		37	1	11	,,	62
2	"		12	2	22	22	38	2	,,	,,	63
1	**	,,	15A	1	,,	"	43	1	,,,	"	90

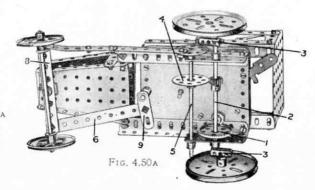

				ra	rts	requ	irea:				
2	of	No.	2A	1 3	of	No.	12	1 8	of	No.	38
3	,,	,,	3	1	,,,	,,	15	1	,,	,,	43
13	**	.,	5	2	,,	,,	15A	1	,,		45
2	**	,,,	6A	1			16	2	,,	**	48B
4	.,,	**	9	1	22		17	2 2 2	.,,	22	53
4	,,	,,	10	2	11	***	19в	2	,,	**	54
4		**	11	2 2 2	,,	***	20 A	10	,,	**	59
					,,	**	22 A	1	.,	,,,	62
		60/	6)	2			24	2	.,	,,	63
0/	6	1000	1	2	,,	,,	26	2 2		2.5	103F
101/	1/			1	**		27A	2			108
0/0	16	VE		1	**		28	5	.,	11	111c
	J.	99		57	.,		37	2	.,	.,	115
200	67	10)		14	.,		37A	1	**	1965	160
100						Clo	ckwor	k M	oto	r	

(not included in Outfit)

# Model No. 4.51 Telpher Span

A Worm Wheel on the armature spindle of the Electric Motor engages with a 1 Pinion that is secured, together with a second &" Pinion, on a vertical 2" Rod. This Rod is journalled in a Channel Bearing secured to the Motor side plates. The second & Pinion engages with a 14" Contrate Wheel carried on the hoisting drum, the latter being formed by a 21 Rod journalled in the end holes of the Motor side plates. The lift and telpher hoisting rope, which is continuous, is wound round the hoisting drum three turns, and is then connected to the lift and telpher in the following manner.

One side of the cord is passed over 1" and 1" loose Pulleys at the top of the tower, then over a 1" fast Pulley attached to the cage, and is finally attached to a Flat Bracket that is carried on the same Rod as the 1" Pulley.

The other side of the cord is passed over a second I" loose Pulley at the top of the tower, and down to a  $2\frac{1}{2}'' \times \frac{1}{2}''$ Double Angle Strip on the telpher.



allow for different thicknesses of material.


### Parts required:

										13					
8	of	No.	1	2	of	No.	20	1	of	No.	. 44	1	of	No.	115
2	***	**	2	4	,,	**	22	1		,,,	45	4	,,	"	126.
3			3	3	,,	"	22A,	5	,,		48A	- 1	,,	,, *	160
	**	69	4	1	,,	**	23	2	,,	,,	52	1	**	,,	162
18	,,	10.	5	2	,,		26	5	**	11	53	1	,,	**	165
9		1.7	8	1	11.	**	28	10	**	**	59	1	,,	2.5	166
4	**	- 0	9	1	,,	**	32	2	.,	,,	62	11.55	T	Electi	ri o
1			11	4	**		35	3	,,		63		1	Moto	
7		**	12	126	**	**	37	1	,,	**	98		100		
1	**	3.9	15A	6	,,	**	37A	1	**	**	99			n Out	
5	,,	**	16	24	,,	,,	38	2	,,	,,	103F		,	n Out	11)
2	,,	,,	18A	1	,,	**	40	4	**	,,	111c				



# Parts required: Electric Motor (not included in Outfit)

# Model No. 4.53 Swivelling and Luffing Jib Crane

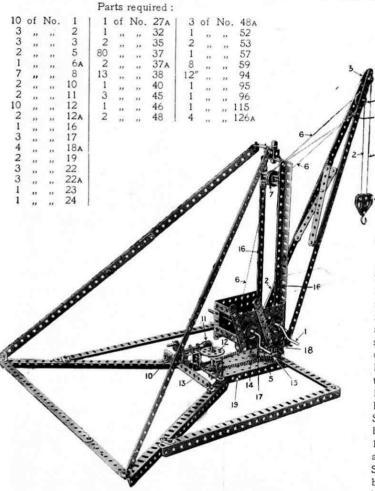

In this model three separate actions are provided, for raising the load, raising the jib, and swivelling the jib. The load is raised by means of a Crank Handle 1 on which the Cord 2 is wound and passes over the 1" Pulley 3, thence round the 3" Pulley in the block 4 (spacing Washers being used to give clearance to the 1" Pulley), the end of the Cord 2 being made fast to the top of the jib. By turning the Handle 1 the load is raised or lowered. The jib itself is raised or lowered by the operation of the Crank Handle 5 on the rod of which a cord is wound, and passes over one of two Pulleys 7 to and round another 1" Pulley 8 in the jib, whence it returns to and passes round the other Pulley 7, being finally made fast to the Double Bracket

finally made fast to the Double Bracket

9 bolted to the jib.

As the Handle 5 is turned the Cord 6 is wound
round the pulleys and the angle of the jib varied.

round the pulleys and the angle of the jib varied. The jib is swivelled by the hand wheel 10, a Worm 11 on which engages a 57-toothed Wheel 12 on the rod of which a 1" Sprocket Wheel 13 is mounted. A Sprocket Chain 14 passes round this Wheel 13 and round a 2" Sprocket Wheel 15 secured to the standard 16 of the crane. The bearing for the Rod of the Worm 11 is made by bolting a 1" Angle Bracket 20 to the 51 " x 21 " Flanged Plate 19, and to the Angle Bracket 20 is secured a 11" Strip 21 and a I" Bracket 22. To the Bracket 22 is bolted a Double Bracket 23. A Flat Trunnion 24 is bolted to the 51" Strip 25 which forms with the Bracket 23 the front bearing for the Rod. The standard is built up of two 121" Girders 16 which are connected at the base by a 12" Double Angle Strip 17 which is bolted to the 2" Sprocket Wheel 15. The 1" Rod 18 is secured in the bush of the Sprocket Wheel 15 and fitted with a Collar below the 5½" × 2½" Flanged Plate 19, Fig. 4.53B.

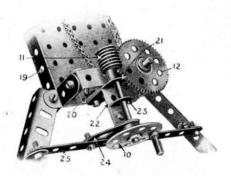


Fig. 4.53A



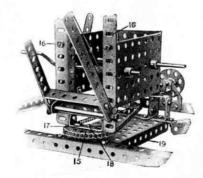


Fig. 4.53B


# Model No. 4.54 Trip Hammer

The shafts carrying the hammers are prevented from rotating in their bearings by means of  $2\frac{1}{2}'' \times \frac{1}{2}''$  Double Angle Strips bolted in pairs to form guides, in which slide the heads of Bolts or short Rods secured to the Couplings in the centre of the hammer shafts. As the Rod carrying the Cranks slowly rotates the hammers rise and fall alternately.

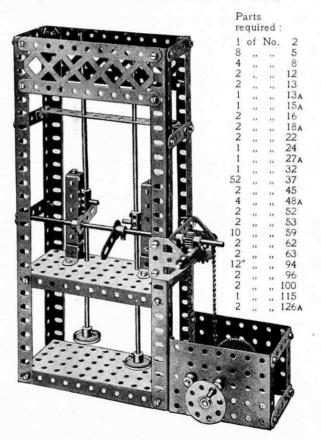

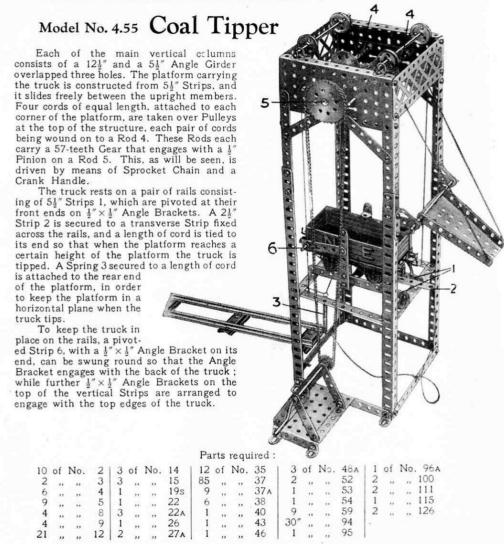

# Model No. 4.56 Cake Walk

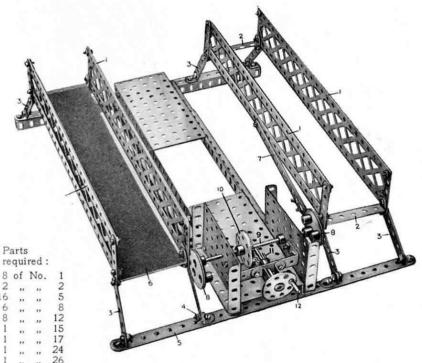

The rocking platforms are built up of Braced Girders I connected by the end Strips 2 and pivotally bolted and lock-nutted to the Strips 3 forming rocking links. These latter are bolted and lock-nutted at 4 to the Angle Girders 5. Strips 6 of cardboard are secured to the end Strips 2. The platforms are rocked by means of Strips 7, one of which is connected to each rocking platform and to Eccentrics 8 fixed on the Rod 9 on which is secured a Contrate Wheel 10 driven by a Pinion 11 from the handle 12. As the handle 12 is turned the platforms are rocked to and fro on the Strips 3. The eccentrics 8 should be so arranged that the platforms rock in opposite directions.


# Model No. 4.57 Anti-Aircraft Gun

The gun represented by the Rod 1 is pivoted upon a transverse Rod 2 which passes through a Coupling on the Rod 1. A 57-toothed Wheel 3 on the pivot Rod 2 is engaged by a Worm 4 operated from the hand wheel 5. By turning this wheel 5 the gun is lifted or lowered. The two vertical Strips forming the framework for the pivot Rod 2 are bolted to a 1½" Pulley 7 which is secured on a vertical Rod 8. A 3" Pulley Wheel 9 is also bolted to a Rod 8 and from the Pulley Wheel is carried by reversed Angle Brackets

by reversed Angle Brackets 10 a framework 11. The Rod 8 with the framework is rotated from the hand wheel 12, a Pinion 13 on the spindle of which engages a 34" Contrate Wheel 14 on the Rod 8. By turning the wheel 12 the gun is swivelled round.




6	of	No.	2	1	of	No.	27A
1	,,	,,	5	1	,,	,,	29
1	,,,		10	1		,,,	32
1 2 4 2	.,	**	11	64	**		37
4	,,	**	12	12 2 4		,,,	38
2	,,	,,	12A	2	,,	,,	45
1	**	,,	15	4	,,		48A
1	,,	,,	15A	2	,,	,,	48B
4	22		16	1	- 27		52
1	,,	,,	17	4	,,	,,	53
1	,,	,,	19в	8	,,	,,	59
1	**	,,	21	1	**	**	62
1 2 2		,,,	22	2			63
	11	,,	24	1 2 2	,,	,,	115
1	,,	,,	26	4	,,	,,	125

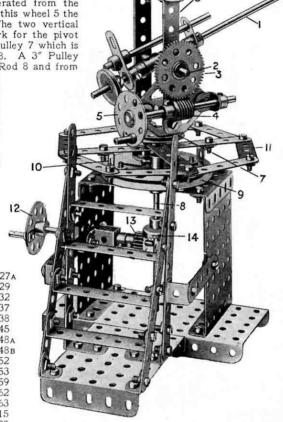

# Model No. 4.58 Spring Balance

The architraves 1 are pivoted on the Rod 3 and secured at their upper ends to a Spring 2. Two  $2\frac{1}{2}$ " Strips 4 are attached pivotally to their lower ends by Bolts and locknuts and connected together in a similar manner. The Hook 6 suspended from a Flat Bracket receives the article to be weighed, which causes the upper ends of the Architraves to move outward, and the weight may be ascertained from the scale that is bolted in position at 7.

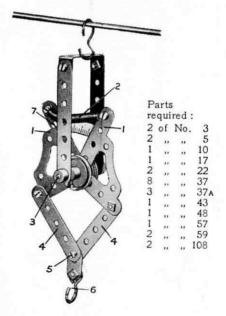

model.

### Model No. 4.59 Wire Rope-Making Machine Parts required: The wire from which the rope is to be made is wound on four bobbins 1. which consist of two pairs of 11" Flanged Wheels and two pairs of 3" Flanged Wheels The bobbins are free to rotate on 2" Rods secured in the ends of two Couplings 2 that are made fast to the 8" Rod 3 at right angles to each other. The wires from the bobbins pass through holes in a Face Plate, a 11 Pulley Wheel 5, and a Bush Wheel secured to the Rod 3 close to the Pulley Wheel 5, and are tied together on a drum at the opposite end of the machine. The drum is mounted on a 61" Rod that is connected by Sprocket Chain to a I" Sprocket Wheel on the Rod 4, which is revolved slowly from the hand wheel through the gearing shown. The Rod 3, together with the bobbins, Face Plate, Pulley Wheel 5, and the Bush Wheel, are rotated from the main driving shaft 7 by means of 2" and 1" Sprocket Wheels. The wires are thus twisted together between the Pulley Wheel 5 and the drum, and are wound on the latter in the form of a cable. In order to prevent the wire from unwinding too rapidly, Washers are placed on the 2" Rods between the Couplings and the bosses of the Flanged Wheels 1, and the Collars 6 are pressed hard against the wheels before being secured to the 2" Rods. A considerable amount of tension is essential to the production of good wire rope, and for this reason the 11 Pulley Wheel 5 and the Bush Wheel behind it are secured close together on the Rod 3 in such a manner that the friction generated by the wires in passing through the holes in the wheels keeps the cable taut while it is being twisted. String or thin wire may be used in the

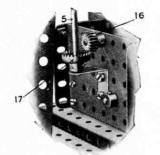


FIG. 4.60A


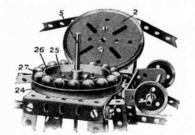


Fig. 4.60B

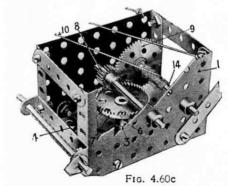


Model No. 4.60 Elevated Jib Crane


				Pa	rts	requ	iired:				
4	of	No.	1 1	1	of	No.	19	1	of	No.	29
10	,,,	,,	2	1	,,	,,	19в	4	**	,,	35
1	,,	20	3	1	,,	,,	19s	85	,,	,,	37
8	,,	,,	5	4	,,		20	1	,,	,,	40
4	,,	,,	8	2	,,	,,	20 B	1	,,	**	46
4	**	**	11	1	,,	**	21	3	,,	,,	48A
14	.,	n	12	1	**	**	22	2	,,	,,	52
3	.,,		12a	2	"	**	22A	5	,,	,,	53
1	,,	"	13	2	"	"	26	1	**	**	57
5	,,	"	16	1	,,	,,	27A	6	,,	,,	59
1	"	**	18a	1	,,	**	28	1		,,	63

The gear-box 1 is secured to a 3" Pulley Wheel 2 (the boss 3 of which is upward) by means of two  $2\frac{1}{2}'' \times \frac{1}{2}''$  Double Angle Strips 4. The  $11\frac{1}{2}''$  Rod 5 passes up through the boss 3, a Collar 6 being placed on top of the boss. The Contrate Wheel 7 is then secured to the top of the Rod 5. A  $\frac{1}{2}''$  Pinion 8 engages the Contrate Wheel 7 and also a 57-toothed Wheel 9 on the Rod 14 on which latter the hoisting cord 10 is wound, passing over the 1" Pulley 12 to the Hook 13. The Rod 5 is actuated from the Crank Handle 15 by the Pinion 16 engaging a  $\frac{3}{4}$ " Contrate Wheel 17 and

through the Gear Wheels 7, 8, and 9, and operates the cord 10 to raise or lower the load. The jib 18 is swivelled from the Crank Handle 19, a continuous cord 20 being wound twice round the  $\frac{3}{4}$ " Flange Wheels 21. The cord 20 passes over 1" guide Pulleys 23 and round the 3" Pulley Wheel 2. By turning the handle 19 the jib is swivelled.

Alternative Construction. In order to make the jib swivel more freely, a ball-race, Fig. 4.60B, may be fitted. This is made by bolting to the top of the frame a 3" Pulley Wheel 24 by Bolts 25 which also secure in the Pulley Wheel 24 a Wheel Flange 26. This provides a circular groove for the reception of the Ball Bearings 27. The Pulley Wheel 2 which is bolted to the gear-box 1 is then placed over the Rod 5 and rests on the Ball Bearings 27, which thus support the weight of the superstructure.

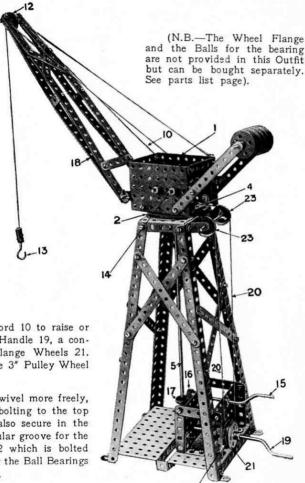

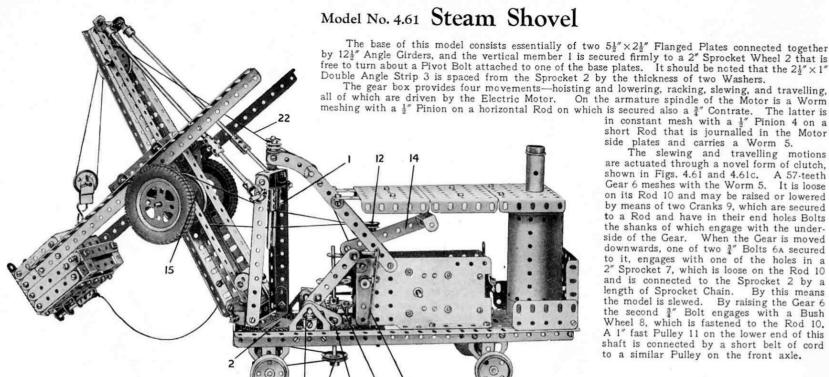

Parts	required	

										F	arts re	equir	ea:										
6	of	No.	2	3	of	No.	14	1 3	of	No.	23	1	of	No.	44	1 3	of	No	. 90	1 1	of	No.	162
2	**	,,	2 <sub>A</sub>	1	,,	,,	15	1	,,	,,	23A	1	,,	,,	45	11"	**	"	94	1	,,	,,	163
6	,,,	**	3	5	,,	**	15A	2	,,	,,	24	1	,,	,;	46	2	,,	"	95	1	,,	,,	164
4	,,	,,	4	5	**	"	16	2	,,	**	26	2	22	**	48	2	,,	,,	103F	2	"	,,	165
18	,,	"	5	5	"	,,	17	2	,,	,,	27A	10	,,	,,	48A	2	,,		111	1			166
2	,,	**	6A	4	,,	,,	18A	1	,,	,,	29	2	,,	.,,	52	3	,,	,,	111c			lecti	
8	"	**	8	4	**	,,	20	2	,,	,,,	32	4	,,	,,	53	2	,,		115				
2	*	**	9	3	**	**	20 A	10	,,	**	35	1	,,	,,	57	1	,,		116a			Moto	r
3	33	**	10	1	**	**	20в	125	,,	33	37	10	**	**	59	3	,,	**	126			t inch	
1	"	**	11	1	**	,,	21	7	,,	,,	37A	2	**	,,	62	4	,,	**	126a		11	Out	it)
12	,,,	"	12	2	**	,,	22	21	,,	,,	38	6	,,	,,	63	2	"	"	142A				
4	**	**	12A	1	**	,,	22A	1			40	2			77	1			147R				

in constant mesh with a 1" Pinion 4 on a short Rod that is journalled in the Motor side plates and carries a Worm 5.

The slewing and travelling motions are actuated through a novel form of clutch, shown in Figs. 4.61 and 4.61c. A 57-teeth Gear 6 meshes with the Worm 5. It is loose on its Rod 10 and may be raised or lowered by means of two Cranks 9, which are secured to a Rod and have in their end holes Bolts the shanks of which engage with the underside of the Gear. When the Gear is moved downwards, one of two 3" Bolts 6A secured to it, engages with one of the holes in a 2" Sprocket 7, which is loose on the Rod 10 and is connected to the Sprocket 2 by a length of Sprocket Chain. By this means the model is slewed. By raising the Gear 6 the second 3" Bolt engages with a Bush Wheel 8, which is fastened to the Rod 10. A 1" fast Pulley 11 on the lower end of this shaft is connected by a short belt of cord to a similar Pulley on the front axle.

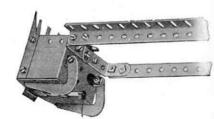


Fig. 4.61a. If available, the Meccano Digger Bucket (part No. 169) may be used with advantage in place of the built-up Bucket, as shown.

### This Model can be built with MECCANO Outfit No. 4 (or No. 3 and No. 3A)

### Model No. 4.61 Steam Shovel (continued)

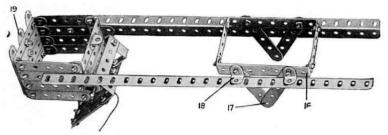


Fig. 4.61B. The Bucket Arm, with Bucket and Guide Frame in position.

It should be borne in mind that the Gear 6 must be always in mesh with the Worm 5, unless it is required to throw it out of gear entirely, when it is only necessary to slide it up the Rod to its fullest extent. To prevent the Gear coming out of mesh with the Worm when in the slewing position, a Ccllar is fixed on the lower  $\frac{3}{4}$ " Bolt, and in order to maintain the operating lever in position after movement, a Spring Clip 9A is mounted on the end of the Rod carrying the Cranks 9, and prevented from rotation by its ends engaging with a  $\frac{1}{4}$ " Angle Bracket bolted to the Flat Trunnion. Hence the required stiffness in the movement of the lever is obtained.

The drive for the racking movement is taken off a 1 fast Pulley 12

secured to the top end of a Rod that carries a  $\frac{1}{2}$ " Pinion 13, which may be brought into mesh with the Worm 5 by sliding the Rod downward with the aid of the lever 14. A belt of cord connects the Pulley 12 with a 2" Pulley 15 secured on a Rod that is journalled in the sides of the jib and which carries two other 2" Pulleys shod with Dunlop Tyres. The frame 16 (Fig. 4.61B) also is mounted on this Rod in the holes 17, and the Girders of the bucket arm engage between the  $\frac{1}{2}$ "  $\times \frac{1}{2}$ " Angle Brackets 18 and the tyre-shod Pulleys. The Brackets 18 should press the bucket arm only lightly into contact with the Tyres, and the driving belt should be taken several times round the Pulleys 12 and 15.


The construction of the bucket itself should be fairly obvious from Fig. 4.61B, with the exception of the catch for releasing the hinged bottom. The catch consists of a  $1\frac{1}{2}$  Rod free to slide in a Double Bracket that is bolted rigidly to the underneath of the bucket. One end of the Rod is fitted with a Coupling, to which the release cord is attached, and the other end fits into the lower hole of a 3" Strip 19.

The hoisting barrel consists of a  $3\frac{1}{2}$ " Rod 20 that is free to slide in the Motor side plates and is controlled by the lever 21, so that the 57-teeth Gear on its extremity may be thrown into or out of engagement with the  $\frac{1}{2}$ " Pinion 4. When out of gear the projecting shank of a Bolt on the Motor side plate engages with one of the holes of the 57-teeth Gear and thus prevents the unwinding of the barrel. The grub-screw in the boss of the Pinion 4 should be filed, if necessary, so that it does not foul the teeth of the 57-teeth Gear.

The pair of  $\frac{1}{2}$ " loose Pulleys mounted at the top of the vertical member form guides round which the hoisting cord 22 passes when the jib is slewed round. The Boiler is retained in position by a  $6\frac{1}{2}$ " Rod, which passes completely through it, and through the base plate, and is secured by a Bush Wheel on its lower end, and at its upper extremity by a  $\frac{3}{4}$ " Flanged Wheel that forms the chimney cap.


It is an advantage to fill the Boiler with heavy objects so as to prevent the machine from tipping forward. Also, when working cross-track, it is advisable to provide "outriggers." These should take the form of arms pivoted to the truck so that they may be swung out at right angles, and by having their ends packed up, used to relieve the wheels and axles from strain.


Much fun may be had with this model, not only during its construction but afterwards when it is set to work. Also, it may easily be converted into a crane by detaching the bucket arm and unhooking the bucket from the Pulley Block.

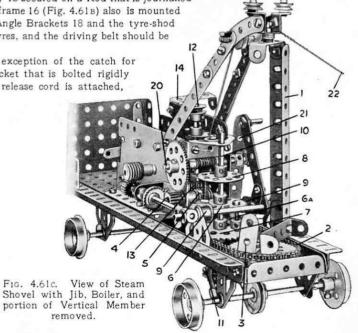

### This Model can be built with MECCANO Outfit No. 4 (or No. 3 and No. 3A)

Model No. 4.62 Steam Wagon

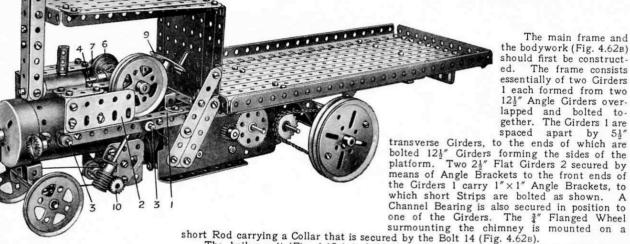

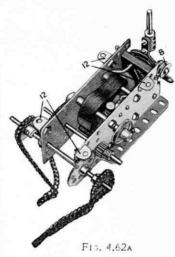

The boiler unit (Fig. 4.62c) is held in position by two 3\{\frac{1}{8}}^{\text{T}} Rods 3 that are passed through holes in the Girders 1, 5\{\frac{1}{2}}^{\text{T}} Strips being bolted to the Girders to cover the elongated holes. A Sleeve Piece represents the cylinder, on the inside of which an Angle Bracket is secured to hold a short Rod 4 representing the piston connecting Rod. A small Fork Piece is carried on 16 of Rod 5, journals for which are provided by a Double Bracket secured to the Roller and the Rolle

the Rod so that its fork engages with the 3" Rod 5, journals for which are provided by a Double Bracket secured to the Boiler and by a Flat Bracket 7 that is bolted to the Channel Bearing on the frame. Two 2" Pulleys serve as a flywheel while a 1" Pulley 6 on the Rod takes up the drive from the armature spindle of the Electric Motor.

### Parts required:

						-		ad arres	· · ·						
	of	No.	1	5	of	No.	16	1	of	No.	35	2	of	No	. 96
6	"	,,	2	3	,,	**	17	127	,,	,,	37	2	,,	,,	103F
6	,,	,,	3	2	,,	,,	18A	5	,,	,,	37A	2	,,		111
10	,,	**	5	4	,,	,,	19в	24	,,	.,	38	6	,,	**	111c
1	**	. ,,	6A	4	,,	,,	20A	1	,,	,,	45	2	,,	"	115
6	,,	**	8	1	,,	,,	20в	2	,,	,,	48	1	,,	"	116A
3	"	,,	9	2	,,	,,	22	3	,,	,,	48A	1			125
4	,,	,,	10	3	,,	,,	23	1	,,	,,	52	4	"	"	126A
5	,,	,,	11	1	,,	,,	24	1	"	,,	53	1		"	160
19	,,	.,,	12	2	,,	,,	26	10	,,	,,	59	1	,,	"	162A
4	,,	,,	12A	2	,,	,,,	27A	2	,,	,,	63	i	"	200	162в
1	,,	,,	15	2	,,	,,	29	19"	,,,		94	1	"	"	163
2	,,	,,	15A	1			32	2	"	21	95	Ť	**	"	164

Electric Motor (not included in Outfit)


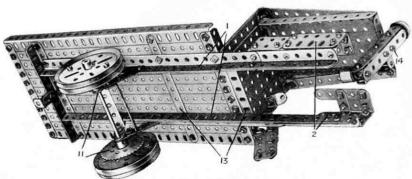


Fig. 4.62B

### Model No. 4.62 Steam Wagon (continued)

The "firebox" is formed by two pairs of Flat Trunnions held together by 11" x 1" Double Angle Strips, one of which is secured to the Boiler. The frame so formed holds the steering mechanism, which is operated by the hand wheel 9, the Rod of which carries a Worm engaging the &" Pinion 10. This Pinion is secured on the end of a 2" Rod carrying a Coupling between two &" Pulleys, and a length of cord wound round the Coupling has its ends secured to the Double Angle Strip carrying the front axle. The Double Angle Strip is bolted to a Double Bent Strip, which is pivoted by a Bolt and two Nuts to the underside of the Boiler.

Fig. 4.62A shows the arrangement of the gearing for the drive to the rear axle. A 1" Pinion on the Motor armature spindle engages a 57-teeth Gear on a Rod that carries a further Pinion engaging a

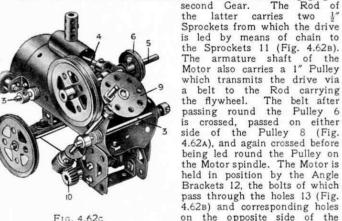




wagon. The switch arm of the Motor is extended by means of a short Rod held in a Coupling, to facilitate control from the cab. The Coupling is secured by two bolts passed through holes in the switch arm and screwed into the tapped holes of the Coupling. Each of the bolts carries a nut for spacing purposes.

When the three units, Figs. 4.62A, 4.62B, and 4.62c have been assembled and fitted together to form the complete model, all moving parts should be examined to see if they work freely. Rotating shafts should be oiled, and for this purpose Meccano Lubricating Oil is excellent.

Rubber covered wire is used for connecting the Accumulator and Motor.

### Model No. 4.63 Trailer (for Lorry or Traction Engine)

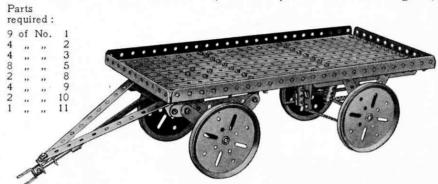


of No. 15A A Face Plate 1 (Fig. 4.63A) is bolted to the Strips of the platform and a 11" Rod 2 secured in its boss passes through the centre hole of a Boiler End, which is held in position on the Rod by a Collar. Two 31" Strips are bolted to the Boiler End and to these 31 " x 1" Double Angle Strips are secured but spaced by means of Collars and Washers. A further Double Angle Strip, to which the drawbar is connected, is attached loosely by lock-nutted Bolts 3.


A brake is provided by the Sprocket Chain 4, which passes over a drum formed from a Flanged Wheel and Bush Wheel on the back axle. The tension on the Chain is varied by operating the hand Wheel 5 on a Threaded Rod, along which travels a Coupling carrying one end

of the Chain. " 162A ΓIG. 4.63A

### Model No. 4.65 Submarine

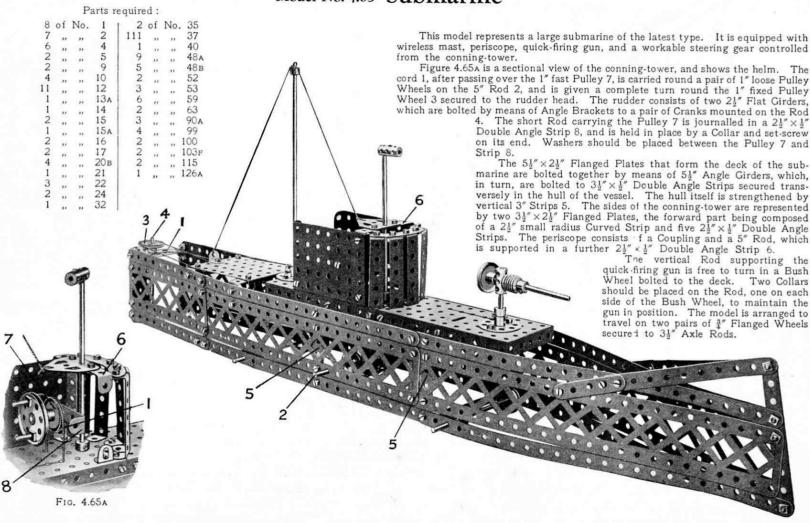

This Model can be built with MECCANO Outfit No. 4 (or No. 3 and No. 3A)

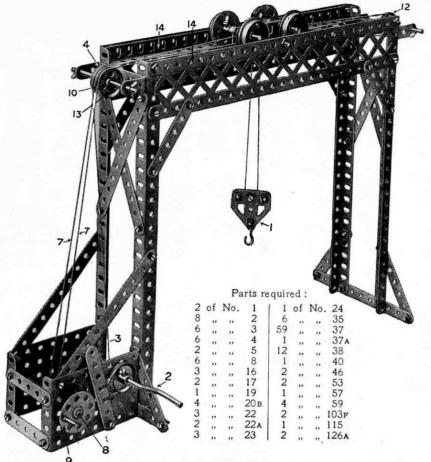

### Model No. 4.66 Gantry Crane

The Pulley 1 is capable of being hoisted to raise the load, or traversed. In order to raise the load the Crank Handle 2 is operated, which winds the Cord 3 passing over the rear Pulley Wheel 4 round the  $\frac{1}{2}$  Pulley 5 and a corresponding Pulley in the block, thence round another  $\frac{1}{2}$  Pulley 6 and is made fast at the end of the gantry. For traversing a continuous Cord 7 is wound several turns on the  $3\frac{1}{2}$  Rod 8 to which is secured a hand wheel 9. The cord passes over the Pulley Wheel 10 and is secured to one of the side Plates 11, and continues round the Pulley 12 returning to and passing over the nearest Pulley Wheel 13 back to the Rod 8. Consequently by turning the hand wheel 8 in one or other direction, the carriage is traversed to and fro along the top Angle Girders 14, which form the travelling rails. The construction of the travelling carriage is shown in Fig. 4.66a, three Washers 15 being placed on each of the outer Bolts, passed through the two Plates 11; and  $\frac{1}{2}$  Pulley Wheels 5, 6, on the inner Bolts. The outer plates being

then bolted together, the Rods 16 of the Flanged Wheels are passed through both plates in the end elongated holes, and Collars 17 secured on the exterior, after which the remaining Flanged Wheels 18 are secured on the ends of the Rods 16.


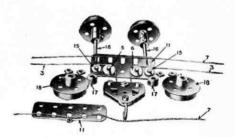


FIG. 4.66A

### HOW TO CONTINUE

This completes our examples of models that may be made with MECCANO Outfit No. 4 (or No. 3 and No. 3A). The next models are a little more advanced, requiring extra parts to construct them. The necessary parts are all contained in a No. 4A Accessory Outfit, the price of which may be obtained from any Meccano dealer.

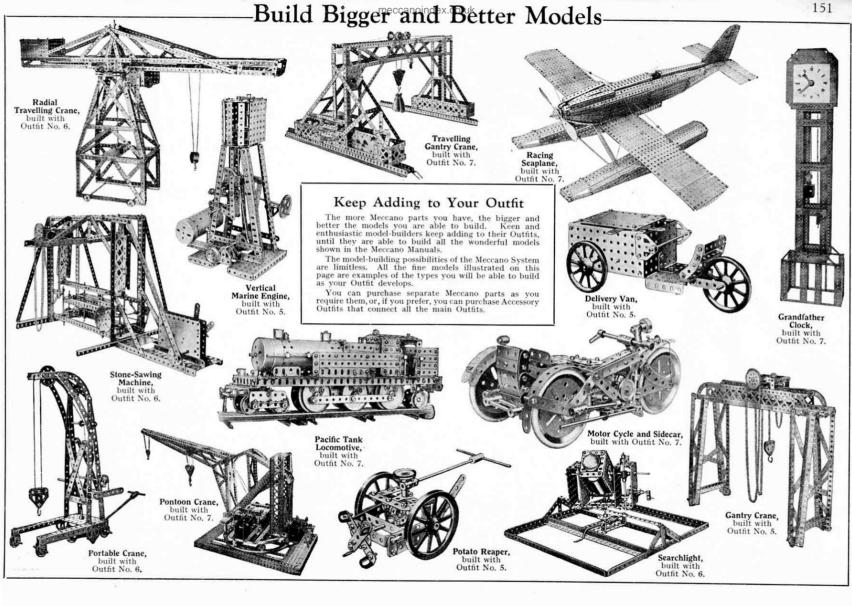

# CONTENTS OF OUTFITS

20	- 41			NESCHIETION A	OF FARI.				3	000		<b>Y</b> 0					V7	9 9 P		44					
Angle Cicker, 214	11.	Perforated Str	ips. 12	**	:	1							-		-	'			-	-	-	1	1	-	-
Augle Grieffert, 244		Terorane on	6		: :	: :	: :		:		1 1	1 1		_		- 1	1 1	0 1	- 1	-	_	_	_		38
Angle Colore, 34, 74, 74, 74, 74, 74, 74, 74, 74, 74, 7	IB		. 7	*	:	:	:	:	1	1	1	1	1	_		1	1	1	1	_	_	_	_		_
Margin Chorters 147	2		3	-	:	:	:	:	:	-	1	4	3		-	_	1				_	_		_	-
Addie Geleicker, 14, 17, 18, 18, 18, 18, 18, 18, 18, 18, 18, 18	Z4		4	t rice	:	:	;	:	!	1	1	1	1	÷	-	-	-				_	_	4	8	
Margin Chebra, M. S.	~ .		. 3	-tot 1	:	:	:	:	1	1	1	1	_		_	-	2000	_	-		-	12	24	1	-
Augie Colchen, 3, 1, 2, 1, 1, 1, 1, 1, 1, 1, 1, 1, 1, 1, 1, 1,					:	:	:	:	1	1	1	1	1	1	1	-				-	_	4	12	12	24
With Branches State Contract C				-01	:	:	:	:	:	00	8	6	1	_	3	-	-				36	1	36	8	120
Angle Golvers, 214  """ 157  "				. :	:	÷	:	:	1	1	1	1	1	1	1	-	1	1	1	-	4	20	24	9	8
Marie Currents, 247  "" " " " " " " " " " " " " " " " " "	٧.			ica	i	÷	:	:	:		r.	1	1		~	-	1	1 2	-	-	9	00	7	1	7
Name Weeks, 17 (1994)		Angle Girders,	2+3	:	:	:	:		:	1	1	1	1	1	1		10	1	1	1	1	1	1	12	_
The brackets of the brackets o	V		181	:	:	:	:	:	1	1	1	1	1	1	1	1	1	1	1	1	1	1	1	9	
Part Branches, 17 (1992)  Part Branches, 17	*		124"	:	:	:	:	:	1	1	1	1	1	-	_		-	90	-	-	1	12	26	1	_
Name New Section 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1	V		91,	:	:	:	:		!	1	1	1	1	1	1	1	1	1	1	-		4	80	6	_
Numbers, Name of Section 1997, Name of Secti	88		74"	:	:	:	:	:	1	1	1	1	1	1	-	-	-	1	- 1	-		1		ď	
Angle Brackets, 1 × 1 × 1 × 1 × 1 × 1 × 1 × 1 × 1 × 1	_		51.						-	- 1	1	1	1	1	-	-	-	_		***		:	1 0	9 0	0 2
Part British Friedrick St. 1. 1. 1. 1. 1. 1. 1. 1. 1. 1. 1. 1. 1.	*		41.				:														*	4	10	9	
Part Brackets			014	:	:	:	:	:		_		1				-		1		1	1		21	13	_
Part Brackets, 17 x x 1 x 1 x 1 x 1 x 1 x 1 x 1 x 1 x	9	u u		:	:	:	:	:		1	1	1	1		1	1	1	1	1	1	1	67	21	01	_
Part Britannia, 17, 18, 18, 18, 18, 18, 18, 18, 18, 18, 18	0	"		:	:	:	:		1	1	1	1	1	1	-	1	-	1	1	1	1	1	1	3	
Part Brackets, 17   17   17   17   17   17   17   17	Q		24	:	;	:	:		1	1	1	1	1	1	1	1	-	1	1	_	-	S	9	_	_
Fig. Received	H	=		:	:	:	:	:	1	-	1	1	1	1	1	1	1	1	1	1	1	!	1	2	_
Path Bruckets, 17 × 1 × 1 × 1 × 1 × 1 × 1 × 1 × 1 × 1	4	2		:	:	:	:	:	1		1	1	1	1	1	1	-	1	1	1	1	4	4	1	
Double Brenders, and a series of the series		Flat Brackets	:	:	:	:	:	:	4	1	-	*	10	32		1	_	~		-		7	16	1.4	
Anigle Brackets, § 7, § 7, § 7, § 8, § 8, § 8, § 8, § 9, 9, 14, 8, 9, 22, 14, 98, 12, 18, 8, 8, 8, 8, 8, 8, 8, 11, 17, 18, 18, 18, 18, 18, 18, 18, 18, 18, 18		Double Bracke	ts	:	:				1	-	-	2				- 1		_							3 5
Axis Rods, 111; "   "   "   "   "   "   "   "   "   "		Angle Brackets	1. X							9		1 0	1 0				•			-			0 9	+ 5	- '
Axie Rode, N. H. T. Ye, S. M.		The same of the same	14	. •	:	:	:	:		_		0	0	-0	-	23 1	-		24		-	_	4	23	76
Axie Rode, 1117	4 4				:	:	:	:	!	1		1	1				-	-	7.5	1	9	1	9	9	_
Ardic Rock, 117  """ 67  """ 8	m	*	×	-	:	:	:	:	1	1		1	1	1	1	1	1	1	1	1	1	4	4	12	_
No. 10.   No.		Rods,		:	:	:	:	:	1	1	1	1	1	_	_	1	-		- 2	1	6	-	er.	ır	
The state of the s	×		:		:				1	-		- 1	1	1					-		1 -		, ,	0 0	
n n s' n n s' n n n s' n n n n n n n n n																			-	I	-	0	*	0	
The contract of the contract	9 10	:	:	:	:	:	:	:	۱	1		1		1	-	1				I	2	8	9	7	_
1		£	:	:	:	:	:	:	1	1	1	1	1	67		1			7,0	1	4	1	4	2	
Crank Handles (2° shaft)  Crank Handles (2° shaft)  Crank Handles (2° shaft)  Pulloy Wheels, 3"  Pulloy Wheels, 1"  Pulloy Whee			:	:	:	:	:	:	1	1	1	1	1	-	_	_				1	ır.	-	9	1	
Crank Handles (5° shaft)  "" 15"		:						-	6	1	•	-	07	-	_			_	_				1	1	_
Crank Handles (5° fabrit)  Crank Handles (5° fabrit)  Wheeks, 3° (15° m)  Wheeks, 3° (15° m)  Wheeks, 1° (			14					:				,	,	•	_		_	_	_		0	4	•	0	
Crark Handles (5° start)  """ 11		"	:	:	:	:	:	:	1	1		1	1	1	I	1	1	1	1	8	8	4	7	9	_
Crark Handles (5 shaft)	m		:	:	:	:	:	:	1	1	1	1	1	1	1	1	1	1	1	1	1	2	2	3	
Crark Handles (7 start)		"	:	:	:	:		:	61	1	-	1	2	1	23	1	- 24		10	1	ıc	4	8	0.	_
Cank Handles (5' shaft)  "" (34' m)  Pulley Wheels, 3' "" (34' m)  Pulley Wheels, 2' "" (34' m)  "" (1' (nose)  "" ""	_	:	1.4	:	:	:			1	1	1		6	6	-	-		_	-		•		•		•
Crank Handles (5° Shaft)  "" (34° "")  Pulley Wheels, 3" (34° "")  Pulley Wheels, 2" (34° "")  Pulley Wheels, 2" (34° "")  "" " 1 (fast)  "" " " 1 (fast)  "" " 1 (fast) "" " 1 (fast) "" " 1 (fast) "" " 1 (fast) "" " 1 (fast) "" " 1 (fast) "" " 1 (fast) "" " 1 (fast) "" " 1 (fast) "" " 1 (fa		-										•	1	1	-		_		*	1	*	1	+ 1	0	***
Wheels, 3'' and 3'' an		Crank Handler		: 5	:	:	:	:					_	١.	1	Ų.	1	1	1	1	1	24	53	2	
Pulley Wheels, 3" " " " " " " " " " " " " " " " " " "		Crams Handles	2 5	iant	:	:	:	:	1	1	1	1	1	-	_	1	_	1	_	1	-	53	8	1	
Pulley Wheels, 3"  Fanged Wheels, 1"  Fanged Wheels			103	"	:	:	:	:	_	1	-	1	_	1	_	1	_	1	_	1	-	1	-	1	
Pulley Wheels, 2***  Pulley Wheels, 1***  """ 1 (floxe)		wheels, 3	:	:	:	:		:	1	I	1	1	1	I	1	I	ı	1	1	4	4	1	4	1	
Flauged Wheels, 14"	_	Pulley Wheels,	3"	:	:	:	:	:	1	1	1	4	4	1	4	1	4	1	4	1	4	1	4	1	
Pulley Wheels, 2"	-	Flanged Wheels	S, 11	:	:	:	:	:	1	-	1	1	1	1	1	1	1	4	4	1	4	4	00	4	_
Flanged Wheels, if the control of th		Pulley Wheels,	2"	:	:	:	:	:	1	1	1	1	1	1	1	2	2	2	4	1	4	. 1	4	1	•
Pulley Wheels, 1½		Flanged Wheels	, S.	:	:	:			1	1	-	1	1	4	4	1	-	1					•	9	•
Bush Wheels. "" " " " [fast] " " " " " " " " " " " " " " " " " " "		Wheels	11						1					-	-	•	_			١.	+ 0	1	+ 0	0	3 .
Bush Wheels, 3° diam, 1° wide		, con	10 /60	: ;	:	:	:	:	1				1	1	1	_	_	1	_	-	21	1	67	23	
Bush Wheels, if (fast)			1 (19	118	:	:			*	1	4	1	4	1	4	1	4	1	4	1	4	7	9	4	-
Bush Wheels. If (fast)	_		01)	(eso	:	:	:	:	1	1	1	1	1	23	61	1	61	-	8	1	8	-	4	Ξ	1
Bush Wheels, "" (last)			-		:	:	:	:	1	_	_	1	1	1	_	1	_	64	3	1	3	-	4	2	
Bush Wheels, "" " " " " " " " " " " " " " " " " "			ş* (fa	st)	:	:	:		1	1	1	1	1	1	1	1	1	-	-	1	-	1	-	3	
Pinion Wheels, 3" diam, 1" wide		Bush Wheels	:	:	:	:	:	:	-	1	_	1	1	1	-	1	-	-	23	1	2	65	10.	6.	
" " " # " " # " " " " " " " " " " " "		Pinion Wheels,	3" dia	m., 1	wid.	e .	:		1	1	1	1	1	1	1	1	1	1		-	1			0	
Gear Wheels, 50-teeth				-					1	1	-	-	-									4	4		
Gear Wheels, 50-teeth			. :													9	1 9	1	1 '	1	1	1	1	-	
Gear Wheels, 50-teeth					٠,		:	:	1	1	1	1	1	1	1	.4	.71	1	24	-	8	67	2	4	-
Gear Wheels, 50-teeth			<b>6</b> 1		,	i	:	:	1	1	1	1	1	1	ļ	I	1	1	1	1	1	1	1	67	-
Contrate Wheels, 1 <sup>4</sup>		Gear Wheels, 50	-teeth	:	:	:	:	:	1	1	1	1	1	1	1	1	1	1	1	1	1	2	61	8	-
Contrate Wheels, 14"				:	:	:	:	:	1	1	1	1	1	1	1	-	-	-	67	1	67	-	8	4	•
Contrate Wheels, 1½"         1         1         1         1         2         2         2         2         2         2         4         4         4         4         4         4         4         4         4         4         4         4         2         2         2         2         2         2         4         4         4         4         2         2         2         2         2         4         4         4         4         4         2         6         2         3         2         4         4         4         2         6         2         3         4         3         4         3         6         14         1		, , , 133		(31	diam	·	:	:	1	1	1	1	1	1	1	1	1	1	1	1	1	1	I	6	•
Bevel Gears, \( \tilde{I}_{\tilde{I}}^{\tilde{I}} \), \( \tilde{I}_{\tilde{I}}	-	Contrate Wheels	S. 14"	:					1	1	1	1	1	1	-			•	-		•	٠	•	1	•
Bevel Gears, \$\beta^*\$		:	104	:	:				1	1	1	1	1	1	١	1						•	4 0	1	• •
Gear Wheels, I', 38-teeth		Bevel Gears, 3"							1	1	1							1	1		1		4		•
Gar Wheels, 1°, 38-teeth		•		:			:	:										1	1	1	I	l	1	4	
Gar Wheels, I', 38-teeth		11.	:	:		:	:	:	I	1		1	1	1	1	1	1	1	1	1	1	1	1	5	•
Verial Wiley Streeth         1         1         1         1         2         2         4           Spanners         2<		Care Wheele 1"		:::	:	:	:	:	1	1	1,	1	1	1	1	1	1	1	1	1	1	1	1	63	•••
Worms         Spanners         1         1         1         2         3         4         1         1         1         1         1         1         1         1         1         1         1         1         1         1         1         2         2         2         2         2         2         2         2         2         2         1         1         1 <t< td=""><td></td><td>Gear Wheels, 1</td><td>, 35-10</td><td>eth</td><td></td><td>:</td><td>:</td><td>:</td><td>1</td><td>1</td><td>1</td><td>1</td><td>1</td><td>1</td><td>1</td><td>1</td><td>1</td><td>1</td><td>1</td><td>1</td><td>1</td><td>1</td><td>1</td><td>4</td><td>4</td></t<>		Gear Wheels, 1	, 35-10	eth		:	:	:	1	1	1	1	1	1	1	1	1	1	1	1	1	1	1	4	4
Spanners         Spanners           Spring Clips         4         2         6         2         8         6         14         -1         1         2         -2         -2         -2         -2         -2         -1	_	Worms	:	:	:	:	:	:	1	1	1	1	1	1	1	-	-	-	2	1	2	1	2	1	64
Spring Clips          4         2         6         2         8         6         14         5         19         7         24         12           Scewa Drivers           1         -         1		Spanners	:	:	:	:	:	:	1	-	-	1	-	1	-	1	-	-	.7	1	2	1	67	1	cA
Screw Drivers , (special) ,		Spring Clips	:	:	:	:	:	:	4	67	9	61	80	9	14	1	14	10	19	1	19	10	2.4	10	36
Nuts and Bolts, 7/32"		Screw Drivers							-	1	-	1			-			)				,		7	3 '
Nuts and Bolts, 7/32*		s)	necial	: _		:			1		•		•		•	1	-	1 -	٠.	1	- ,	1		1	٠,
Nuts and bolts, 7/32 16 — 16 20 36 24 60 34 94 32 126 43 169 145 314 280  Nuts 4 2 6 — 6 — 6 — 6 — 6 — 6 — 6 — 6 — 6 —  Washers		W. t. and Dollar	- 1000		:	:		:	1 :	1	1 :	1 :	1	Į.	1	1	1	-	-	1				177	-
Washers		vales and poits,	-	:	:	:	:	:	16	1	16	50	36	24	9	34	94	32	126	43		200			94
Washers		Nuts	:	:	:	:	:	:	4	63	9	1	9	1	9	1	9	1	9	1		7-5			9
Hanks of Cord		Washers	:	:	:	:	:	:	1	1	1	8	8	9	14	1	14	10	24	1	9.4	-			50
Propeller Blades		Hanks of Cord	:						-	1	-	1		, -	: 0	-	: 0	: -	; -	0	5 0		_	400	3 0
A LOUGHE LINE OF THE LOUGH AND A PARTY OF THE	1000	Propeller Blades						:			•			•	4	•	9	•	*	N f	0	3 6	0	1	0

ភូមិ ឬ ឬ ឬ ឬ ឬ ឬ ឬ ឬ ឬ ឬ ឬ ឬ ឬ ឬ ឬ ឬ ឬ ឬ ឬ	Springs					Ī	Ī				Ī							Ī				1
ăă	anked Bent Strips	: :	: :	1 1	: :	:	1 -	1 1	1 -	1.1	-	1 1	1 -	-		1.1		1			01 0	
Ă	Double Bent Strips	:	:		:	:	1	1	١.	1	• 1	-		-	- 61	-	, 69	1	- 6	- 60	7 9	
72 46 42 8 6 6 7 7 7 8	Double Angle Strips,	, 2½" × 1"		:	;	:	1	1	Ī	1	1	1	1	-	-	-	2	27	4	1	4	
		2½"×1½"	1	:	:	:	1	1	1	1	1	1	I	1	1	1	1	_	-	-	5	- 1
		× %	×14	:	:	:	1	1	1	1	1	1	1	1	1	1	1	67	67	1	61	- 1
	:	×	-	:	:	:	I	1	1	-	-	1	-	-	23	1	61	1	53	2	4	
		X 44 7	-	:	:	:	73	1	64	4	9	61	œ	61	01	1	10	1	10	4	4	
	u	X 45	i in		:	:	I	1	1	1	Ī	1	I	63	67	4	9	i	9	,	7	
		444	-	:	:	:	1	1	1	1	1	1	Ī	1	1	1	1	1	1	က	3	
		X		:	:	:	1	1	1	I	1	1	I	1	1	67	61	2	4	1	7	
Đ,	Eye Pieces, with boss	S		:	:	:	1	I	Ì	Ī	1	1	1	I	1	1	1	-	-	-	2	- 1
ď	Perforated Flanged	Plates, 5½"		×24	:	:	-	1	-	1	-	Ī	-	-	23	1	61	5	4	8	7	- 1
Ξ	Flat Plates, 5½"×3½"	:			:	:	1	1	1	1	1	1	1	1	1	1	1	4	4	1	4	
Ď	Perforated Flanged Plates, 31	Plates		×25	:	:	1	1	1	I	1	1	1	8	3	62	S	1	2	2	7	- 1.
Ξ	Flat Plates, 4½"×2¾"	:	:	:	:	:	Ī	1	1	1	1	1	I	I	1	1	1	23	23	23	4	C
P	Perforated Flanged	Sector Plates	Plate	s	:	:	1	1	Ī	63	61	Ī	2	I	22	1	61	1	67	1	ci	-
	" Strips, slotted,		5.	:	:	:	1	1	1	I	1	1	1	1	1	1	1	1	1	1	1	
M	Meccano Standard Mechanisms Manuals	fechar	isms	Manua	Is	:	1	1	1	I	1	1	J	1	1	ı	I	-	-	1	-	
	How to use Meccano Parts	no Pa	ts.			1	1	1	1	1	1	1	1	-	-	1	-					
777	Hooks	;					-	1	-	1	-	1	-	•		1		-		1 7	- 0	
	Loaded						1	١	1	1	•	ı	•	ı	•	1	•		1			•
((2.5	Spring Cord. 40" len	eth					1	1	1	I		-							ı	٠.		
	Coupling Screws for Spring	Spring	Cord			2	1	1		1									1	-	-	1.3
_	Collars with Set Screws	SWS.			: :	:	١	1	1	1				4	7	2	1 5	1 0				2 3
_	Cranks						I	1	1	I		0	0	.		1		0	9		67	
•	ed Cranks						1	1	1	1		,	1		1		1		4	1 0	+ 0	2
	Double Arm Cranks					:	1	1	ı								1	1 0	1 9			1 8
	Countings	:	:		:	:					1		1		١.	"	1 9	.4	71 0	1 9	7	4
	Strip Couplings	:	:		:	:					ı		1	-	-	0	٥	1	9	20	5	4
	Threaded Bosese	:	:	:	:	:			i	1		1	1	1	ı	1	1	ı	1	21 (	24 (	1
	mtantu rossus	:	:	:	:	:	1	1	ı	I	1	1	1	1	1	1	1	1	1	8	8	
-	Flat Diator 51" Col	:	:	:	:	:	1	1	1	1	1	1	ı	1	1	-	-	1	-	-	2	
	at Flates, 54 × 24	:	:	:	:	:	1	Ì	I	I	1	1	1	1	1	1	1	-	-	2	9	
		:	:	:	:	:	1	ĺ	Ī	I	1	1	1	1	I	1	1	1	1	2	73	
	Iriangular Plates, 24		:	:	:	:	I	1	1	1	1	1	1	1	1	1	1	1	1	67	5	-
_		:	:	:	:	:	1	I	I	1	1	1	1	1	1	7	2	1	73	2	4	-
_	Screwed Kods, 114	:	:	:	:	:	1	I	I	1	1	1	1	1	1	1	1	1	1	1	1	CA
		:	:	:	:	:	1	1	1	1	1	1	1	1	1	1	1	1	1	1	1	
	2	:	:	:	:	:	1	1	1	1	1	1	1	1	1	-	-	1	-	1	5	
	"	:	:	:	:	:	1	ı	I	1	1	1	1	1	1	1	1	1	1	67	5	- 1
	" 2"	:	:	:	:	:	1	1	1	1	1	1	1	1	1	1	1	1	1		-	_
	:	:	:	:	:	:	1	1	1	1	1	1	1	1	1	1	1	1	1	1	6 1	· O
	ed Strips, 5	" rad	ins .	:			1	1	1	1	1	1	1	1	1	1	1					9
	21. 15	large					1	1	1					c		_	٠,	, , 5/5	_		0 0	
		93"	•	:	:	:	0	10	1 -	1	1 .	ı	1 '	N	N -			N	_		-	13
	Sprocket Chain	:				: :	1	4	-	11	+	11	+	11	+	40"	404	1 1	4 %	+ ù	χò	20
	Wheels,	2"	:	:	:	:	1	1	1	1	1	1	1	1	1		0	1 1	-	_		N
		t rejons	:	:	:	:	1	1	1	1	1	1	1	1	1	_	1	ī	_	_	_	6.00
		:	:	:	:	:	1	1	1	1	1	1	1	1	1	1	1	1	1	_	_	5 63
	ĸ		:	:	:	:	1	1	1	1	1	1	1	1	1	01	23	1	63	64		9
	Braced Cirdore 91"		:	:	:	:	1	1	1	1	1	1	1	1	I	_	_	1	_		-	-
	an ne	:	:	:	:	:	1	1	1	1	ı	1	ī	1.	1	1	1.	i	1.		NEW S	_
	124"	: :		: :	: :	:	11	11	11	11	11		10	-	- 6	10	-	ı		_		15
	: :	:	:	:	:		1	1	1	1	1	1	1 1	1	1	1	- 1	1	r	_		2
_	, 11 m	:	:	:	:	:	Ī	Ī	1	i	1	1	1	1	1	1	1	1				-
_	- 13	:	:	:	:	:	1	1	Ĭ	67		1		1	67	7	9	_	7	_	00	œ
	ards for Looms	:	:	:	:	:	1	1		1	1	1	1	1	1	I	1	1.	1.	1.		0
	at Girders, 54"	: :			: :		1	I	1 1	1 1	1 1	1 1					1	-	_	_	21	117
103A	91"	:	:	:	:	:	1	1	1	I	1	1	1	1	1	1	1	1	11	6	_	. 0
*	, " 124,"	:	:	:	:	:	ī	ı	1	1	1	1	1	I	Ĭ	1	L	1	1	10	-	CA
	#TE	:	:	:	:	:	ı	1	1	1	ı	1	i.	ī	1	1	1	1	1	1	1	4
	33				: ;	-			1								1	1	1	1	,	00
	n 21"	:	:	:	:		1	I	1	1	1	1	1	1	1	67	2		1 7	0.	1 1	0 1
	2"	:	:	:	:	:	1	1	1	1	1	1	1	1	1	1	1	1	- 1	1		0
		:	:	:	:	:	1	1	1	1	1	1	1	1	1	1	1	1	1	-		T IC
	17 7	:	:	:	:	:	1	1	1	1	-	1	1	1	1	1	1	1	1	1	C F	CA
	Reed Hooks	:	:	:	:	-	1	1	1	1	1	1	1	1	1	-	1	1	1	1	-	-
	od Rollers		:	:	:	:				1			1	1	1	1	1	1	1	1	-	- 6
	pr			:	:	:			1						1	1	1	1	1	1	,	N .
	signing Tables	:		: :	: :		-	1	1	1	1	1 1	1 1	1 1	1 1		1 1	1 1	1 1	1 1		-
	Architraves	:	:	:	:	:	1	1	1	1	1	1	1	1	1	2	2		_		477.00	10
Fac	ce Plates, 24"	:	:	:	:	:	1	1	1	1	1	1	1	1	1			_	7			11
Ra	ck Strips, 34"	:	:	:	:	:	1	1	1	1	1	1	-	1	1	1		. 1		-		
Bol	its, 2"	:		:	:	:	1	1	1	1	1	1	1	2	23	-	3	1	8	9 6		10
		:		:	:	:	1	k.	1	1	1	1	1	1	1	1	1	1	_		-	-
T.		:	:	:	:	:	+	7	9	1	9	1	9	1	9	1	9	-	9	Second		-
Thr	Threaded Pins	:		: :	:	:	1 1		1 1	1 1	1	1 -	1-	1.	10	1	1 :	1	1	10	631	
For	k Pieces				:	: :	- 1	1				- 1		-	4 -	1 1	4-		-		-	
Smo	"Il Danie Diagon																					ï

meccanoindex.co.uk

### Contents of Outfits-continued

-	2 400444040044001010100100444110040001111011100000111111	
9	₹   x x x x y y   x   x   x   x       4 x y x x   x     y y y y x   y   x   x	
	0 -0 0 444 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0	1111111111111111111111
16	¢   -∞   ω   4       -           ∞-44	11111=====111111111111111111
10	n	
4	\$	
4	4	11111111111111111111111111111111
3,4	ξ       αα  α     4    -  -  -   -	111111111111111111111111111111111111111
60	0               400	111111111111111111111111111111111111
2,4	5	11111111111111111111111111111111111
- 67	3             400	111111111111111111111111111111111111111
	<u> </u>	111111111111111111111111111111111111111
-		111111111111111111111111111111111111111
	<u> </u>	111111111111111111111111111111111111111
-0		
-V00	<u> </u>	
00		
_	5	
1		· · · · · · · · · · · · · · · · · · ·
RT.		raphi
DESCRIPTION OF PART.	The control of the co	ith-speed Ship-Coaler totor Cycle and Sidecar refger
NO NO		eed Ship-Coalerry yele and Sideca and Sideca and Sideca and Scales
IPTIC	Descurrion of particular plants of particular plant	gh-speed Ship-Cor Chassis C.  thor Cycle and Si cedger
ESCR	beginners of the property of t	
"	Discs (Jacca)  In Couplings  Trumions  Trumion	Motor of Motor of Motor of Motor of Motor of Platforn Bagatel Log Saw Log Stone is a Meccan Meccan Meccan Meccan Meccan of Motor
ı	Train Couplings  Compression Springs  Train Couplings  Train Couplings  Train Couplings  Train Couplings  Train Couplings  Rack Segments (3' diam.)  Boss Bell Cranks  Boss Bell Cranks  Theodolite Protractors  Handrail Supports  Hondrail Supports  Hondrail Supports  Hondrail Supports  Hondrail Supports  Wheel Flanges  Universal Couplings  Treodolite Protractors  Handrail Supports  Wheel Flanges  Universal Couplings  Rubber Rings, 3' diam.  Dunlop Tyres, 2' internal diam  Circular Strips (34' diam.)  Boy Clutches.  Circular Strips (34' diam.)  Dog Clutches.  Rubber Rings, 4' min the nots  Pawis  Pates, 6' min Pat	22
	Hub Dises (54" diam.). Channel Segments (8) to compresso (54" diam.). Channel Segments (8) to compresso (54" diam.). Spring Buffers Truminons Flat Truminons Flat Truminons Flat Truminons Flat Truminons Flat Truminons Place Backets Comer Barckets Theodolite Protractors Flywheels .2" Theodolite Protractors Wire Lines Handrall Supports Whie Lines Rubber Rings, 3" diam. Dualop Tyres .2" internal Circular Circlers (54" diam. Bullop Tyres .2" internal Circular Strips (74" diam. Ball Flood Barchets Circular Strips (74" diam. Carcular Strips (74" diam. Ball Flood Barchets Circular Strips (74" diam. Ball Flood Barchets Circular Saws Circular Saws Chinmey Adaptors Soleve Brides Flood Barchets Flood Barchets Flood Barchets Flood Barchets Contact Screws Flood Barchets Flood	S : : : : : : : : : : : : : : : : : : :
· ·		
No.	118 1190 1190 1190 1190 1190 1190 1190 1	

Full instructions for building a fine range of models are included with each Outfit.

### **MECCANO**















The Meccano Magazine is the Meccano boy's own newspaper. It tells him of the latest Meccano models; what Meccano Clubs are doing; how to correspond with other Meccano boys; the Competitions that are running, etc. It contains splendid articles on such subjects as Railways, Famous Engineers and Inventors, Electricity, Bridges, Cranes, Wonderful Machinery, Aeronautics, Latest Patents, Radio, Stamps, Photography, Books and other topics of interest to boys, including suggestions from Meccano boys for new Meccano parts and correspondence columns in which the Editor replies to his readers' enquiries. The publishing date is the first of each month. If you are not already a reader of the Meccano Magazine write to the Editor for full particulars, or order a copy from your Meccano dealer or from any newsagent.



The World's Best Magazine for Boys

## INDEX TO MODELS

		Model No.	Description.
Acrobat on See-saw	: :	1.56	Clay Modelling Mach
: :	: :	0.99	Clock Grandfather
u	: :	00·106 00·114	E.
View T	:	00.53	
Wire L	: :	00.103	
Vire T Wire T	: :	00.112	
0 0	20; 0	1.296. 2.29;	
	.:	00.120; 2.28	Coco-nut Shy
:	::	0.73; 0.105	
: :	: :	0.33	
: :	::	0.160; 1.43	Cow and Milkmaid
:	:	00.1	" Breakdown
: :	: :	00.21	" Elevated
chine	: :	0.52; 1.6	" Gantry Tib
:	: :	1.106	Grab
: :	:	1.96	Jib
: :	: :	8.08	" Lorry
: :	: :	0.69; 1.229	" Mobile
::	23;	0.142; 1.59	". Overhead Patent Luffin
:		.116; 1.164	" Radial Travel
1-14;	.15	1.19; 1.20	" " " Wag
: :	::	0.18; 0.144	" Kevolving
:-	:	0.150	" Rotating
:	80	179; 1:167	" Swiveling
::	: :	3.6	" Travelling
: :	1 :	00.36; 0.36	ar in the
:	:	00.155	Crocodile
ar	1 1	1.179	Crossbow
: :	: :	00.98	Crosshead Demonstra
: :	; ;	1.123	Cum-bak
:	: :	1.83	Cutlery Basket
: :	: :	1.3; 1.127	Dancer, The Meccane Dancers, Eccentric
aw	: :	1.148	Derrick
ith Sig	als	4.8	Devil Wall
: :	: :	0.32	Dinosaurus
;		1.67: 4.17	Diplodocus Disappearing Meccar
::	: :	4.56	Distance Indicator Dividers
: :	: :	0.151	Dog
::	: :	2.41	Drafting Machine
: :	::	0.101; 3.14	" Automatic
itus	: :	3.36	Rock
:	: :	4·14 00·26	Drinking Trough
	: :	00.49; 1.42	Dump Car
: :	1 1	00.19	Easel
: :	:	4.0	Electric Loco
	178	1.207	" Car Electric
: :		00.35	Embossing Machine Emery Wheel
: :	: :	1.185	Engine, Beam
::	: :	0.37; 0.102 2.34	" Two-cylinder
" Bath00-	: 19	161; 0·148; 1·55	Extended Ash Tip
::	: :	0.136	Fan Ceiling
eou.	. :	0.153	Farm Sight
: :	: :	90.00	Fire Alarm
			III

;	1.23 1.25 1.25 1.25 1.25 1.157 1.157 1.157 1.157 1.157 1.157 1.157 1.157 1.157 1.157 1.157 1.157 1.157 1.118 1.197 1.28 1.199 1.28 1.38 1.28 1.38 1.	0.00
0 0	Govenor, Centrifugal Engine  "amonhone Granophone Gravel Sifter Gravel Sifter Grilder, Coffee Grullotine " Guillotine " Big " " Field, and Carriage " Field, and Carriage " Naval Quick firing Gyroscope " Machine " Hark Saw, Power Hammer, Double Drop Hammer, Double Drop Harmock " Hark Saw, Power Hand Punch Hardet " Hardet " Hand Punch Hardet " " Hardet " Ha	
Model No. 00.38 1.1.1.1.1.1.1.1.1.1.1.1.1.1.1.1.1.1.1.	7 7 7 7 7 7 7 7 7 7 7 7 7 7 7 7 7 7 7 7	5; 1-173; 3-1 600-57 100-57 11-133 11-129

1.105

# INDEX TO MODELS (continued)

Description.  Swing Alternating  " Boat Automatic Switch " Automatic Switch " Collage " Collapsible " Collage " Collapsible " Collage " Collapsible " Collage " Collapsible " Collage " Collage Mast Telescope Mast Telescope Mast Telescope Mast Telescope Telescope Telescope Telescope Telescope Telescope Telescope Telescope Mast Telescope Mast Rack" Transpler Span Transpler Transpler Span Transpler Transpler Span Transpler Tra	Walking Man  Warehouse Warehouse Warch and Chain Watch and Chain Wall Driller Well Driller Windlass Windlass Windmill Wiretal Wiretal Wiretal Wiretal Wiretal Wacht  **Aoth **Lend **Lend **Lend **Lend
Models (197) (198) (197) (198) (197) (198) (197)	Stam Engine, Under type
Lathe Elliptical	

Patents and Designs
Great Britain
250,378 671,485
253,236 671,534
290,121 671,790

680.416

682,208

323,234

671,484

### MECCANO

THE TOY THAT MADE ENGINEERING FAMOUS

Millions of boys in every country throughout the world play with Meccano.

These are the Meccano Factories and distributing centres.

Patents and Designs Great Britain

682,209 718,404 682,934 718,731 683,011 733,541 686,112 733,542 698,054 740,413

Canadian Office and Warehouse: Meccano Ltd., 34, St. Patrick Street, Toronto.




London Office and Warehouse :

Meccano Ltd.,

Walnut Tree Walk.

Kennington Road, London, S.E.11.

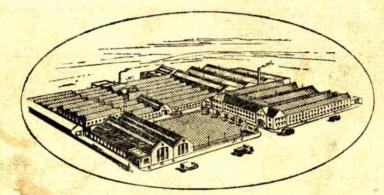

Head Office and Factory: OLD SWAN, LIVERPOOL.

### Meccano Agencies :

Amsterdam, Asuncion, Auckland, Barcelona, Basle, Batavia, Bogota, Bombay, Buenos Aires, Calcutta, Cape Town, Caracas, Colombo, Constantinople, Durban, Genoa, Guavaquil, Helsingfors, Hong Kong, Iquitos, Jerusalem, Johannesburg, Karachi, Mexico, Monte Video, Rio de Janeiro, Santiago, Sao Paulo, Shanghai, Stockholm, Sydney, Trinidad, Vienna. Meccano G.m.b.H., Berlin SW.68, Alte Jakobstrasse 20-22.



Meccano (France) Ltd., 78-80, Rue Rébeval, Paris XIXemc.