

# MECCANO

(TRADE MARKS 296321, 501113, 76, 12633, 10274, 55/13476, 589/13, 884/25, 2913, 80, 124, 356, 18086, 5408, 41812, 4174, 9048, 5548, 2389, 91637, 83171, 157149, 32822, 200839, 209783, 214061, 214062, 12892, 29084, 33816, 1818, 16737, 16900, 72236, 494935-4-5-6, 139420, 383/13, 5348, 50204, 10/12258, 22826, 18982, 20083/925, 2189, 7315, 29041, 26877, 6595, 464718, 410379)

HORNBY'S ORIGINAL SYSTEM-FIRST PATENTED IN 1901

# INSTRUCTIONS

FOR OUTFITS


Nos. 4 to 7

Price 1/6

Copyright by MECCANO LIMITED, LIVERPOOL, throughout the world

No. 30

**ENGLISH EDITION** 

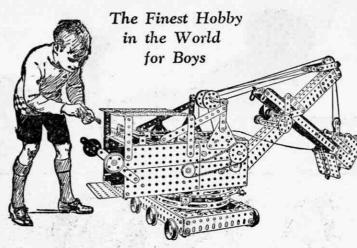

## MECCANO

#### REAL ENGINEERING IN MINIATURE

The Meccano system is composed of over two hundred and fifty different parts, mostly made of steel or brass, each one of which has a specific mechanical purpose. These parts combine to form a complete miniature engineering system with which practically any mechanical movement may be reproduced in model form. More can be accomplished with Meccano than with any other constructional toy, for no other system has such possibilities. The genius is in the parts and you can commence to build models as soon as you get your Outfit home. A screwdriver, provided in the Outfit, is the only tool necessary

There is no limit to the number of models that can be built with Meccano—Cranes, Clocks, Motor Cars, Ship-Coalers, Machine Tools, Locomotives—in fact everything that interests boys. The most wonderful feature about the system is that it is real engineering; it is fascinating and delightful and it gives you a satisfaction beyond anything that you have ever previously experienced.

#### HOW TO BUILD WITH MECCANO

Make the simplest models first—they will provide hours of fun—and then try to improve them. Every model can be made in a dozen different ways. It is important to screw up all the nuts and bolts tightly to ensure that your models will be strong and firm when they are completed.

Meccano is sold in ten different Outfits, numbered 000 to 7. All Meccano parts are of the same high quality and finish, but the larger Outfits contain a greater quantity and variety of parts, making possible the construction of more elaborate models. Each Outfit from No. 00 upwards may be converted into the one next higher by the purchase of an Accessory Outfit. Thus a No. 3 may be converted into a No. 4 by adding to it a No. 3a. A No. 4a then converts it into a No. 5 and so on up to No. 7. In this way you may build up your Outfit by degrees until you possess a No 7. It is important to remember that Meccano parts may be bought separately at any time in any quantity from your Meccano dealer.

All models shown in this Manual are numbered and for reference purposes each model number is preceded by the number of the Outfit with which it may be built. Thus, for example, model No. 4.26 may be built with No. 4 Outfit, and model No. 6.15 with No. 6 Outfit.

#### MECCANO SERVICE

The service of Meccano does not end with selling an Outfit and an Instruction Manual. When you want to know something more about engineering than is now shown in our books, or when you strike a tough problem of any kind, write to us. We receive over 200 letters from boys every day all the year round. Some write to us because they are in difficulty, others because they want advice on their work or pleasures, or about the choice of a career. Others, again, write to us just because they like to do so and we are glad to know that they regard us as their friends.

Although all kinds of queries are put to us on all manner of subjects, the main interest is, of course, engineering. No one has such a wonderful knowledge of engineering matters as that possessed by our staff of experts. This vast store of knowledge, gained only by many years of hard-earned experience, is at your service. We want the Meccano boy of to-day to be the famous engineer of to-morrow.



#### THE "MECCANO MAGAZINE"

The Meccano Magazine is the Meccano boy's own newspaper. It tells him of the latest Meccano models; what Meccano Clubs are doing; how to correspond with other Meccano boys; the Competitions that are running, etc. It contains splendid articles on such subjects as Railways, Famous Engineers and Inventors, Electricity, Bridges, Cranes, Wonderful Machinery, Aeronautics, Latest Patents, Radio, Stamps, Photography, Books and other topics of interest to boys, including suggestions from Meccano boys for new Meccano parts and correspondence columns in which the Editor replies to his readers' enquiries. The Magazine is published on the first of each month. Write to the Editor, Meccano Magazine, Old Swan, Liverpool, enclosing 6d. in stamps, and giving the names and addresses of three of your chums who are not Meccano boys. He will then forward a specimen copy of the "M.M." post free. If you wish to become a regular subscriber the rates are 4/- for six issues or 8/- for twelve issues, post free. If you prefer to do so, you may order the Magazine from your Meccano dealer or from any newsagent or bookstall, price 6d.

## MECCANO STANDARD MECHANISMS


There are many Meccano movements that have to a certain extent become standardised; that is to say they may be applied to more than one model, in most cases without any alteration, but in some few instances with only slight alterations to the original movement. These have been collected and classified, and may be obtained in the form of a Manual entitled "Meccano Standard Mechanisms." This Manual describes in detail various belt and rope mechanisms, roller and ball bearings, screw mechanisms, gear boxes and gear ratios, etc. Every Meccano experimenter has need of this useful book.

STANDARD MECHANISMS

POWER 161 (1971)

POWER 161

You may obtain a copy of the "Standard Mechanisms" Manual from your dealer, price 1/-, or direct from Meccano Ltd., Old Swan, Liverpool, price  $1/1\frac{1}{2}$  post free.

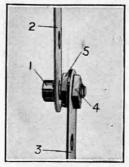

S.M. 262

#### SIMPLE MECCANO PIVOTS


In building Meccano models it is frequently required to attach two parts together so that one or both are quite free to swivel. A very simple way to do this is shown under detail number 262 in the "Meccano Standard Mechanisms" Manual, and for the benefit of those readers who are unable to consult the special Manual, we have reproduced this detail. As will be seen, it consists of a simple type of pivot or swivel bearing formed by a bolt and two nuts. The bolt is secured rigidly to a Strip or Plate, etc., by means of the nuts, which are secured tightly against opposite sides of the Strip, sufficient space being left beneath the head of the bolt to permit another Strip to turn freely about its shank.

A somewhat similar form of swivel-joint, also widely used, consists of a bolt and lock-nuts (Standard Mechanism No. 263). The two Strips to be connected pivotally are placed on the bolt and held in position by two nuts locked together on the shank. The Strips must be allowed a certain amount of play so that they can pivot independently about the bolt. These pivoting devices will be found equally valuable in the simplest and the most elaborate models.

## Particulars of Meccano Parts

7. 24½" 9b. 3½" 46 45. Double 8. 12½" 9c. 3" 47 48 48 95. 5½" 9c. 3" 47 48 48 48 10. Flat Brackets 9f. 1½" 48d 48c 48c. 11. Double Brackets 48c 48c 48d 12. Angle Brackets, ½" ½" 50a. Eye Pinton Wheels, 3" diam., with set screws 13. 11½" 18b. 1² 55a. 18b. 1² 55b. 18b.			1 all	iculari	OL	ATC	cca
11. 124"			Perforat			No.	
1a. 91" 1b. 71" 1b. 72" 1c. 5. 24" 1d. Hankse 2. 55" 6a. 1½ 1d. Propell 33. Springs 44. Cranke 34. Lege 15. 244" 15. Angle Girders 14. Cranke 15. Double 16. 12½ 17. 99c. 3" 17. 184 185 19. 11½ 185 11. Double Brackets 12. Angle Brackets 13. 11½ 14. Axle Rods 13. 11½ 15. 11½ 16. 3½ 16. 3½ 17. 2" 18b. 1½ 17. 2" 18b. 1½	2000			No.			Nuts and
1b. 7½"			121"	3. 31"	- 1		Weekers
2. 5½" 6a. 1½"			91"	4. 3"		38.	Hanks of
2a. 4½"		16.	71"	5. 24			
7. 24½"			54"	6. 2	-		
7. 24½" 9b. 3½" 4f. 45. Double 8b. 12½" 9c. 3 47 48a. 9½" 9c. 3 48b. 7½" 9c. 2 48a. 18b. 7½" 9c. 2 48b 48b. 11. Double Brackets 48b. 12. Angle Brackets, ½" ½" 50a. Eye Pid. 1½" 12a. 1" 1" 1" 50a. Eye Pid. 1½" 12b. " 1" 1" 1" 50a. Eye Pid. 1½" 12b. " 1" 1" 1" 50a. Eye Pid. 13a. 8" 16b. 3" 52a. Flat Pl. 15b. 5" 18a. 1½" 55a. 18a. 1½" 55a. 18a. 1½" 55a. 18a. 1½" 55a. 18b. 1" 55a. 19b. 19b. 3" diam., with set screws 19b. " 20b. " 20		za.	4 to Apple			44.	Cranked B
7a. 18½" 9b. 3½"		7	241" Angle	1 90 41"			
8a. 9½" 9d. 2½" 47a 17a 8b. 7½" 9d. 2½" 48 48b. 7½" 10. Flat Brackets 11. Double Brackets 12. Angle Brackets, ½" ½" 48d. 12a 12b 1½" 1" 50a. Eye Pirate Parkets 12b 1" ½" 50a. Eye Pirate Parkets 13. 11½" 16b. 3" 52. Flat PI 12b 1" ½" 52. Perfora 52a. Flat PI 12b 17 2" 54. Perfora 53a. Flat PI 14. 6½" 17 2" 54. Perfora 53a. Flat PI 15. 5" 18a. 1½" 55 18b. 1½" 55 18b. 1½" 55 18b. 1½" 55a. 18c. 1½" 55b 56b 56b 56b 56b 56b 56b 56c. Meccar 19b. 3" diam, with set screws 56e. Meccar 20b. "" "" "" "" 56c. Meccar 56d. "" "" "" 57b. 56c. Meccar 56d. "" "" "" 57b. 56c. Meccar 56d. "" "" "" 57b. 57c. "" 57c. "		70	181"	9b. 31		46.	" At
8a. 9½" 9d. 2½" 47a. 8b. 7½" 9e. 2"" 48b. 7½" 9e. 2"" 48b. 10. Flat Brackets 48b. 11. Double Brackets 48b. 12. Angle Brackets, ½" ½" 48d. 48c. 12. Angle Brackets, ½" ½" 50a. Eye Pilot. 12b. " 1" ½" 50a. Eye Pilot. 12b. " 1" ½" 50a. Eye Pilot. 13a. 1½" 16b. 3" 52a. Flat Pl. 15b. 3" 16b. 3" 52a. Flat Pl. 15b. 5" 18a. 1½". 55a. 16b. 3½" 16b. 3½" 55a. 16b. 3½" 55a. 18b. 1½". 55b. 19b. 3" dia. with centre boss and set screw 56e. Meccar 20b. " Pulley Wheels 19b. 3" dia. with centre boss and set screw 57b. Hooks 19c. 6" " " " " " " " " " 56b. 56c. Meccar 20b. " " " " " " " " 55b. 37a. S 57a. S 57a. S 57a. S 57b. 11 1½" " " " " " " " 58b. 12" " 57b. 11 1½" " " " " " 58b. 12" " 57b. 11 1½" " " " " " 58b. 12" " 57b. 11 1½" " " " " 58b. 12" " 57b. 11 1½" " " " 58b. 12" " 57b. 11 1½" " " " " 58b. 12" " 57b. 11 1½" " " " " 58b. 12" " 57b. 11 1½" " " " " 58b. 12" " 57b. 11 1½" " " " " " 58b. 12" " 57b. 12 1 1½" " " " " " " " 58b. 12" " 57b. 12 1 1½" " " " " " " " 58b. 12" " 57b. 12 1 1½" " " " " " " " " 58b. 12" " 57b. 12 1 1½" " " " " " " 58b. 12" " 57b. 12 1 1½" " " " " " " 58b. 12" " 57b. 12 1 1½" " " " " " 58b. 12" " 57b. 12 1 1½" " " " " " " 58b. 12" " 57b. 12 1 1½" " " " " " " 58b. 12" " 57b. 12" " " 57b. 12" " 57b.		8.	121"	9c. 3			
8b. 7½" 9f. 1½" 48a 10. Flat Brackets 48b 48c 11. Double Brackets 48c 48d 12a 12b 1½" 12b			91"	9d. 24"			"
10. Flat Brackets			71"	9e. 2"			**
10.   Flat Brackets			51"	9f. 1½"			
11. Double Brackets		10.	Elat Brackets				(86)
12b.		11.	Double Brackets				,,,
12b.		12.	Angle Brackets, 1"	× 1,			Eye Piece
Axle Rods    13a.   11½"   16a.   2½"   53.   Perfora     15a.   8"   16b.   3"     15a.   4½"   17   2"     15a.   4½"   18b.   1       15b.   3" diam, with set screws   56e.     15a.   7   18b.   7		12a.	,, ,, ,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,	×1"			Perforated
13. 11½"   16a. 2½"   53a.   Perfora   13a.   8"   16b. 3"   53a.   Flat PI   15.   5"   18a.   1½"   55.   18b.   1½"   55.   18b.   1½"   55.   18b.   1½"   55a.   18b.   1½"   56b.   18b.   1½"   56b.   18b.   1½"   56c.   18b.   1½"   57b.   57		120.	" " Avlo	Dode			
13a. 8"   16b. 3"   53a. Flat IP  14. 6½"   17 2"   54. Perfora 15. 5"   18a. 1½"   55.   18truct 16. 3½"   19. Crank Handles, Large   56a.   56a.   19s.   56b.   19s.   57b.		12	111"	1 10- 01"			Perforated
14. 6 6 7 17 2 54. Perforts 15. 5 7 18a. 1 18b. 1 2 55. 7 15a. 4 1			8"	16b. 3"		53a.	Flat Plate
15a. 4½"   18b. 1½"   56a. Instruction   56b.   18b. 1½"   56b.   56c.   57a.   57a.   57a.   57a.   57a.   57a.   57b.   57a.   57b.   57a.   57a.   57b.   57b.   57a.   57b.   57a.   57b.   57			61"	17 2"			Perforated
15a. 4½"   18b. 1"   55a.   18t true   15b.   1   55b.   15b.   1   55b.   15b.   1   55b.   15b.   1   55b.   1   55			5"	18a. 1½"			"
19. Crank Handles, Large			41"	18b. 1"			"
20. Flanged Wheels, 1 g diam		16.					Instructio
20. Flanged Wheels, 1 g diam			Crank Handles, Lar	ge			
20. Flanged Wheels, 1 g diam		19s.	"	all			
190. 6		19a.	Wheels, 3" diam., w	ith set screws			Meccano S
190. 6		20.	Flanged Wheels, 14	diam			" I
190. 6		206.	" "Dulley	Wheele			Bound Ma
19c. 6"		101	3" die with centre b	oce and set screw			
20a. 2" " " " " " 57b. 58s. Coupling 22. 1 1 1 1 1 2 " " " " " " 58s. Coupling 22. 1 1 " " " " " " " 58s. Coupling 22. 1 1 " " " " " " " 58s. Coupling 22. 1 1 " " " " " " 58s. Coupling 22. 1 1 " " " " " 58s. Coupling 22. 1 1 " " " " 58s. Coupling 22. 1 1 " " " 58s. Coupling 22. 1 " " 59s. Collars 24. Bush Wheels " " " " " " 61. Windman 62. Cranks 62a. Thread 62s. Pinion Wheels, 3" " " " " " " " " " " 63s. Coupling 25s. " " 63s. Coupling 25s. " " 1 2 " " " 63s. Coupling 26s. " " 1 2 " " 1 2 " " 63s. Coupling 26s. " " 1 2 " " 1 2 " " 63s. Strip 66s. Thread 63s. Coupling 26s. " " 1 2 " " 1 2 " " 63s. Coupling 26s. " " 63s. Coupling 26s. " " 63s. Coupling 66s. Centre 66s. Weight 65s. Centre 66s. Weight 65s. Centre 66s. Weight 65s. Centre 66s. Weight 65s. Centre 65			6"				72.
21. 14° """ """ "" "" "" " " " " " " " " " "			9" " "			57b.	" Loae
23a. ½" ", without ", ", ", "   61. Windn   23. ½" ", without ", ", ", "   62. Cranks   24. Bush Wheels   ", ", ", "   62. Thread   62. Thread   62. Sp. Pinion Wheels, ¾" diam., ¾" wide   62. Double   62. Coupling   63. Coupling   64. Couplin		21.	11" " "				Spring Co
23a. ½" ", without ", ", ", "   61. Windn   23. ½" ", without ", ", ", "   62. Cranks   24. Bush Wheels   ", ", ", "   62. Thread   62. Thread   62. Sp. Pinion Wheels, ¾" diam., ¾" wide   62. Double   62. Coupling   63. Coupling   64. Couplin		22.	î" " "			58a.	Coupling
22a. 1" , without , " , " , 61. Cranks 23. 4" , without , " , " , 62. Cranks 24. Bush Wheels , " , " , 4" , wide 25s. Pinion Wheels, 3" diam., 4" wide 62b. Double 25a. " , " , 4" , " , 4" , " , 63. Coupli 63. Coupli 26a. " , " , 4" , " , 4" , " , 63b. Strip C 62b. Double 63. Coupli 64. Coupli 64. Coupli 65b. Threat 66c. Weigh 65b. " , " , 4" , " , 4" , " , 63b. Strip C 66c. Weigh 65b. " , " , 4" , " , 4" , " , 65b. Centre 27. 50 teeth to gear with 3" pinion							Collars wi
24. Bush Wheels. """ """ "" " " " " " " "		22a.					
24. Bush Wheels, \$\frac{\pi}{2}\$ diam., \$\frac{\pi}{2}\$ wide  25. Pinion Wheels, \$\frac{\pi}{2}\$ diam., \$\frac{\pi}{2}\$ wide  25. Pinion Wheels, \$\frac{\pi}{2}\$ diam., \$\frac{\pi}{2}\$ wide  25. Pinion Wheels, \$\frac{\pi}{2}\$ diam., \$\frac{\pi}{2}\$ wide  25. Coupli   26. ""\$\frac{\frac{\pi}{2}}{2}\$ ""\$\frac{\frac{\pi}{2}}{2}\$ ""  26. ""\$\frac{\frac{\pi}{2}}{2}\$ ""\$\frac{\fra		23.	1" " "	n n n			
Gear Wheels 65. Centre 27. 50 teeth to gear with \$\frac{x}{y}\$ pinion 66. Weigh 27a. 57 7 \$\frac{x}{2}\tau_{x}\$ \$\frac{x}{2}\tau_{x}		24.	Bush Wheels	1/ mide			
Gear Wheels 65. Centre 27. 50 teeth to gear with \$\frac{x}{y}\$ pinion 66. Weigh 27a. 57 7 \$\frac{x}{2}\tau_{x}\$ \$\frac{x}{2}\tau_{x}		25.	Pinion Wheels,	nam., wide			Couplings
Gear Wheels 65. Centre 27. 50 teeth to gear with \$\frac{x}{y}\$ pinion 66. Weigh 27a. 57 7 \$\frac{x}{2}\tau_{x}\$ \$\frac{x}{2}\tau_{x}		25a.	" " 43"	" 🦥 "			
Gear Wheels 65. Centre 27. 50 teeth to gear with \$\frac{x}{y}\$ pinion 66. Weigh 27a. 57 7 \$\frac{x}{2}\tau_{x}\$ \$\frac{x}{2}\tau_{x}		250.	" " 1"	" " "			
Gear Wheels 65. Centre 27. 50 teeth to gear with \$\frac{x}{y}\$ pinion 66. Weigh 27a. 57 7 \$\frac{x}{2}\tau_{x}\$ \$\frac{x}{2}\tau_{x}		26.	" " 1"	" 1" "			
Gear Wheels 65. Centre 27. 50 teeth to gear with \$\frac{x}{y}\$ pinion 66. Weigh 27a. 57 7 \$\frac{x}{2}\tau_{x}\$ \$\frac{x}{2}\tau_{x}		26h	" " 1"	4"		64.	
27.       50 teeth to gear with \$\frac{3}{4}" \text{pinion} \text{ in \$\frac{1}{4}"}\$       66.       Weight 27a.       57 """ "\$\frac{1}{4}" \text{"} "(3\frac{1}{4}" \text{diam.})\$       68.       Wood 28.       Contrate Wheels, \$1\frac{1}{4}" \text{diam.}\$       69.       69.       Set Sc 29.       69.       Gear Wheels, \$1\frac{1}{4}" \text{diam.}\$       69.       Geap 3.       Grub \$\frac{1}{2}\$       69.       Grub \$\frac{1}{2}\$       70.       Flat \$\frac{1}{2}\$       70.       Flat \$\frac{1}{2}\$       72.       72.       72.       72.       73.       74.       76.       Triang \$\frac{1}{2}\$       79.       8^2       36.       80.       5^2       79.       8^2       36.       89.       5^2       60.       50.       79. </td <td></td> <td>200.</td> <td></td> <td></td> <td></td> <td></td> <td>Centre Fo</td>		200.					Centre Fo
30a. " " ½" 16 " (Can only be 30c. " " 1½", 48 " fused together 31. Gear Wheels, 1", 38 teeth 72. " 73. " 73. Worms 77. " 73. " 73. Sanners 78. 11½" 79. Sanners 79. Sanners 79. Sanda 8. Serew Drivers 79. Sanda 8. " Special 89. 5" Serial 79. Sanda 89. 5" Cu 37. Nuts and Bolts, 7/32" 89a. 3"		27.	50 teeth to gear wi	th 4" pinion			Weights,
30a. " " ½" 16 " (Can only be 30c. " " 1½", 48 " fused together 31. Gear Wheels, 1", 38 teeth 72. " 73. " 73. Worms 77. " 73. " 73. Sanners 78. 11½" 79. Sanners 79. Sanners 79. Sanda 8. Serew Drivers 79. Sanda 8. " Special 89. 5" Serial 79. Sanda 89. 5" Cu 37. Nuts and Bolts, 7/32" 89a. 3"		27a.	57 " " "	1" " "	4		*** " *
30a. " " ½" 16 " (Can only be 30c. " " 1½", 48 " fused together 31. Gear Wheels, 1", 38 teeth 72. " 73. " 73. Worms 77. " 73. " 73. Sanners 78. 11½" 79. Sanners 79. Sanners 79. Sanda 8. Serew Drivers 79. Sanda 8. " Special 89. 5" Serial 79. Sanda 89. 5" Cu 37. Nuts and Bolts, 7/32" 89a. 3"			133 " " "	1" ,,(3½" diam	1.)		Cot Coron
30a. " " ½" 16 " (Can only be 30c. " " 1½", 48 " fused together 31. Gear Wheels, 1", 38 teeth 72. " 73. " 73. Worms 77. " 73. " 73. Sanners 78. 11½" 79. Sanners 79. Sanners 79. Sanda 8. Serew Drivers 79. Sanda 8. " Special 89. 5" Serial 79. Sanda 89. 5" Cu 37. Nuts and Bolts, 7/32" 89a. 3"			Contrate Wheels, 1	diam			
30a. " " ½" 16 " (Can only be 30c. " " 1½", 48 " fused together 31. Gear Wheels, 1", 38 teeth 72. " 73. " 73. Worms 77. " 73. " 73. Sanners 78. 11½" 79. Sanners 79. Sanners 79. Sanda 8. Serew Drivers 79. Sanda 8. " Special 89. 5" Serial 79. Sanda 89. 5" Cu 37. Nuts and Bolts, 7/32" 89a. 3"			n "10 - "7" oc	<sup>2</sup> ,,			
34. Spanners			Bever Gears, \$ , 26	Can only he			Flat Plat
34. Spanners			" " 11" 48	"Cused together			
34. Spanners			Coar Wheels 1" 3	S teeth			Triangula
34. Spanners			Worms				**
34b. Box Spanners     78. Hg       35. Spring Clips     79. 8°       36. Screw Drivers     79a. 6°       36a.     " Extra Long     80. 5°       36b.     " Special     89. 5°       37. Nuts and Bolts, 7/32°     89a. 3°			HOLLIS				
36. Screw Drivers							111
36. Screw Drivers			Spring Clips				8"
36a. "Extra Long 80. 5 36b. "Special 89. 5½" Cu 37. Nuts and Bolts, 7/32" 89a. 3			Screw Drivers				6"
36b. " Special 89. 33 Co			Ext	ra Long			5 C.
37. Nuts and Bolts, 7/32"				cial			
37a. Nuts			Nuts and Bolts, 7/	32"		89a.	,,
37b. Bolts, 1/32 1 30. 22		37a.	Nuts			90	21" "
		376.	Boits, 1/32				

No.			- 100	."		
37f.	Nuts and B	olts,	1/32			
37g.	Washers	**	**			
38.	Washers			***	***	
10.	Hanks of Co					
41.	Propeller Bl	ades				
43.	Springs					
44.	Cranked Ber	t Stri	DS			
45.	Double ,		E.e.	4.0		
46.	Ang	e Stri	ns 2	11" × 1	1"	
47.	" Ang	le Strij	9	1" v	11"	23
	,, ,,		- 3	2 1 × × × × × × × × × × × × × × × × × ×	11"	•••
17a.	n n	31	- 3	150	1#	***
48.	" "			i" 🗸	i"	•••
48a.	" "	**	- 7	11"	i."	***
48b.	,, ,,	,,		11. ×	1"	***
48c.	n "	**				
48d.	Eye Pieces, Perforated I	Y	- '	5 V	2	•••
50a.	Eye Pieces,	with b	OSS		=1"	014
52.	Perforated I	lange	1 11	ates,	35 ×	29
52a.	Flat Plates, Perforated I	24 × 5	1 171		01"	01"
53.	Perforated I	lange	a Pi	ates,	34 ×	24
53a.	Flat Plates.	44" X	48			
54.	remorated i	range	er me	ector	Plate	:S
55.	,, 5	strips,	slot	ted, 5	F. lo	ng
55a.		**	**	- 2	_ ,,,	
56.	Instruction	Manua	al,	No. 4	-7	• • •
56a.		,,	- 1	NO. U	0-3	***
56b.	,,			No. 0		
56e.				No. (	.00	
56c.		indard	Me	chani	sms l	Manua
56d	Bo	ok of	New	Mod	els	
56f.	Bound Many					
57.	Hooks					
57a.	" Scient	60				
57b.		4				
58.	Spring Cord					
	Coupling Sc	rowe fo	or S	nring	Core	1
58a.	Collars with	Cot C	oron	L. m.P		
59.	Conars with	Set S	cren		•••	***
61.	Windmill Sa Cranks Threaded C Double Arn	1115	•••		***	***
62.	Cranks			***		***
62a.	Threaded C	Canks			•••	•••
62b.	Double Arn	Cran	11.5	•		***
63.	Couplings		***	***		
63a.	Octagonal C	ouplii	igs			• • •
63b.	Strip Coupl	ings	***	***		***
63c.	Couplings Octagonal C Strip Coupl Threaded E Centra Forl	ouplin	gs	***	***	***
64.	" B	osses		***	***	***
65.						***
66.	Weights, 50	gram	mes	***	***	***
67.						***
68.	Woodscrew	5, 1"				
69.						
69a.	Coul Corne	5, 5/32	2"			***
69b.		7/39	2"			
70.	Flat Plates,	51"×	21"			
72.	- me I mees,	21"×	21"			
	Triangular	Plates	21	<b>"</b>		
	Triangular	· In cos	1"			
76.			mod.		s	
	**	Sere			- C.V.	
76. 77.		Scre	Wed	800	31	
76. 77. 78.		Scre	Wed	80a.	31	
76. 77. 78. 79.	11½" 8"	Scre	}	80a. 80b.	3½ 4½	
76. 77. 78. 79. 79a.	11½" 8" 6"	Scre	}	80a. 80b. 81.	2"	
76. 77. 78. 79.	11½" 8"	Scre	}	80a. 80b.	2"	, 

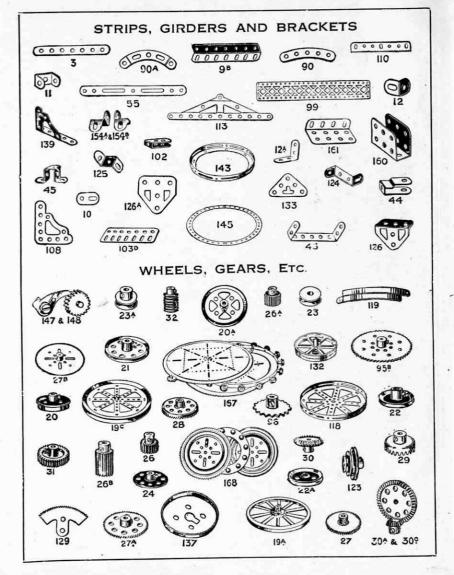

# **PLATES** RODS, CRANKS AND COUPLINGS 136 MISCELLANEOUS

## Particulars of Meccano Parts (continued)

No		l No.
90a	. 2½" Curved Strips, cranked, 1¾"	131. Dredger Buckets
	radius, 4 to circle	132. Flywheels, 23" diam
94.	Sprocket Chain	133 Corner Brackete
95.	" Wheels, 36 teeth, 2" diam.	134 Cronk Chafts 1" start
95a	. " " 28 " 1½"	135 Theodelite Destruct
95t	. " 56 3"	
96.	,, 18 ,, 1"	ton the composite to the
96a	. " " 14 " 3"	100 011 100 011
97.		18100-
97a	. " " 3" "	120 Floored Develope (al. 14)
98. 99.	" , 2½" " " , 12½" "	
99a		140. Universal Couplings
99b		141. Wire Line (for suspending clock
100.	51"	weights)
100a	41"	1 142. Rubber Ringe 3" rim
101.		142a. Dunlop Tyre to fit 2" diam. rim
102.	Single Bent Strine	1420. " " 3" " "
103.		
103a	. 91"	142d. " 1½" " " " " " "
103b	. " " 12½" "	143. Circular Girders, 54 diam
103c	, , 4 <sup>1</sup> , ,	144. Dog Clutches
103d	. ,, ,, 31"	145. Circular Strips, 7½" diam. over-all 146. "Plates, 6" "
103e.	, , 3" ,	147. Pawls, with pivot holt and puts
103f.	,, ,, 2½"	
103g	" " 2" "	147b Direct Date and Co.
103h	" " <u>1</u> ½" "	148. Ratchet Wheels
103k		149. Collecting Shoes, for Electric Locos
104. 105.	Shuttles, for looms	150. Crane Grabs
106.	Reed Hooks, for looms Wood Rollers	151. Pulley Blocks, Single Sheave
106a	Cand Dallan	152. " Two "
107.	Tables for Designing Machine	153 Three
103.	Architraves	154a. Corner Angle Brackets, 1", right
109.	Architraves	hand
110.	Rack Strips, 3½"	154b. Corner Angle Brackets, 4" left hand
110a.	_ "," 6i"	155. Rubber Rings, §"
111.	Bolts, **	156. Pointers, 21" over all, with boss
111a.		156. Pointers, 2½" over all, with boss 157. Fans, 2" diam.
111c.	. 1"	
113.	Girder Frames	
114.	Hinges	160 Channel Bearings 11"
115.	Threaded Pins	
116.	Fork Pieces, Large	169 Poiler semulate viti 12
116a. 117.	Steel Delle Malian	162a. ,, ends
118.	Steel Balls, \"diam	162b. ,, without ends
119.	Hub Discs, 5½" ,, Channel Segments (8 to circle,	163. Sleeve Pieces
110.		164. Chimney Adaptors
120.		164. Chimney Adaptors
120a.		166. End
120b.	Compression Cont.	167. Geared Roller Bearings
121.	Train Couplings	167a. Roller Races, geared, 192 teeth
122.	Miniature Loaded Sacks	167b. King Frames for Rollers
123.		167c. Pinions for Roller Bearings, 16 teeth
124.	Reversed Angle Brackets 1"	168. Ball Bearings, 4" diam. /
125.		168a. " Races, flanged disc
126.	Trunnions	168b. " " toothed "
126a.	Flat Trunnions	168c. ,, Casings, complete with balls 169. Digger Buckets
127.	Simple Bell Cranks	170 Fearnthin 17 41
128.	Boss Bell Cranks	
129.	Rack Segments, 3" diam	
130,	Triple Throw Eccentrics	172 Rail Adentes
* TI		
	e series includes 26 funnels in the correct design	and colours of leading shipping companies.

Model No. 4.1

## Periscope



Parts required: 16 of No.


Small pieces of looking glass should be inserted in the top and bottom plates.

## Model No. 4.2 Steam Winch

A  $\frac{1}{2}$  Pinion secured to the armature of the Electric Motor turns a  $1\frac{1}{2}$  Contrate Wheel I mounted on an 8" Axle Rod, to the opposite end of which is secured a Worm Wheel 2. The drum 4 of the winch consists of two 3" Flanged Wheels and is secured to the end of a  $3\frac{1}{2}$  Rod, which carries a  $\frac{1}{2}$  Pinion that is driven by the Worm 2. The cylinder is composed of a Sleeve Piece, secured by two nuts and bolts to the end of a 21" Flat Girder 5, and two 3" Flanged Wheels. The piston rod is attached pivotally to the connecting rod by means of an End Bearing 3, and the Crank Pin 6 is formed by a Threaded Pin secured to the Bush Wheel. The Boiler is secured in place by two Angle Brackets bolted to its base and to the  $5\frac{1}{2}$ "  $\times 2\frac{1}{2}$ " Flanged Plates forming part of the engine bed. It will be noted that the 1" x 1" Angle Bracket supporting one end of the 8" Rod is spaced away from the Motor by a Flat Bracket, in order to obtain proper clearance for the Contrate Wheel 1.

#### Parts required .


#### Model No. 4.3 Band Saw

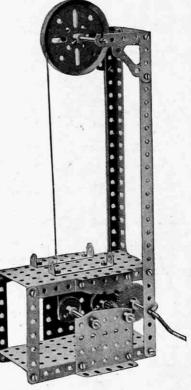

		P	arts	requ	irec	1:	
2	of	No.	3	1	of	No.	27A
1	,,	,,	5	4	,,	.,,	35
2	,,	,,	8	26	,,,	,,	37
3	. ,,	**	16	2	,,	,,	48A
1	**	,,	19	2	,,	,,	52
1	.,,	,,,	19в	2	,,	99	53
2	,,,	,,,	22	4	,,	- 27	59
1	. "	v	26	2	"	.,,	108

#### Model No. 4.4

#### Treadle Hammer

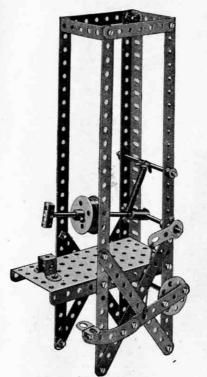

Model No. 4.5 Ancient Motor Car

This model performs very amusing antics, all its movements being derived from a Clockwork Motor in the chassis. When the Motor is set in motion the model

wobbles violently along the floor, while the driver seems to be endeavouring to keep it in a straight line and the passenger (who seems to have fallen on to the floor!) appears in constant danger of being thrown completely out of the car!


A ½" Pinion on the Motor shaft engages with the 1½" Contrate Wheel 1 attached

to the back axle 2. The latter is journalled in two  $2\frac{1}{2}$ " Flat Girders bolted to two  $5\frac{1}{2}$ " Angle Girders to which the Clockwork Motor is attached. Two Couplings 3 are fixed to each extremity of the Rod 2, and the road wheels, are attached to their centre threaded holes by Threaded Pins. The Couplings are set at an angle of 180 degrees to one another and so cause the car to wobble in a most peculiar manner when it is running.

A 57-teeth Gear 4 is fixed to a  $4\frac{1}{2}''$  Rod 5 that carries at one end a Bush Wheel. This is connected to the front wheels by a link built up of  $3\frac{1}{2}''$  and  $4\frac{1}{2}''$  Strips and attached by an Angle Bracket 7 to the  $2\frac{1}{2}''$  Double Angle Strip 8 that forms a bearing for the front axle. This results in the front road wheels being turned alternately from side to side. The  $1\frac{1}{2}''$  Rod forming the pivot for the steering should be kept fairly loose to allow for the rolling of the chassis.

A  $4\frac{1}{2}$ " Strip 6 is lock-nutted to the Double Angle Strip 8 at one end and at the other to a Crank 9 which is fixed to a  $3\frac{1}{2}$ " Rod. This is journalled in the holes of the Clockwork Motor and at its top a Bush Wheel is secured. The driver is attached pivotally to the Bush Wheel by an Angle Bracket and  $2\frac{1}{2}$ " Strip, so that when the Motor is in motion he steers quite realistically. The passenger at the back is attached to the frame by a Spring clamped between




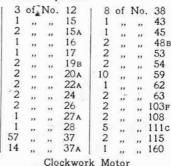


(not included in Outfit)

#### Parts required:

2	of	No.	1	3	of	No.	16	1	of	No.	45
4	,,	"	2	2	,,	.,,	20в	1	,,	,,,	48
3	,,	,,	3	1	,,,		24	1	,,	,,	52
1	,,		5	2	,,	,,	35	5	,,	,,	59
2	,,,		8	23	,,	,,	37	1	,,	,,	62
2	,,	,,,	12	2	,,	,,	38	2	,,	,,	63
1	,,	"	15A	1	"	,,	43	1	,,	,,	90

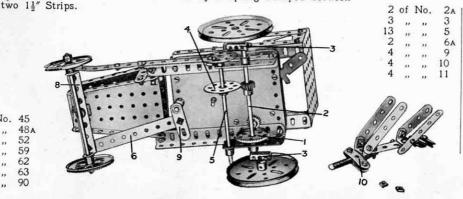


## Model No. 4.6 Elliptical Lathe

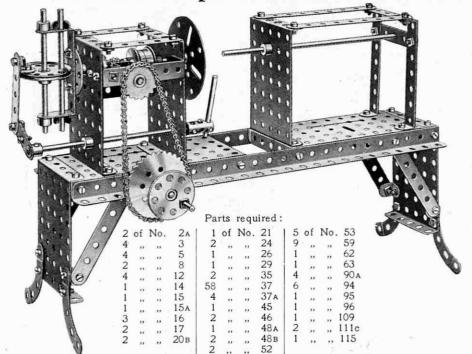


#### Model No. 4.8 Swing Saw

P	arts qui	red	. * .						/3			
2	of	No.	. 1			2/	U	00/0	00	4		
6		.,,			-	54		/ 5	th.			
12	,,		5			2.41	-	_53	1	9211	L,	
8	,,	,,	2 5 8				1 18	15	A	CON.	۳	
2	,,	,,	9			01	1	- 18	g			
1	,,	,,	14				1	10	8			
12 8 2 1 1 3 4	,,	,,	16			G.	100	///	8	O	1	
3	,,	,,	17			00	9000		8	0		
4	,,	,,	22			0	6 1	7	8	0 0		
1			26			0	10 30	11/11	18	0		
1	,,		27 A			0	127	13/14	<u> </u>	0	1	7
2	"	**	35		4-		14/17	1975	<b>3</b> 3	9		
57	.,,	,,	37			0	1/1/2	1/6	招	40	111	
1 2 57 2 2 1 2 2 7 1 12 2 2 2 7	,,,	**	48			0	1 12	SCE.	招	0	111	
2	,,	**	48A				1 14 16	1	38	CL	111	6 n
1	"	**	48 D		5-	49	1 19 47			0		, H .
2	,,	.,	52		5	100	1 12/09	. 10	88	0	1	A COL
2	,,		53		A.		VAL	- AVA		CB	1	1000
7		.,	59				ATTO	100	硼			100
1	,,	,	63	.600	是多	No. of Lot	011	-12	8.		III and	1
12	,,		94	1/10/00		0		7) A	-	H	11:38	
2	,,	,,	96	Part I				14/			1000	The state of
2	**	,,	126	C MITS	900	0 0 0				- 1		
2	,,	,,,	126A	0	000	Olone I	0	00	6 6			1
1	,,	33	159	- 0		CIA	CIEC .	0	A	-	0.0	0
Ele (r	ectr iot i	ic inclu- utfit	Motor ded in )	V	• • •	V		00.		1		

#### Model No. 4.7 Distance Indicator

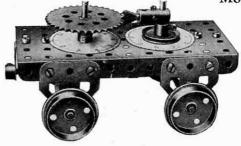

1	of	No.	4	16	of	No.	37
4	,,	***	10	1		,,	37 A
2		,,	12	3	,,	,,	38
1	,,,	.,	15	1	,,	,,,	52
2242	,,	,,,	16	3 2	,,	,,	59
2	,,	**	17	2	,,	,,	62
4	,,	,,	20в	- 1	,,	,,	63
2		22	26	1	,,	,,	65
1	,,	,,	28	1	,,,	,,	95
1	**	,,	23	1	,,	**	96
		4	of No	. 12	26A		

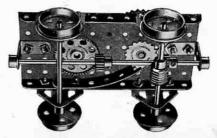


A ½" Pinion secured to the armature spindle of the Electric Motor engages with a 57-teeth Gear Wheel 1, the shaft of which carries two 1" Pulleys that transmit the drive by belts to the operating Rod 3. Two driving belts 6 and 7 are used side by side to obtain a more positive grip. The framework 4, carrying the Circular Saw 5, is free to swing about the Rod 3.

## Model No. 4.9 Alternating Swing

#### Parts required:

3	of	No.	1	18	of	No.	8	3	of	No.	37A	1 4	of	No.	90
8	,,		2	4	,,	,,	12	10	,,	.,	48A	4	.,		90 A
2	,,	**	4	2	,,	,,,	14	2	- 22	**	48D	3	**		99
9	,,	,,,	5	2	.,,		24	2	,,	- 20	54	1	**		111c
2	,,	,,	6A	2	,,	"	26	9	,,	,,	59	1			115
				72			37	2		-	62				

Clockwork Motor (not included in Outfit)

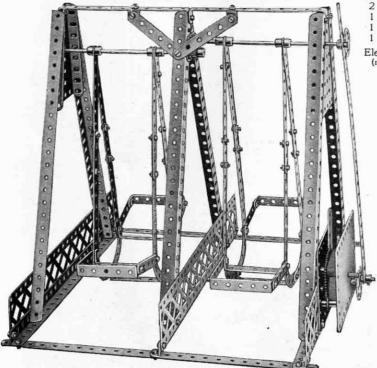



The guard 1 consists of a  $5\frac{1}{2}''$  Angle Girder held in place by a Collar, the threaded bore of which engages the shank of a Bolt passed through the elongated hole in the Flanged Plate 2. Hence the guard may be moved nearer or further from the Circular Saw as required to allow for different thicknesses of material.

#### Model No. 4.11

#### Yacht


#### Parts required:

9	of	No.	1	2	of	No.	15
7	-11	- 33	2	2		,,	18A
4	**	,,,	3	1	,,	**	22
2	77	.,,	4	51	- ,,	.,,	37
2	,,	,,	5	1	,,	,,	44
1	,,	,,	10	2	,,	,,	48A
5	,,	,,,	12	1	,,	,,	52
1	"		13a	1	- 22	,,	54




#### Model No. 4.12 Inclined Delivery Chute

The cage 1 is raised from the Hand Wheel 2 by means of an endless Cord 3 which passes over the upper 11 Pulley 4. A Cord 5 winding on Rod 6 between two 1" fast Pulleys raises or lowers the cage. The truck 7 is raised or lowered along the inclined rails 8 by a Crank Handle 9, a Cord 10 being wound on the Rod 11, passing over a Pulley 12, and connected to the truck 7. When the truck reaches the end of the inclined rails 8 it rests upon two 51" Strips 13 pivoted at 14, the weight of the truck depressing these pivoted Strips and tipping the load.

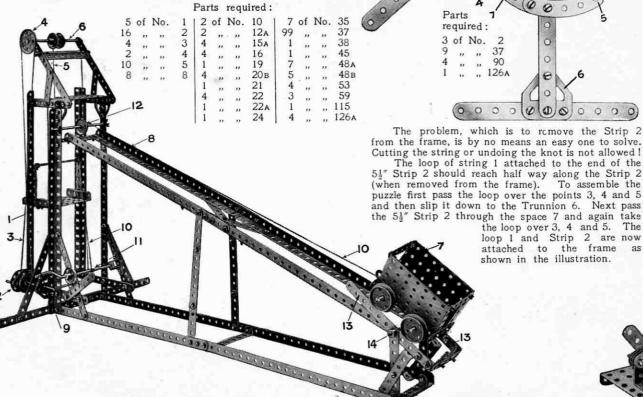

Model No. 4.13 Puzzle

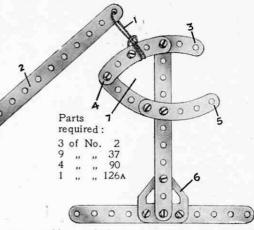


from the frame, is by no means an easy one to solve. Cutting the string or undoing the knot is not allowed! The loop of string 1 attached to the end of the 54" Strip 2 should reach half way along the Strip 2 (when removed from the frame). To assemble the puzzle first pass the loop over the points 3, 4 and 5 and then slip it down to the Trunnion 6. Next pass the 51" Strip 2 through the space 7 and again take the loop over 3, 4 and 5. The


loop 1 and Strip 2 are now attached to the frame shown in the illustration.

Model No. 4.14 Three-arm Signal

		Parts				
1 2 2 6 4 3 1	,,	lo. 1 ,, 2 ,, 3 ,, 5 ,, 12 ,, 12 ,, 17	2 27 5 11	of 1	Vo. ""	22 22A 35 37 37A 38 52
	,		1 4 3 1	"		90 111 126a
					E(	
	0					
0		0000				
	•	:				
		00	£->			
6	1					

#### Model No. 4.15 Breast Drill

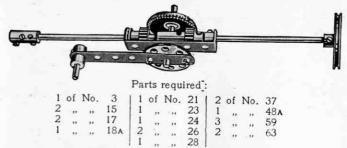

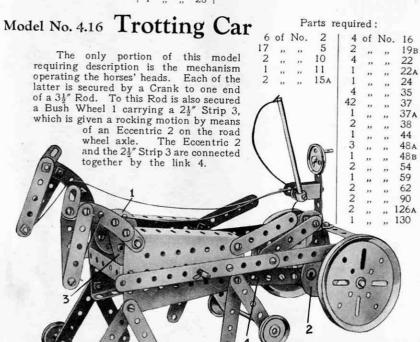


## Model No. 4.17 Warehouse


The Cord 1 that raises and lowers the elevator passes from the top of the car 11 over the 1" loose Pulley Wheel 4 and the 11 Pulley 5, and is wound between two 1" fast Pulley Wheels on a 3" Axle Rod 2, which is driven from the Electric Motor via a Worm Wheel, a 57-toothed Gear Wheel, a 3" Contrate Wheel, and a 1" Pinion. The elevator car is counterbalanced by a weight 3, consisting of a Fork Piece, fourteen 9= 21" Strips, and a Collar, which is connected to the car by a Cord 10 passing over a 1" fast Pulley Wheel (behind the Wheel 5) and the 1/2" loose Pulley Wheel 6.

The elevator car is guided by a pair of vertical Cords 7, which pass through holes in the  $2\frac{1}{2}'' \times \frac{1}{2}''$  Double Angle Strips 8 as shown, and the weight 3 is similarly guided by the cords 9.



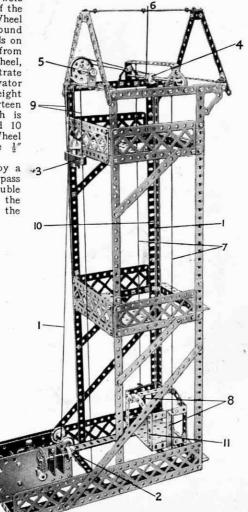

## Model No. 4.18 Searchlight

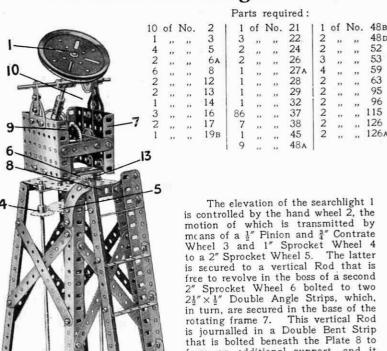

is controlled by the hand wheel 2, the motion of which is transmitted by means of a 1" Pinion and 3" Contrate Wheel 3 and 1" Sprocket Wheel 4 to a 2" Sprocket Wheel 5. The latter is secured to a vertical Rod that is free to revolve in the boss of a second 2" Sprocket Wheel 6 bolted to two 21" × 1" Double Angle Strips, which, in turn, are secured in the base of the rotating frame 7. This vertical Rod is journalled in a Double Bent Strip that is bolted beneath the Plate 8 to form an additional support, and it carries at its upper end a 1 Pinion that engages with the 11 Contrate Wheel 9. The motion of the Contrate 9 is transmitted to the pivotal Rod of the searchlight by means of the Pulleys and belt 10. The searchlight is rotated by the second hand wheel 11, the drive from which is transmitted through Worm gearing to the vertical Rod 12, the upper end of which carries a 1" Sprocket Wheel 13, that engages with the 2" Sprocket Wheel 6.

#### Model No. 4.19 Conductor's Punch


He only needs a strap with which to hang it over his shoulder to make him into a conductor. The 21" Strip at the bottom is spaced by two Washers away from Parts the body of the punch to allow required: the ticket to pass in to be 3 of No. 5 punched. The punch Rod is passed completely through the Spring. The lower end of the latter presses against the Double Bracket and the upper end against a Collar secured to the Rod.


Model No. 4.20


Automatic

This is just the thing for your younger brother!



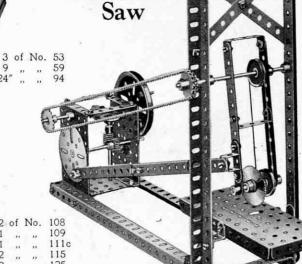

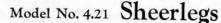

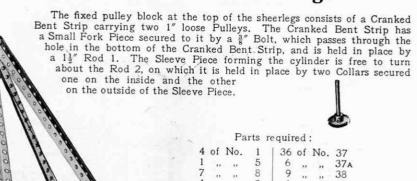



Electric Motor (not included in

## Model No. 4.22 Table Croquet




Coloured marbles may be used for Full instructions for the balls. playing croquet may be obtained from any sports or games dealer.

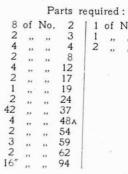

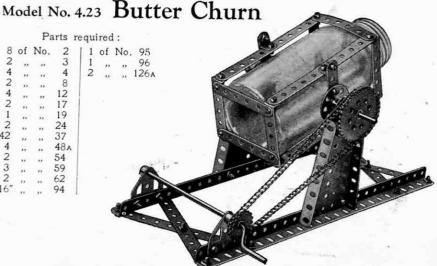


## Model No. 4.24 Diplodocus


#### Parts required;

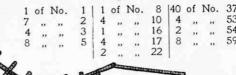

This representation of a prehistoric animal is a most extraordinary effort sent in by a young French boy to compete in one of the big Meccano Model-building Competitions. We could scarcely class it as an engineering model, but any boy with a brain clever enough and an imagination lively enough to conceive and construct such an animal as this from Meccano parts deserved a good prize, so we awarded him one. Screw the Nuts and Bolts up tightly because the Diplodocus looks most dejected when he droops.

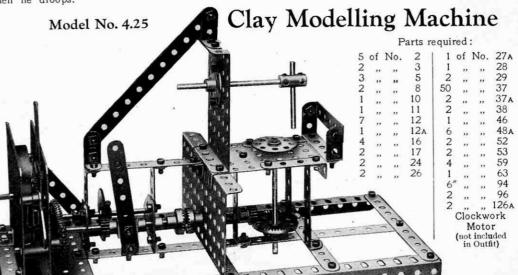

## Model No. 4.26 Bale Press

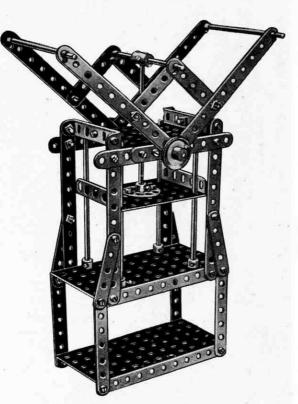

#### Parts required:


				Pa	rts	requ	irea:				
10	of	No.	2	1	of	No.	24	2	of	No.	
4	,,	,,,,	3	- 8	- 11	,,	35	2	.,,	**	53
8	,,	,,	5	44	,,	- 22	37	4	,,	**	59
4	,,	.,,	15	14	,,	0	37A	1	,,	"	63
1	,,	22	15A	2	,,	**	38	2	,,	**	111
2	,,,	,,,	17	2	""	"	48A				

#### Model No. 4.27

## Weather Vane

#### Parts required:

7	of	No.	1	54	of	No.	37
11	,,	.,,	5	2	,,	,,	38
8	,,	,,,	10	2	,,	,,	52
4	,,	,,	11	1	,,	,,	54
17	,,	,,	12	2	,,	,,	59
1	,,	,,,	14	1	,,	"	109
1	"		24	1	"	"	126a

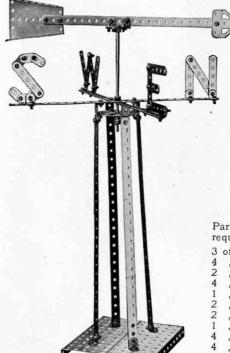


## Model No. 4.28 Geometrical Apparatus

This most ingenious model for transforming a circular movement into a rectilinear movement was designed by M. Pierre-Th. Dufour, who used it in his Thesis (presented to the Faculty of Science in Paris) to obtain his degree of Doctor of the University of Paris. He required an instrument which would transform a circular movement into a movement rigorously rectilinear and a

rectilinear and he states in his published work that he was able to do this "with the aid of Meccano parts, which permit of making experiments so easily in mechanisms of the most varied types."


The point F is fixed, and is situated at a distance from the fixed point E, equal to AE, the two arms FB and FD being together equal to the four sides of the lozenge ABCD. The trajectory of the point C is then at right angles to EF. It will be found that whilst the point C is moving in a straight line at right angles to EF, the point A is describing a circle round the fixed point E.


Every Meccano Boy should make up this very interesting model and experiment with it.

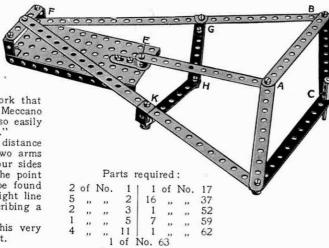

#### Model No. 4.29 Cable Railway

The reversing lever 1 is pivoted near its centre to a Reversed Angle Bracket and at its lower end to a  $2\frac{1}{2}$ "  $\times$  1" Double Angle Strip 2. This Strip is kept in place on the Rod 3 by two Collars. The two  $\frac{3}{4}$ " Contrate Wheels are fastened on this Rod in such a position that one or other can be brought into gear with a  $\frac{1}{2}$ " Pinion secured to the Rod 4 by moving the reversing lever. This Rod 4 is journalled in one of the side plates of the gear box and in a  $3\frac{1}{2}$ "  $\times$   $\frac{1}{2}$ " Double Angle Strip bolted between Plate 5 and the Strips.

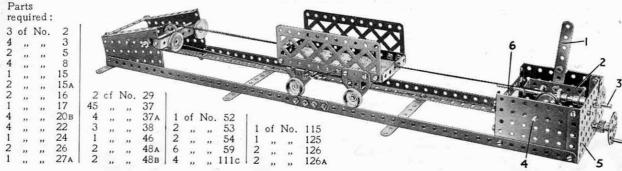

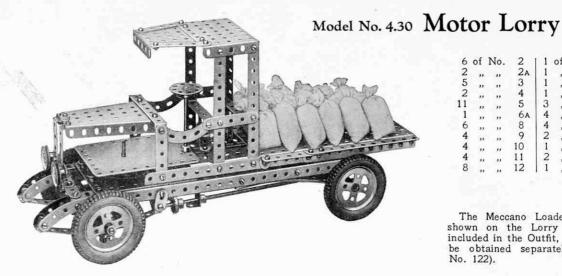

#### Parts required:


6	of	No.	2	1	of	No.	13 <sub>A</sub>	1	of	No.	29	6	of	No.	63
2	,,	,,	2A	1	,,	,,	15	95	,,	***	37	4	,,	,,	90
5	,,	,,	3	1	,,	,,	15A	14	,,	,,	37A	2	,,	,,	90 A
2	,,	,,	4	1	,,	,,	16	15	,,	,,	38	2	,,	,,	111
11	,,	,,	5	3	.,	,,	17	1	,,	,,	48	6	,,	,,	111c
1	,,	.,	6A	4	,,	,,	18A	2	,,	,,	48A	1	,,	,,	115
6	,,	,,	8	4	,,	,,	20A	3	,,	,,	48в	1	,,	,,	116A
4	,,		9	2	,,		22	5	,,	,,	53	1	,,	,,	125
4	,,	,,	10	1	,,	,,	24	1	,,	,,	54	4	.,	,,	142A
4			11	2	,,	,,,	26	10	,,	,,	59	1	,,	,,	147в
8	,,	,,	12	1	,,	,,	28	1	,,	,,,	62	2	,,	.,,	165

Clockwork Motor (not included in Outfit)


The Meccano Loaded Sacks shown on the Lorry are not included in the Outfit, but may be obtained separately (Part No. 122).

The front Wheels are mounted on 3" Bolts, which form the stub axles and are secured in Couplings 1 (Fig. 4.30a). Each of the latter carries in its centre transverse hole a 11 Rod 2, which is passed through the end holes of two 41 Rod 2. Strips laid one upon the other, and loosely clamped in place by Collars. The end transverse holes of the Couplings hold the Rods 3 and 4 which are connected pivotally together at their ends by Swivel Bearings and two short Rods joined by a Coupling. A 2" Rod 5 is held in another Coupling on the Rod 4 and is connected by means of a Swivel Bearing and 31 Rod to a Crank on the lower end of the steering column. A Pivot Bolt is passed through the end transverse hole of the Coupling on the 31 Rod and is secured to the Crank by two nuts.

The bonnet is attached pivotally to the body by Bolts 6 and lock-nuts so that it may be raised to allow the winding key of the Motor to be inserted. The shanks of the Bolts 10 enter the top holes of the 2½" Double Angle Strips in the front of the chassis, but they are not secured to the Strips.

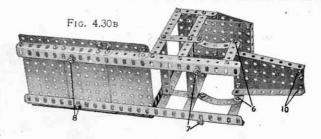


The complete body shown in Fig. 4.30B can be detached from the chassis (Fig. 4.30A) by undoing the 3" Bolts 7 and 8, which are passed through holes in the Angle Girders of the chassis and spaced therefrom by Washers. The Bolts 7 are inserted in the hole marked 9 (Fig. 4.30A) and the corresponding hole in the other side Girder, whilst Bolts 8 are passed through the end holes but one of the two side Girders.

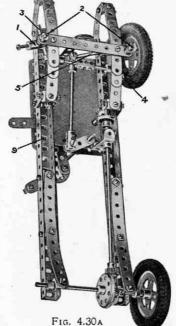

Parts

## Model No. 4.31 Speed Indicator

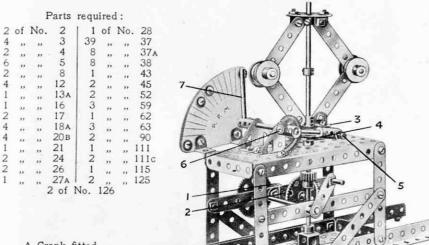



A Crank fitted with a Threaded Pin to form a handle is secured on a  $3\frac{1}{2}$  Rod carrying a 57-teeth Gear that meshes with a  $\frac{1}{2}$  Pinion 1 on a  $1\frac{1}{2}$ 

Rod. The latter Rod carries a Contrate Wheel and is journalled in one of the holes of a 5½" Strip and a Double Bent Strip 2. A Pinion on the vertical 8" Rod which carries the governor is in engagement with the Contrate.

The  $2\frac{1}{2}$ " Strips forming the governor arms are lock-nutted to Angle Brackets which in turn are secured rigidly to Bush Wheels. The upper Bush Wheel is secured to the Rod, while the lower wheel 3, which is free on the Rod, is connected to a  $1\frac{1}{2}$ " Pulley 4 by  $\frac{3}{8}$ " Bolts, but spaced therefrom by nuts on the shanks of the Bolts. The  $\frac{3}{4}$ " Bolt 5 is passed through the end tapped hole of the Coupling and locked in position by a nut so that its shank protrudes into the space between the Bush Wheel and Pulley. As the weights of the governor fly outward under centrifugal force the Bush Wheel and Pulley unit 3 rises, carrying with it the Bolt 5 and its Coupling and so actuating the pointer (a 2" Rod 7). The extent of the movement of the latter over the graduated scale indicates the speed at which the vertical shaft rotates. A Spring secured to the  $5\frac{1}{2}$ "  $\times 2\frac{1}{2}$ " Flanged Plate is fixed by the Bolt 6 in such a manner that the pointer tends to return to its original position as the motion decreases.

#### Model No. 4.32 Catapult

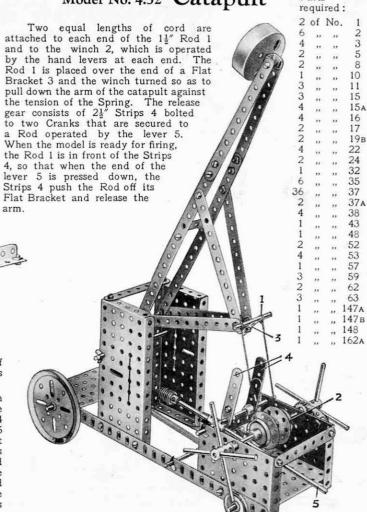

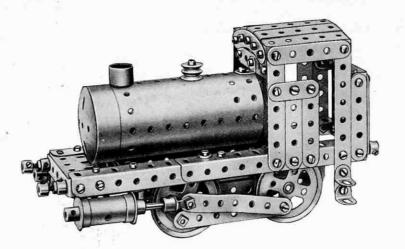

Model No. 4.33


## 0-4-0 Shunting Locomotive


The superstructure is shown in detail in Fig. 4.33a. Each of the two side members is built up from two  $5\frac{1}{2}''$  Angle Girders overlapping five holes. The cab roof is composed of five  $2\frac{1}{2}'' \times \frac{1}{2}''$  Double Angle Strips bolted to two  $2\frac{1}{2}''$  Curved Strips and is attached to the frame of the cab by Angle Brackets. The front of the cab is composed of three  $2\frac{1}{2}''$  Strips connected together so as to form three sides of a square and bolted to the Boiler by an Angle Bracket. The cylinders 2 are bolted to the side members by means of two Flat Brackets 3 which are bent slightly outward.

Each side of the frame that carries the wheels is composed of two  $5\frac{1}{2}$ " Strips overlapping seven holes and one  $5\frac{1}{2}$ " Strip attached by Flat Brackets 4 as shown in Fig. 4.33B.

The coupling Rods 7 are attached to the front pair of Wheels by Bolts and lock-nuts and to the back pair by  $\frac{3}{8}''$  Bolts and lock-nuts. The connecting Rods 8, which are bent slightly as shown, are attached at one end to the Bolts 9 and at the other to End Bearings feet up, which carry the  $1\frac{1}{2}''$  Rods forming the piston rods.

To assemble the model, the Bolts 5 are passed through the centre holes of the  $2\frac{1}{2}$ " Strips 6, and through the Boiler, and are then secured by their nuts (the Washers shown being used to space the Strips 6 from the  $1\frac{1}{2}$ " Double Angle Strips).

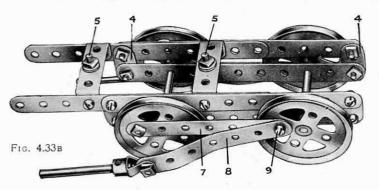


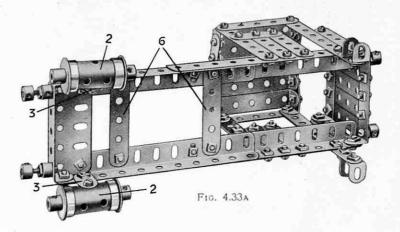

#### Parts required:

								and a		7.7					
6	of	No.	2	10	of	No.	12	10	of	No.	38	1	of N	Vo.	116a
2	,,		2 A	4	**	**	17	7	.,,	17	48A	1	.,	,,	162
6	,,	,,	3	4	,,	<i>n</i>	20 A	6	,,	10	59	2		,,	163
18	,,	,,,	5	4	,,	,,	20в	2	,,	**	90	1	23	,,	164
2	,,	**	6а	2	,,	31	23	1	,,	,,	103F	1	,,	12	166
		**									111				
6	,,	.,	10	15	,,	,,	37a	5	,,	"	111c				

## Model No. 4.34 Tipping Motor Wagon

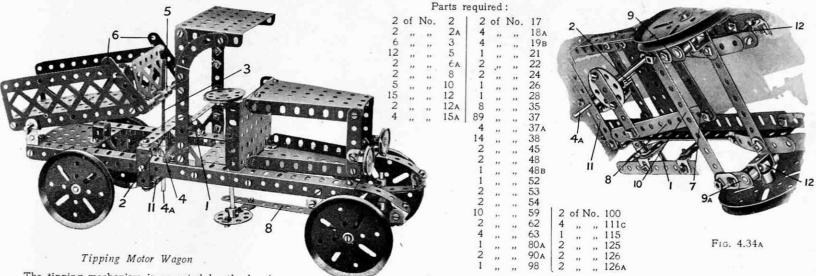


(not included in Outfit)

The tipping mechanism is operated by the hand Wheel 1, the shaft of which carries a  $1\frac{1}{2}$ " Contrate Wheel that engages with the  $\frac{1}{2}$ " Pinion 2. The  $3\frac{1}{2}$ " Threaded Rod 3, to which the Pinion 2 is secured,

is journalled in one end of a Coupling 4 and passes through the central threaded bore of a second Coupling 5, which is mounted between the ends of two short Rods that are free to turn on bolts passed through  $2\frac{1}{2}$ " Strips 6. These Strips 6 are attached pivotally to the body of the lorry. The short Rod 4 $\alpha$  passes through the  $3\frac{1}{2}$ " Strip 11 and is secured in the lower end of the Coupling 4, the centre transverse hole of which forms a bearing for the Rod of the hand Wheel 1.


The steering gear is shown in Fig. 4.34a. The  $2\frac{1}{2}$ " Strip 7 is pivoted to the Strip 8, but is secured rigidly at right-angles to the Crank 9. The Crank 9a is made to move simultaneously with the Crank 9 by means of the tie-rod 10. The front road Wheels are mounted on  $\frac{3}{4}$ " Bolts secured in Collars 12.

#### Model No. 4.35 Sextant and Theodolite

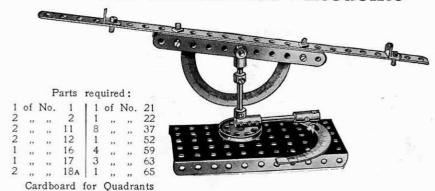


## Model No. 4.36 Trip Hammer

The shafts carrying the hammers are prevented from rotating in their bearings by means of  $2\frac{1}{2}'' \times \frac{1}{2}''$  Double Angle Strips bolted in pairs to form guides, in which slide the heads of bolts or short Rods secured to the Couplings in the centre of the hammer shafts. As the Rod carrying the Cranks slowly rotates the hammers rise and fall alternately.

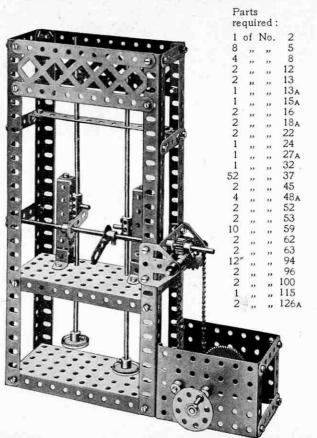

## Model No. 4.37 Swing Bridge

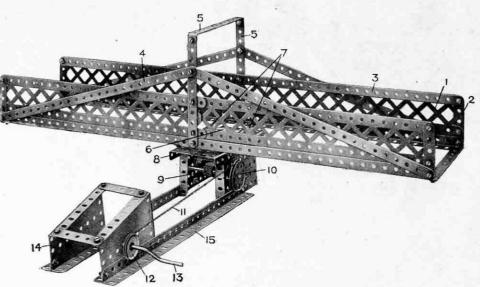

#### Parts required:

8	of	No.	1	L	1	of	No.	16	1	of	No.	21	50	of	No.	37	2	of	No.	53
6			2		1	,,	.,	17	1	,,	,,	22 27 <sub>A</sub>	1	,,	,,	48A	2	,,	,,	54
6		**	5		1	,,		19	1	,,	,,	27A	1	,,	. ,,	48p	2	2)	- >>	59
6			8		1		**	19B	1	,,	,,	32	1	,,,	,,,	52	4	,,	,,,	99

The sides of this model, as shown in the illustration, are made of the Braced Girders 1 secured to the upright Strips 2 and reinforced by the inner Strips 3. Other diagonal Strips 4 brace the side Girders to the top structure 5 forming a stay for the sides 1. The swing base of the bridge is composed of a 3" Pulley Wheel 6 which is bolted to two cross  $5\frac{1}{2}$ " Strips 7 which in turn are secured to the main base side Girders. The bridge swings on the Perforated Plate 8 on a short Rod, on the lower end of which is secured a Gear Wheel engaged and driven by a Worm 6 on the spindle of which is the grooved Pulley 10 driven by the Cord 11 which is operated from the smaller grooved Pulley 12 on the Crank Handle 13. The Crank Handle is journalled in two Sector Plates 14 secured to the base Angle Girder 15.

## Model No. 4.38 Stephenson's "Rocket" Locomotive

The chimney is attached at its lower end to two Trunnions 1 that are bolted to the front of the boiler. A  $1\frac{1}{2}''$  Strip 2 held in place by a  $\frac{1}{2}'' \times \frac{1}{2}''$  Angle Bracket closes in the space between the Trunnions at the bottom, and a  $\frac{1}{2}'' \times \frac{1}{2}''$  Angle Bracket 3 performs a similar function at the top.

The trailing wheels are secured on an axle that is journalled in  $2\frac{1}{2}$ " Strips attached to the bottom extremities of the  $2\frac{1}{2}$ " Strips 4. The rearmost ends of the horizontal Strips are secured by Flat Brackets. The upper ends of the Strips 4 serve as mountings for the cylinders, which are secured rigidly thereon by  $\frac{3}{8}$ " Bolts, on each of which are four Washers between the cylinder and the Strip.


#### Parts required:

8 of No. 2	4 " " 3 6 " " 10 56 " " 37 1 " " 11 11 " " 5 4 " 16 8 " " 38 1 " " 11 1 " " 16 1 1 " " 19 1 1 1 " " 10 1 1 1 " " 10 1 1 1 1 " " 10 1 1 1 1	
n n n n n n n n n n n n n n n n n n n	an an	11 11c 16a 26 62 63 64
0 3		
		8 . 8

#### Model No. 4.39 Girder Crane

The boom is rotated by means of the handle 1, on the axle of which is a Worm engaging with a 57-teeth Gear Wheel secured to an 111 Rod 2. At the upper end of the Rod 2 is a 1" Sprocket Wheel that meshes with a 2" Sprocket Wheel 3 bolted to the boom of the The handle 4 is crane. connected by means of a 1" Pinion, 11" Contrate Wheel, and a 1" Sprocket Wheel 5 to the 2" Sprocket Wheel 6. The Rod 7, to which the

latter is secured, is free to rotate in the boss of the Sprocket Wheel 3, and carries at its upper end a  $\frac{3}{4}$ " Contrate Wheel which, by means of a  $\frac{1}{2}$ " Pinion and a 57-teeth Gear Wheel, rotates the Rod 8. A Cord wound on the latter Rod raises the pulley block 9. The handle 10 controls the traversing movement of the trolley by an endless rope drive similar to Standard Mechanism No. 169.

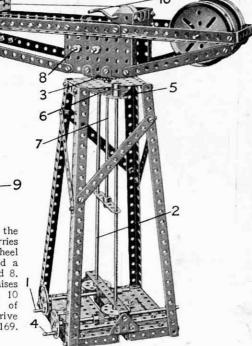

12	of	No.	2			P	arts	requi	red	:		, 2	of	No.	48p
2	,,,		3	4	of	No.	16	2	of	No.	27A	2			52
2	,,	,,	5	3	,,	- 22	17	1	,,	**	28	3	,,	**	53
22262922	,,	,,	6A	1	,,	,,	19	1	,,	**	29	1	,,	"	57
6	"	,,	8	4	,,	,,	19s	1	,,	11.	32	9			59
2	,,	22	9	4	,,	,,	20в	8	,,	**	35	2	,,,	11	90 A
9	22	"	10	1	,,	,,,	21	76	,,	,,	37	2	,,	,,	95
2	"	"	12A	1	22		22	5	,,	10	37A	2	**	.,	96
2	,,	,,,	13	2	,,	,,	22A	2	.,,	-21	38	2			103F
1	,,	"	13 <sub>A</sub>	2	,,	,,	23	2	,,	,,,	46	4	,,,	21	111c
1	"	"	14	2	,,	"	24	2	,,		48	2	"	.,,	115
1	,,,	"	15A	2	,,	,,	26	4	,,	,,	48A	2	"	,,	126

Parts

required: 10 of No.

> 2 of No. 27A ..

> > " 111c ,, 115 " 147в

#### This Model can be built with MECCANO Outfit No. 4 (or No. 3 and No. 3A)

#### Model No. 4.40 Level Luffing Jib Crane

The side plates of the gear box (5½"x2½" Flanged Plates) are connected together at each end by 2½" Strips, the front also being fitted with a  $2\frac{1}{2}$ "  $\times \frac{1}{2}$ " Double Angle Strip 1, which forms a bearing for the jib pivot. A 3" Pulley 2 bolted to the bottom of the gear box slides on the rim of a second 3" Pulley 3, which is fixed to the travelling base, and a 2" Rod is secured in the boss of Pulley 3 and passed through the boss of Pulley 2. A 11 Contrate 4 (Fig. 4.40A) is next secured to the Rod, together with a Coupling 5, the latter being spaced from the Contrate by Washers and held in place by a Collar. A 31 Rod, on which is fixed a 1 Pinion engaging with the Contrate, is journalled in the Coupling 5 and in the 21" Strip 6. A handle consisting of a Bush Wheel and a Threaded Pin attached to this Rod manipulates the slewing movement. The Crank Handle 7 carrying a 1 "Pinion slides in the side plates of the gear box, so that the Pinion may be engaged

with either of the two 57-teeth Gears 8 and 9. The Gear 8 is attached to a 3½" Rod on which are fixed two drums consisting of four small Flanged Wheels. These form the luffing barrel. Two lengths of cord are attached to the jib head, passes over the 1" Pulleys 10, and are then wound four times round the luffing barrel. From here they are carried over the two 11 Rods 11 and the 41 Rod 12, and finally are secured to the moving carriage 13. When

the model is working the Boiler End on the carriage should be weighed

until it exactly counterbalances the jib.

The 57-teeth Gear 9 is fixed to the 31 Rod forming the hoisting barrel. A length of cord attached to this is passed over one of the remaining 1" loose Pulleys on the Rod 14, round one of the 1" loose Pulleys at the jib head, back to the remaining 1" loose Pulley at 14, and finally over the other 1" loose Pulley at the jib head and down to the hook. When a load is put on the hook the cords between the jib head and the top of the superstructure tend to contract, thus taking all the load off the luffing cords.

The rails of the carriage 13 should be kept well oiled, so that the

carriage slides easily.


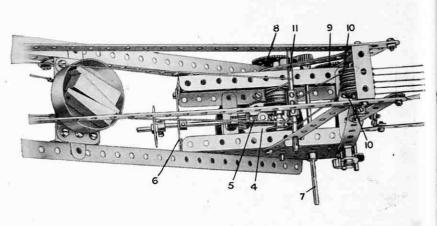


Fig. 4.40a. Plan view of gear box.

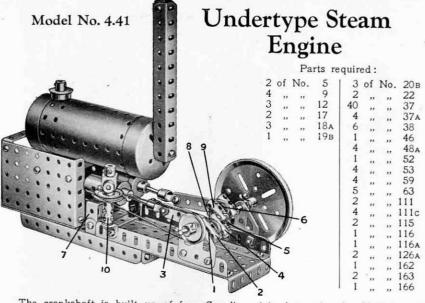


The crankshaft is built up of four Couplings joined together by \( \frac{3}{4}\) Bolts. A \( \frac{3}{4}\) Bolt 1 is passed through the centre threaded hole of the Coupling 2 and screwed up as tightly as possible. The connecting Rod 3 is now slipped on and spaced by two Washers, one on each side of the Strip, after which the Coupling 4 is screwed on to the Bolt 1 so that the connecting Rod revolves easily in the intervening space. A \( \frac{3}{4}\) Bolt 5 is next screwed into the Coupling 4 until it strikes the end of Bolt 1. The second crank is assembled in the same way—that is, a \( \frac{3}{4}\) Bolt is passed through the centre threaded holes of two Couplings—but two Washers are placed at 6 and a \( \frac{3}{4}\) Bolt 8 is inserted in the Coupling 9 in the same way as the Bolt 5 in Coupling 4. A \( \frac{3}{4}\) Bolt is now passed through the inner transverse hole of Coupling 9 and through the corresponding hole in Coupling 4, and is gripped securely by the set-screws of both Couplings. The whole crankshaft is held rigid by the \( \frac{3}{4}\) Bolts, for the head of Bolt 5 engages with the hole in the end of Coupling 9 whilst the head of Bolt 8 engages the end of Coupling 4.

Two 2" Rods are used for the ends of the crankshaft, one carrying a 3" Pulley to represent a flywheel and the other a 1" Pulley round which a length of cord is passed which takes the drive to a 1" Pulley on the centrifugal governor. The latter is built up from a Large Fork Piece with Collars attached by means of 3" Bolts, to represent the governor weights. The Fork Piece and 1" Pulley are attached to a 1½" Rod that turns in the top of the Coupling 9, which is secured on a Threaded Pin and attached to the base by an Angle Bracket.


The cylinders are composed of two Sleeve Pieces, each fitted with one  $\frac{2}{4}$ " Flanged Wheel, and are bolted to a  $2\frac{1}{2}$ " × 1" Double Angle Strip 7.

#### Model No. 4.42 Bale Lifter

The bale platform 1, consisting of a  $2\frac{1}{2}" \times 5\frac{1}{2}"$  Flanged Plate, is raised by operating a Crank Handle 2, a Pinion 3 on which engages a 57-toothed Wheel 4 on a Rod 5, upon which is wound a Cord 6,

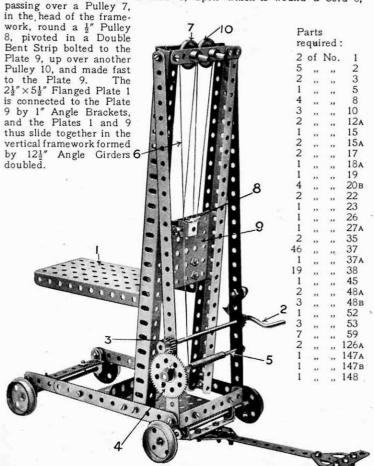

## Model No. 4.43 Power Press

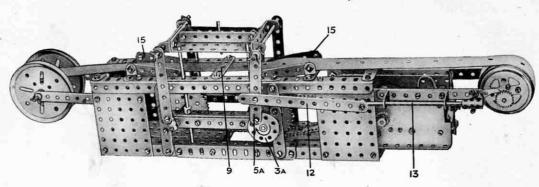


The model shown in the illustration represents a type of automatic press used in factories for stamping out small metal parts. Although the model does not stamp out steel parts, it will cut neat round holes at equal distances in a strip of paper with great rapidity.

The drive from the Electric Motor is transmitted via the ½" Pinion on the armature shaft to a 57-teeth Gear on the Rod IA, and from another ½" Pinion on this Rod to a second 57-teeth Gear on the Rod I. Two I" Sprocket Wheels on the latter Rod are connected by Sprocket Chain to 2" Sprocket Wheels on the "crankshafts" 2. One crankshaft is formed from a 3½" Rod and two Bush Wheels 3, 3A, and the other from a 3½" Rod carrying two Couplings 4 placed at exactly similar angles. Four Strips 5, which form connecting links between the "die platten" 6 and the crankshafts, are lock-nutted to the Bush Wheels and attached pivotally to the Couplings by ¾" Bolts. They are pivoted to the die platten by means of two 4½" Rods and retained in place by Spring Clips.

The  $3\frac{1}{2}$  Flanged Plate forming the die platten is strengthened with two  $3\frac{1}{2}$  Strips 7 bolted to the Plate by Double Brackets. The die 8, a  $1\frac{1}{2}$  Rod, is secured rigidly to the platten by means of a Crank. Two  $2\frac{1}{2}$  Strips 9 bolted to the frame of the model and spaced apart by Washers form the "sink," through which passes the paper strip. Guides 15 are provided to keep the material in correct alignment.

The feed drum is composed of two Boiler Ends attached to the Rod 10 by means of

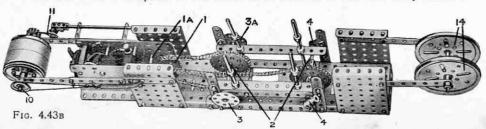

#### Parts required:

				1				
8	of	No.	2	1	of	No.		
2	,,	,,	2A	1	,,	***	46	
6	"	,,	3	2	,,	,,	48	
18			5	2	,,	,,	48A	
2	**	23	8	2			52	
-	"	"		-	"	22		
4	,	,,	9	5	,,	"	53	
2	,,	,,,	11	10	,,	,,	59	
1	,,	,,	15	1	,,	,,	62	
5	,,	. ,,	15A	3	,,,	,,	63	
5 5 2 1 2 2 2	,,	,,	16	30"	,,	,,	94	
2	"	"	17	2	"	- "	95	
2	- 22	"			"	25		
1	,,	**	18A	2	**	**	96	
2	,,	,,	19в	2	,,	,,	111c	
2	**	,,	20A	1	,,	,,	147A	
2	.,	"	24	1	,,	"	147в	
1	"	"	26	1	"		148	
	>>	33			14	"		
2	,,	**	27A	2	p.	"	162A	
13	,,	,,	35	Ele	ctr	ic	Motor	
102	,,	,,	37				led in	
19			38	1		Outfi		
	2.1	22	00		-			


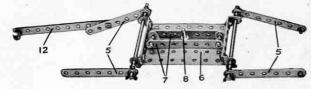


Fig. 4.43a

two 2" Pulleys. At one end of this Rod is affixed a 1" Pulley on which works a spring-controlled brake, and on the other end is attached a Ratchet Wheel that engages with a Pawl 11, which is retained in constant engagement by means of a piece of Spring Cord or elastic. The Pawl is attached to a 4½" Rod 13 by means of a Coupling and the Rod is pivotally connected by a 5½" Strip 12 to the Strip 5A.

The arrow on the Bush Wheel 3A shows the direction of travel, this being very important as the feed drum must only turn when the die platten is at the top of its stroke. The paper to be stamped is first wound on to the drum 14, then passed through the guides 15 and through the guide 9 and its end is stuck to the feed drum at the other end of the model.


#### Model No. 4.44 Motor Breakdown Crane

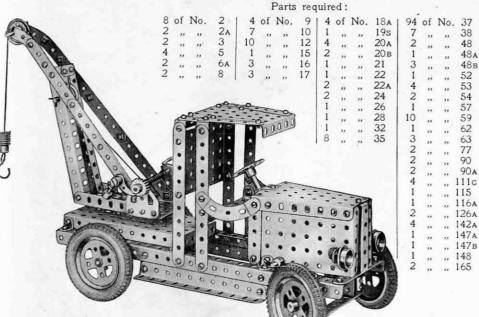


Bearings for the steering column 1 (Fig. 4.44A) are formed by a Flat Bracket and Coupling 2. A 3½" Rod passes through the centre transverse hole of the latter and carries a 1½" Contrate Wheel which is spaced by means of three Washers from the Coupling. The teeth of the Contrate are engaged by a ½" Pinion on the Rod 1. The Crank 3 carries a Flat Bracket bolted so that its round hole is over the elongated perforation of the Crank, and a bolt passed through both is screwed into the tapped bore of a Collar on a 2" Rod. This Rod is attached pivotally to the inner end of a stub axle by means of a swivel bearing formed from a Collar and Small Fork Piece.


The front road wheels rotate freely on the  $1\frac{1}{2}''$  Rods, and are held in position by Collars. The Couplings 4 are pivoted by means of  $\frac{3}{8}''$  Bolts to the extremities of two  $4\frac{1}{2}''$  Strips that are bolted together face to face to form the front axle. Two  $1\frac{1}{2}'' \times \frac{1}{2}''$  Double Angle Strips 5 secure the  $4\frac{1}{2}''$  Strips to the side Girders of the model.


#### Model No. 4.45 Opisometer

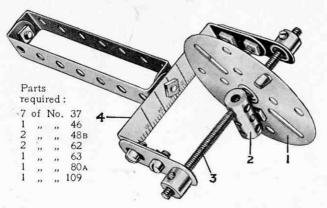

This instrument can be put to practical use for measuring curved lines, the perimeter of bodies, map routes, etc. The Face Plate 1 is free on the Screwed Rod 3, but is attached by a Bolt to a Coupling 2, the end transverse tapped hole of which engages with the thread of the Rod. The scale 4 may be graduated by running the Face Plate along a line of given length and marking its position in relation to the scale for every inch. The Screwed Rod is of course immovable, being gripped by the set-screws of the two Cranks.

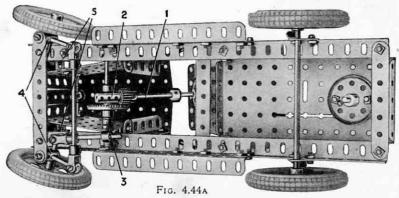

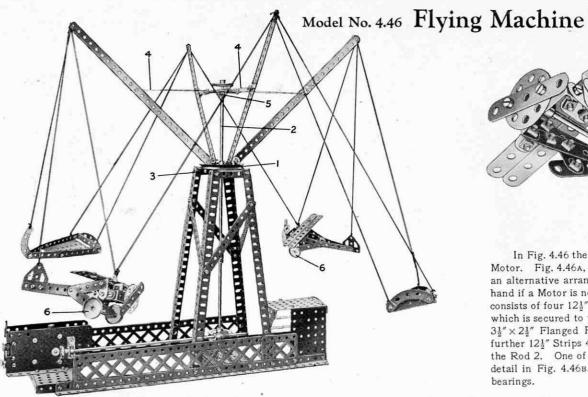

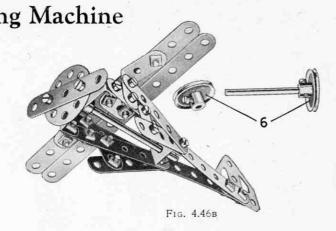

In Fig. 4.46 the model is shown equipped with a Meccano Electric Motor. Fig. 4.46a, which shows the base of the model only, indicates an alternative arrangement by which the model may be operated by hand if a Motor is not available. The revolving portion of the model consists of four  $12\frac{1}{2}$ " Strips bolted to the 3" Pulley Wheel 1 (Fig. 4.46) which is secured to the main vertical shaft 2 and rests directly on the  $3\frac{1}{2}$ "  $\times 2\frac{1}{2}$ " Flanged Plate 3. The  $12\frac{1}{2}$ " Strips are supported by two further  $12\frac{1}{2}$ " Strips 4, crossed and bolted to a Face Plate 5 secured to the Rod 2. One of the aeroplanes attached to the model is shown in detail in Fig. 4.46b. The Wheels 6 are shown removed from their bearings.

#### Parts required:

							car to	cqui								
6	of	No.	1	4	of	No.	12 <sub>A</sub>	1	of	No.	27A	2	of	No.	54	
16	,,,	**	2	2	,,		13	1	,,	,,	29	3	,,	,,	59	
2	,,	,,	2A	1	,,	,,	14	1	,,	,,	32	1	**	**	63	
11	,,	,,,	5	2	,,	,,	16	122	23		37	4	,,	**	90A	
1	,,	,,,	6A	2	,,	**	17	2	**	**	37A	1	,,	**	98	
6	**	5.00	8	1	21		19в	1	,,	,,	46	2	,,	,,	99	
3	,,	***	9	1	-,,	11	21	2	,,	,,	48	1	,,	,,	109	
6	,,	.,,	10	4	,,	**	22	6	,,	,,	48A	2	**	,,	111c	
3	,,		11	2	,,	111	24	2	,,	,,	52	2	,,	**	126	
2	,,	**	12	1	**	,,	26	3	,,	,,	53	2	,,	,,	126A	

Electric Motor (not included in Outfit)


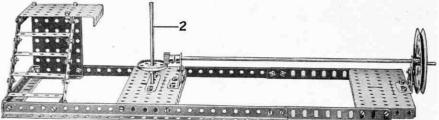


FIG. 4.46A

## Model No. 4.47 Swivelling and Luffing Jib Crane

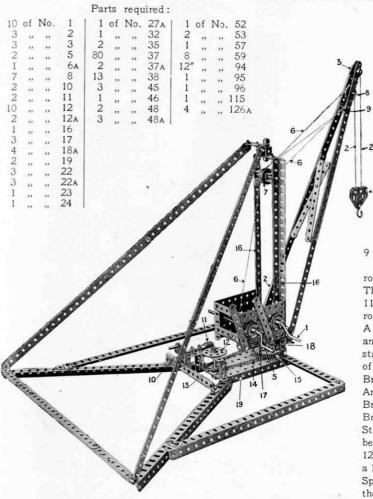

In this model three separate actions are provided, for raising the load, raising the jib, and swivelling the jib. The load is raised by means of a Crank Handle 1 on which the Cord 2 is wound and passes over the I" Pulley 3, thence round the 1" Pulley in the block 4 (spacing washers being used to give clearance to the 1" Pulley), the end of the Cord 2 being made fast to the top of the jib. By turning the Handle 1 the load is raised or lowered. The jib itself is raised or lowered by the operation of the Crank Handle 5 on the rod of which a cord is wound, and passes over one of two Pulleys 7 to and round another 1" Pulley 8 in the jib, whence it returns to and passes round the other Pulley 7, being finally made fast to the Double Bracket

9 bolted to the jib. As the Handle 5 is turned the Cord 6 is wound round the pulleys and the angle of the jib varied. The jib is swivelled by the hand wheel 10, a Worm 11 on which engages a 57-toothed Wheel 12 on the rod of which a 1" Sprocket Wheel 13 is mounted. A Sprocket Chain 14 passes round this Wheel 13 and round a 2" Sprocket Wheel 15 secured to the standard 16 of the crane. The bearing for the Rod of the Worm 11 is made by bolting a 1" Angle Bracket 20 to the rectangular Plate 19, and to the Angle Bracket 20 is secured a 11" Strip 21 and a 1" Bracket 22. To the Bracket 22 is bolted a Double Bracket 23. A Flat Trunnion 24 is bolted to the 51" Strip 25 which forms with the Bracket 23 the front bearing for the Rod. The standard is built up of two 123" Girders 16 which are connected at the base by a 11" Double Angle Strip 17 which is bolted to the 2" Sprocket Wheel 15. The 1" Rod 18 is secured in the bush of the Sprocket Wheel 15 and fitted with a Collar below the rectangular Plate 19, Fig. 4.47B.

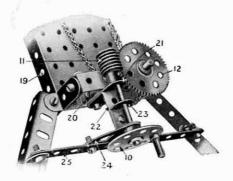


FIG. 4.47A



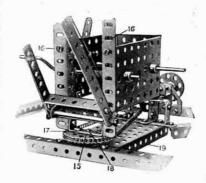


Fig. 4.47B

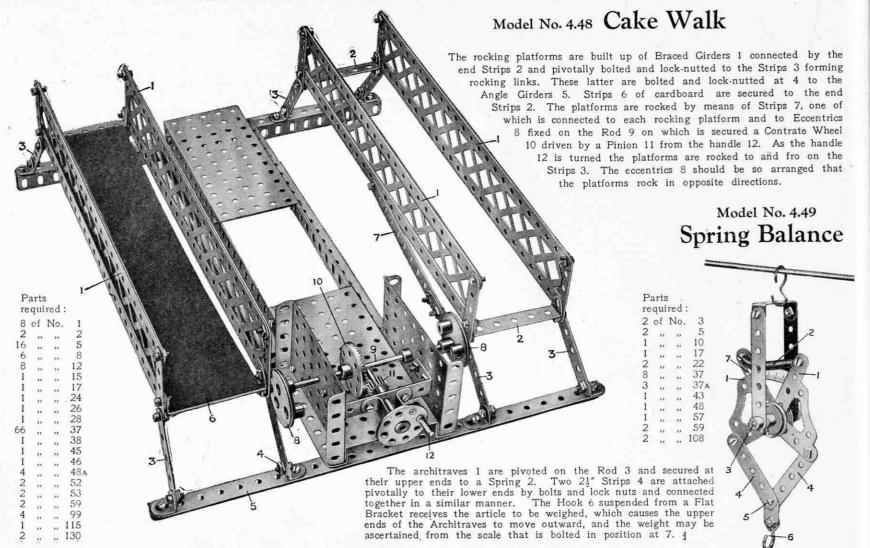


## Model No. 4.50 Naval Quick-firing Gun

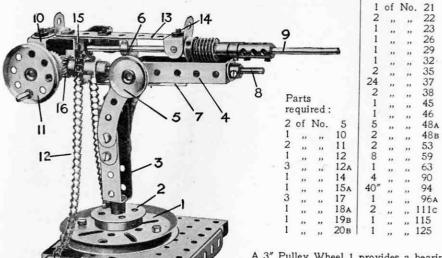

A 3" Pulley Wheel 1 provides a bearing for the vertical  $4\frac{1}{2}$ " Rod forming the axis about which the gun pivots. The Rod is secured to the base by a Flanged Wheel 2 and a 1" Pulley Wheel attached to it beneath the larger Wheel 1. Two Double Angle


Strips 3, spaced apart by a Double Bracket, are mounted upon this vertical Rod and held in place by a Collar secured to its upper end. Two 21 Curved Strips overlapped 4 holes are bolted to each of the Double Angle Strips 3, and their upper holes form bearings for a short Rod passing through the ends of further Double Angle Strips 4, and carrying a hand wheel 5. Two spring clips are mounted on this Rod inside the Strips 4 to secure it to the pivoting portion of the gun, the elevation of which may be altered on turning the Wheel 5. The Strips 4 are bolted to the end of a Double Angle Strip 6, and the same bolt secures an Angle Bracket which in turn is bolted to the Double Angle Strip 7. The Rod 8 passes through the end holes of the Strips 4 and 7 and is held in place by two Collars. On the top of the Strip 6 is bolted a 31" Double Angle Strip 13, the upturned ends of which form the sighting apertures. The Bolt 14 secures a Double Bracket and an Angle Bracket, the latter together with one of the holes in the Strip 6 forming bearings for the barrel 9. A 1"×1" Angle Bracket 15, bolted beneath the Strip 6, and the end of the Strip 7 provide bearings for the short Rod carrying a 3" Sprocket Wheel and 3" Pinion 16. Two 1" x 1" Angle Brackets 10 form bearings for a 2" Rod carrying the hand Wheel 11. This Rod is fitted with a 3" Contrate Wheel which engages with the Pinion 16. On rotation of the Wheel 11, the small Sprocket Wheel actuates the Sprocket Chain 12 which represents the cartridge belt.

## Model No. 4.51 Automatic Gong

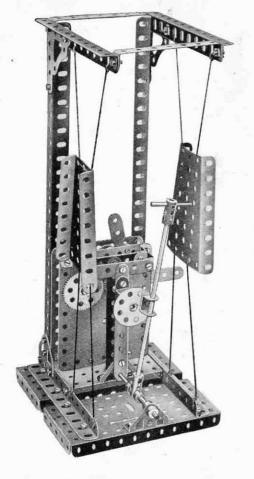


Parts required: 2 of No. Clockwork Motor

(not included in Outfit)

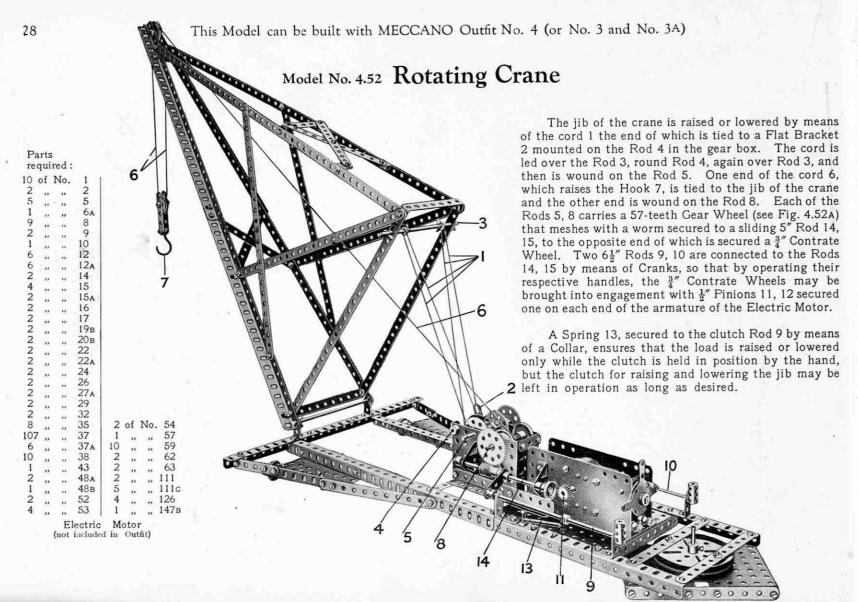

## Model No. 4.52 Rotating Crane (continued)

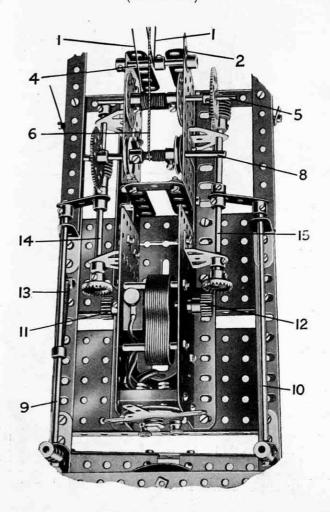


#### Model No. 4.53 Anti-Aircraft Gun

The gun represented by the Rod 1 is pivoted upon a transverse Rod 2 which passes through a Coupling on the Rod 1. A 57-toothed Wheel 3 on the pivot Rod 2 is engaged by a Worm 4 operated from the hand Wheel 5. By turning this Wheel 5 the gun is lifted or lowered. The two vertical Strips forming the framework for the pivot Rod 2 are bolted to a 1½" Pulley 7 which is secured on a vertical Rod 8. A 3" Pulley Wheel 9 is also bolted to a Rod 8 and from

the Pulley Wheel is carried by reversed Angle Brackets 10 a framework 11. The Rod 8 with the framework is rotated from the hand Wheel 12, a Pinion 13 on the spindle of which engages a 3 Contrate Wheel 14 on the Rod 8. By turning the Wheel 12 the gun is swivelled round.


#### Parts required:

6	of	No.	2	1	of	No.	27A
11	,,	,,	5	1	,,		29
1			10	1			32
2		. ,,	11	64			37
2 4	100		12	12	,,	"	38
2			12A	2	"	"	
-	**	**			"	107	45
1	2.5	11	15	4		.,,	48A
1	22	22	15A	2			48B
4	,,	***	16	1	1,,		52
1			17	4	- 11	22	53
1			19в	- 8	"		59
1	**		21	1	- "	31	
	"	23		1	22	**	62
2	22		22	2	,,	,,	63
	,,	,,	24	2 4	,,		115
1	,,	,,	26	4			125
			2 of 1	No.	126	A	

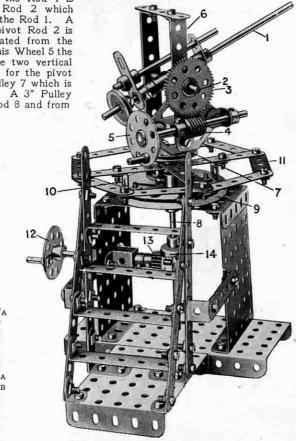


## Model No. 4.54 Potato Chopper


## Model No. 4.55 Mechanical Cross Bow

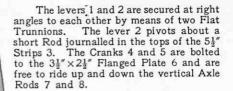

#### Parts required:

8	of	No.	2	4	of	No.	37A
3 2 2 4	,,	,,		4	,,,	,,	38
2	,,	,,	6A	1	,,	,,	43
2	,,	,,	8	2 2 1	,,	,,	48A
	,,	,,	9	2	,,	,,	48 D
04211	,,	,,	12	2	"	"	52
4	,,	,,	12A	1	,,	,,	53
2	,,	,,	14	10	,,	,,	59
1	,,	,,,	17	2 2 2	,,	,,	62
1	,,		18a	2	,,		111c
3	,,	,,	37	2	,,	.,	126
	,,	"2			26		

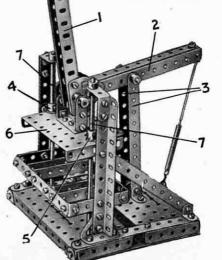

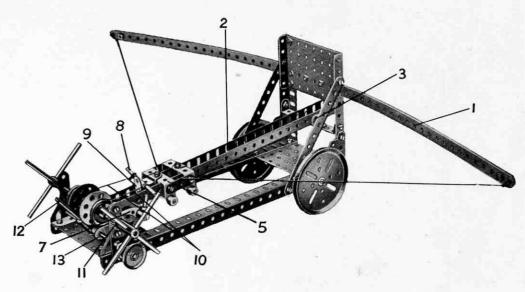


This model represents a large military weapon of the type used before the invention of gunpowder. It is built on the principle of the crossbow. Each side of the bow 1 is composed of three 121 Strips bolted together, the centre being strengthened by three 21" Strips. The trough 2, which is formed from two 121" Angle Girders, is held loosely between a pair of Angle Brackets 3, and its rear end is secured to a Double Bent Strip bolted to the 3½" × 2½" Flanged Plate. The carriage 5 is composed of four 1" x 1" Angle Brackets joined by a pair of 11/2" Strips and guided by two 12" x 12" Angle Brackets. A Double Bracket is bolted to one of the latter, and carries in its turn a Flat Bracket 9. When the handles are turned in an anti-clockwise direction. the Cords 10 draw the carriage back, and are prevented from unwinding by the Pawl 7 engaging a 1" Pinion Wheel 11. When the lever 12 is depressed, the ends of a pair of 2½" Strips bolted to Cranks 13 lift the 2" Rod 8 off the Flat Bracket 9. This releases the carriage, and the projectile (a marble) is shot out of the trough 2 with considerable force.

#### Parts required:


		•	ar to	requ			
5	of	No.	1	53	of	No.	37
7	,,	,,	5	2	,,	,,	37A
2	**	,,	6A	5	,,	,,	38
1	,,	,,	8	1	,,	,,,	45
2	,,	,,	9	1	,,	,,	48
1	,,	,,	10	1	,,	,,	48в
2 1 1 1 4	,,	,,	11	3	,,	,,	53
4	,,	,,	12	2 3	,,	,,	59
4	,,	,,	12A	2	,,	,,	62
1	,,	,,	15	3	,,	,,	63
3	,,	,,,	15A	2 1 2 1	,,	,,	108
4	,,	. ,,	16	2	,,	,,	111
4	,,	"	17	1	,,	,,,	115
2	,,	,,	19в	2	,,	,,	126
4	,,	,,	22	1	,,	,,	126A
13442421	,,	,,,	24	1	,,	,,	147A
1	,,	,,	26	1	,,	,,	147в

## Model No. 4.56 Submarine

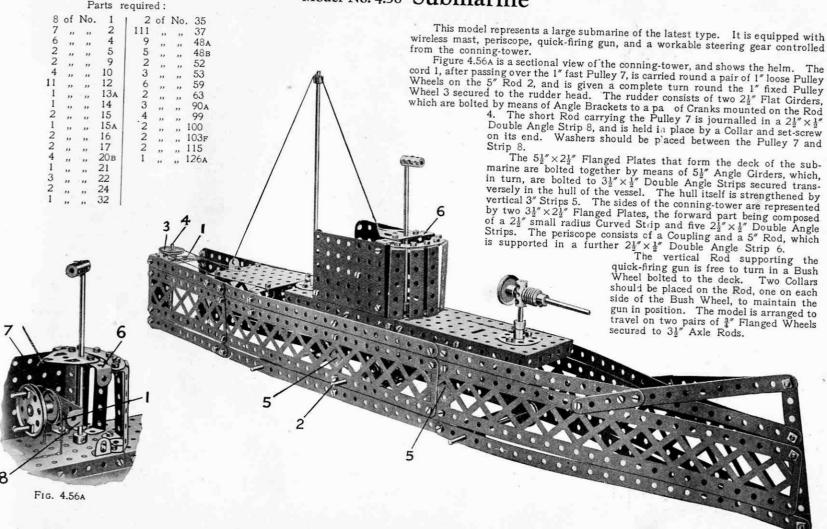

2 of No. 126A

## Model No. 4.57 Wire Rope-Making Machine

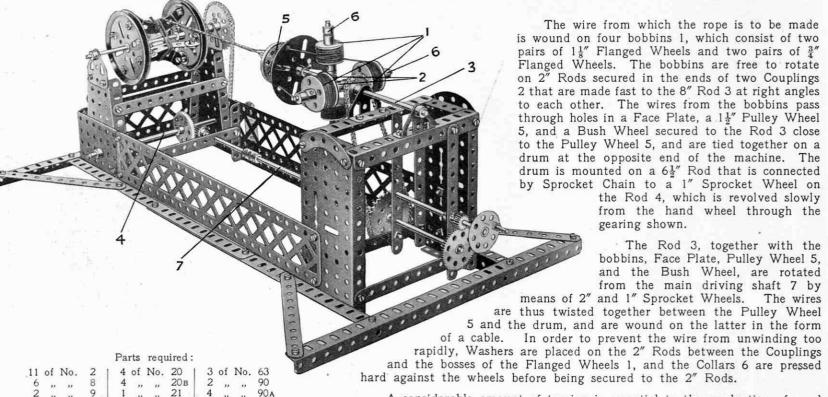

A considerable amount of tension is essential to the production of good wire rope, and for this reason the  $1\frac{1}{2}$ " Pulley Wheel 5 and the Bush Wheel behind it are secured close together on the Rod 3 in such a manner that the friction generated by the wires in passing through the holes in the wheels keeps the cable taut while it is being twisted. String or thin wire may be used in the model.

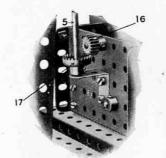


Fig. 4.58A


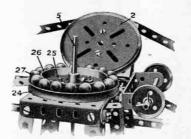


Fig. 4 588

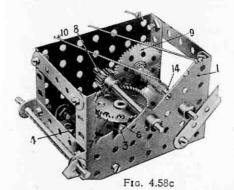

## Model No. 4.58 Elevated Jib Crane


				Pa	arts	req	uired:			- 0.00	
4	of	No.	1	1 1	of	No.	19	1	of	No.	29
10	"	,,	2	1	,,	,,	19в	4	,,	,,	35
1	,,	"	3	1	,,	,,	19s	85	,,	,,	37
8	"	"	5	4	,,	,,	20	1	22	,,,	46
4	"	21	.8	1	"	,,	21	3	,,	,,	48A
14	2.2	22	11	1	"	"	22	2	"	,,	52
14	"	"	12	2	"	- 27	22A	5	**	,,	53
1	33	**	12A	1	"	"	24	1	22	22	57
5	"	**	13 16	1	"		26	6	"	12	59
1	"	21	18a	1	25	217	27A 28	1	"	**	63
		**									


The gear-box 1 is secured to a 3" Pulley Wheel 2 (the boss 3 of which is upward) by means of two  $2\frac{1}{2}'' \times \frac{1}{2}''$  Double Angle Strips 4. The  $11\frac{1}{2}''$  Rod 5 passes up through the boss 3, a Collar 6 being placed on top of the boss. The Contrate Wheel 7 is then secured to the top of the Rod 5. A  $\frac{1}{2}''$  Pinion 8 engages the Contrate Wheel 7 and also a 57-toothed Wheel 9 on the Rod 14 on which latter the hoisting cord 10 is wound, passing over the 1" Pulley 12 to the Hook 13. The Rod 5 is actuated from the Crank Handle 15 by the Pinion 16 engaging a  $\frac{3}{4}''$  Contrate Wheel 17 and

through the Gear Wheels 7, 8, and 9, and operates the cord 10 to raise or lower the load. The jib 18 is swivelled from the Crank Handle 19, a continuous cord 20 being wound twice round the Flange Wheel 21, against which is butted a Bush Wheel 22 to make it into a double flange pulley. A cord 20 passes round 1" guide Pulleys 23 round the 3" Pulley Wheel 2. By turning the handle 19 the jib is swivelled.

Alternative Construction. In order to make the jib swivel more freely, a ball-race, Fig. 4.58B, may be fitted. This is made by bolting to the top of the frame a 3" Pulley Wheel 24 by Bolts 25 which also secure in the Pulley Wheel 24 a Wheel Flange 26. This provides a circular groove for the reception of the Ball Bearings 27. The Pulley Wheel 2 which is bolted to the gear-box 1 is then placed over the Rod 5 and rests on the Ball Bearings 27, which thus support the weight of the superstructure.

(N.B.—The Wheel Flange and the Balls for the bearing are not provided in this Outfit but can be bought separately. See parts list page).

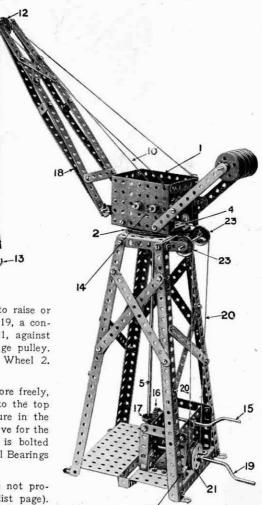

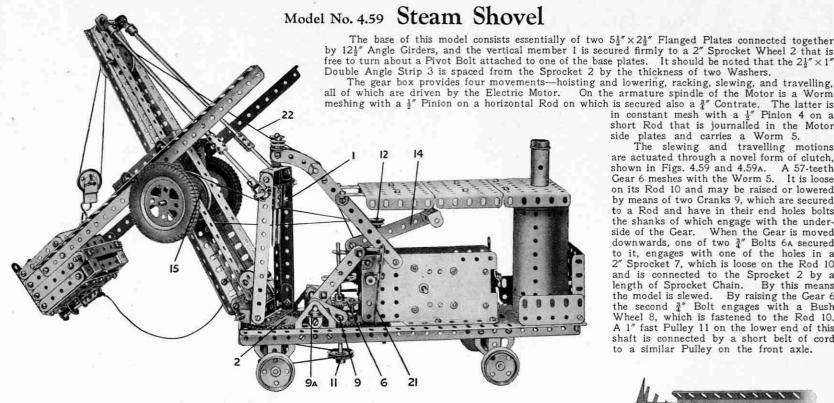

-	
Parte	required:

6			rans required.															
	of	No.	2	3	of	No.	14	3	of	No.	23	1 1	of	No.	44	3 of	No.	90
2	,,	,,	2A	1	,,	,,	15	1	,,	,,	23A	1	,,	,,	45	11" ,,	,,	94
6	,,	,,,	3	5	,,		15A	2	,,,		24	1	,,		46	2 ,,		95
4	,,		4	5	,,		16	2	,,	,,	26	2	,,	,,	48	2 ,,	.,	103F
18	,,	,,	5	5	,,	,,,	17	2	,,	,,	27A	10	**	99	48A	2 ,,	,,	111
2	,,		6A	4	,,	-,,	18a	1	,,	"	29	2	**		52	3 ,,	- 27	111c
8	,,	,,	8	4	,,	,,	20	2	,,		32	4	,,	,,	53	2 ,,	,,	115
8 2 3	,,	***	9	3	,,	"	20 A	10	,,		35	1	,,	,,,	57	1 ,,	,,	116A
3	,,	"	10	1	,,	"	20в	125	,,	,,	37	10	**	,,,	59	3 "	,,,	126
1	,,	,,	11	1	,,		21	7	,,	,,	37A	2	- ,,	,,,	62	4 ,,		126A
12	,,	,,	12	2	,,	,,	22	21	,,	,,	38	6	,,	,,,	63	2 ,,	,,	142A
4	,,	"	12A	1	,,	,,	22A	1	,,	,,	40	2	,,	,,,	77	1 ,,	,,	147в

1 of No. 1162 1 ,, ,, 163 1 ,, ,, 164 1 .. .. 166

Electric Motor (not included in Outfit)

in constant mesh with a 1 Pinion 4 on a short Rod that is journalled in the Motor side plates and carries a Worm 5.

The slewing and travelling motions are actuated through a novel form of clutch, shown in Figs. 4.59 and 4.59A. A 57-teeth Gear 6 meshes with the Worm 5. It is loose on its Rod 10 and may be raised or lowered by means of two Cranks 9, which are secured to a Rod and have in their end holes bolts the shanks of which engage with the underside of the Gear. When the Gear is moved downwards, one of two 3" Bolts 6A secured to it, engages with one of the holes in a 2" Sprocket 7, which is loose on the Rod 10 and is connected to the Sprocket 2 by a length of Sprocket Chain. By this means the model is slewed. By raising the Gear 6 the second 3" Bolt engages with a Bush Wheel 8, which is fastened to the Rod 10. A 1" fast Pulley 11 on the lower end of this shaft is connected by a short belt of cord to a similar Pulley on the front axle.

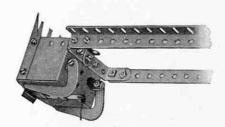


Fig. 4.59A. If available, the Meccano Digger Bucket (part No. 169) may be used with advantage in place of the built-up Bucket, as shown.

### Model No. 4.59 Steam Shovel (continued)

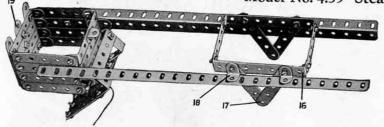


Fig. 4.59B. The Bucket Arm, with Bucket and Guide Frame in position.

It should be borne in mind that the Gear 6 must be always in mesh with the Worm 5, unless it is required to throw it out of gear entirely, when it is only necessary to slide it up the Rod to its fullest extent. To prevent the Gear coming out of mesh with the Worm when in the slewing position, a Collar is fixed on the lower  $\frac{3}{4}$ " Bolt, and in order to maintain the operating lever in position after movement, a Spring Clip 9A is mounted on the end of the Rod carrying the Cranks 9, and prevented from rotation by its ends engaging with a  $\frac{1}{2}$ "  $\times \frac{1}{2}$ " Angle Bracket bolted to the Flat Trunnion. Hence the required stiffness in the movement of the lever is obtained.

The drive for the racking movement is taken off a  $\frac{1}{2}$ " fast Pulley 12

secured to the top end of a Rod that carries a  $\frac{1}{2}$ " Pinion 13, which may be brought into mesh with the Worm 5 by sliding the Rod downward with the aid of the lever 14. A belt of cord connects the Pulley 12 with a 2" Pulley 15 secured on a Rod that is journalled in the sides of the jib and which carries two other 2" Pulleys shod with Dunlop Tyres. The frame 16, (Fig. 4.59B) also is mounted on this Rod in the holes 17, and the Girders of the bucket arm engage between the  $\frac{1}{2}$ "  $\times$   $\frac{1}{2}$ " Angle Brackets 18 and the tyre-shod taken several times round the Pulleys 12 and 15.

The construction of the bucket itself should be fairly obvious from Fig. 4.59B, with the exception of the catch for releasing the hinged bottom. The catch consists of a  $1\frac{1}{2}$  Rod free to slide in a Double Bracket that is bolted rigidly to the underneath of the bucket. One end of the Rod is fitted with a Coupling, to which the release cord is attached,

and the other end fits into the lower hole of a 3" Strip 19.


The hoisting barrel consists of a 34" Rod 20 that is free to a


The hoisting barrel consists of a  $3\frac{1}{2}$ " Rod 20 that is free to slide in the Motor side plates and is controlled by the lever 21, so that the 57-teeth Gear on its extremity may be thrown into or out of engagement with the  $\frac{1}{2}$ " Pinion 4. When out of gear the projecting shank of a bolt on the Motor side plate engages with one of the holes of the 57-teeth Gear and thus prevents the unwinding of the barrel. The grub-screw in the boss of the Pinion 4 should be filed, if necessary, so that it does not foul the teeth of the 57-teeth Gear.

The pair of  $\frac{1}{2}''$  loose Pulleys mounted at the top of the vertical member form guides round which the hoisting cord 22 passes when the jib is slewed round. The Boiler is retained in position by a  $6\frac{1}{2}''$  Rod, which passes completely through it, and through the base plate, and is secured by a Bush Wheel on its lower end, and at its upper extremity by a  $\frac{3}{4}''$  Flanged Wheel that forms the chimney cap.

It is an advantage to fill the Boiler with heavy objects so as to prevent the machine from tipping forward. Also, when working cross-track, it is advisable to provide "outriggers." These should take the form of arms pivoted to the truck so that they may be swung out at right angles, and by having their ends packed up, used to relieve the wheels and axles from strain.

Much fun may be had with this model, not only during its construction but afterwards when it is set to work. Also, it may easily be converted into a crane by detaching the bucket arm and unhooking the bucket from the Pulley Block.

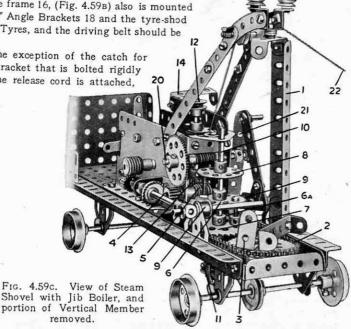

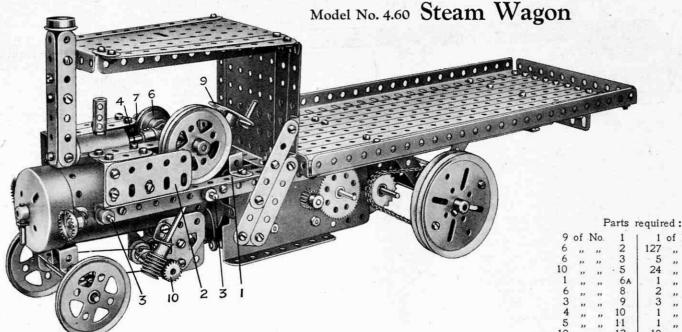

The main frame and the bodywork (Fig. 4.60a) should first be constructed. The frame consists essentially of two Girders 1 each formed from two  $12\frac{1}{2}$ " Angle Girders overlapped and bolted together. The Girders 1 are spaced apart by  $5\frac{1}{2}$ " transverse Girders, to the ends of which are bolted  $12\frac{1}{2}$ " Girders forming the sides of the platform. Two  $2\frac{1}{2}$ " Flat Girders 2 secured by means of Angle Brackets to the front ends of the Girders 1 carry 1"  $\times$  1" Angle Brackets, to which short Strips are bolted as shown. A Channel Bearing is also secured in position to one of the Girders. The  $\frac{3}{4}$ " Flanged Wheel surmounting the chimney is mounted on a short Rod carrying a Collar that is secured by the Bolt 14 (Fig. 4.60a).

The boiler unit (Fig. 4.60B) is held in position by two  $3\frac{1}{2}$ " Rods 3 that are passed through holes in the Girders 1,  $5\frac{1}{2}$ " Strips being bolted to the Girders to cover the elongated holes. A Sleeve Piece represents the cylinder, on the inside of which an Angle Bracket is secured to hold a short Rod 4 representing the piston connecting Rod. A small Fork Piece is carried on the Rod so that its fork engages with the 3" Rod 5, journals for which are provided by a Double Bracket secured to the Boiler and by a Flat Bracket 7 that is bolted to the Channel Bearing on the frame. Two 2" Pulleys serve as a flywheel while a 1" Pulley on the Rod takes up the drive from the armature spindle of the Electric Motor.


1 " " 6A 1 " " 45
6 " " 8 2 " " 48
3 " " 9 3 " 48A
4 " " 10 1 " " 52
5 " 11 1 " " 53
19 " 12 10 " " 59
4 " 12A 2 " " 63
1 " 15 2 " " 94
2 " 15A 2 " " 95
5 " 16 2 " " 95
5 " 16 2 " " 95
5 " 16 2 " " 95
5 " 16 2 " " 95
1 " 17 2 " " 103F
2 " " 18A 2 " " 111
4 " " 19B 6 " " 111c
4 " " 20A 2 " " 115
1 " " 20B 1 " " 116A
2 " " 22 1 " 125
3 " 23 4 " 126A
1 " 160
2 " " 26 1 " 162A
2 " " 27A 1 " 162B
2 " " 29 1 " 163

Electric Motor (not included in Outfit)

### Model No. 4.60 Steam Wagon (continued)

The "firebox" is formed by two pairs of Flat Trunnions held together by  $1\frac{1}{2}'' \times \frac{1}{2}''$  Double Angle Strips, one of which is secured to the Boiler. The frame so formed holds the steering mechanism, which is operated by the hand wheel 9, the Rod of which carries a Worm engaging the  $\frac{1}{2}''$  Pinion 10. This Pinion is secured on the end of a 2'' Rod carrying a Coupling between two  $\frac{1}{2}''$  Pulleys, and a length of cord wound round the Coupling has its ends secured to the Double Angle Strip carrying the front axle. The Double Angle Strip is bolted to a Double Bent Strip, which is pivoted by a bolt and two nuts to the underside of the Boiler.

Fig. 4.60c shows the arrangement of the gearing for the drive to the rear axle. A  $\frac{1}{2}$ " Pinion on the Motor armature spindle engages a 57-teeth Gear on a Rod that carries a further Pinion engaging a second Gear. The Rod of the

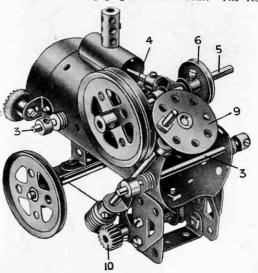

37A

45

48

48A

52

53

59

63 94

95

96

03F

11

11c

15

25

60

16A

26A


62A

62<sub>B</sub>

63

64

Fig. 4.60B

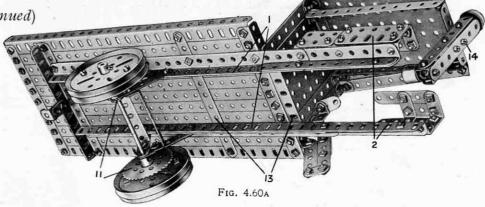


latter carries two 1" Sprockets from which the drive is led by means of chain to the Sprockets 11 (Fig. 4.60A). The armature shaft of the Motor also carries a 1" Pulley which transmits the drive via a belt to the Rod carrying the flywheel. The belt after passing round the Pulley 6 is crossed, passed on either side of the Pulley 8 (Fig. 4.60c), and again crossed before being led round the Pulley on the Motor spindle. The Motor is held in position by the Angle Brackets

12, the bolts of which pass through the holes 13 (Fig. 4.60A) and corresponding holes on the opposite side of the wagon.


The switch arm of the Motor is extended by means of a short Rod held in a Coupling, to facilitate control from the cab. The Coupling is secured by two bolts passed through holes in the switch arm and screwed into the tapped holes of the Coupling. Each of the bolts carries a nut for spacing purposes.

When the three units, Figs. 4.60A, 4.60B, and 4.60C have been assembled and fitted together to form the complete model, all moving parts should be examined to see if they work freely. Rotating shafts should be oiled, and for this purpose Meccano Lubricating Oil is excellent.

Rubber covered wire is used for connecting the Accumulator and Motor, and may be coiled to represent a miniature hose. The coil should be tied to the side girder of the wagon and to the flange of the Electric Motor (see Fig. 4.61B, page 40) so that the wire can be passed through the platform to the Accumulator.

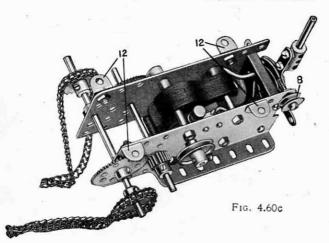

### Model No. 4.61 Trailer (for Lorry or Traction Engine)

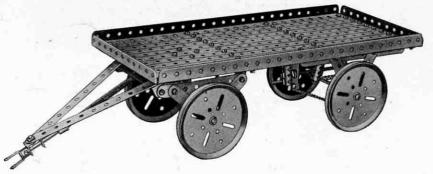

Parts required:

9 of No. 1 | 2 of No. 15a | 6 of No. 38 | 1 of No. 109
4 ,,, 2 | 1 ,,, 17 | 1 ,,, 43 | 2 ,,, 111
4 ,,, 3 | 1 ,,, 18a | 1 ,,, 46 | 1 ,,, 1116
8 ,,, 5 | 4 ,,, 19B | 3 ,,, 48B | 1 ,,, 115
2 ,,, 8 | 1 ,,, 20 | 3 ,,, 59 | 1 ,,, 116
4 ,,, 9 | 1 ,,, 24 | 2 ,,, 63 | 1 ,,, 162
2 ,,, 10 | 68 ,,, 37 | 1 ,,, 80a | 1 ,,, 166

In Cor


ma is w The

the the fro con

11:

A Face Plate 1 (Fig. 4.61A) is bolted to the Strips of the platform and a  $1\frac{1}{2}$ " Rod 2 secured in its boss passes through the centre hole of a Boiler End, which is held in position on the Rod by a Collar. Two  $3\frac{1}{2}$ " Strips are bolted to the Boiler End and to these  $3\frac{1}{2}$ "  $\times$   $\frac{1}{2}$ " Double Angle Strips are secured but spaced by means of Collars and Washers. A further Double Angle Strip, to which the drawbar is connected, is attached loosely by lock-nutted Bolts 3.

A brake is provided by the Sprocket Chain 4, which passes over a drum formed from a Flanged Wheel and Bush Wheel on the back axle. The tension on the Chain is varied by operating the hand Wheel 5 on a Threaded Rod, along which travels a Coupling carrying one end of the Chain.

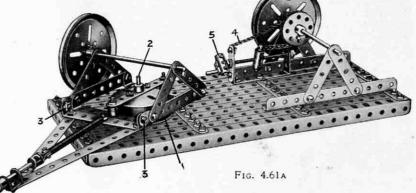

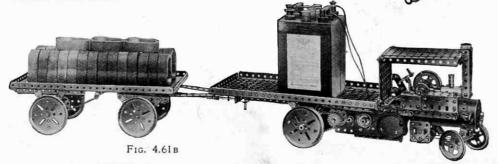


Fig. 4.61b shows models Nos. 4.60 and 4.61 coupled together and heavily loaded. The small Fork Piece on the trailer drawbar is inserted in a Double Bracket fixed under the rear end of the wagon (see Fig. 4.60a) and held in place by a short Rod carrying a collar.

The model steam wagon has remarkable hauling power and will pull with ease, at a considerable speed, a load weighing over eighteen pounds in addition to the 6-volt 20 amp. Accumulator. By employing further reduction gearing between the Electric Motor armature shaft and back axle still heavier loads can be hauled, of course.

### Model No. 4.62 Gantry Crane

The Pulley 1 is capable of being hoisted to raise the load, or traversed. In order to raise the load the Crank Handle 2 is operated, which winds the Cord 3 passing over the rear Pulley Wheel 4 round the  $\frac{1}{2}$ " Pulley 5 and a corresponding Pulley in the block, thence round another  $\frac{1}{2}''$  Pulley 6 and is made fast at the end of the gantry. For traversing a continuous Cord 7 is wound several turns on the  $3\frac{1}{2}''$  Rod 8 to which is secured a hand Wheel 9. The cord passes over the Pulley Wheel 10 and is secured to one of the side Plates 11, and continues round the Pulley 12 returning to and passing over the nearest Pulley Wheel 13 back to the Rod 8. Consequently by turning the hand Wheel 8 in one or other direction, the carriage is traversed to and fro along the top Angle Girders 14, which form the travelling rails. The construction of the travelling carriage is shown in Fig. 4.62a, three Washers 15 being placed on each of the outer Bolts, passed through the two Plates 11; and  $\frac{1}{2}$  Pulley Wheels 5, 6, on the inner Bolts. The outer plates being


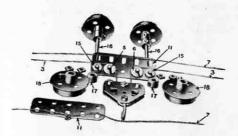



FIG. 4.62A.


then bolted together, the Rods 16 of the Flanged Wheels are passed through both plates in the end elongated holes, and Collars 17 secured on the exterior. after which the remaining Flanged Wheels 18 are secured on the ends of the Rods 16.

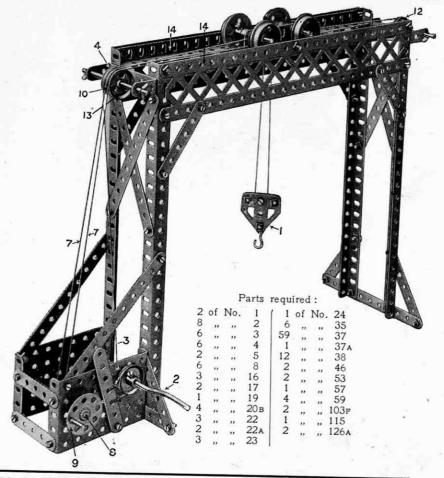


### HOW TO CONTINUE

This completes our examples of models that may be made with MECCANO Outfit No. 4. The next models are a little more advanced, requiring a number of extra parts to construct them. The necessary parts are all contained in a No. 4A Accessory Outfit, the price of which may be obtained from any Meccano dealer.

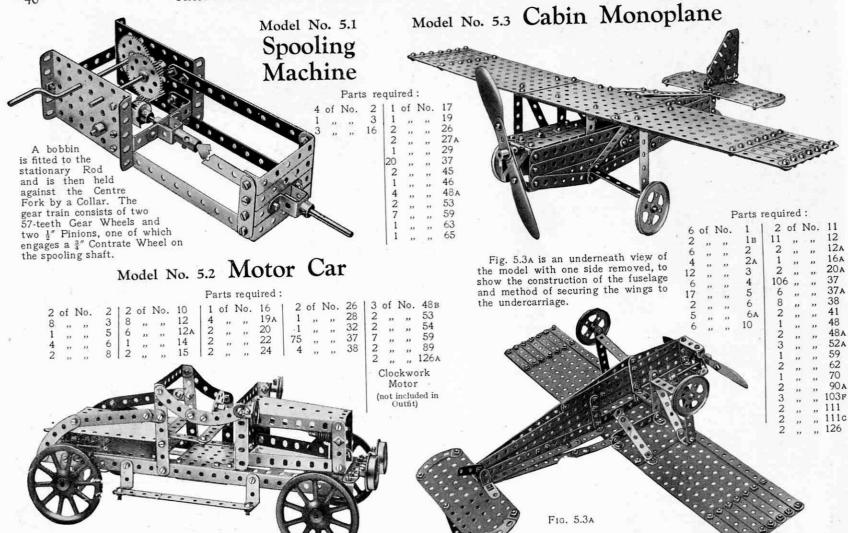

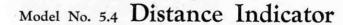

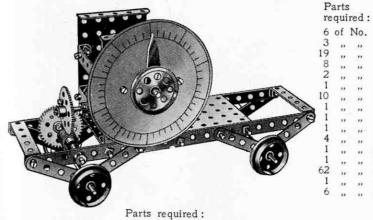


4	of	No.	2	12	of	No.	15A	12	of	No.	22	1
4	,,	,,	3	1	,,						24	
8	,,	,,,	5	1	,,		17	2	,,	"	26	
10	**	,,	12	4	,,	,,	20	2	,,	,,	27A	
2	,,	,,	15	1	,,	"	21	1	,,	,,	28	






		Fa	112 16	quii	eu.	100		
5	of	No.	3	1	of	No.	32	
6	,,	.,,	5	77	,,	,,	37	
4 5	,,	,,	8	2	,,	**	38	
5	,,	,,	12	2	- 22	**	45	
1	- 22	**	12A	7	,,	,,	48A	
2	,,	,,	14	1	.,,	**	48в	
1	,,	,,	15	2	,,	,,	52	
2 2 4	,,	22	16	4	,,	.,,	53	
2	,,	22.	18a	2	,,		54	
	,,	"	19A	8	,,	,,,	59	
1 2 2	,,	,,	19в	1	,,	,,,	63	
2	,,	,,	22	1	,,,	**	109	
2	,,	- "	24	3	,,,	,,,	126A	

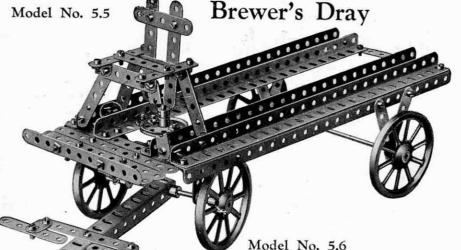



Armoured Motor Car


The turret, made up of a number of Double Angle Strips 1 bolted at the top to a 3" Pulley 2 and below to a Face Plate, is bolted on a Rod 3 passing up the centre which forms the pivot of the turret so that it may freely turn. The gun 4 is bolted in a Coupling on this pivot Rod.



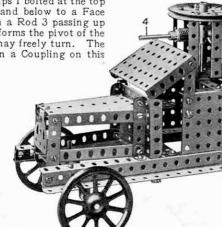

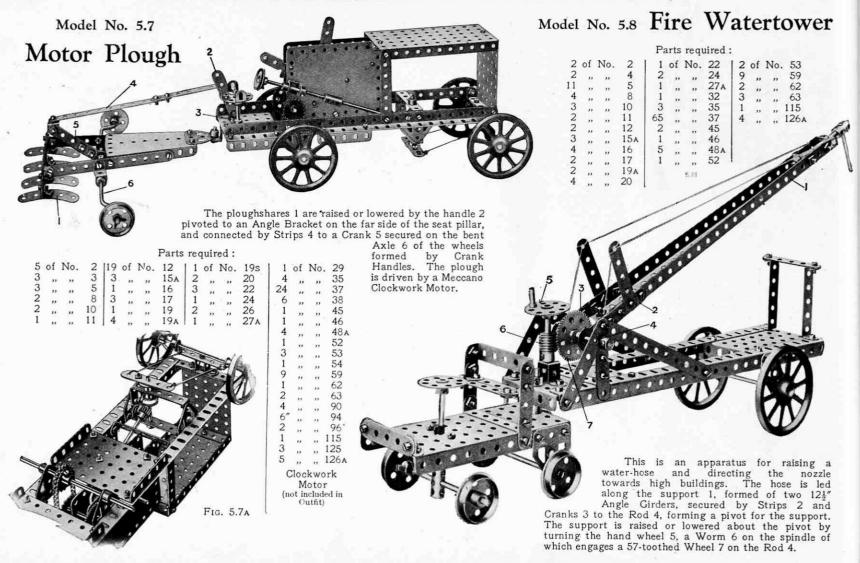

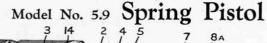


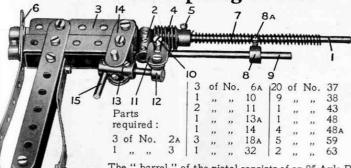

The "barrel" of the pistol consists of an 8" Axle Rod 1 passing through a Coupling 2 and through the ends of two 2½" × ½" Double Angle Strips 3. It carries a Worm 4, which is secured by a Bolt 5 in place of its grub-screw. This

bolt serves as the foresight, the backsight being formed by the upper hole of a 14" Strip 6. A Meccano Spring secured by one of its end loops to the bolt 5, is mounted on the barrel and opened out to form a compression spring. The loop at the other end should be cut away.

Collars, with set-screws extracted, may be used as bullets, or small pieces of wood of similar shape may be employed. The gun is loaded by placing the bullet upon the barrel and pushing the Spring 7 back until the bullet passes the Collar 8. The latter is rigidly secured by means of a 7/32" Bolt 8A to a 61" Rod 9, which is free to turn slightly in its bearings. The Bolt 8A is pushed in front of the bullet, so preventing the Spring 7 from expelling it from the barrel. Another Collar and Bolt 10 is secured to the Rod 9 and coupled by means of a Flat Bracket 11 to a bolt mounted in a Collar 12. This in turn, is secured to a 14" Rod inserted in a Coupling 13 pivotally mounted and spaced on either side

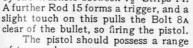


by two Washers between 11" Strips 14.

of ten yards or more.

									3	"	,,	48 A
					1	of	No.	16	2	,,	,,	48 E
	1 2	of	No.	4	1	,,	,,	18A	2	,,	,,	53
	6	**	,,	5	4	,,	.,,	19A	3	**	,,	59
	2	"	,,	6A	1	,,	,,	20	1	,,	,,	62
Danta	3	,,	,,	10	1	,,	,,	21	1	,,	,,	63
Parts	3	,,	,,	11	1	,,	"	22	2	"	,,	90
required:	14	,,	,,	12	1	,,		24	1	"	,,	115
4 of No. 2	2	,,	,,	15	1	,,	"	32	2	,,	,,	125
2 3	1			154	62	"	,,	37	2	.,	"	1264

Model No. 5.10

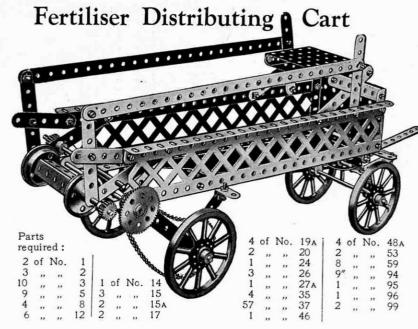


### Model No. 5.11 Field Gun and Carriage

2 of No. 38




### Model No. 5.12 Fret Saw

				Pa	rts	requ	uired:				
4	of	No.	1	12	of	No.	17	5	of	No.	59
17	.,,	,,,	2	1	,,		19в	1	,,		115
6	,,	,,	8	4	,,		22	2	,,	,,	126A
1			15	53			37	1			130

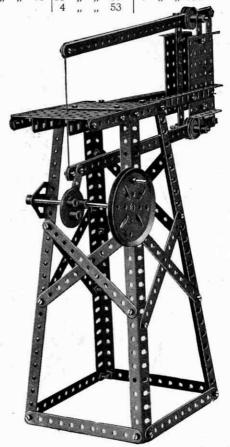


	of	No.	1
1	,,	,,	1в
4	"		2
2	.,,	**	2A
12	"	,,	3
1	. 11	**	5
2	"	"	6 <b>A</b>
2	"	,,	8a
4	,,	,,	9
12	"	,,	10
21	"	"	12
2	"	,,	12A
1	"	,,	15
i	"	,,	15A
1	,,	"	16
1		,,	16A
1	,,		17
4	,,	,,	20A
1	,,	,,	21
4	,,		22
1	,,	,,	23
1	,,	,,	26
1	,,	,,	27 <sub>A</sub>
2	,,	**	29
112	21	"	37
11	**	,,,	37A
4	,,	"	38
1	**	**	40 48 <sub>A</sub>
6	,,,	**	48B
2	"	"	52A
2	"	"	53
1	**	***	54
9	,,,	**	59
ź	"	,,,	77
4	"	,,,	90 A
7	"		94
1		.,	96
1	,,		96A
3			111
3	,,	,,	111c
4	,,		142A
1	,,	,,	160
	not	ork includ Outfit	Motor ded

### Model No. 5.13 Char-à-Banc

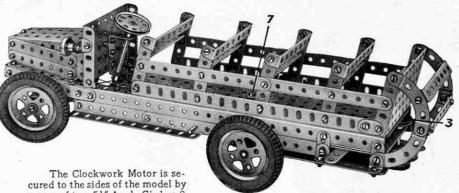

means of two 5½" Angle Girders 8 (Fig. 5.13a) and the ½" Pinion on the Motor driving shaft engages with a 57-teeth Gear on the Rod 1. Two 1" Pulleys 2 and 3 are secured to each extremity of this Rod and are connected by cord to the Pulleys on the Rod 4. The jockey pulley 5, over which one side of the cord passes, is mounted on the Motor side plate by a Flat Bracket and an Angle Bracket. The Rod 6, which guides the cord to and from the Pulley 3, is journalled at one end in the side of the model and at the other in a Collar secured to the floor by a Bolt 7.

Steering is accomplished by means of a cord passed about four times round the lower end of the steering column and connected to each end of the  $3\frac{1}{2}'' \times \frac{1}{2}''$  Double Angle Strip 9. This latter is pivoted at its centre hole to a  $1\frac{1}{2}''$  Strip secured to the fore part of the bonnet by a  $1'' \times 1''$  Angle Bracket.

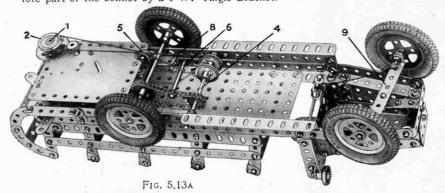


Parts

required:

2 of No. 1

Model No. 5.14

### Skein Winder

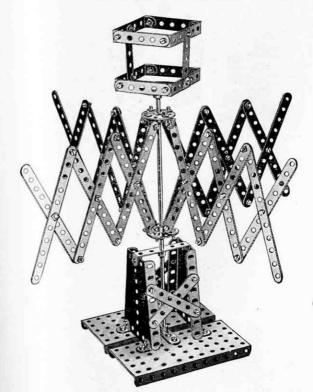


### Parts required:

24	of	No.	2	1 2	of	No.	24	
4	,,	**	4	86	39	99	37	
7	22	22	5	5	37	.,	48A	
8	,,	**	12	2	,,	,,	52	
1	**	**	13	2	**	**	54	
1		"	21	2	***	,,,	59	


### Model No. 5.15 Measuring Machine

The drive is transmitted from the road wheels by a \( \frac{3}{4}'' \)
Contrate Wheel engaging a \( \frac{1}{2}'' \) Pinion. A Worm on the shaft of the latter engages another \( \frac{1}{2}'' \) Pinion, on the Rod of which is fixed a pointer which indicates up to five yards. When this pointer touches the 2" Sprocket Wheel, on which is fixed a second indicating dial, it turns the wheel round one tooth, representing five yards.

A Ratchet is fixed at the other end of the pointer Rod. It consists of a 1" Sprocket Wheel and a 2½" Strip that is bolted to the frame by a ½" Reversed Angle Bracket.

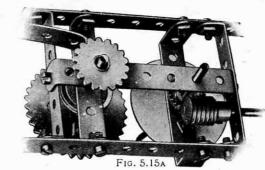


Model No. 5.16 Invalid Chair

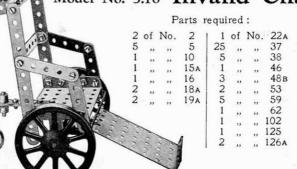



Outfit)

Outfit)

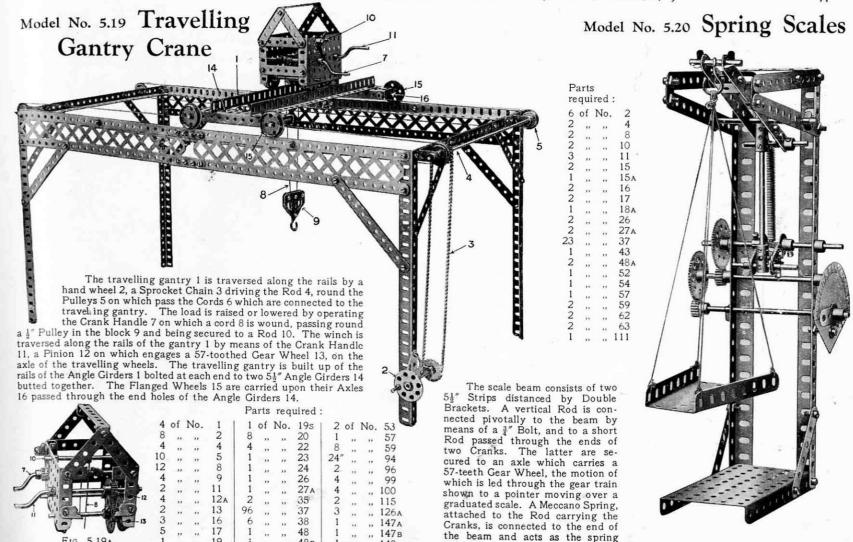

balance.

unted

to the

t both

(S.M.

Model No. 5.21



### Parts required:

of Weighing Platform,

							0000000					
7	of	No.	2	1	of	No.	16	2	of	No.	52A	
2	,,	,,	4	1	,,	,,	17	13	,,	,,	59	
2	,,		5	1	,,	,,	18A	4	,,	,,	63	
4	,,	**	6	2	,,	**	20	1	**	22	80a	
4	,,	**	6A	1	,,	,,	32	4	,,	,,	90 A	
4	,,	**	8	8	,,	,,,	35	6"	,,	,,	94	
4	,,		9	76	,,	,,	37	3	,,	,,	100	
9	.,,		10	5	,,	**	37A	1	,,	,,	111	
1	.,		11	10		**	38	1	22	- 22	111c	
8	,,	**	12	1	,,	,,	46	2	"	,,	115	
6	,,	,,,	12A	2	11	,,	48	2	,,	,,,	125	
18622	**	**	14	4	"	,,	48 D	1	,,	,,,	126A	
2	"	,,	15A									

Two 5½" Strips 2 (Fig. 5.21B) are supported pivotally at one end by Flat Brackets held loosely between Collars on the Rod 1, and are spaced apart at the other end by two 1" Reversed Angle Brackets 7, the out-turned portions of which carry a Flat Bracket 7A. Meccano Sprocket Chain 8 connects the Bracket 7A with the Screwed Rod 9, which is held in the centre transverse hole of a Coupling 11. This Rod 9 is connected by another Coupling to a 41" Rod on which a weight 12 (a Worm Wheel) is free to slide. Another weight 10 (two Flanged Wheels) is secured to a Coupling that may be fixed at any suitable point on the other end of the balance arm, and the entire arm is suspended from the Coupling 13 by means of a piece of strong silk 14.

> Two 21" Strips 6A are connected pivotally by Flat Brackets to the Rod 6, and their other ends hold a Rod 5 that passes under the Strips 2. A Double Bracket 4 is passed over the Rods 3 and 5 and held in place by a 3" Bolt 4A. The platform merely rests on the levers in the base, the Rod 15 and Threaded Pins 18 (Fig. 5.21A) making contact with the Strips 2 and 6A respectively. The Angle Brackets 17 are merely guides and rest against the inner sides of the Braced Girders in the base.

An excellent model for use

in conjunction with Hornby Trains


> Rear view, with Platform and Approaches removed.

the balance arm is horizontal when no load is applied to the platform. A truck placed on the rails 19 causes the arm 9 to be pulled downwards by the Chain 8, and the extent of the load may be calculated by noting the distance through which it is necessary to move weight 12 in order

to return the arm to the horizontal.

The position of the weight 10 should be adjusted so that

Fig. 5.21 General view. FIG.

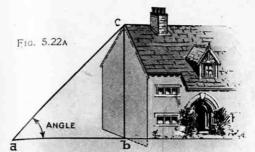

Parts required:

24 of No. 37

lat

hat

lat-

des des ase. hat the o be oad ugh

### Model No. 5.22 Sighting Apparatus

This model is for determining the heights of buildings, towers, etc. The pointer  $11\frac{1}{2}$ " Rod 1 is pivoted on the 2" Rod 2 and controlled by a Spring 3, the pointer 1 being adjusted by the cord 4 which passes round a guide Pulley 5 and on to the Axle 6 upon which it is wound by the Crank Handle 7


which operates the Gear Wheel and Pinion 8. A graduated scale of degrees 9 made of cardboard, or a protractor, is mounted in order to read off the angle of inclination of the pointer.

In finding the height of a building, measure out a number of feet or yards from the foot of the building, and set this out to some scale corresponding to the line  $a\ b$  (Fig. 5.22a). Then standing at the point a furthest from the building, and keeping


the Angle Girders 10 horizontal, move the pointer 1 until it is directed towards the top of the building. Then read off the angle on the scale 9, and draw a line a c, making the angle b a c equal to the angle read off. Then draw a vertical line b c from the point b, and with the same scale used for setting off the distance a b measure the height b c, which will be the height of the building.

Parts

required:

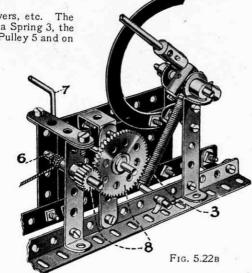


### Model No. 5.23 Mouse Trap

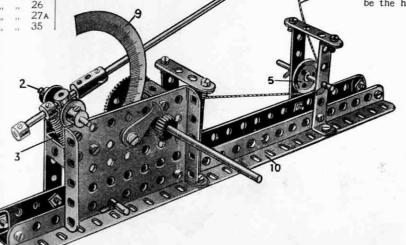


2 of No. 63

1 .. .. 147A

" " 147в

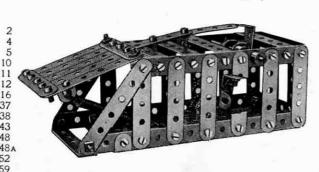

### Model No. 5.24 Helicopter Toy

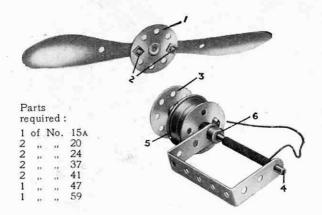

The Bush Wheel 3 and the two Flanged Wheels 5, which act as a flywheel, are all secured to the 41 Rod 4, and the latter is journalled in a  $2\frac{1}{2}'' \times 1\frac{1}{2}''$ Double Angle Strip, in which it is retained by a Collar 6. The Double Angle Strip forms a convenient handle with which to hold the toy.

Rod 4. The propeller I should be placed so that the shanks of the Bolts 2 lodge freely in the holes of the Bush Wheel 3. If now the free end of the cord wound on the Rod 4 is given a smart pull, the propeller will immediately leap off into the air.

### Model No. 5.25 Automatic Racer

The car is lifted, by means of rotating arms driven by the Clockwork Motor, from the lower track on to an elevated chute, which tilts and allows the car to descend rapidly so that its momentum carries it to the upper end of the inclined track, where a 1"×1" Angle Bracket forms a stop to prevent it running off the end. Gravity then causes the car to descend and pass under the raised chute—which has been automatically lifted by means of balance weights—to the lower extremity of the track, where it releases a catch, thus allowing the cycle of operations to be carried out until the spring of the Motor is run down.


For the construction of the main track  $12_4^w$  Girders are secured by mans of both passed through their elongated holes and through  $3_2^w \times 2_2^w$  Flanged Plates. The bolt heads should be spaced from the upturned flanges of the girders to allow sufficient room for the 2" Pulleys of the car to pass unimpeded. Two 51" Girders are bolted vertically to Trunnions which, in turn, are secured to 54" Transverse Girders near the lower end of the track. The vertical Girders are braced by 94" Girders


A & Pinion on the Motor driving spindle meshes with a 57-teeth Gear, the Rod of which carries a & Pinion meshing with a further Gear on a 14" Rod 1. This Rod carries a 1" Sprocket Wheel transmitting the drive through Chain to the Sprocket on a 64" Rod journalled in the vertical Angle Girders. The 64" Rod also carries two Couplings carrying the Rods 3, two Double Brackets to which the Girders of the elevated chute are secured, and two Bush Wheels clamped on either side of the balance weight 4. The Rods 3 carry near their outer ends Collars, in the tapped holes of which bolts 5 are screwed and arranged to

A 3" Strip 6 is held loosely to a Pivot Bolt and carries a Flat Bracket to which two Angle Brackets are fixed so that they catch the bolt 5 and prevent the Rods 3 revolving. The mechanism should be very carefully adjusted so that the Angle Brackets 7 and 8 of the car release the catch and then come into position directly above the bolts 5, which, being freed, are raised by means of the Motor. The lower edges of the Brackets 7 should be slightly higher than those of the Brackets 8. The bolts 5 carry the car up and deposit it on the upper girders, which are normally held in a horizontal position by the Girders 9. The latter are pivoted by lock-nutted bolts at 10 and are provided with balance weights 11 consisting of 21 Strips. A Rod 12 held in Cranks at the ends of the Girders carries Collars which are so arranged to keep the side members of the chute in align-

Before setting the model in operation all parts on rotating shafts should be fixed securely. The Sprocket 2, the Couplings carrying the Rods 3 and the Bush Wheels which hold the weight 4, should all be provided with two grub screws, since they must be absolutely immovable on the horizontal 61" Rod.

### Parts required:

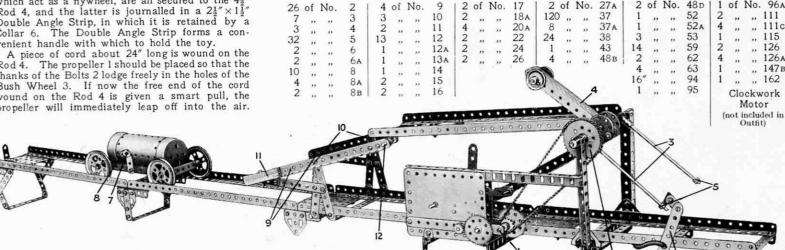


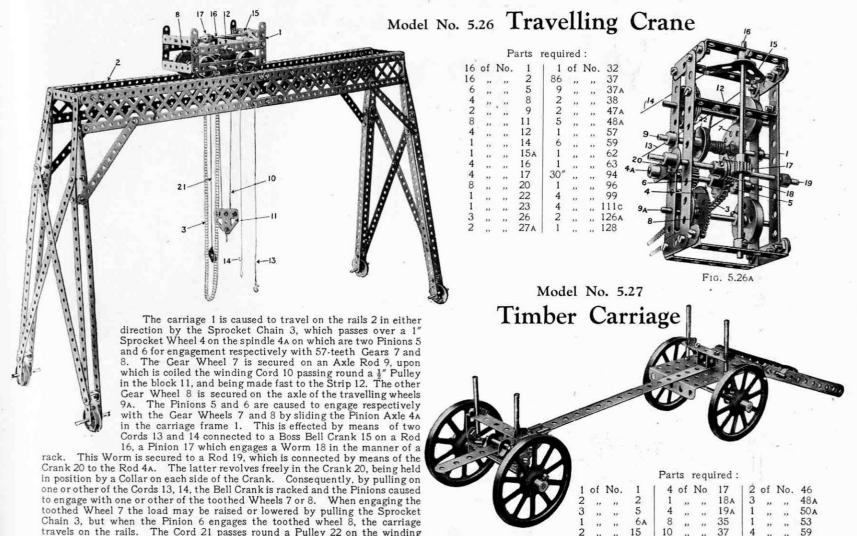

Axle and acts as a brake.

### Model No. 5.28 Vertical Drill

### Model No. 5.29 Giant Auto Swing

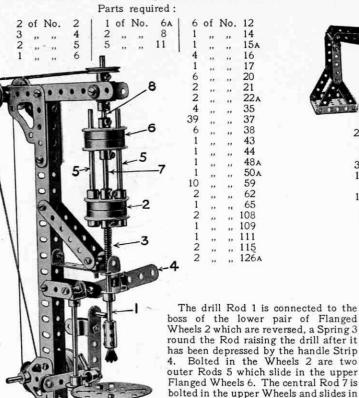

the centre bosses of the lower Wheels 2. The upper Wheels 6 are bolted to the

driving spindle 8 and consequently the

drill is driven by the Rods 5 when the

drill is depressed by the handle 4

See also "Meccano Standard Mechan-

Drive (Section XIII).

isms," under Locking Device

(S.M. 137) and Variable

against the Spring.

Parts required: 1 of No. 24 27A

The beam 1 is rocked by means of a Crank 2 secured on the end of a Rod which forms the beam pivot and which is bolted in a Bush Wheel secured to the beam. This Crank 2 is connected by a Strip 3 to another Crank 4 on a Rod 5. On the end of this is a large Sprocket Wheel driven by a Chain 6 from a small Sprocket Wheel 7 on a Rod 8. This Rod is driven by means of a Worm on the Rod of the 3" Pulley 9 which Worm engages and drives the Gear Wheel 10 on the Rod 8. As the Crank 4 continuously rotates the link 3 causes the upper Crank 2 to oscillate and also the beam 1.

### Model No. 5.30 Vertical Marine Engine

The crosshead I consists of two Flat Trunnions secured together by two Double Brackets, which are free to slide between  $4\frac{1}{k''}$  Strips 2 forming the crosshead guide. The latter is attached at its upper extremity to a  $\frac{1}{k''} \times \frac{1}{k''}$  Angle Bracket on the bottom cylinder cover, and at its lower extremity to a  $\frac{1}{k''} \times \frac{1}{k''}$  Angle Bracket that is mounted on a Trunnion. The Strips of the guide are spaced apart by a Washer on each of the retaining bolts. A Coupling is secured rigidly to the apex of the crosshead by bolts, which are inserted in its upper transverse tapped bore. This Coupling is secured to the piston rod and is attached pivotally to the connecting rod by a Fork Piece that rides on two bolts inserted in its lower transverse tapped bore.

The crankshaft is built up from two Rods on the inner ends of which Cranks are secured very rigidly. The crank pin is a \{\frac{1}{2}^m} Bolt, which is fixed rigidly by nuts in the end holes of the Cranks and in Flat Trunnions that form the balance weights. The "big end" (a Coupling 3) is free to turn on the crank pin between the Cranks, and is attached to the lower end of the connecting rod.

The model is fitted with Stephenson's valve gear. This comprises two Eccentrics, which are mounted upon the crankshaft in such a manner that their throws are opposite, and each Eccentric is connected by a 4½ Strip, to one end of an "expansion link" 4. The latter consists of two 2½ large Radius Curved Strips, bolted together at each end by a ½ Bolt and three nuts. On one of these Strips slides a "die block" 5 and the other is connected pivotally to a crank arm 6 by a 2½ Strip. The die block is an Eye Piece, which is attached to the lower end of the valve spindle by a ½ Reversed Angle Bracket and an End Bearing. The crank 6 is mounted on the "weigh shaft" 6a, to one end of which is secured a 1½ Pulley carrying a "spider" (taken from a Swivel Bearing) in which works a Screwed Rod. The latter is rotated by turning the Wheel 7, so actuating the crank 6 and moving the expansion link in the die block.

Fig. 5.30a

The Marine Engine from the condenser side, with two supporting Girders and one side of cylinder removed.


cet


The "thrust block" 8 consists of two Trunnions and one Flat Trunnion. The two former are bolted down to four Double Brackets 9, Washers spacing each Trunnion from the Double Brackets, whilst 1½" Strips keep the Trunnions apart. The lower portions of the Double Brackets are clamped between pairs of 2½" Strips bolted to the bed plate to keep the thrust block in position whilst the Flat Trunnion is secured in place by a ½" × ½" Angle Bracket. Collars fixed to the crankshaft represent the thrust collars of the actual device.

The circulating pump is represented by a Sleeve Piece 10 fitted with a 4" Flanged Wheel, through which the pump plunger passes. The pump is retained in position by being pushed on to a Chimney Adaptor that is bolted to the base plate, and it is worked off the crosshead through a lever and links. The Boiler secured next to the pump represents the condenser.

### Parts required:

4	of	No.	2	1	of	No.	20	2	of	No.	62
4	,,	,,	2A	2	,,	,,	20 A	4	,,	,,	63
1	,,	"	3	1	,,	,,	20в	1	,,	,,	80a
2	,,	,,	4 5	1	,,	,,	21	2	,,	,,	90
10	,,	,,	5	1	,,	,,,	23	2	,,,		109
4	,,,	,,,	6A	1	"	.,,	23 <sub>A</sub>	2	,,	,	111
4	,,	,,	84	2	,,	,,	24	6	,,	,,	111c
2	,,	,,	8в	86	,,	,,	37	1	,,	,,	115
1 7 5	,,	,,	10	18	,,	,,	37A	1	,,	.,	116
7	,,	,,,	11	24	,,	,,	38	1	,,	,,	125
	,,	,,	12	1	,,	,,	48	4	,,	,,	126
1	,,	,,,	14	3	,,	,,	48A	5	,,	,,	126A
2	,,	,,	15	3	,,	,,	48в	1	,,	,,	162
	,,	"	16	1	,,	,,,	50 a	1	,,	,,,	163
1	,,	"	16A	2	,,,		52	1	,,,	- 11	164
1	,,	**	17	3	,,	.,,	53	1	,,	,,	165
2	,,	"	18A	15	,,	,,,	59	1	,,	,,	166

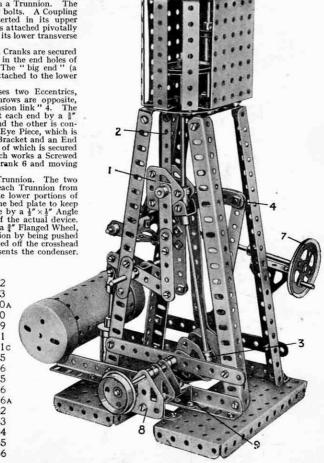

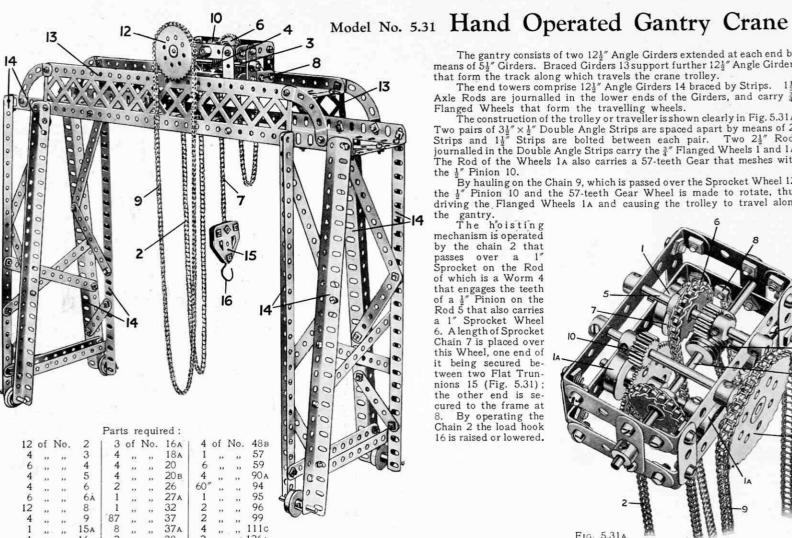

The gantry consists of two 121" Angle Girders extended at each end by means of 51" Girders. Braced Girders 13 support further 121" Angle Girders that form the track along which travels the crane trolley.

The end towers comprise 121 Angle Girders 14 braced by Strips. 112 Axle Rods are journalled in the lower ends of the Girders, and carry 3"


Flanged Wheels that form the travelling wheels.


The construction of the trolley or traveller is shown clearly in Fig. 5.31A. Two pairs of 31" x 1" Double Angle Strips are spaced apart by means of 2" Strips and 11 Strips are bolted between each pair. Two 21 Rods journalled in the Double Angle Strips carry the 3" Flanged Wheels 1 and 1A. The Rod of the Wheels 1A also carries a 57-teeth Gear that meshes with the 1" Pinion 10.

By hauling on the Chain 9, which is passed over the Sprocket Wheel 12, the 1 Pinion 10 and the 57-teeth Gear Wheel is made to rotate, thus driving the Flanged Wheels 1A and causing the trolley to travel along

the gantry.

The hoisting mechanism is operated by the chain 2 that passes over a 1" Sprocket on the Rod of which is a Worm 4 that engages the teeth of a 1" Pinion on the Rod 5 that also carries a 1" Sprocket Wheel 6. A length of Sprocket Chain 7 is placed over this Wheel, one end of it being secured between two Flat Trunnions 15 (Fig. 5.31); the other end is secured to the frame at By operating the Chain 2 the load hook 16 is raised or lowered.

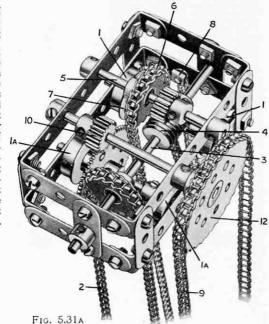

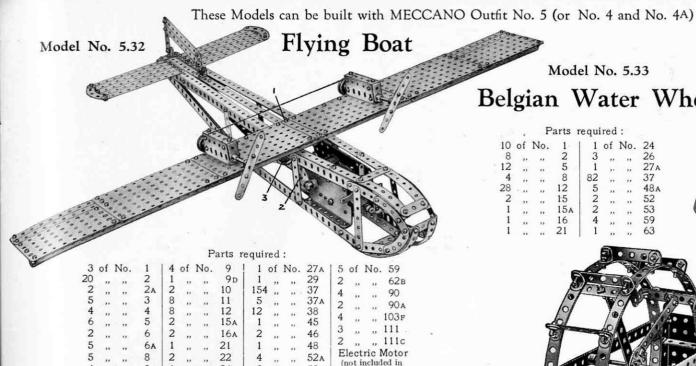


The Flat Plates of the main plane are secured to a girder consisting of one 121/2" Angle Girder extended at each end by 91 "Girders and bolted along the leading edge of the plane with the projecting flange toward the tail of the model. A 2½" Angle Girder is bolted to the centre of the girder so formed and is secured, in turn, across the fuselage. The wings are held rigid by the 3" Bolt 1, which is passed through the 121 Strip in the centre of the fuselage but is spaced therefrom by a Collar.

Outfit)

The Electric Motor is fixed to the lower pair of Angle Girders by means of two Angle Brackets at the front, and two 3" Bolts at the rear passed through the Motor Flanges and secured by nuts below the lower faces of the Girders. The armature spindle carries a 1" Pinion meshing with a 57-teeth gear on the 21" Rod 2, which carries a 3 Contrate Wheel. The latter engages a Pinion on a further 21 Rod to which the 11" Pulley 3 is secured. Bearings for the Rod are formed by a 11" Strip and Double Bent Strip which are bolted by Angle Brackets to the side plates of the Motor. Cord is passed round the Pulley 3 to each of the 1" Pulleys on the propeller shafts of the miniature engines.

Each of the engines consists of two 21/2" Flat Girders and a 21/2" × 1" Double Angle Strip held together by means of Double Brackets and fixed to the wings by similar

means.

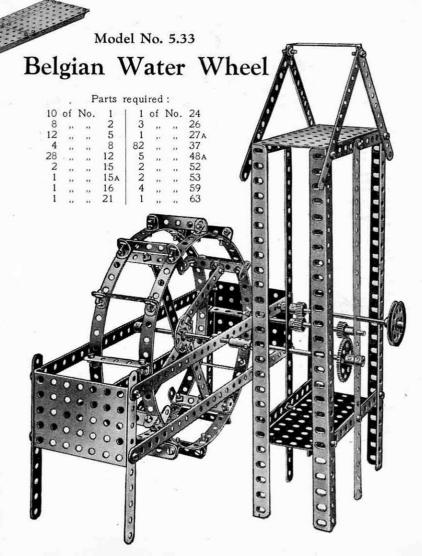

### Model No. 5.34

## Apparatus Well-Drilling

The drive is transmitted from the Motor armature shaft Pulley that is connected when desired to a 3" Pulley on the Rod 2, which forms the hoisting drum for the sand pump 3. The latter is represented by an 11½" Rod secured by a Small which passes over one of to the Rod I by means of two sets of 57-teeth Gears and Pinions. This Rod carries a  $\frac{3}{4}$ " Sprocket Wheel and I" for derrick head. cord, Pulleys at the the hoisting to 1" loose Fork Piece Rod

A 1" Sprocket 5 and ½"
A 1" Sprocket 5 and ½" The 4" Sprocket on the Rod 1 is connected by Sprocket Chain to a 2" Sprocket on the Rod 4. A 1" Sprocket 5 and \frac{1}{2}" may be cured to the tool hoisting drum, which is supplied with a Pawl and Ratchet 8. The cord is wound on to this shaft, carried over the remaining 1" loose Pulley at the derrick head, and Sprocket 6 is seattached to an End Bearing on the tool, the construction of Pulley being connected by cord to a 1" fast Pulley on t crankshaft of the steam engine. The 1" Sprocket 5 may connected, by two different lengths of Sprocket Chain, either of the Sprockets 6 and 7. The 1" Sprocket 6 is fast Pulley are nipped on the other end of this Rod, which is clearly shown in the illustration.

The 2" Sprocket 7 is secured to the crankshaft 9, which is built up from two short Rods and two Cranks, the latter u wo 3 being rigidly secured together

. 3½" Rod 7½" Angle a Double Bolt crankshaft is connected to the beam 10 by a 31 Strip The beam is pivoted at by and A 31" Screwed Rod, turning freely between two centre hole of this Double Bracket, passes through .... hole of a Coupling 13. This carry out the actual digging attached pivotthe end threaded behind he tool cord when it is desired to end 13" Rod at their ends by a having three nuts inner 14, which is clamped Bracket is attach on a ournalled in the Coupling carries Washer Collars in the d its centre of through ally to Collars. means and its

Parts
required:
1 of No. 13A | 6 of No. 37A | 12 of No. 37A | 12 of No. 13A | 6 of No. 37A | 12 of No. 13A | 6 of No. 37A | 12 of No. 37A | 13 of No. 37A | 14 of No. 37A | 15 of No. 37A | 15

Motor of included in

(not

Outfit)

lectric

### Model No. 5.34 Oil Well-Drilling Apparatus

(continued)


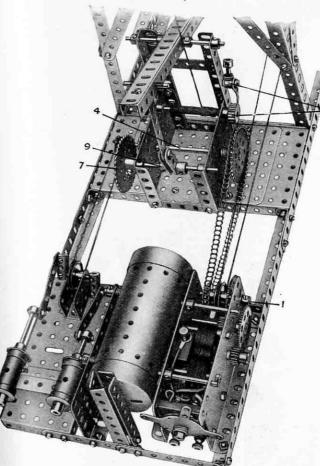


FIG. 5.34A

### Model No. 5.35 Potato Reaper

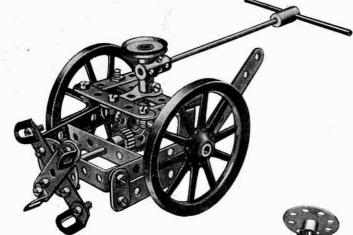

### Model No. 5.36

### Map Measuring Instrument

Parts required:

2	of	No.	2	2	of	No.	24	5	of	No.	37	1	of	No. 62B	
3	,,	- 22	17	2	.,,	- 11	26	1			48	1		" 109 125	
1		0.00	18A	2			27A	4			59	1	- 55	125	

By rolling this model along any desired route in a map, it is possible to obtain a very close approximation of the actual distance. The dial consists of a Face Plate on which is stuck a circular disc of white cardboard, and is divided into forty equal parts representing inches, which, when compared with the scale of the map, will give the mileage. Thus, if the dial gives a reading of 10, and the scale of the map is ½" to the mile, the actual distance will be 20 miles.

The Bush Wheel 1 forms the "travelling wheel," and its motion is transmitted through a gear train to the dial shaft 3. Readings are taken through the hole in the Reversed Angle Bracket 4.

### Model No. 5.37 Cable Ploughing Engine

Two 121" Angle Girders 1, forming the main frames, are extended at the front by Iwo 123 angle Griders 1, forming the main frames, are exceeded at the front by the 5½" forders 2, the complete frames being joined together at the front by the 5½" × 3½" Flat Plates 3, 3A and at the rear by a 3½" × 2½" Flanged Plate 4. Each side of the gear box and controlling platform is built up from a 3½" × 2½" Flanged Plate and a 4½" × 2½" Flat Plate. "These are held rigid by the 3½" Strip 5 (shank portion cut away in Fig. 5.37A) and the 3½" × ½" Double Angle Strip 6.


and the  $3\frac{1}{4}^{1} \times \frac{1}{4}^{2}$  Double Angle Strip 6.


The front axle pivot 7 (a Pivot Bolt) has a Bush Wheel secured to it which carries two  $1^{1} \times 1^{2}$  Angle Brackets 8 and two  $\frac{1}{4}^{1} \times \frac{1}{4}^{2}$  Angle Brackets 9. The tool tray, which is built up of four  $2\frac{1}{4}^{1} \times \frac{1}{4}^{2}$  Double Angle Strips and one  $2\frac{1}{4}^{2}$  Flat Girder, is secured to one of the Angle Brackets 8 by means of a  $\frac{1}{4}^{1} \times \frac{1}{4}^{1}$  Angle Brackets 10 and 11, the latter forming bearings for the front wheel stub axles. A  $2\frac{1}{4}^{2}$  Rod 12 passed through the Angle Brackets 9 and 10 forms a suitable connection for the three-point suspension system. The worm and pinion steering is similar to Standard Mechanism No. 166.

A  $\frac{1}{4}^{2}$  Pinion on the Motor armature shaft engages with a  $\frac{1}{4}^{2}$  Evinon on the Rod 13, which carries a  $\frac{3}{4}^{2}$  Contrate engaging with a  $\frac{1}{4}^{2}$  Pinion on the Rod 14. This Rod, journalled in a  $1\frac{1}{4}^{2} \times \frac{1}{4}^{2}$  Double Angle Strip 15 and in the  $3\frac{1}{4}^{2} \times \frac{1}{4}^{2}$  Double Angle Strip 6, carries a Worm that meshes with a  $\frac{1}{4}^{2}$  Pinion on the layshaft 16. The latter is slidable in its bearings and is controlled by the lever 17 (a  $3\frac{1}{4}^{2}$  Strip that is pivoted at its second hole from the handle end to a  $\frac{1}{4}^{2} \times \frac{1}{4}^{2}^{2}$  Angle Bracket, which, in turn, is secured to the Double Angle Strip 6, in the second hole from one end). A bolt is secured to the lever 17 so that its shank lies between two Collars secured to the layshaft. Operation of the lever causes the  $\frac{1}{4}^{2}^{2}$  Pinion on the layshaft to causes the 1" Pinion on the layshaft to

FIG. 5.37A

engage with either of the two gears 18 and

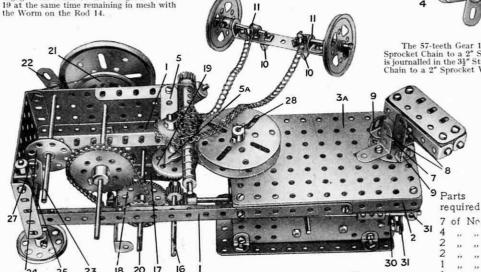

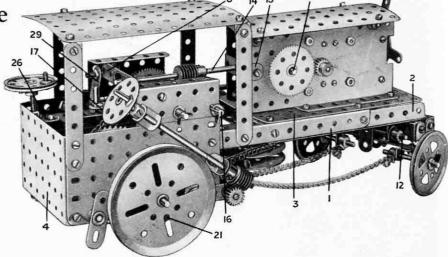

The 57-teeth Gear 18 is secured to a  $4\frac{1}{2}$  Rod 20° on which is fixed a  $\frac{3}{4}$  Sprocket Wheel connected by Sprocket Chain to a 2" Sprocket Wheel on the rear axle. The  $1\frac{1}{4}$ " Contrate 19 is secured to a  $2\frac{1}{4}$ " Rod that is journalled in the  $3\frac{1}{4}$ " Strips 5 and 5a and has attached to it a 1" Sprocket Wheel that is connected by Sprocket Chain to a 2" Sprocket Wheel on the cable drum shaft 28.

Brake drums (2" Pulleys 21) are fitted to the rear axle and round these are passed cords that are attached at one end to the side plates of the model and at the other to Double Arm Cranks 22. The latter are secured to each end of a 41 Rod 23 that carries a Bush Wheel 24 connected pivotally by a 11 Strip to the Coupling 25, which has a 3½ Screwed Rod passing through its end transverse threaded bore. The Screwed Rod is journalled in the Girder 1 and Flat Bracket 26 and in the Angle Bracket 27, which is spaced by four Washers to keep the Rod in correct alignment. A suitable handle is attached consisting of a 11" Pulley fitted with a #" Bolt.

The Crank 29, secured to the shaft 30, manipulates the reversing handle of the Electric Motor through the Coupling and 11" Strip 31. The latter is lock-nutted to the reversing handle and attached loosely to the Coupling by a 1" Bolt. The shaft 30 consists of one 61" and one 1" Rod joined by a Coupling

	and	15 ]	our	nalled	in two	An;	gle I	3rack	ets sec	ured	to t	he ma	ain fra	me.			
		1	of	No.	14	2	of	No.	27A	3	of	No.	52A	2	of	No.	. 96
ed:		2	,,		15	1	,,	,,	28	3	.,		53	1	,,	,,	103F
Vo.	3	4	,,		15A	1	,,,		29	2			53A	2	,,		109
	6A	2	,,		16A	2		.,	32	16	**		59	6	,,	,,	111c
,,	84	2		.,	17	7	,,,	**	35	1	,,,	**	62	2	,,	,,	115
,,	9	2	21	**	18A	85	2.0	**	37	2	7,	**	62B	1	,,	,,	147B
,,	10	2	,,	**	19B	4	,,	.,,	37A	6	,,	,,	63		F	lect	ric
**	11	4	.,	,,	20 A	21	**		38	1	**	,,	70			Note	
**	12	1	,,	11	21	1		,,	48	1	.,	.,,	A08	(			ded in
**	12A	2	**	.,	24	4	**		48 A	34"	**	,,	94			Outfi	t)
	13A	3	,,	11:	26	2	11	11	48B	2	17	13	95				


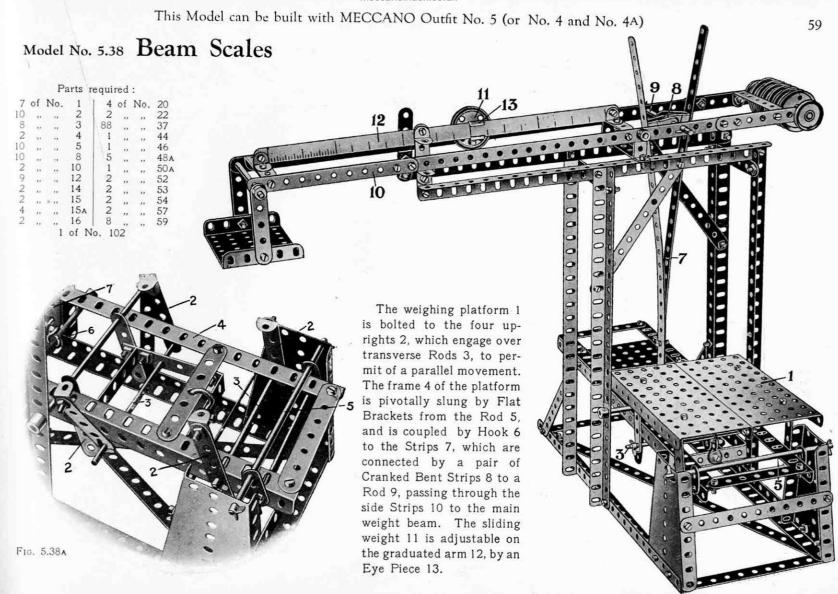


FIG. 5.39A

### This Model can be built with MECCANO Outfit No. 5 (or No. 4 and No. 4A)

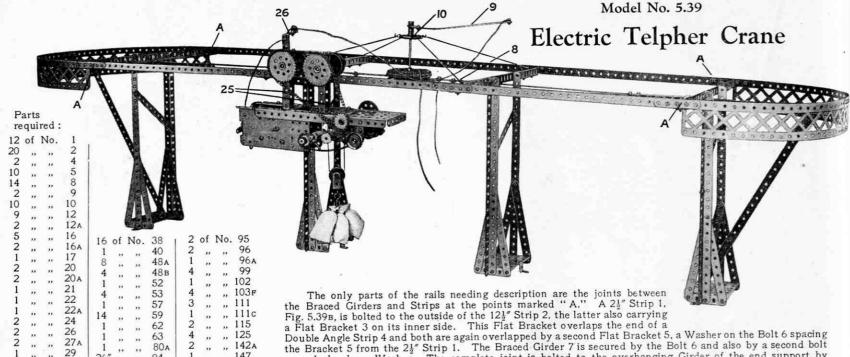

spaced also by a Washer. The complete joint is bolted to the overhanging Girder of the end support by

means of the Double Angle Strip 4.

,, 160

Electric

Motor

(not included in

Outfit)

The current conductor is insulated by means of 2" Dunlop Tyres mounted on 2" Pulleys and clamped to the central 121" Strip 8 by means of two 3" Bolts. These are inserted in the holes of the 2" Pulleys on each side on the Strip 8 and great care should be taken to prevent them touching the Strip. A 31 Rod nipped in the boss of the upper Pulley has attached to it a Bush Wheel 10, with a Crank swinging loosely immediately above it, but held in place by a Collar. A 121" Strip 9, is bolted to this Crank and bent upwards slightly so as to clear the electric telpher. The complete conductor is held vertical by four cords attached to the Bush Wheel 10 and tied to the two central standards.

The two 52" Angle Girders 11 of the telpher (Fig. 5.39A) are attached at one end to the flanges of the Electric Motor and at the other to the 51 × 21 Flanged Plate 12. To each side of the Plate 12, two 21 Flat Girders are bolted to form the sides of the gear box. The drive from the armature shaft of the Motor to the 3" Sprocket 13 will be seen clearly from the illustration. From this Sprocket the drive is transmitted by means of Sprocket Chain to a 1" Sprocket on the lay shaft 14 of the gear box. This Rod is moved into any desired position by means of the 31 Screwed Rod 15 through the medium of the Coupling 16 and Threaded Pin 17. The latter is provided with two nuts so that the Collar 18 may be fixed rigidly to it but still allowed to turn freely between the two Collars clamped to the Rod 14. The smooth portion of the Threaded Pin is inserted in the Coupling, but not gripped therein.

Model No. 5.39


### Electric Telpher Crane

(continued)


The  $\frac{1}{2}''$  Pinion 19 on the end of the layshaft engages with either of the 57-teeth Gears 20 and 20A. Gear 20A is fixed to the hoisting shaft, which is provided with a Pawl and Ratchet 21, the Pawl being locknutted to a  $2\frac{1}{2}''$  Strip 22. Gear 20 is nipped on one end of the Rod 23, the other end of which carries a 1" Sprocket Wheel that is connected by Sprocket Chain to the two 2" Sprockets 24 on the driving axles. The latter are supported in  $3\frac{1}{2}'' \times \frac{1}{2}''$  Double Angle Strips 25, which are joined together at the top by a  $3\frac{1}{2}''$  Strip. Two 1" Angle Brackets and one  $\frac{1}{2}''$  Angle Bracket 26 surmount one of the axle bearings. This is to keep the conductor wire clear of the Sprockets. The travelling wheels are built up from  $1\frac{1}{8}''$  Flanged Wheels and Bush Wheels butted together, the wide groove thus obtained being required to enable the telpher to negotiate small curves.

To wire the model the following notes will be useful. One wire is taken from a terminal of the Accumulator to the set-screw in the boss of the top Pulley of the insulator. The current runs from here to the end of the conductor arm and a wire attached to this passes through the bracket 26 and is fixed to a terminal of the Motor. The remaining terminals on the Motor and

Accumulator are earthed to the frame of the model.

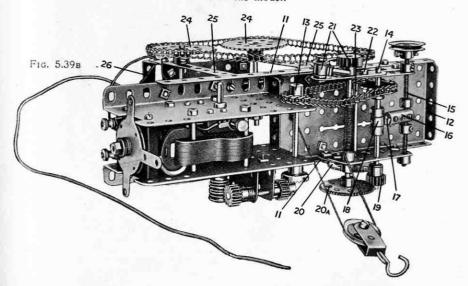

### Model No. 5.40 Delivery Van

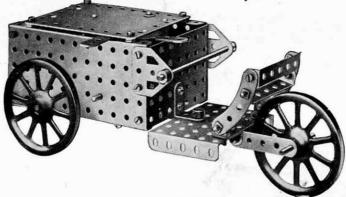

Parts required:

1	of	No.	3
3	,,	,,	5
4	,,	,,	12
1		,,	12A
1	,,	.,,	15
2	.,,	,,	15 <sub>A</sub>
1	,,	,,	17
1	,,	,,	18A
3	,,	,,	19A
1	.,,	,,	26
1	.,	,,	28
31	**	,,	37
9 2 2 3	,,	,,	38
2	- 20	,,	484
2	,,,	,,	52
3	,,	.,	53
7 2 9"	,,	,,	59
2	, ,,	,,	90
9"	,,		94
2	.,	,,	96
2	,,	,,	126A
(		kwo	rk

Clockwork Motor (not included in Outfit) A ½" Pinion on the Motor driving shaft (see Fig. 5.40A) engages with a 1½" Contrate Wheel that is secured to a 3½" Rod journalled in the side plates of the model. This Rod carries a 1" Sprocket Wheel that is connected by Sprocket Chain to a further 1" Sprocket on the axle of the front road wheels.


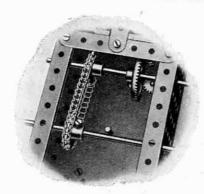


FIG. 5.40A

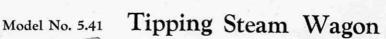

Each main side member of the chassis consists of two  $12\frac{1}{2}''$  Angle Girders overlapped seven holes. The front axle is duplicated for strength, each portion consisting of two  $5\frac{1}{2}''$  Strips overlapped nine holes and bolted to one side of the leaf springs. Each of the latter consists of one  $3\frac{1}{2}''$ , and one  $1\frac{1}{2}''$  Strip, a  $\frac{3}{8}''$  Bolt passing through all three Strips serving to secure the spring to the axle. The ends of the Springs are secured to Angle Brackets, the front Angle Brackets being mounted on a Rod 1 that is carried in Trunnions bolted to the chassis, whilst the rear ones have Flat Brackets attached pivotally to them by lock-nutted bolts and mounted on a Rod in a similar way to the front ones. The Springs for the rear wheels are constructed and mounted

in an exactly similar manner to the front ones.

The equalising beams of each bogie are two 4½"

Strips that are connected at their centres by 1"×1"

Angle Brackets 2. Each pair of equalising beams

Angle Brackets 2. Each pair of equalising beams pivots freely about an 8" Rod 3, that is passed through Collars attached by \( \frac{3}{8}" \) Bolts to the Springs.

The steering gear is based on the correct Ackermann principle and is built up in the following way: The stub axles are secured in Couplings 4, which are free to turn about \( \frac{1}{4}\)" Bolts inserted in their centre holes and attached by double nuts to the extremities of the front axle. The track rod (which connects the Wheels so that they turn together) is attached pivotally by means of Swivel Bearings 5, to the ends of short Rods that are held in the end bores of the Couplings. The free end of one of these Rods carries a third Swivel Bearing 6 which is connected by a Rod to a Double Arm Crank on the lower extremity of the steering column. The latter is journalled in a reinforced bearing consisting of a \( \frac{1}{2}\)" Reversed Angle Bracket that is bolted to the floor of the cab.

The Motor armature spindle carries a Worm meshing with a 1 Pinion on a Rod that has also a 1 Pinion on a Rod that has a 1 Pinion on a 1 Contrate Wheel 7 secured to it. The latter is in constant mesh with a 1/2" Pinion on a sliding Rod 8. This Rod has two further 1" Pinions, one between and the other outside the Motor side plates, and by sliding it in its bearings, the Pinions may be brought into mesh with either of the 57-teeth Gears 9 and 10. The Gear 10 is secured to a short Rod journalled in the Motor side plates and carrying also a 1" loose Pulley 11, which is retained in place on the Rod, together with a Flat Bracket, by Collars. One end of a length of cord is tied to the Flat Bracket and is passed over one of the 1" loose Pulleys 12 that are free on a Rod, which is carried by Strips attached rigidly to the underside of the tipping body. The cord then passes

	Model No. 5.41	Lipping	Steam W
	000000000000000000000000000000000000000	lapped of two of the all this secure is carriattach	Cach main side member a seven holes. The from 5½" Strips overlapped latter consists of one 3 see Strips serving to see d to Angle Brackets, the did in Trunnions boltened pivotally to them be the front ones. The
Parts required: 6 of No. 1	7		0
2 ,, ,, 1B 1 of No. 13A	No. 22A , , , , 23 , , , 23A , , , 26 , , , 26 , , , 27A , , , 27A , , , 27A , , , 29 , , , 32 , , , 35 , , , 37 , , , 38 , , , 40 , , , 40 , , , 43 , , , 43 , , , 70	B 1 of No. 90 24" , , , 94 2 , , , 95 A 2 , , , 96 A 4 , , , 100 2 , , , 103 B 2 , , , 108 1 , , , 109	4 of No. 111c  2 " " 115  1 " " 116A  1 " " 125  4 " " 126A  1 " " 160  1 " " 163  1 " " 163  1 " " 164  2 " " 165  1 " " 166  Electric Motor (not included in Outfit)

Model No. 5.41 Tipping Steam Wagon (continued)

Model No. 5.42 Armoured Motor Tricycle

to the Pulley 11 back over the second Pulley 12, and is attached finally to the Rod on which the Gear 10 is secured.

The Gear 9 is mounted on a 61" Rod that passes completely through both Motor side plates and is also supported in additional bear-

ings consisting of 21" Flat Girders bolted to the chassis members. Sprocket Wheels are secured on each end of the Rod and are connected by Sprocket Chain to the 2" Sprockets on the road wheel axles. It will be seen, therefore, that by sliding the Rod 8,

either the travelling or tipping movement may be effected. The sliding of the Rod is accomplished by a 2" Rod that engages between a 1" loose and a 1" fast Pulley, and is secured in a Coupling on a Rod 13. The latter is journalled in a 31" Double Angle Strip bolted to the chassis and carries on its other end another Coupling in which is held a Rod to serve as a lever. In order to manipulate the latter conveniently a Strip 14 that projects through the slot of the 51" x 21" Flanged Plate forming the side of the cab is attached pivotally to it by a bolt inserted in a Collar on the upper extremity of the lever. A Spring 15 keeps the lever normally in the travelling position, so that to engage the tipping movement it is necessary to pull out the Strip against the tension of the Spring. A similar scheme is followed in the case of the Motor con-

trol switch; a 51" Strip 16 is attached pivotally to the top end of a Crank Handle, which is secured rigidly by means

of a Coupling to the motor switch arm.

The tipping body pivots about a 31" Rod 17 that is passed through holes in two 121 Angle Girders bolted to the underside of the body, and also through the ends of a 21" x 1" Double Angle Strip. This Double Angle Strip is secured by &" Bolts to a 51" Angle Girder spanning the end of the chassis, and is spaced therefrom by three 21" Strips.

FIG. 5.41A

3 ,, ,, 22 2 ,, ,, 24 1 ,, ,, 32

Parts required:

3 " " 19A

4 of No. 18a | 1 of No. 52

Clockwork Motor (not included in Outfit)

This is driven from the Motor Spindle 1, a small Sprocket Wheel at the rear, not shown in the illustration, being geared by a chain to the larger Sprocket Wheel 2 bolted on the Axle Rod of the rear Wheels 3.

### Model No. 5.43 Electric Tram Car

The external construction of the model is shown clearly in Figs. 5.43 and 5.43A.

The bells are composed of two small Flanged Wheels 1 attached to the roof of the lower deck by means of Angle Brackets, and Collars attached to a cord running through the bosses of both Wheels, form the strikes.

The seats on the upper deck are constructed as follows: backs are two sets of 5%" Strips 2 connected together at the ends by means of 2" Strips, which are secured to the floor of the upper deck by means of two 91 Angle Girders 3. The seats proper are  $5\frac{1}{2}$  Strips similar to 2 but are joined together by Flat Brackets and secured to the backs by Angle Brackets.

The construction of the bogies will be seen clearly in Fig. 5.43A the mounting of the 2" Pulleys 4 and 5 being the only part needing description. Each Pulley 5 is secured to the 11 "x1" Double Angle Strip and the Trunnion on the bogie by means of 3" Bolts, three Washers on each being used for spacing purposes. The second Pulley 4 is connected to two 11 Strips 6 by means of 3 Bolts spaced similarly to those on the Pulley 5, and the  $1\frac{1}{2}$ " Strips 6 are bolted to the  $3\frac{1}{2}$ " Strip 7 and the  $5\frac{1}{2}$ "  $\times 3\frac{1}{2}$ " Flanged Plate 8. The bogie pivot, a 3" Bolt, is passed through the boss of the Pulley 4 and secured in the boss of the Pulley 5.


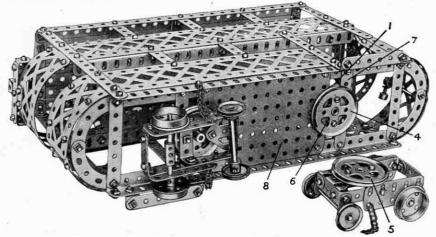


Fig. 5.43A

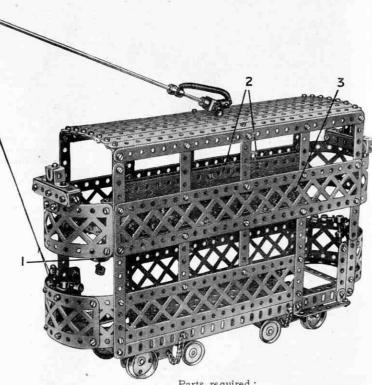

Parts required:


										20.5							
	19	of	No.	1	4	of	No.	11	6	of	No.	37A		of	No.	90 A	
	12	,,		1в	20	,,	,,	12	24	,,	,,	38	8"	,,	,,,	94	
	12	,,		2	1	,,	,,,	13	1	,,	,,,	40	4	,,	,,	99	
,	12	,,		2A	3	,,	**	16A	1	,,	,,	43	4	,,	,,	100	
	17	.,,		3	4	,,	,,	17	2	**	,,	45	4	,,	,,	103F	
	12	,,		4	2	,,	,,	18A	2	**	,,	48	3	,,	,,	111	
	18	,,		5	4	,,	,,	20	2	,,	,,	48A	6	,,,	**	111c	
	14	,,		6	4	,,	,,	20 A	4	- ,,	,,	48B	2	,,	,,	115	
	6	,,		6A	2	,,	٠,,	20в	3	,,	,,	52A	1	,,	10	116	
	4	,,		8	4	,,	,,	22	13	,,	,,	59	1	,,	,,	116A	
	4	,,	7	8A	1	,,	,,	23	4	,,	,,	63	2	,,	,,	126	
	12	,,	,,	10	169		37	37	2	,,	,,	77	1	,,	,,	147в	


### Model No. 5.44 Battle Cruiser


The hull consists of three rows of  $12\frac{\pi}{2}$  and  $5\frac{\pi}{2}$  Strips, the upper row being bolted to the flanges of the Sector Plates and  $5\frac{\pi}{2}$  Flanged Plates which form the deck. The superstructure is built up on two  $12\frac{\pi}{2}$  Angle Girders, which are spaced apart by  $1\frac{\pi}{2}$  Strips and a longitudinal  $12\frac{\pi}{2}$  Strip and secured by Angle Brackets to the Flanged Plates.  $2\frac{\pi}{2}$  Strips are bolted vertically to support  $2\frac{\pi}{2}$  Double Angle Strips, to which further Strips are secured to form the navigating bridge.

The tripod mast is placed directly behind the bridge. The mast proper, which consists of one  $6\frac{1}{2}$ " Axle Rod, is secured to the deck by a  $1\frac{1}{2}$ " Pulley Wheel and carries a Flanged Wheel and two 1" Pulleys. Two further  $6\frac{1}{2}$ " Rods are passed through holes in the Flanged Wheel and their lower ends are inserted in holes in the upper deck and secured by Spring Clips. The funnel consists of ten  $2\frac{1}{2}$ " Strips bolted in a vertical position and held together by Flat Brackets slightly bent. It is secured to the ship by Angle Brackets.

The aeroplane launching platform consists of  $2\frac{1}{2}$ " Strips bolted to a Bush Wheel, while the miniature aeroplane is built up from a 2" Rod carrying a Collar, in the tapped hole of which a bolt is securely fixed. A Double Bracket and a  $1\frac{1}{2}$ " Strip are held on the

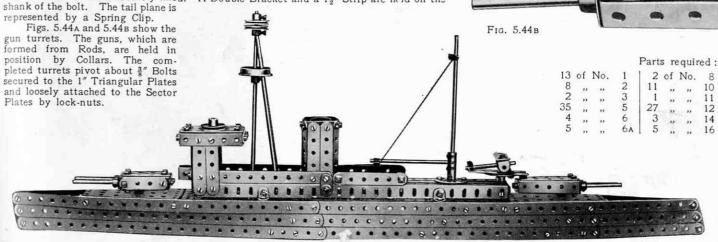

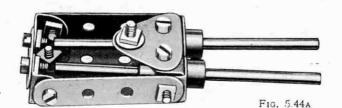


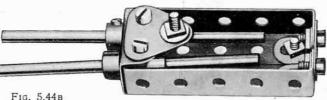



1	of	No.	18A
1	,,	,,,	20
1	.,,	,,	21
3	,,	,,	22
1 3 2 3 146	,,		24 35
3	,,		35
146	5 ,,		37
4	,,	,,	38
1	,,	,,	45
1 2 6	,,	,,	48
6	,,	,,,	48 A
1	,,	.,	52
1 2 9	,,	,,	53
2	,,		54
9	-,,	- 20	59

### HOW TO CONTINUE

This completes our examples of models that may be made with MECCANO Outfit No. 5. The next models are a little more advanced, requiring a number of extra parts to construct them. The necessary parts are all contained in a No. 5A Accessory Outfit, the price of which may be obtained from any Meccano dealer.

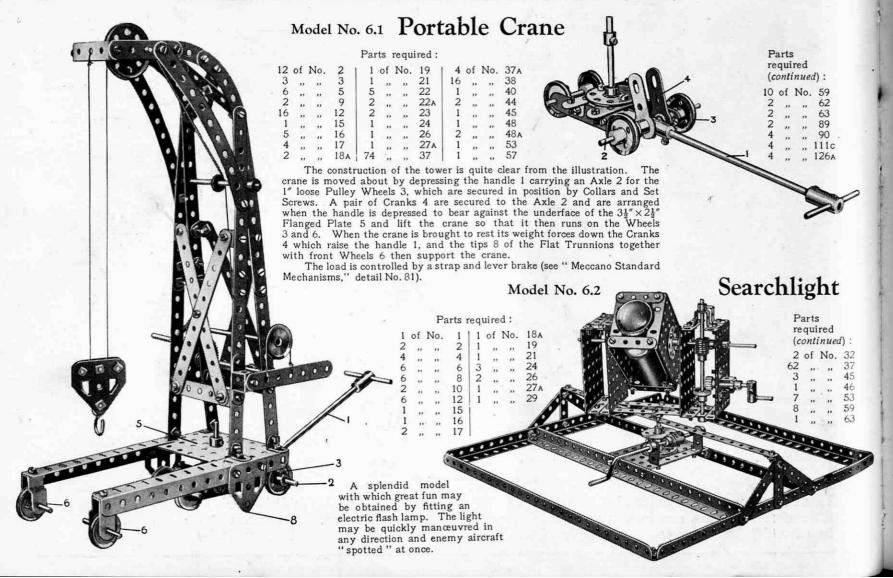

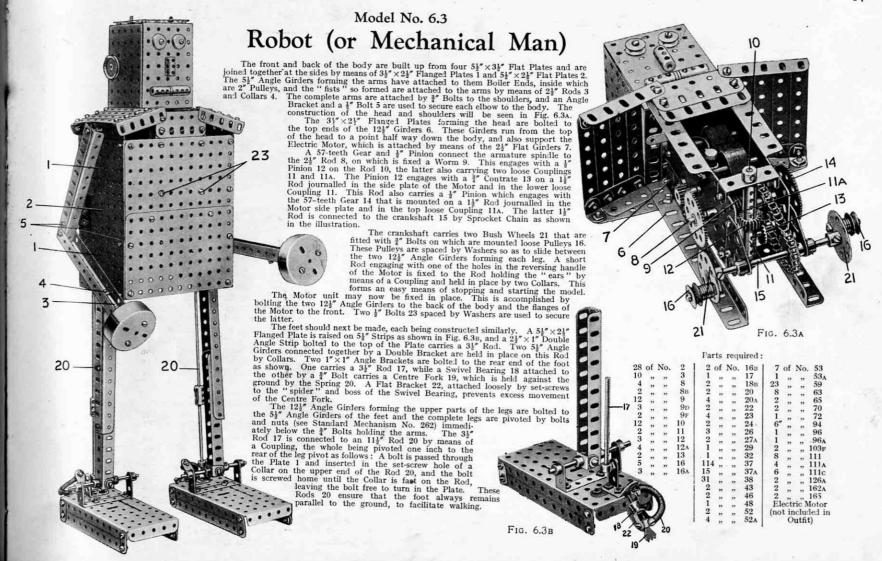

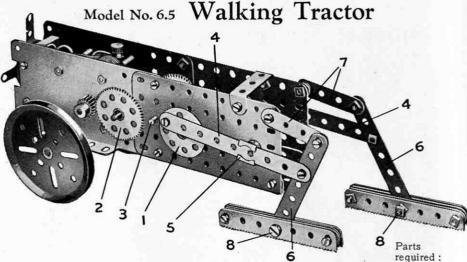

This is a model of a recently invented machine designed to travel over very rough surfaces where ordinary wheeled vehicles could not pass.

The gear train by which the motion from the Motor armature is transmitted to the "legs" of the machine, consists of three  $\frac{1}{2}$ " Pinions and three 57-teeth Gear Wheels. One of the latter can be seen at 2; the second 57-teeth Gear is secured to a 2" Rod 3 and is rotated by a  $\frac{1}{2}$ " Finion secured to the shaft of wheel 2. The third Gear is fixed to the 2" Rcd carrying the Bush Wheel 1. Another Bush Wheel is secured to the opposite end of the latter Rod, and these two Bush Wheels actuate the legs by means of connecting  $4\frac{1}{2}$ " Strips 4. The Bush Wheels should be arranged so that the pivots of the connecting Strips 4 are placed at 180 degrees to each other.

The Strips 4 slide to and fro in Eye Pieces 5, which are secured to the shanks of § Bolts that are free to turn in the side plates of the model. The Strips are pivoted to the 3½ Strips 6 forming the legs by means of bolts and lock-nuts and their other ends are pivoted by the same method to the Bush Wheels 1. The legs are pivoted at their upper ends to two 2" Strips 7, and the latter are pivoted to the side plates.

Each of the "shoes" consists of a  $3\frac{1}{2}$ " Rack Strip and seven  $3\frac{1}{2}$ " Strips—the latter being used to increase the weight of the shoes. The Strips 6 are inserted in the centres of the shoes and Pivot Bolts 8 are passed through their end Holes. Washers should be placed on the  $\frac{1}{2}$ " Bolts securing the ends of the shoes together, so that the shoes are quite free to move about the Pivot Bolts 8.

The Motor is mounted on 3" Pulley Wheels, the axle of which is journalled through Angle Brackets bolted beneath the Motor.

2	of	No.	
16	,,	,,	3
2	11	,,	6
1	"	"	6A
2	"	"	12
1	,,	"	16
2	,,	"	16A
1	.,,	"	17
2 2 3	- "	"	19B 24
2	**	"	26
3	"	37	27 A
12	**	"	37
2	"	"	38
1	"	"	48
2	"	.,	50 A
2	11	"	53 A
1	**	,,	59
2	,,	"	110
4	"	"	111
6	,,	"	111A
6	"		111c
2	,,	,,	147B
	E	lecti	
	N	Noto	r

Model No. 6.6

### Cantilever Bridge

6A


6A

7A


0A 3A 9 0 1 1A 1C

in

	Par	ts 1	equir	ed:				
1	8	of	No.	6A	2	of	No.	48B
2	8	,,	,,,	8	14	. ,,	,,,	90
3	18	,,	,,	9	8			99

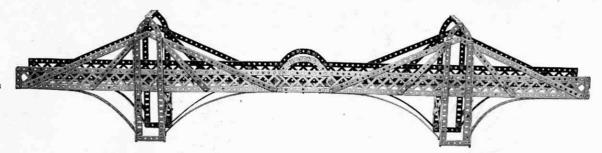


### Model No. 6.7 St. Malo Transporter Bridge

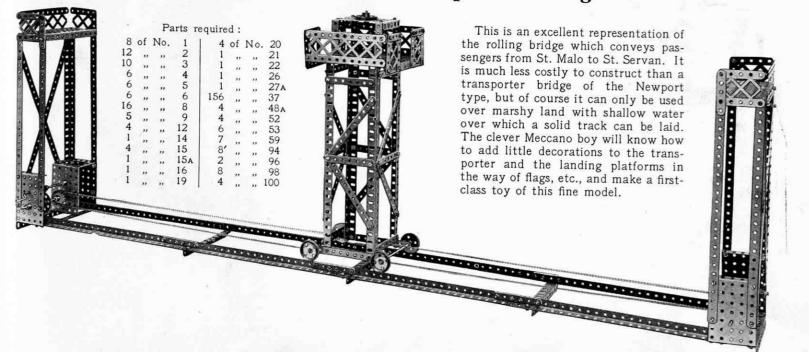

### Model No. 6.8 Fly Boats

# Parts required:

### Model No. 6.9 Platform Scales

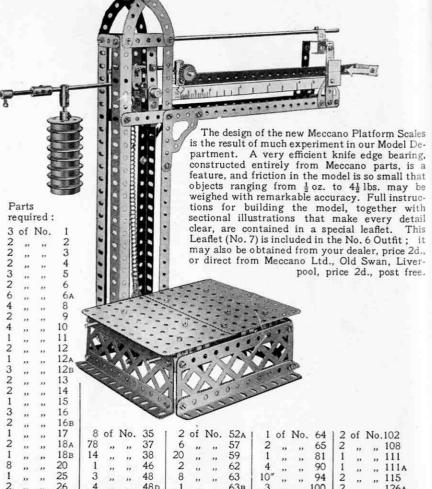


Parts required:

21 22 1 of No. 24

12 of No. 1

De.

is

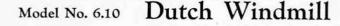


The construction of the sails 1 of the mill, will be readily followed from the illustration. They are bolted to an inner strip frame 2 and to a Bush Wheel 3 fixed on a Rod 4, on which is also mounted a Fulley Wheel 5. The driving cord passes round this Fulley Wheel to a lower Pulley Wheel 6, the driving of which will be followed from Fig. 6.10A.

The Pulley Wheel 6 is on the outer end of the Rod 7 on which is fitted a  $1\frac{1}{2}$ " Gear Wheel 8 driven by a  $\frac{1}{2}$ " Pinion 9 on the Axle Rod 10. The Axle Rod

also carries a  $\frac{1}{2}$ " Pinion 11 engaged by a Worm 12 on the driving shaft 13 which carries a driving Pulley 14. The driving

gear is enclosed in two  $3\frac{1}{2}'' \times 2\frac{1}{2}''$  Flanged 10-Plates 15 bolted to a Base Plate 16.

The vertical tower of the mill is made from Corner Angle Girders 17 bolted to side Plates 15.

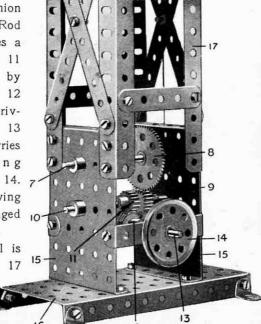



72

## Model No. 6.11 Drop Hammer

## Parts required:

								-											1988
1	of	No.	1	10	of	No.	8	4	of	No.	16	75	of	No.	37	5	of	No.	59
2		1999	l B	2	19	1 997	9 D	6		200	20	6		**	30	1	**		63
4	,,	,,,	2	1	,,	,,	11	1	,,	.,,	22A 24	1	.,	,,	40	2	,,	,,,	72
1	,,		2A	1	,,	,,	12A	2	,,,	,,	24	4	,,	.,,	48A	1	,,	"	95A
4	,,	**	3	1	,,	,,,	13	2	,,	,,	26 27 a	2	,,	. ,,	52	12	,,	,,,	97
4	,,	**	5 [	1	,,	,,	15A	2	**	**	2/A	1	**	"	53	4	- 22	2.5	108

The construction details of this model are clearly shown in the illustration. The vertical hammer shaft is guided through  $2\frac{1}{2}'' \times \frac{1}{2}''$  Double Angle Strips secured in the upper frame-work. The operating Cord is led from a point on the shaft near the hammer-head up to a guide Pulley (Standard Mechanism No. 39) situated at the top of the model, and from thence down to the winding drum consisting of two Flanged Wheels butted together in the gear box.


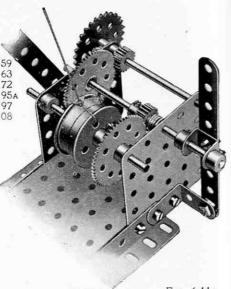


FIG. 6.11A

The Rod carrying the winding drum is rotated through a chain of reduction gearing from the driving shaft carrying a Sprocket Wheel, which may, of course, be coupled to a Meccano Motor or any other driving method. The intermediate shaft is slidable

in its bearings and is controlled by the hand lever shewn in Fig. 6.11A, while its gears are so arranged that they may be easily slipped out of engagement with the driving shaft, with the result that the hammer, being released, forcibly strikes the table secured in the base of the machine. From this it will be seen that the power of the blow may be altered as desired, since the hammer may be dropped from varying heights.

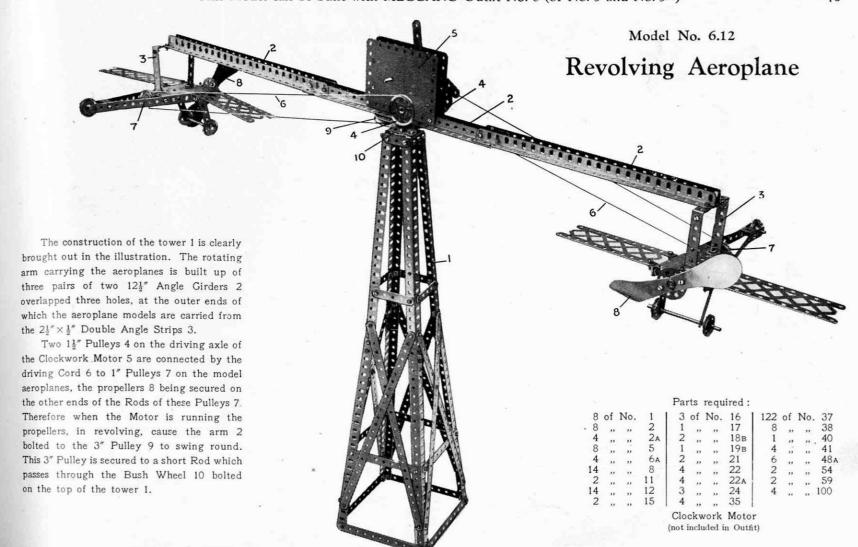

ed

le


ts

th

ly

be

er

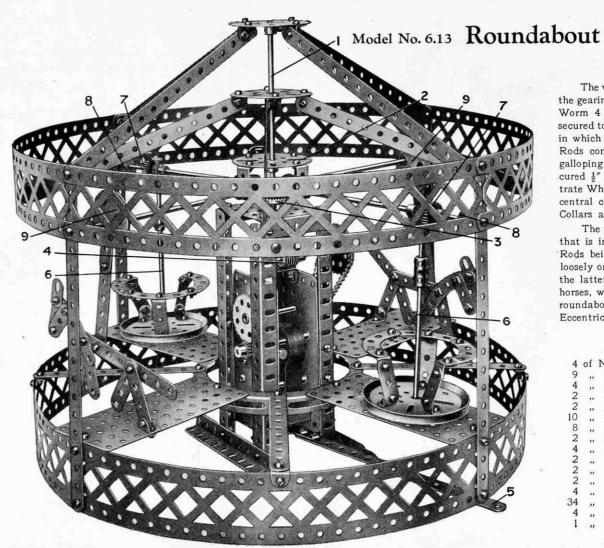



The vertical Rod 1 is driven from the Motor through the gearing shown, the final drive being taken through a Worm 4 and 57-teeth Gear Wheel. A Face Plate 2 secured to the Rod 1, carries four 1"  $\times$  1" Angle Brackets, in which are journalled the inner ends of the four  $6\frac{1}{2}$ " Rods conveying the drive to the revolving cars and galloping horses. On the ends of these Rods are secured  $\frac{1}{2}$ " Pinions, which engage with a fixed  $1\frac{1}{2}$ " Contrate Wheel 3. The latter is attached to the top of the central column by  $\frac{1}{2}$ " Bolts, on the shanks of which Collars are placed for spacing purposes.

The vertical Rods 6 each carry a \( \frac{3}{4}'' \) Contrate Wheel that is in mesh with a \( \frac{3}{4}'' \) Pinion 7, the ends of the Rods being journalled in Couplings that are mounted loosely on the horizontal \( 6\frac{1}{2}'' \) Rods. The outer ends of the latter are journalled in Double Brackets 8. The horses, which are attached pivotally by one leg to the roundabout, are caused to "gallop" by means of the Eccentrics 9. A 7\( \frac{1}{2}'' \) Strip 5 operates the Motor switch.

## Parts required:

4	of	No.	1A	4	of	No.	14	4	of	No.	63
-	01	140.	1/2/09/11		OI	140.			01	140.	
9	,,	,,	1B	2	**	"	15 .	4	*	,,	70
4	,,	,,	2	2	,,	"	16A	1	,,	**	72
2	,,	,,,	3	2	,,	,,,	18a	2	,,	**	90
2 2	,,	,,	2 3 5	2	,,	,,	19в	6	,,	,,	90 A
10	,,	,,	6	2 2	,,	,,	25	9"	,,	,,	94
8	,,	,,	6A	4	,,	,,	26	1	,,	,,	95A
2	,,		8в	2	,,	,,	27 A	1	,,	,,	96A
	,,	,,	9	1	,,	,,	28	8	,,	,,	99
2 2	,,	,,	9в	2	,,	,,	29	3	,,	,,	109
2	,,	,,	9p	1	,,	,,	32	2	,,	,,	111A
2	,,	,,	10	142	2 ,,	,,	37	2	,,	,,	130
4	,,	,,	11	6	,,	,,	37A	1	,,	,,	143
34	,,	,,	12	8	,,		38		E	lectr	ic
4	,,		12 <sub>A</sub>	2	,,		48		N	foto	r
1	"		13a	10	,,		59	(n	ot i	nclud	ed in

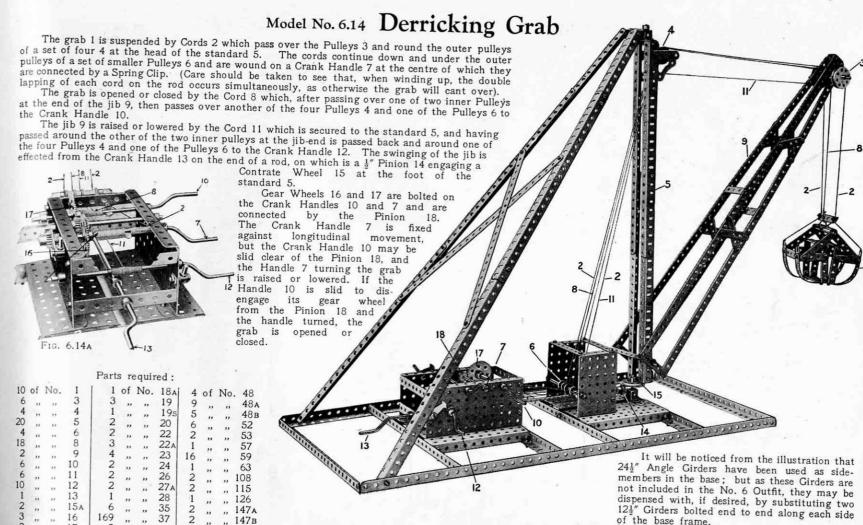

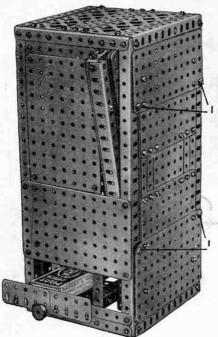

## Model No. 6.15 Penny-in-the-Slot Machine

The sides of the model can be removed by undoing four nuts 1 from bolts that are firmly secured by additional nuts to the corner Girders. Thus the machine can be re-loaded and attention can be given to the mechanism if necessary. Each side is built up from Flat Plates bolted to 91 Angle Girders. Four 51 X21 Flat Plates,

and three 5½" Strips are bolted to the Girders at the back of the model.

Fig. 6.15a shows the mechanism removed from the model. Four 12½" Angle Girders are spaced apart by 2½"×½" Double Angle Strips and 2½" Strips to form a receptacle for the match boxes. It will be seen that the bolts are so arranged that they do not in any way interfere with the downward movement of the boxes. The 94" Strip bolted between the rear pair of Girders is clamped between two 24" Strips (see Fig. 6.15c) near its

Details of the drawer and slide are shown in Fig. 6.15a. The Bolts 2 holding the  $2\frac{1}{2}$ " Strips to the  $1\frac{1}{2}$ "  $\frac{1}{2}$ " Double Angle Strips of the slide should be passed through the vertical  $12\frac{1}{2}$ " Angle Girders, one hole above their lower extremities. The Angle Brackets 3 form guides for the  $5\frac{1}{2}$ "  $\frac{1}{2}$ " Double Angle Strips of the drawer. The Rack Strip 4 is secured to a 1"  $\times$  1" Angle Bracket and to a  $3\frac{1}{2}$ " Strip that is fixed by an Angle Bracket to the Flat Girders at the front of the drawer.

A 3" Pinion 5 (Figs. 6.15a and 6.15c) is mounted on a Pivot Bolt and gripped in place by a 1" Bolt 6. When the drawer is moved in or out, the Rack Strip engaging with the Pinion causes the latter to rotate. Normally, with the drawer closed, the Bolt 6 should be almost touching an Angle Bracket 7 (Fig. 6.15c) that is secured to a Crank on the end of a  $4\frac{1}{2}$  "Axle Rod, which also carries a second Crank to which the Flat Bracket 8 is fixed by a  $\frac{3}{4}$ " Bolt. The Cranks are so arranged that when the  $\frac{3}{4}$ " Bolt strikes the vertical Angle Girder the Angle Bracket 7 just clears the teeth of the Pinion 5. A  $\frac{3}{4}$ " Strip is bolted to a Double Arm Crank fixed on the other extremity of the  $\frac{4}{2}$ " Rod, and carries two  $\frac{2}{4}$ " Strips as a balance weight. The weight is correctly adjusted by means of a bolt and Washers. The Flat Bracket 9 is spaced from the  $\frac{4}{4}$ " Strip by two Washers and a  $\frac{3}{4}$ " Bolt 10 carrying four Washers is bolted in the fourth hole from the end of the Strip.

The slot for the penny is shown detached from the model in Fig.

The slot for the penny is shown detached from the model in Fig. 6.15p. It is secured in place by a 1" Triangular Plate bolted to the upper transverse 51" Angle Girder at the front of the outer casing of the model, and also by the &" Reversed Angle Bracket shown in Fig. 6.15c. The penny is inserted between the two pairs of Girders 11 and 12 and falls between the Flat Bracket 9 (Fig. 6.15c) and the 4½" Strip. The Washers on the Bolt 10 serve as a "stop," but they will not retain

The weight of the penny raises the Crank carrying the Angle Bracket
7, but only sufficiently to allow the Bolt 6 to pass unimpeded, for the Centre Fork 13 engages the Flat Bracket 8 and prevents further movement of the Crank. The Centre Fork is held in a Coupling which is loosely attached to the model by a 1 Bolt passed through its centre

transverse hole, and secured by two nuts to an Angle Bracket. The Rod 14 held in the lower transverse hole of the Coupling is forced upward by the Bolt 6 when the drawer is pulled out, and thus forces the Centre Fork 13 out of engagement with the Flat Bracket. The penny is then free to drop off the end of the lever. The weight of the Rod 14 then returns the Centre Fork to its normal position, and as the drawer is pushed back, the Bolt 6 raises the Angle Bracket 7, which should be arranged obliquely. When the drawer is pushed right in, the next box of matches should fall into position in the drawer, and the weight 15-consisting of a piece of lead-is provided to assist the downward movement of the boxes.


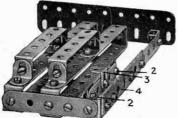



Fig. 6.15B


Darte vacuired .

1 0		No.	1 1												
				4	of	No.	10	4	of	No.	48A	2	of	No	. 77
1	99	,,	1 A	12		,,	12	4	,,	,,	48 D	2	,,	,,	100
5	,,	,,	2	1	**	**	12 <sub>A</sub>	4	.,,		52A	5	,,	**	103F
1		**	2 A	1	.,,	**	15A	4	**	**	53a	1	,,	,,,	110
2	,,	,,	3	1	,,	,,	18в	1	,,	,,	59	1	,,	,,	111
11	,,		5	1	**	,,	23a	2	**	.,	62	2	,,	,,	111A
8 2 8	,,	**	8	1	,,	,,	26	1	,,	**	62в	2	,,	,,	111c
8	22	**	8A	170	.,,	"	37	1	,,		6.3	1	,,	**	125
2	,,	**	8в	13	,,		37a	1	,,,	"	65	1	2.5	22	147B
8	,,		9	16	,,		38	6	**	**	70				
1	**	***	9F	2	,,	**	48	2	,,	.,	72				

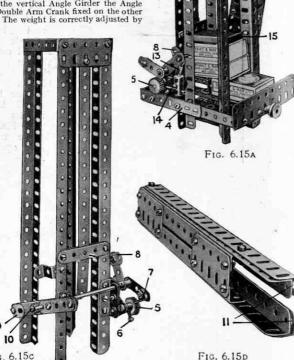

## Model No. 6.16 Joy Wheel

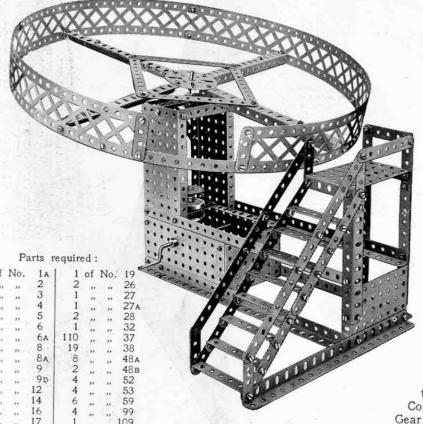

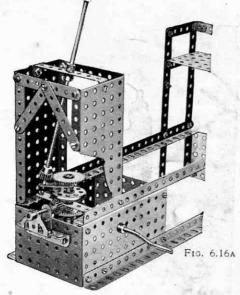


This model comprises a new and very interesting Meccano motion.

The Crank Handle drives by means of a Worm Wheel and 57-toothed Gear Wheel a vertical Rod carrying two 1½" Contrate Wheels and a Gear Wheel, as shown in Figure 6.16A. The lower Contrate Wheel is secured to the shaft but the upper one revolves freely upon it. The latter is driven from the fixed Contrate Wheel by means of a ½" Pinion, and its rection of relation in security.

direction of rotation is consequently reversed.

The end of the shaft carrying the revolving part of the model is journalled on a short Strip bolted to the upper Contrate Wheel and carries a ½" Pinion which engages with the Gear Wheel secured on the vertical shaft. Thus on operation of the Crank Handle, the model revolves upon its axis, at the same time twisting slowly round with an amusing "wobble." A circular piece of cardboard is cut and placed in position to represent the floor found in real "Joywheels."

This Model can be built with MECCANO Outfit No. 6 (or No. 5 and No. 5A) Theodolite Model No. 6.17

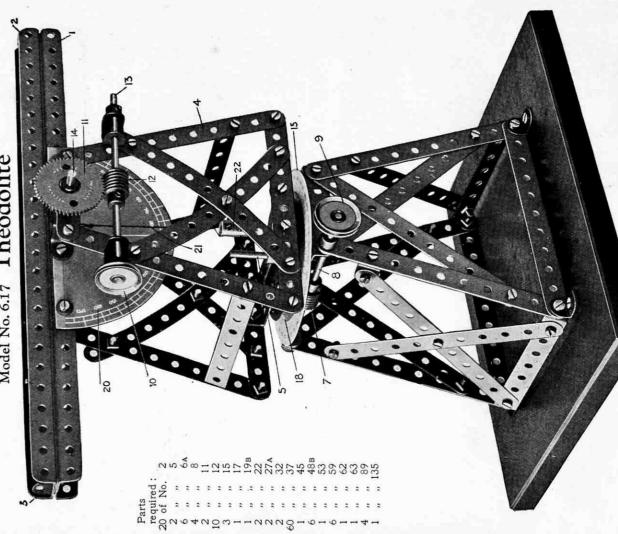


The Theodolite arm is represented by two reversed pairs of 12½" Angle Girders 1 and 2, an Angle Bracket being secured at each end to form the sights, one of which is shown at 3. A small piece of paper, with a pin hole punched in its centre, is secured over the hole in the Angle Bracket 3 and two crossed threads over that in the Angle Bracket at the other end of the arm. The arm is elevated or depressed by the Pulley 10 and the Worm 12 on the Rod 13, the Worm meshing with a 57-teeth Gear 11 on the pivot Rod 14. This Rod is secured by a Crank to the sighting arm.

The upper framework 4 is secured to a short Rod 5 by means of a 3″ Pulley 18 that is secured by \$\frac{1}{2}\$ Bolts to the transverse \$3\frac{1}{2}\$ \times \frac{1}{2}\$ Double Angle Strips bolted to the bottom of the frame. A 57-teeth Gear is fitted to the lower extremity of this pivot rod and engages with the Worm 7 on the Rod 8. Hence, on turning the hand wheel 9 the swivelling structure may be rotated. A graduated disc 15, ent from the Theodolite Protractor from the Angle Strips had a second of the signal of the surface of the surface of the signal of the same had a second of the surface of the su

Hence, on turning the hand wheel 9 the swivelling structure may be rotated. A graduated disc 15, cut from the Theodolite Protractor (part No. 135) and bolted to the top of the fixed base, indicates the horizontal angular movement. The vertical movement of the sighting arm is indicated by means of the semi-circular protractor 20, also cut from part No. 135, and bolted to the lower Angle Cirder 1, the correct reading being given by a "plumb line" 21. This line consists of a short length of cord looped over the Rod 14 and carrying a Coupling 22, which forms the "bob" at its lower end.

# 21. This line consists of a short length of , which forms the "bob" at its lower end.

This Model can be built with MECCANO Outfit No. 6 (or No. 5 and No. 5A)

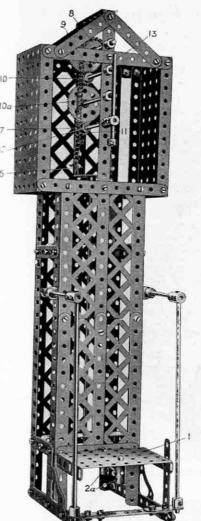

Model No. 6.18

## Automatic Weighing Machine

Parts	required	:
-------	----------	---

2	of	No.	1	1	of	No.	24	12	of	No.	59
6	,,	,,	2	2	,,		26	2			62
2			3	2	"	***		1.00	"	**	
	.,,	**	0	1 4		11	27 A	6	"	**	63
6	**		4	64	,,	,,	37	10"	,,	,,	94
4	7.4		5	2	- "	**	37в	1	**	,,	96
4	**	.,	8	1	**	,,	43	2		,,	99
1	,,		13	1	.,,		48A	6	**		100
2	,,	,,	13 <sub>A</sub>	3	,,	***	48в	2		**	108
1	,,		15A	2	,,		52	2	**	**	100
7	,,	,,	16	1		**-	53				

The platform 1 is connected by cross Rod and Couplings 2A to a Rod 2 (by means of a further Coupling) passing through the centre of the machine and guided in the 31" Double Angle Strips 3 and 3A connected to side Strips 4. At the upper end of this Rod 2 is a Bush Wheel 5, to which is connected a Cord 6 and Sprocket Chain 7. This Chain passes round a Sprocket Wheel 8 on the same spindle as the 57-toothed Gear Wheel 9 engaging a 1/2" Pinion 10. The Pinion 10 also engages another 57-toothed Gear Wheel 10A, and this in turn a  $\frac{1}{2}$  Pinion II on the spindle 12 carrying the pointer 13. The other end of the Chain is coupled by a Spring 14 to the cross piece 3A, and the pointer is thus always returned to zero immediately the load is removed from the platform.

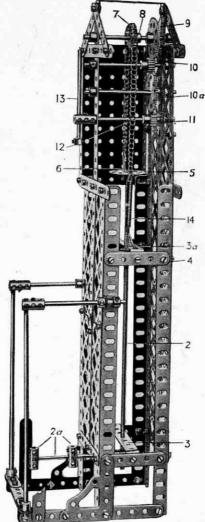


FIG. 6.18A

Fig. 6.19A

## Model No. 6.19 4-4-4 Electric Locomotive Each current collector is composed of two 3½" Rods 1 secured by Couplings to a 3" Rod that is journalled in a 21 x 1 Double Angle Strip. The Double Angle Strips, in turn, are secured to a Trunnion at either end of a 95" Strip 2 (Fig. 6.19A), and the latter is attached to the roof of the locomotive by means of two 6 B.A. Bolts 3, which are insulated from the roof by Insulating Bushes and Washers. An ordinary Washer is placed

over each Insulating Washer in order to prevent the bolts on the Strip 2 touching the roof. The 6 B.A. Bolts and Insulating Washers are not included in the No. 6 Outfit, and if they are not available, ordinary bolts may be used, provided that they are wrapped in insulating tape or otherwise prevented from


making metal-to-metal contact with the roof.

A Collar is secured by means of a Set-screw on each of the 3" Rods journalled in the Double Angle Strips, and a short length of cord is tied to the Set-screw and passed round the Rod before being fastened to two Springs 4. This results in both collectors tending to rise. Either of the collectors may be locked horizontally however, by a Handrail Support 5, which is passed through a hole of the Double Angle Strip and inserted in the Grub-screw hole of a Collar, so that by turning the Handrail Support, the Rod is gripped and prevented from rotation.

Those parts of the collectors that are in contact with the overhead wire, consist of short lengths of thick copper wire secured by Set-screws to Collars on the ends of the 31" Rods. A length of insulated wire is fastened to the 91" Strip 2 and is taken to one of the Motor terminals, whilst the remaining Motor terminal is connected to the frame of the model.

Each of the 1 "x1" Angle Brackets 6 is duplicated in order that a nut may be held between their lugs. Hence it is only necessary to insert the bolt in the hole and screw it home. Tais device is necessary because the interior of the model is inac-

cessible when the sides are in place.

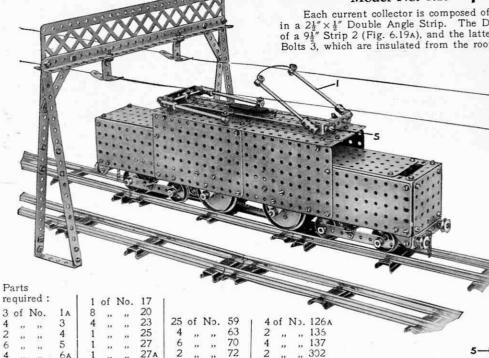


3 of No. Electric Motor (not included in Outfit)


Parts Nos. 302 to 305 are used for insulation purposes, but are not included in the Outfit.

Farts Required for Overhead Wire Standard as illustrated :-

8	of	No.	2	1 2	of	No.	12	2	of	No.	46	
2		**	4	4	,,	,,	12 12a 37	1	,,	,,,	99	
2			8	26		,,	37					

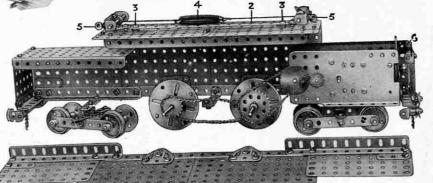

## Model No. 6.20 Steam Tug Boat

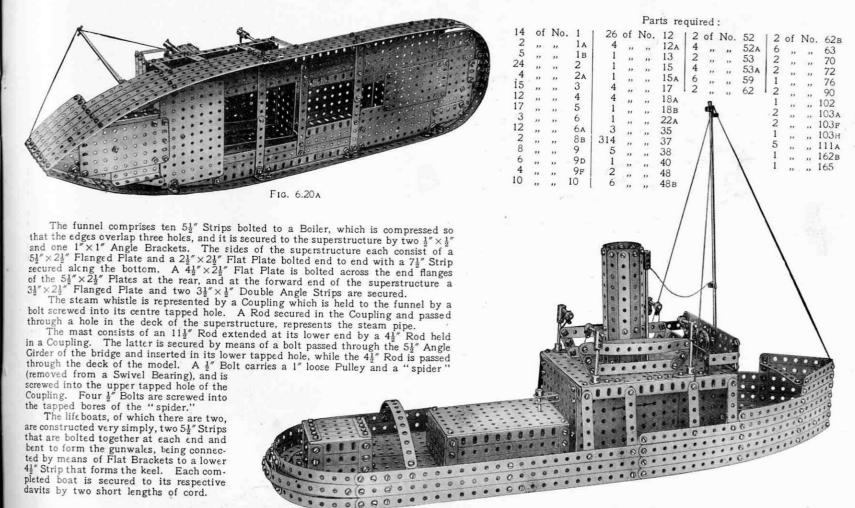

alled end B.A. laced is on ating y are they from


of the ength pefore ectors horipassed in the indrail ation. th the

and is aining el. order s only This

inac-

Rods.

3

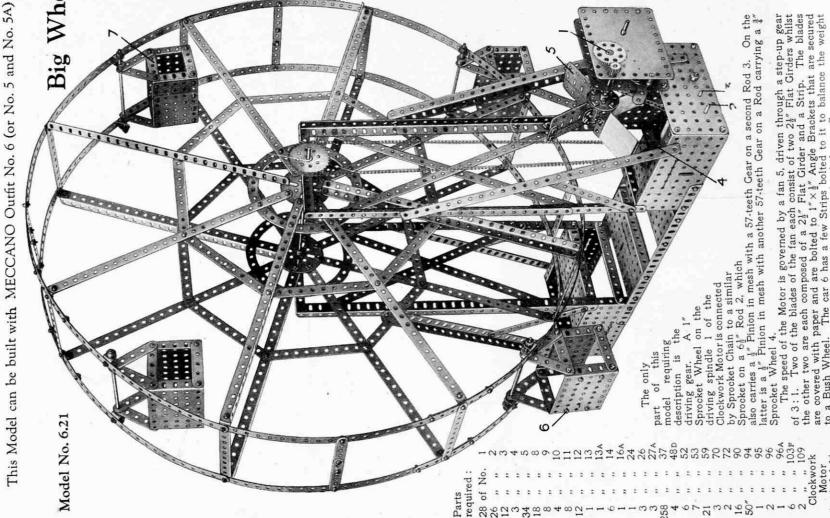

secured weight to it to forming one are each composed th paper and are bo Flat with Wheel. other two two 23 covered a Bush V a Bi

(not included in Outfit)

the are

and No. 5A) This Model can be built with MECCANO Outfit No. 6 (or No. 5


are covered with paper and the safew Strips bolted to it to balance to a Bush Wheel. The car 6 has a few Strips bolted to the car 7.

of the two 2½ × 2½ Flat Plates forming one side of the car 7.

Motor (not included in Outfit)

## Crane 6.22 Model No.

37	45	46	48A	25	23	54	27	29	62	63	94	95	96	66	147A	147B	148		Motor	ui po	
å	:	:	:	3	:	:	:	:	2	3	:	:	2	:	:	:	=			ude	40.00
of	:	:	:	:	:	:	3	=	:	:	:	2	2	2	*	:	:		Electric	(not incl	(
139	-	-	7	4	-	7	-	14	г	-	9	7	4	9	-	-	-	į	Ele	ou)	200
-	7	m ·	4	S	ω,	=	12	13A	14	15	15A	91	17	18A	200	21	22	22A	24	26	110
							:	"				:							"	*	
No.			-	-7																	

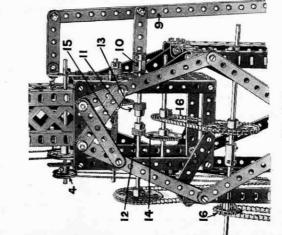



6.22A

guide central model is well shown in the illustration a Pulley 4. passes of the jib I is effected from the man of the jib I is effected from a Pulley 3 to a Pulley r Pulley 5 on the same shaft passed 6 which, after winding round g 8 fixed on the

9 slides the spindle 10 carrying two Pinions that either the Pinion 11 may engage the raise or lower the load, as the Wheel 14 the tra-through the Chain and from the Motor latter on lower Wheel 13 the Pinion 11 Pinion 12 the and The rame of the model is well shown The swinging of the jib 1 is effected 2 by means of a Cord coupling a Pulle Round a larger Pulley 5 on the sam continuous Cord 6 which, after win Pulley 7, passes round a Pulley 8 fix spindle of the jib.

The handle 9 slides the spindle 10 ca 11 and 12 so that either the Pinion 12 Gear Wheel 13 or the Pinion 12 the When the Pinion eages the Wheel wound on or off the spindle to raise and when the Pinion 12 engages the resing movement is effected throug Sprocket 16. The power is taken froway of the 1" and 2" Sprockets 17, spindle carrying the Pinions 11 and

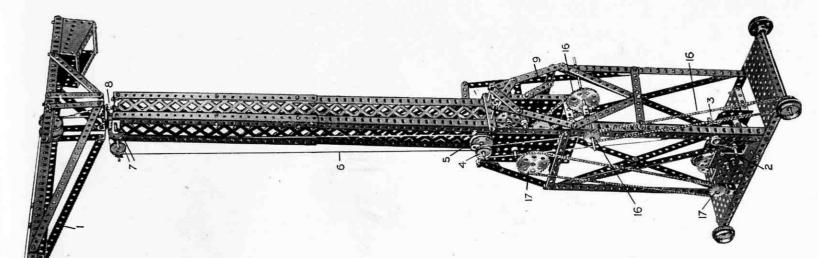

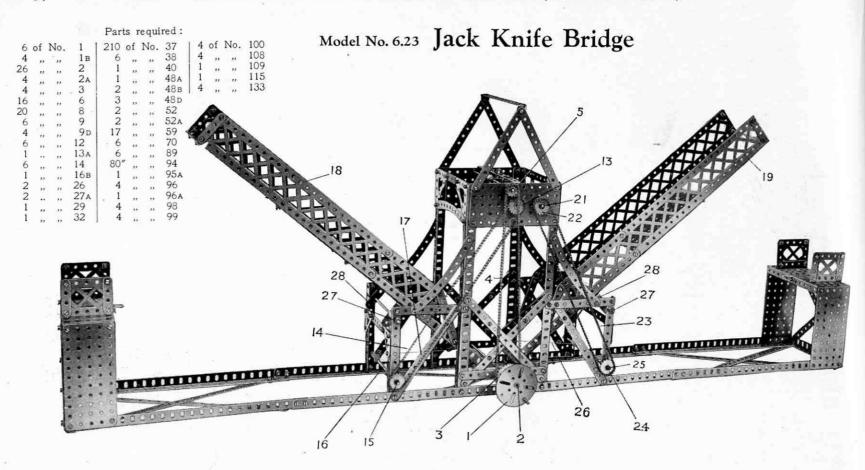

The arms of the bridge are raised or lowered by rotating the hand-wheel 1. On the 8" Rod 2 of the hand-wheel is mounted a  $1\frac{1}{2}$ " Sprocket Wheel 3 which is coupled by a Chain 4 to a  $\frac{3}{4}$ " Sprocket Wheel 5 on a  $6\frac{1}{2}$ " Rod 6, Fig. 6.23A. On this rod a Worm Wheel 7 drives a  $\frac{1}{2}$ " Pinion 8 on a  $3\frac{1}{2}$ " Rod 9, on which is a  $\frac{3}{4}$ " Contrate Wheel 10. This engages a  $\frac{3}{4}$ " Pinion 11 carried on a 3" Rod 12, on the outer end of which is a 1" Sprocket Wheel 13 connected by a Sprocket Chain 14 to a 1" Sprocket Wheel 15 on a  $6\frac{1}{2}$ " Rod 16; on this rod a Cord 17 is wound, connected to the end of one arm 18 of the bridge. The other arm 19 is operated from a 57-toothed Gear Wheel 20 on the Rod 12

## Model No. 6.23 Jack Knife Bridge

(continued)

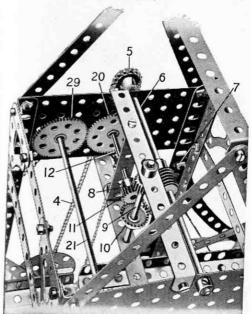


Fig. 6.23A

engaging a similar Wheel 29 on the  $6\frac{1}{2}''$  Rod 21. On the end of this rod a 1" Sprocket Wheel 22 is coupled by a Chain 23 to another 1" Sprocket Wheel 24 on the  $6\frac{1}{2}''$  winding Rod 25, the Cord 26 from which is connected to the other arm 19 of the bridge.

The arms 18 and 19 are pivotally carried on  $6\frac{1}{2}$  Rods 27 by means of  $3\frac{1}{2}$  X  $1\frac{1}{2}$  Double Angle Strips 28.

## Model No. 6.24 Box Ball Alley

This model of a Box Ball Alley gives endless amusement, apart from the actual construction. The object is to hit one of the Strips 1, which have various number values, by means of a ball rolled along the platform 2, the ball after striking and tipping one of the Strips being returned by the tray 3 to the player. The Strips 1 are pivoted by Double Bent Strips on to a Rod 4, so that each Strip may swing independently. The upper end of each Strip is engaged by Strips 5, the ends of which are bent slightly down, as shown, so that while the Strips 1 are normally held in the position shown, when one of the Strips is struck by the ball it is deflected backward and its upper end snaps outward past the bent end of its Strip 5, which thus acts as a spring, the deflected Strip being then retained in that position until it is reset. To reset any or all of the Strips 1 a handle is formed by a Strip 6 pivoted at 7 and controlled by a tension Spring 8. A Cord 9 connects the Strip 6 to a short Strip 10 forming a Crank and bolted to a Bush Wheel 11 on an axle journalled in the side Plates 12. This axle on its interior carries two further Bush Wheels to which are secured two short Strips 13 forming Cranks, a long Double Bent Strip 14 being in turn bolted to the Strips 13. When therefore the handle 6 is pulled out against the Spring 8 the Cord 9 rotates the Bush Wheel 11 and forces out the long Double Bent Strip 14 which pushes out the Strips 1 and resets them in their normal positions. During this resetting operation the upper ends of the Strips 1 snap back beneath the bent ends of the spring Strips 5. Parts required: 6 of No. 1

Electric Motor (not included in

Outfit)

Model No. 6.25

## niversal Radial Drilling Machine

ures of the travelling bed of the model will be apparent from Fig. 6.25a. The saddle pillar and slides on the bed, consists of two 3½" × 2½" Flanged Plates secured together bolts that serve to fasten a Bush Wheel 2, and it is retained in place on the side d by 21" Angle Girders. The traversing of the saddle along the bed is effected by hich is journalled in a Handrail Support 13 and works in a Threaded Boss 14; it ans of a reversible ratchet 3. This consists essentially of a 2" Strip, mounted freely

on the Rod, with a 1/2" x 1/2" Angle Bracket attached pivotally to it so that the Bracket may engage with the teeth of a 1 Pinion secured to the Rod, the Bracket being weighted with a Collar to ensure constant engagement. The device works equally well in either direction. thro

is st


the 6.25

sad

me

The base of the pillar is secured rigidly by \( \frac{1}{2}'' \times \frac{1}{2}''' \times \f to a 3" Pulley, which is attached to the saddle by a 11 Rod. The Rod is fixed in the boss of the Pulley and passes through the centre holes of the Flanged Plates and through the Bush Wheel 2. A 2" Screwed Rod, secured to a 2" Strip, is inserted in the set-screw hole of the Bush Wheel and serves as a locking device, whereby the pillar may be locked in any desired position.

Attention should next be paid to the saddle that slides upon the pillar and carries the horizontal arm (Fig. 6.25B). The part fitting e pillar consists of two 3½"×2½" Flanged Plates 4 that are connected together by "Strips. Double Brackets 5, bolted to the flanges of the Plates, press against the rders of the pillar, and in order that they do so efficiently, they are packed out with ashers. Each of the slides carrying the arm consists

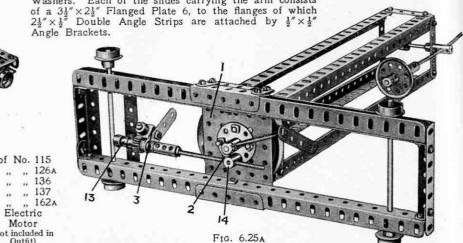

Parts red	quired:		
2 of No. 3	3 of No. 15A 3 16	16	Univ
11 ", ", 5 8 ", ", 6 6 ", ", 6A 12 ", ", 9B 4 ", ", 9D 5 ", ", 10 8 ", ", 11 22 ", ", 12 1 ", ", 12B 1 ", ", 13	2 " " 16A 1 " " 16B 4 " " 17 1 " " 18A 1 " " 19B 4 " " 20B		The main features I that carries the pilla face to face by the bomembers of the bed ba Screwed Rod, which is actuated by means of
22 " " 12 1 " " 12B 1 " " 13	2 " " 21 2 " " 22 2 " " 24 1 " 25		
			the pi
000	9a		Girder Wash of a C 2½"× Angle
		81.1	
= 0	0)	1 of N	No. 64   1 of No. 115 ,, 77   4 ,, 126a 2 ,, 136

## Model No. 6.25 Universal Radial Drilling Machine

(continued)

A 3/4" Bolt is secured rigidly to a 31/2" Strip 7, which is attached to the Plate 6 so that the shank of the bolt passes through the centre holes of the Plates 4 and 6; the Strip 7 is spaced away from the Plate 6 by a Washer on each of its retaining bolts, to make room for the nut on the 3" Bolt. A Bush Wheel and a locking handle (the latter consisting of a Threaded Crank, to which is bolted a 21" Strip, are then placed on the shank of the Bolt, so that by turning the locking handle, the arm may be locked and prevented from tilting. A 3" Bolt serves as a pivot for the two Plates on the other side of the saddle and is inserted in a Coupling, in the tapped hole of which works the 44" Screwed Rod 8 (Fig. 6.25) that forms a means of traversing the arm. Vertical movement of the saddle upon the pillar is effected by the Screwed Rod 16, which is journalled in the Strip 17 on the saddle and works in a Coupling at the top of the Pillar.

ldle

her

by it

ely

it

red

on-

ion.

kets The

ntre

2"

hole

illar

the

ting

c by

the

with

The "drillhead" 9 is capable of being turned through a complete circle and also tilted in a vertical sense to a considerable degree; the constructional details of this portion of the model are well brought out in Fig. 6.25B. The drill head proper consists of a  $2\frac{1}{2}$ "×1" Double Strip attached by two  $\frac{3}{4}$ " Bolts to a 57-teeth Gear 9A (Fig. 6.25B) and a Boiler End, the Gear being spaced equidistantly between the Double Angle Strip and the Boiler End by Collars on the Bolts. A Wheel Flange 10, attached to a  $2\frac{1}{2}$ "×1" Double Angle Strip, forms a bearing for the Boiler End,


over which it fits. The object of this bearing is to relieve the central shaft of strain. The shorter arms of the Double Angle Strip are attached to Double Arm Cranks, that are secured by double grub-screws to a Rod 11, the latter having secured to it a 57-teeth Gear that is in mesh with a Worm. By this gear the drill head may be tilted in a vertical direction. By turning a 1" fast Pulley the drill head may be rotated through a complete circle about the central shaft, through the medium of a Worm that is in mesh with the 57-teeth Gear 9A.

The  $11\frac{1}{2}''$  Rod 12 conveying the drive from the Motor carries a  $\frac{3}{4}''$  Contrate Wheel in mesh with a  $\frac{1}{2}''$  Pinion, which is loose on the Rod 11 and engages with a second  $\frac{3}{4}''$  Contrate. The latter is secured to a short Rod that passes through the Boiler End-Wheel Flange unit and terminates in a  $1\frac{1}{2}''$  Contrate Wheel. This Contrate drives


the drill spindle, which may be moved longitudinally in its bearings in order to feed the drill into the work, and is actuated by a 2½" Strip.

The Motor armature spindle carries a  $\frac{1}{2}$ " Pinion in mesh with a 57-teeth Gear on a short Rod that carries also a  $\frac{3}{4}$ " Pinion. The latter is in mesh with a 50-teeth Gear. This Gear is secured to a Rod that has at its upper end a  $\frac{1}{4}$ " Pinion, which is in mesh with a  $1\frac{1}{2}$ " Contrate on the end of the  $11\frac{1}{2}$ " Rod 12.

The Cranked Bent Strip 18 is provided for lifting purposes.

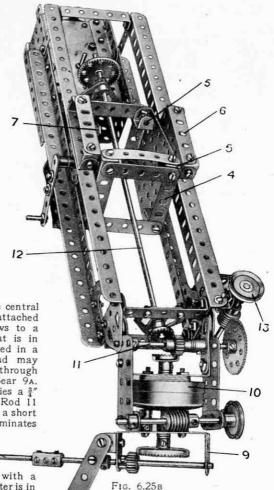


Model No. 6.26 Jack

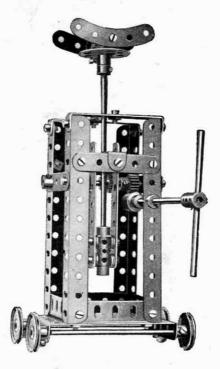


Parts required:

			11 15 11				
5	of	No.	5	3	of	No.	26
4	,,	33	9	1	- ,,	,,	32
44222	,,	- 22	9 D	32	,,,	.,,	37
2	,,	,,	12	8	,,	**	38
2	.,,	,,	14	3	,,	,,	48A
2	,,	,,,	15A	1	,,	,,	53
1	-11	,,,	16	7	,,	,,	59
1	**	,,	16в	2	,,	- 27	63
4	,,	**	22	2	,,	,,	90
1	.,	,,,	24	2	,,	,,	110

## Model No. 6.27 Weighbridge

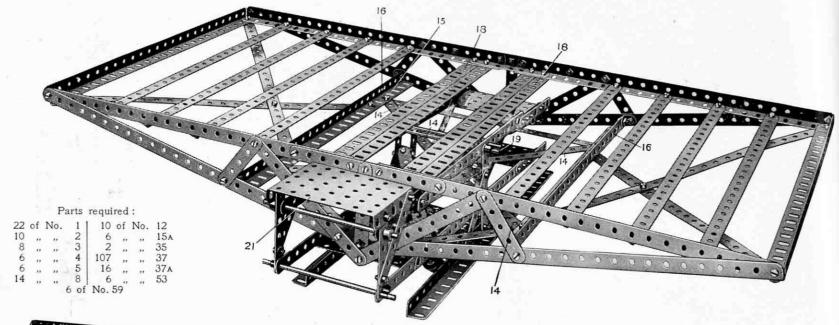

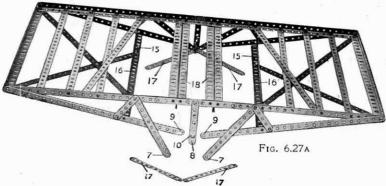


Begin the construction of this model by making the weigh beam, Fig. 6.27A. The side Strips 1 are bolted to the base Angle Girders 2, and in the Strips 1 are journalled the Rods 3 which form the fixed pivots of the weigh beam. The upper and lower Rods 4 are journalled in the Strips 5 and form the moving pivots of the beam. All the Rods 3 and 4 pass through perforations in the upper and lower Strips 6 of the beam. Next construct the platform, Fig. 6.27B, leaving the Strips at one side unconnected, as shown. The platform is then passed between the upper and lower parts of the weigh beam, and the unconnected Strips then bolted as follows:

## Model No. 6.27 Weighbridge (continued)

The ends 7 are bolted to the lowest hole 8, and the ends 9 to the Bolt 10, which also carries an Angle Bracket. The outer holes 14 of the 12½" crossed Strips, Fig. 6.27B, are then bolted to the same holes 15 in the Angle Girders 16 as the Strips 17. The other ends of the Strips 17 are secured to the Angle Bracket at 10. The Double Angle Girders 18 are then bolted in position, and the upper holes 19, Fig. 6.27B, are bolted to the Angle Girders 18 in the centre holes and the holes 20, Fig. 6.27B, to the Angle Girders 18 at the fifth hole from the Girder ends. The load to be weighed rests on the main platform, and the weights are placed on the small Rectangular Plate 21 at the end of the weigh beam.

Fig. 6.27B

## Model No. 6.28 Punching Press

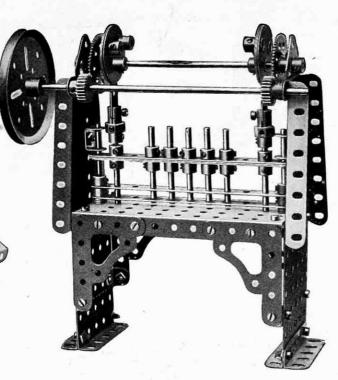

## Parts required:

922	of	No.	2	1	of	No.	19в	2	of	No.	53
2	,,	,,	6	2	23	,,,	25	2	,,	,,	54
2	,,	**	9D	2	,,	,,	27A	21	,,	•,	59
2	,,	,,,	11	34	,,	,,	37	2	,,	,,	63E
i	"	**	13 <sub>A</sub>	6	,,	,,,	38	4	,,	.,,	108
1	"	"	14	2	,,	,,	48A	2	,,,	,,	126A
9	,,	**	17	1	"	,,	52	2	,,	,,	130
								6			

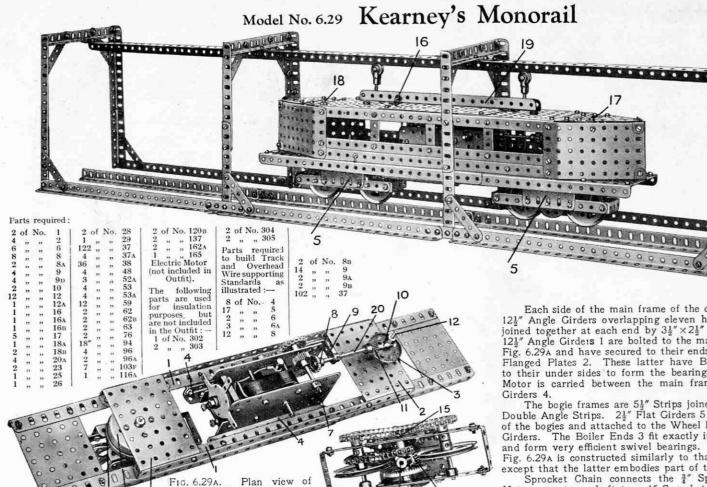


Fig. 6.29B. Underneath view of Driving Bogie of Monorail Car.

Chassis of Monorail Car, with

driving bogie removed.

Each side of the main frame of the car is composed of two 121" Angle Girders overlapping eleven holes, these sides being joined together at each end by 31" x 21" Flanged Plates. Two 121" Angle Girders 1 are bolted to the main frames as shown in Fig. 6.29A and have secured to their ends two further 31" x 21" Flanged Plates 2. These latter have Boiler Ends 3 attached to their under sides to form the bearings for the bogies. The Motor is carried between the main frames on the 54" Angle

The bogie frames are  $5\frac{1}{2}$ " Strips joined together by  $1\frac{1}{2}$ "  $\times \frac{1}{2}$ " Double Angle Strips. 21" Flat Girders 5 are bolted to the sides of the bogies and attached to the Wheel Flanges 6 by 21 Angle Girders. The Boiler Ends 3 fit exactly into the Wheel Flanges and form very efficient swivel bearings. The bogie included in Fig. 6.29A is constructed similarly to that shown in Fig. 6.29B except that the latter embodies part of the driving mechanism.

Sprocket Chain connects the 3" Sprocket Wheel on the Motor armature shaft to a 1" Sprocket Wheel on the Rod 7. This Rod carries a 3" Pinion that meshes with the 3" Contrate 8, which is secured to a 31 Rod 20 journalled in the 1" x 1" Angle Bracket 9 and in a Coupling 10. A second 31" Rod 12, inserted in the end hole of this Coupling, carries a 11 Contrate that

## Model No. 6.29 Kearney's Monorail (continued)

meshes with the 1 Pinion 11 on the Rod 20. The Rod 12 passes through the Boiler End 3, through a Double Bent Strip and a Double Arm Crank bolted to the inside of the Wheel Flange 6, and enters the Coupling 13. Between this Coupling and the Wheel Flange a 1" Pinion 14 is nipped on the Rod and engaged with a 11 Contrate on a 2" Rod 15. This Rod is journalled in the bogie sides and in the Coupling 13 and carries a 3" Sprocket that is connected by Sprocket Chain to a 1" Sprocket Wheel on one of the driving axles. This axle is connected to the second driving axle by means of 1" Sprockets and Sprocket Chain.

The construction of the body, which is a complete unit, will be seen fairly clearly from the illustration. It should be noted however, that two  $2\frac{1}{2}$  Flat Girders 17 are used at one end of the roof and one  $2\frac{1}{2}$ " Flat Girder and two Flat Brackets 18 at the other. Two 1/2 loose Pulleys carried in the jaws of two Swivel Bearings form the collectors. These are free to slide on 1" spring-mounted Rods that are attached by Cranks to the Angle Girders 19. The latter are secured to the roof by 6 B.A. Bolts (part No. 304) and insulated from the model by Insulating Bushes and Washers. These special electrical parts are not included in the Outfit and if they are not available ordinary bolts may be used provided that they are wrapped round with insulating tape so that they do not make contact with the metal parts. When the car is on the rails the  $\frac{1}{2}$ " loose Pulleys collect the current, which is taken down the wire 16 to one of the terminals on the Motor. The other terminal is earthed to the car and the current returns through the wheels to the lower rail.

The construction of the rails will be seen fairly clearly from the illustration, but it will be noticed that the standards are all built up from different length girders. This is in order to conform with the selection of girders supplied in the Outfit, but if Strips are used in conjunction with the girders a considerable length of rail may be

constructed.

VO

ed

gle

les gle ges in

9в

m. the


7.

8, gle


ted

hat

Model No. 6.30 Machine Gun

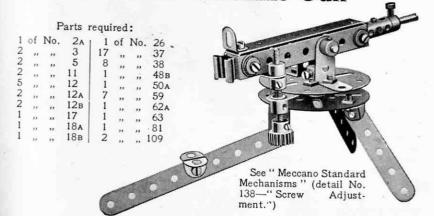

## Model No. 6.31 Linen Winder

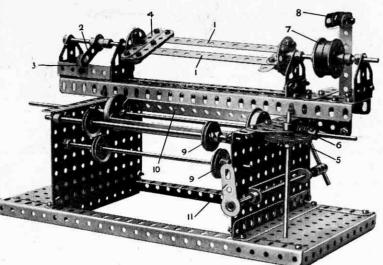


## Parts required:

2	of	No.	2	1	of	No.	13	1 1	of	No.	27A	1 2	of	No	48p
1	,,	,,	2 <sub>A</sub>	2	,,		13 <sub>A</sub>	1	,,		32	2	,,	,,	52
8	,,,	,,	5	1	,,	,,	14	66	,,	,,	37	2	,,,		52A
4	"	"	8	1	"	"	15A	2	,,	,,	37A	16	"		59
4	,,	,,	9	2	**	2.7	16	1	11	,,,	37в	2	,,	,,	62
4	"		9F	1	"	"	16A	6	,,,	,,,	38	2	,,	,,	63
6	"	"	10	4	"	"	20	1	"	"	44	5	,,		126A
1	"		11	4	,,	**	22	1	**	,,	48A		-		
7	,,		12	2	"	***	24	1	,,		48в				

In order to disengage the winding frame bars 1 the Crank 2 is lifted clear of the stop 3 and drawn back, this action disengaging the end cross Strips 4 from the tips of the frame bars 1 and permitting the wound linen to be removed. The Gear Wheel 5 engaging the Worm 6 forms a counter, 7 are the belt Pulleys, and 8 the belt striker operated by Crank 11; 9 are the guide Pulleys for the main linen drums 10.

## Weighing Automatic Model No. 6.32

This Model can be built with MECCANO Outfit No. 6 (or No. 5 and No. 5A)

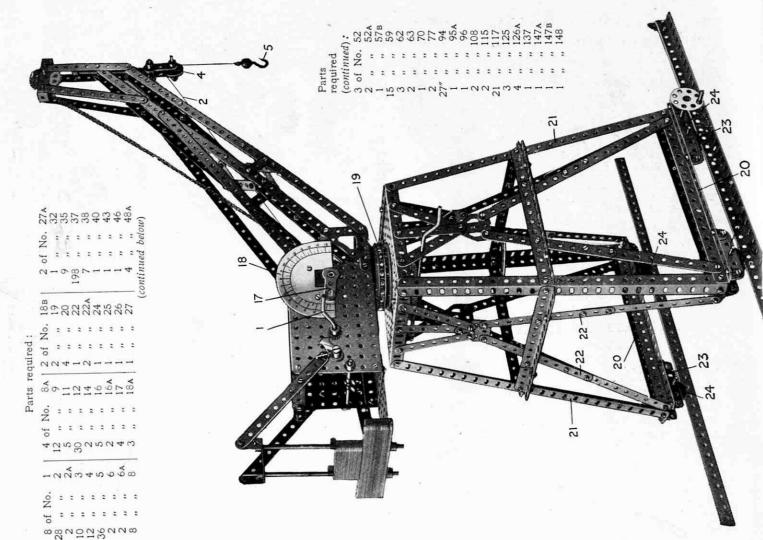

## Model No. 6.32 Automatic Weighing Crane (continued)


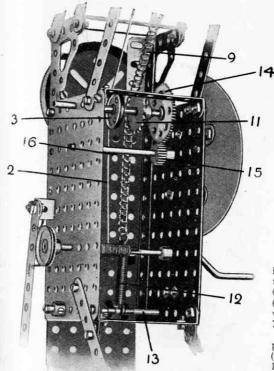


Fig. 6.32A

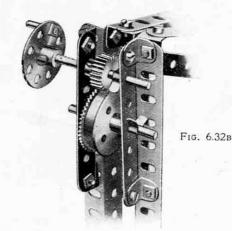

This is a model of a crane that, when raising a load, automatically indicates the weight carried. The load is raised or lowered by the operation of the Crank Handle 1 upon which is wound a lifting Cord 2 passing round a 1" Pulley 3 and over another 1" Pulley 4 (Fig. 6.32c) to the Loaded Hook 5. The 1" Pulley 4, which bears the weight of the load, is carried by two Cranks 6 connected to a  $3\frac{1}{2}$ " Rod 7, slidable in two Double Brackets 8.

To the top of the rod is connected a Sprocket Chain 9 which passes over a 1½" Sprocket Wheel 10 and under a 1" Sprocket Wheel 11 (Fig. 6.32A), the other end of the Chain being connected to a Spring 12, secured to a 3½" Rod 13. Thus, when a load is being raised the weight is carried by the Rod 7 which pulls down in its bearings and consequently extends the Spring 12. In this movement, the Chain 9 rotates the Sprocket Wheel 11 and a 1½" Gear Wheel 14, on the rod of the Sprocket 11, engages a ½" Pinion 15 on a Rod 16. On the outer end of this Rod 16 is a Crank 17 that sweeps round the

graduated Dial 18 to indicate the weight of the load that is being lifted.

The construction of the remainder of the model will be clearly seen from the illustration. The Bearings 23 carrying the Flanged Wheel 24 are formed of 2½" Strips connected to the Girders 20 by Angle Brackets.

It will be noted that the crane jib is carried upon Ball Bearings 19, the Balls (Part No. 117) for which are not supplied in the No. 6 Outfit but may be obtained separately. The crane will work well without the ball bearing, but the operation is easier when such a bearing is fitted.


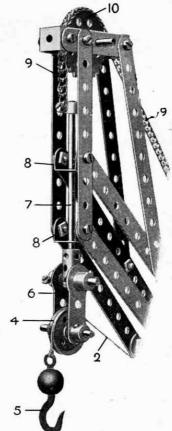


Fig. 6.32c

## Model No. 6.33 Vertical Lifting Bridge

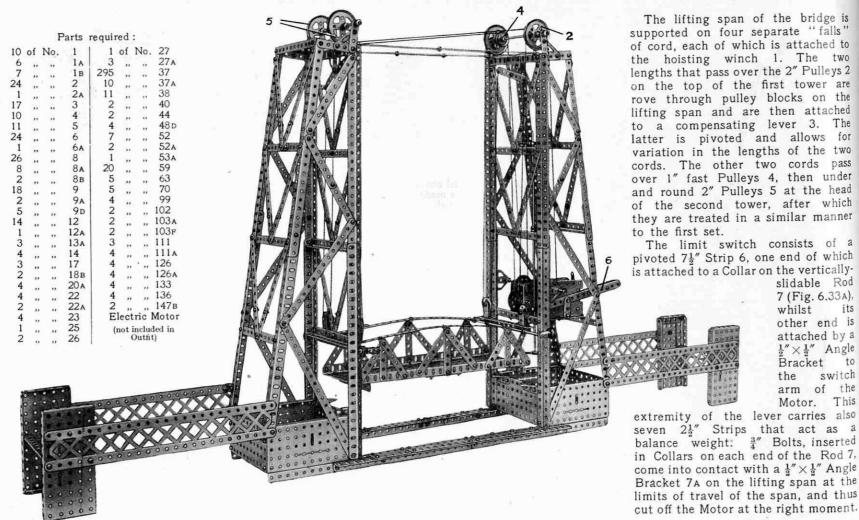

## Model No. 6.33 Vertical Lifting Bridge

l to two ys 2 are the ched The for two pass nder

head

hich

nner

of a

vhich

cally-

Rod

33A),

nd is

by a

Angle

witch

the

This

also

as a

serted

Rod 7.


Angle

at the

d thus

oment.

its

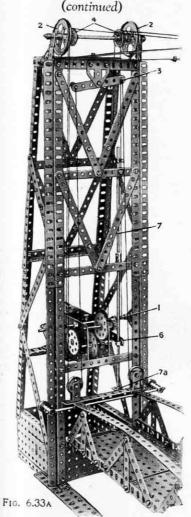

## Model No. 6.34 Heald-Making Machine

re		red	10000		/														_		-		•	•	•	•	F		2
6	of	No.	5		1.0								R				-7		9.		100	A	10						1
2	,,	,,,	6A	1				-	0 0			0/	/0				,			A	110	- 10					181		
2	**	"	8	V			Old.				8	1				_11_				-4	4					•:	0. 6	-1	
2	**	.,	12	a.	40		•	•		. 0	I IA	9.2				Vision I				100	-				28	Soft		-	
2	,,	.,	12 <sub>B</sub>	-	-						-					-					74					"		<b>a</b>	
2			14	-													l.	1			• 186				•			B	
2	**	**	15A	44		•	•	•						- A	-10	. 0			-					40.00					
1	,,		16A	+	-		COMP.	PARTIES.	Chil 24		in the last				-7	0			(3)	0	G	, 6,	•	9	*	9	3 6	iğ.	
1		**	25	- 1	10	9	•	9	ט פ	40		.6.		-	- /-	-	-		VENNY TOTAL	BANKS IN		SER PER	3/1		1	r)	-4	•	
2	**		26	- 1	1		PER		TON	SET Y	10710	7 100	THE O		n					UN	JBA	<b>FELS</b>	u		U				
2	**	**	27A	3			LE		Jinu			1,48	U	200 marie	Maria		-	THE PARTY			-	1	-						
2	"	**		9			Name of the last				′				Ė		6	:	4	1		11							
-2		**	29								Ю				)			,											
50		,,	37																										

This model converts thin lengths of wire into healds for use in Meccano looms. Two typical specimens of healds made with the machine are shown in Fig. 6.34a.

Two  $4\frac{1}{2}$ " Axle Rods are placed longitudinally in the model. One of these Rods carries a handle, composed of a Threaded Pin and Bush Wheel 1, and a  $\frac{1}{2}$ " Pinion that engages with a 57-teeth Gear Wheel secured to an 8" Rod 3.

The other  $4\frac{1}{2}$ " Rod 2 revolves in the opposite direction to the handle 1, the reverse motion being obtained in the following manner. The inner end of the 8" Rod 3 is journalled in one end of a Coupling, through the centre hole of which passes the vertical  $2\frac{1}{2}$ " Rod 7. The latter carries a  $\frac{3}{4}$ " Pinion and is journalled in the centre holes of two  $2\frac{1}{2}$ "  $\times$  1" Double Angle Strips bolted to the base Angle Girders. Another 8" Rod 4 is journalled in the opposite end of the Coupling, and this Rod is fitted with a 57-teeth Gear Wheel meshing with a  $\frac{1}{2}$ " Pinion on the Rod 2. Rods 3 and 4 are both free to revolve in the ends of

the Coupling, but the drive is transmitted from Rod 3 to Rod 4 via two  $\frac{3}{4}$ " Contrate Wheels 5 and 6 and the Pinion on Rod 7; hence the direction of rotation of Rod 4 is reversed.

Each of the two  $4\frac{1}{2}$ " Rods is fitted with a Coupling carrying a Threaded Pin 8, 9 secured at right-angles to its end; these Pins form hooks over which is slipped the loop of wire from which the heald is formed. Each Rod is also equipped with a Compression Spring that is mounted between a  $2\frac{1}{2}$ " ×  $2\frac{1}{2}$ " Flat Plate (forming the inner bearing for the Rod), and a Collar on the Rod in such a way that it tends to hold the Coupling carrying the Threaded Pin against the Plate. Two  $\frac{\pi}{4}$ " Bolts 10 and 11 are bolted to the side of the machine to form a gauge by which the correct length of wire may be ascertained.

The healds are manufactured as follows: A piece of suitable wire, about 13" in length, is passed round the Bolts 10 and 11 and the ends twisted together with a pair of pliers to form a loop. A convenient size of wire is 26 S.W.G. (.018" in diameter).

Next the loop of wire is removed and passed over the Rod 7, and its ends slipped over the Pins 8 and 9. The hand wheel is now rotated and the loop of wire is twisted into the form of a heald, the Rod 7 forming the hole through which will pass the warm threads of the

the warp threads of the loom. As the loop of wire is twisted the  $4\frac{1}{2}$ " Rods carrying the Threaded Pins 8 and 9 are drawn slightly towards the Rod 7. This movement is allowed for by the small Compression Springs already mentioned.


.. .. 111

,, 115



FIG. 6.34A

## Model No. 6.35 Watt's Beam Engine

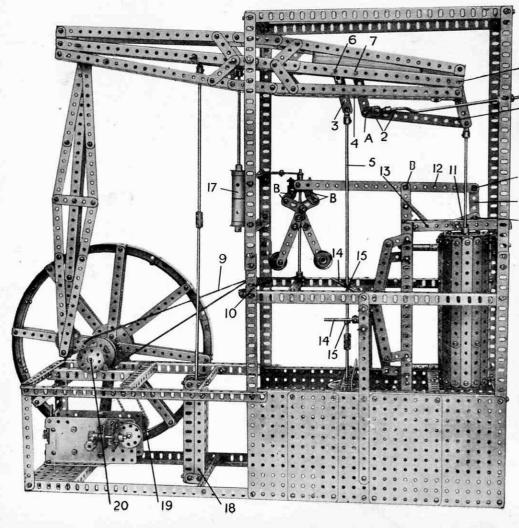

This model of James Watt's double-acting Beam Engine incorporates working reproductions of three of the great engineer's most notable achievements-sun-andplanet gear, steam governor and parallel motion-as well as a representation of a fourth-the water-cooled condenser. The 1" Sprocket Wheel 19 is connected by Sprocket Chain to a similar Sprocket in the flywheel-shaft, which is journalled in two Trunnions secured to the main frames. The piston rod is kept parallel by the parallelogram 1, the point A in which is connected by the Crank Handle and 1" Reversed Angle Bracket 2 to the framework. An extra link 3, secured to the main parallelogram by the 13" Strip 4, is added to keep the condenser pump rod 5 perpendicular. The complete link unit is pivoted on the 2" Rods 6, 7 and 8 and held in place by Collars. In constructing the cylinder it should be noted that 11 Strips and Flat Brackets are used at top and bottom respectively for connecting the separate Strips forming the sides. The governor, driven as shown by the Spring Cord 9 passing over the 3" loose Pulleys 10, is connected to the throttle valve 11 (a Crank carried on a 11" Rod) by the 121" Strip 12 and the 2" Strip 12A. A Bolt secured in the end hole of the Strip 12 slides between the two Bush Wheels on the governor, these Bush Wheels being spaced apart by

means of Spring Clips held in place by 1" Bolts. All joints marked B are lock-nutted.

The condenser is shown in detail in Fig. 6.35A. It consists chiefly of two cylinders, one of which is composed of a Boiler and the other 31" × 1" Double Angle Strips bolted round the periphery of two Bush Wheels. The main steam pipe, which is constructed from 121" Angle Cirders to form a square, is secured to latter at the bottom and at the top to two 51" Angle Girders 13, which are bolted together in a similar manner to the main pipe. The main steam pipe in the actual engine carries the inlet and exhaust ports, these being represented in the model by 11" Strips pivoted on 1" and 14" Rods carried in 124" Strips bolted inside the Angle Girders. It will be noticed in constructing the connections between the steam pipe and cylinder that the Screwed Rod used in the building of the top connection does not pass inside the cylinder as that in the bottom. The tappet Rods 14 are rocked by the Threaded Pins 15, and returned by the action of the Springs 16. The method of connecting the valves to the tappet rods will be seen clearly in Fig. 6.35A.

The sun and planet gear that is incorporated in the model is described in Standard Mechanism No. 279. To complete the engine a feed water pump 17 and water circulating pump 18 are fitted.

## Model No. 6.35 Watt's Beam Engine (continued)

			Parts	requi	red	:	
6	of	No	. 1	1 4	of	No.	48p
3			1 A				
10	- "	"	1 B		**	"	52
27		**	2	27	, "	**	52A
10	**	"	3	29	,,	**	58
2	"	"	4		**	"	59
18	"	22		3	**	"	62
	"	"	5	8		- 201	63
16	**	**	6	2	,,,		64
13	,,,	.,,	6A	6	.,	,,	70
26	12	- 22	8	4		"	77
8	**	"	8A	1	"		80a
18	"	**	9	1	,,	22	81
2	**	22	9F	11"	,,	,,	94
8		"	10	2	,,	,,	96
8	"	"	11	4	,,	,,	109
31	**	**	12	4	- 22	,,	111
2	**	**	12A	6	,,	,,	111a
2		**	12 <sub>B</sub>	6	,,		111c
3	**	**	13	2	**		115
1		,,	13A	1	- 11		116a
5	,,	,,	14	8			119
2	**		15	1			25
1		.,	15A	2	,,	,,	26
5		,,	16	1		**	26A
1	,,	,,	16A	2	11		28
4	**		17	1	"		33
4			18 <sub>A</sub>	i	**	1	47в
2	,,		18в	l i	"	" 1	60
1	,,	,,	19	i	33	,,	62
1	**	,,	20 A	2	**		63
2	"	,,	20в	1	,,	1	64
4	3.1		22		"	1	65
2	**	"	23	2 2	,,	4	66
1	**	"	23A		,,,	Jee .	00
4	**	**	24	į I		tric	
1		"	26		Mo	tor	
2	77	"	27A	(no	t inc	ludeo	l in
I	**	,,	28	114		tfit)	
i	**	"	32	In	addi	***	
19	11	"				part	the
314	11	11	35	used	as	the	bal-
6	**	"	37	ance		ight	for
	**	"	37A	the			
36	**	**	38	1 0	t N	lo.	2
2	28	200	43	4	,,	,,	2A
5 7	**	"	48A	14	,,	,,	3
1	11	"	48в	10	,,	**	4


d

ly he ng tle rip nd on by

nts

sts nd ery ted at are ain rts, 1" ngle bed in der the 16. 1 be odel olete


ump

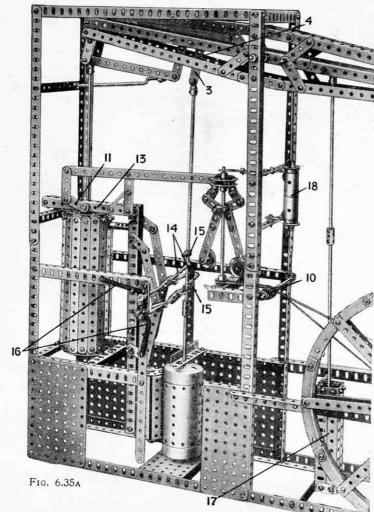


Model No. 6.36

## Ash Tray and Match Holder

The match-box holder is secured to the pedestal by a Fork Piece 1, and a Bush Wheel 2 carries the Wheel Flange 3, which forms the ash tray. A strip of sand paper or the roughened portion of a match-box cover may be pasted on each of the Flat Plates to facilitate the striking of the matches.

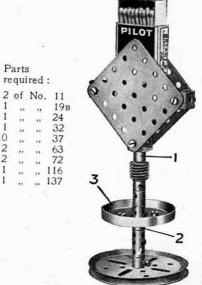

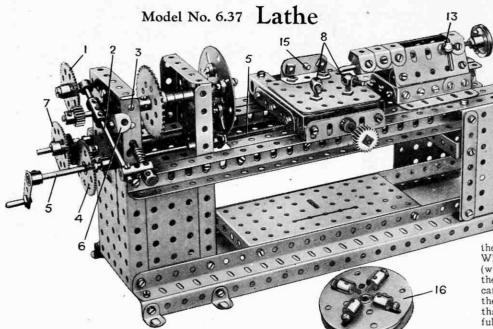

Parts required:

						-				70						
8	of	No.	3 1	2	of	No.	15 <sub>A</sub>	23	of	No.	38	6	of I	No.	103F	
6	,,		5	1	.,	,,	16	1		.,	48A	1	,,	,,	109	
4	,,		6A	2	**	.,,	16A	3	.,		48в	6			1111	
8			8	1			18A	3			52	1		**	111A	
4			8A	2	,,	.,	18в	6	,,	.,,	53	5	11:	**	111c	
2	.,,	.,	9в	1	,,	,,	22	16		,,	59	3	,,	,,	115	
6	,,		9 D	2	,,	**	24	1	,,		62	1	**	.,	120в	
3	,,	,,,	9F	2		**	25	1	,,	+9	62в	4	,,	**	136	
4			10	2 2	,,		26	5	**	131	63	1	**	.,,	147в	
4		.,	11	3	,,	***	27A	2	**		72	1	,,	,,	165	
9	,,		12	1	.,		35	2	,,	,,	80в					
4	,,		12A	95	.,,	,,	37	1	,,		81					
1			15	19			37A	1			95					

The headstock of the lathe is composed of two  $5\frac{1}{2}'' \times 2\frac{1}{2}''$  and two  $3\frac{1}{2}'' \times 2\frac{1}{2}''$  Flanged Plates. Bush Wheels, bolted to the former Plates, form reinforced bearings for the "mandrel," which carries a 2" Sprocket Wheel and is strengthened by the addition of a Coupling and Collars.


Each side of the lathe bed is built up from two  $12\frac{1}{2}''$  and two  $9\frac{1}{2}''$  Angle Girders, bolted together to form an H-section girder, and the rear end of the bed is supported by two  $3\frac{1}{2}'' \times 2\frac{1}{2}''$  Flanged Plates, which have  $3\frac{1}{2}''$  Strips bolted to them for strengthening purposes and are spaced apart by a  $3\frac{1}{2}'' \times \frac{1}{2}''$  Double Angle Strip and a  $3\frac{1}{2}'' \times 2\frac{1}{2}''$  Flanged Plate. Both the Plate and the Double Angle Strip are spaced from the side Plates by the thickness of a Washer.

The change-speed gearing for actuating the leadscrew 5 is arranged as follows: A ½" Pinion on the mandrel is in continual mesh with a 57-teeth Gear Wheel 1, which is mounted freely on a Pivot Bolt on the end of a lever 2. The latter pivots and is free to slide on the mandrel, so that by placing the springloaded plunger on the end of the lever in the hole 3.

the Gear 1 is brought into mesh with a 57-teeth Gear 4 on the lead-screw. When the plunger is placed in the hole of an  $\frac{1}{2}$  " $\times$   $\frac{1}{2}$ " Angle Bracket 6 (which is spaced from the Plate by three Washers on the securing bolt), the Gear 1 engages with another 57-teeth Gear Wheel 7 on a Rod that carries a  $\frac{1}{2}$ " Pinion and is journalled in a  $2\frac{1}{2}$ "  $\frac{1}{2}$ " Double Angle Strip at the rear of the headstock. The Pinion is in mesh with an "idler" Pinion that is in mesh with the Gear Wheel 4. The Gears 4 and 7 must be carefully adjusted on their respective Rods, so that the movable Gear 1 meshes correctly with both. The lead-screw is a  $4\frac{1}{2}$ " Screwed Rod secured by a

Coupling to the Rod carrying the Gear 4. A Crank is provided to traverse the slide rest by hand if the mechanical movement is considered too fast for delicate work. The bottom and top slides of the slide rest are shown in Figs. 6.37a and 6.37c. The portion that slides on the lathe bed (see Fig. 6.37a) consists of a  $3\frac{1}{2}" \times 2\frac{1}{2}"$  Flanged Plate, to the flanges of which are bolted  $2\frac{1}{2}"$  Angle Girders, a  $2\frac{1}{2}"$  Strip being placed between each Girder and the flange of the Plate. Two  $3\frac{1}{2}"$  Angle Girders are secured

to further  $2\frac{1}{2}$ " Girders as shown, and upon these the top slide runs. The latter—of which the underside is shown in Fig. 6.37c—is built up from two  $2\frac{1}{2}$ "  $\times 2\frac{1}{2}$ " Flat Plates, to two sides of which duplicated  $2\frac{1}{2}$ " Flat Girders are secured by means of  $\frac{3}{4}$ " Bolts 8 and  $\frac{3}{8}$ " Bolts 9. Each pair of Flat Girders is packed away from the Plates by a  $2\frac{1}{2}$ " Strip. The top slide is pushed on to the  $3\frac{1}{4}$ " Angle Girders and the end of the feed-screw 10 inserted in the set-screw holes of a Double Arm Crank.

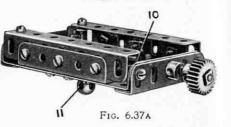

(one Coup "spi of th the Angl


Angiorde retai in ti

thro pass the i

Two which hole Was Face

shar tool Han firm that a levachi pacl

Bolt turn Model No. 6.37 Lathe (continued)

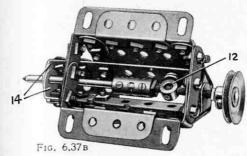

m

d-

ar

on

w.

6

lt),

hat

at

ion

are-

hes

y a lide

ork.

37c.

nged

aced

ured

The completed slide rest is placed in position on the lathe-bed, and the lead-screw passed through the tapped bores of a Handrail Support 11. It is very important that there should be absolutely no slackness in the longitudinal and cross movements of the slide rest, as this will prevent accurate work being obtained, particularly in the case of metal-turning.


The tailstock is shown in Fig. 6.37B. The tailstock spindle is a 21" Rod (one end of which is turned to a point in the lathe) that is secured by a Coupling to a 2" Screwed Rod. The latter works in the tapped bores of a "spider" 12 (removed from a Swivel Bearing) that is attached to the frame of the tailstock by a Handrail Support 13 (Fig. 6.37), so that by screwing up the latter the spindle is locked. The spindle slides in two 31" x 1" Double Angle Strips 14, and the complete tailstock is slidable on the lathe bed in order that work of varying lengths may be accommodated. It may be retained in the required position by passing Threaded Pins through the holes in the tailstock Girders and those in the lathe bed.

The "chuck" for holding the work to be turned, consists of a Face Plate to which four equidistantly-spaced Collars are secured by Set-screws passed through the Face Plate and inserted in their tapped bores. A 3" Bolt is passed through each Collar and held in place by two nuts, so that by turning the nuts, the bolts can be made to grip the work from four different directions.


A more satisfactory and stronger chuck is shown separately at 16, but this requires four Threaded Bosses while Outfit No. 6 contains only three. Two Face Plates and a Wheel Flange are clamped together by four 1 Bolts, which are screwed into the Threaded Bosses. The Bosses bed into the slotted holes of the Face Plate, and are hence prevented from twisting round. One Washer and a Collar is used on the shank of each 1 Bolt between the two Face Plates, and a Washer is also placed under the head of each Bolt.

The turning tool may be held in place on the top slide of the slide rest by Strips, which are placed over the shanks of the #" Bolts 8 and over the tool, so that by screwing down the Handrail Supports, the tool is clamped firmly. It is very important to see that the point of the tool is exactly on a level with the centre of the work : to achieve this it may be necessary to pack up the tool by Strips, etc. The Bolt 15 forms a "steady" when turning work of small diameter.



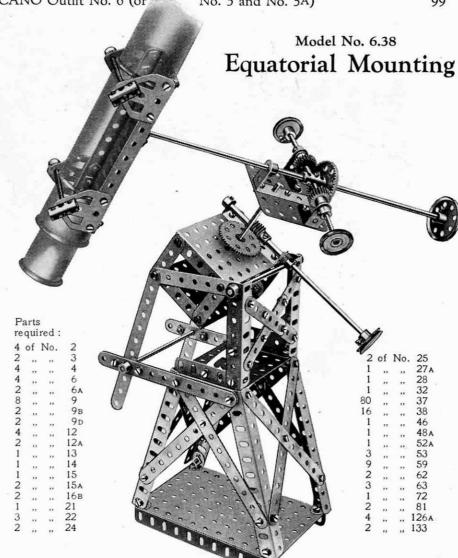

This Model can be built with MECCANO Outfit No. 6 (or No. 5 and No. 5A)

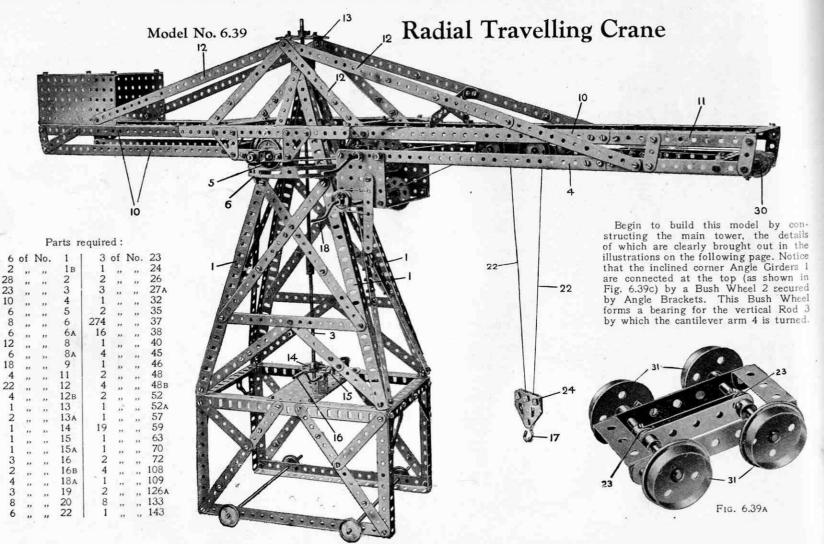

Model No. 6.39 Radial Travelling Crane (continued)

The cantilever arm 4 turns on a wheel-race formed of Flanged Wheels 5, which run on a circular Girder 6 supported by four 1"x1" Angle Brackets bolted to the Corner Girders 1. The cantilever is built up (as shown in Fig. 6.39B) from two 91' Angle Girders 8 braced by two 51" Angle Girders 9 overlapped nine holes. From these, 121" Angle Girders 10 extend at one side, and to similar Girders 10 at the other side are connected 54" Girders 11.

The inclined Strips 12 are connected at the top, by means of Angle Brackets, to a Face Plate 13 secured to the vertical Rod 3. At the foot of the Rod 3 is a 14" Gear Wheel 14 engaged by a Worm Wheel 15 operated by the Crank Handle 16 and in this way the cantilever arm is

Fig. 6.39B Fig. 6,39c swung round, the Wheels 5 riding on the Circular Girder 6. The load carried from the Hook 17 is raised or lowered by the Crank Handle 18, a 1 Pinion 19 on which engages a 11 "

Gear Wheel 20 on a Rod 21 on which is wound a Cord 22. This Cord passes over a 1 Pulley 23 to the block 24 and back over another 1 Pulley on the trolley, and is secured to the 31 Double Angle Strip 25 at the outer end of the cantilever arm. Consequently, when the trolley is caused to travel along the cantilever arm the load remains suspended at a constant height-an important point and an interesting detail.

The trolley is caused to move to and fro along the cantilever arm by the action of the Crank Handle 26. On this a 1/2" Pinion 27 engages a 11 Gear Wheel 28 on a rod on which is wound the Cord 29, the opposite ends of which are connected to the opposite ends of the trolley. The Cord 29 passes round a Pulley 30 at the outer end of the jib. By turning the Crank Handle 26, therefore, the Cord 29 winds on and off its Rod, and moves the trolley to and fro, its Wheel 31, as shown in Fig. 6.39A running on the Angle Girders 10.


The Wheels 5 are connected to 11 Rods 5A which are journalled in Double Bent Strips 5B bolted to 31 Strips 5c

carried from the Angle Girders 8 by Corner Brackets 5p.

## Model No. 6.41 Mill Engine

	Parts red	quired :			0		
6 of No. 1 4 ., , , 1A 3 ., , 1B 25 ., , 2 1 ., , 2A 5 ., , 3 3 ., , 4	1 of No. 15 2 , 15A 4 16 1 16A 1 16B 3 17 3 18A	8 of No. 38 1 45 4 48 7 48A 1 50A 6 52	2 of No. 62B 5 ,, 63 6 ,, 70 2 ,, 72 2 ,, 76 1 ,, 81 46" ,, 94	are seen fairly clearly The "wrist-plate is secured to the 5½". valve cranks 8, 8a, an wrist plate by ½" Bolt Bush Wheel to hold by two 12½" Strips being used for spacing No. 263) direct to the valves	in the illustrations. The "7 (Fig. 641B), which con ×3½" Flat Plate forming on d the exhaust valve cranks s. These Bolts serve also t the ½" Bolts in position. T ypurposes. The two exhau eir respective links, the Rod	Corliss valve gear is but sists of a Bush Wheel, is set side of the cylinder blk so, 9A, consist of 2½" Str. os secure a 2" Strip 10, a the eccentric on the cranh d attached pivotally to the st valve cranks 9 and 9A is on which they are more	free to turn about a Pivot Bolt that ock. The links connecting the steam ips that are attached pivotally to the nut being placed on either side of the kishaft is connected to the wrist plate the Strip 10 by a Pivot Bolt, a Collar are lock-nutted (Standard Mechanism unted representing the rotary exhaust
20 6 12 6A 19 8A 2 8B 9 9 2 9B 4 9F 2 10 8 11 29 12 1 12A 2 12B	4 ,, 20 2 ,, 20A 5 ,, 26 1 ,, 26 1 ,, 28 300 ,, 37 20 ,, 37 4	4 ,, ,, 52A 3 ,, ,, 53 4 ,, ,, 53A 10" ,, ,, 58 16 ,, ,, 59 4 ,, ,, 62	1 " " 95 2 " " 96 1 " " 96 4 " " 97 8 " " 99 2 " " 99 A	The Face Plates cylinder to represent the Bracket bolted togeth Pin secured to the Fac links between the write soft No. 100 4 , , , 108 4 , , , 109 2 , , , 111 5 , , , 111 6 6 , , , 111 5 2 , , , 115 8 , , , 119	or hy Sat-corouge to form or	r teocciles triangle the an	re journalled in the side plates of the onsists of two 1½" Strips and one Flat sex of which is pivoted on a Threaded ip by its slotted hole. The connecting Pins and held in position by Collars; the links are bent slightly to obtain sufficient clearance. Each of the two Bush Wheels 14, 14A, which turn freely on the valve rods, has an ordinary bolt inserted in the set-screw hole and locked in place by a nut. A 2" Strip is now bolted across the face of each Bush Wheel so that when the Strips are vertical the bolt in the boss of 14 is pointing—to use a clock face as a comparison—to 5 o'clock, while the bolt in the boss of 14a is pointing
, , 13				4 ,, ,, 126A			to 11 o'clock. The Cranks 8 and 8a are now secured on the Rod, and a ½"×½" Angle Bracket is bolted to the end hole of each. Short lengths of Spring Cord
	200						

## Model No. 6.41 Mill Engine (continued)

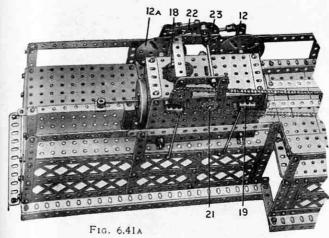

hich

the the

late

ollar

aust

Flat

aded

cting

lars; the hich has the place olted Vheel

rtical nting comthe

Rod, et is each.

Cord

### (Continued from above)


A Boss Bell Crank is bolted to the 2" Strip 22 (Fig. 6.41B), which carries a \(\frac{3}{4}\)" Bolt locating between the Pulleys 17, and is secured by a Coupling to a \(\frac{3}{2}\)\" Rod carrying a Bush Wheel 23. Two Collars are attached pivotally to the latter and are connected by \(\frac{1}{2}\)\" Rods and End Bearings to the 2" Strips on the Bush Wheels 14 and 14A.

In the illustration the Crank 8 is about to be pulled down by the Angle Bracket on the trip 13. As this downward movement continues, the trip commences to ride up the bolt on the boss of the Bush Wheel 14, thus releasing the Angle Bracket on the Crank, which returns to its normal position under the influence of a length of Spring Cord that is fixed to the Coupling 19 (Fig. 6.41a). The other valve functions similarly, except that the Crank 8a is tripped in an upward direction instead of downward.

If the engine speed increases, the governor weights fly out and partially rotate the Bush Wheel 23 through the medium of the crank 22. This alters the position of the bolts in the bosses of the Bush Wheels relative to the trips, so that the Cranks are tripped earlier in the stroke of the piston.

By altering the position of the Rods in their respective Collars, both valves may be arranged to lift an equal amount by their trips. The Angle Brackets on the trips and Cranks 8 and 8A must be adjusted very carefully.

In constructing the crosshead the following notes will be useful. Two pairs of 1½" Angle Girders 1 and four ½"×½" Angle Brackets 2 are secured to two Couplings 3 and 4 by two ½" Bolts. One of these passes through the centre tapped hole of the Coupling 3 and the other through the end plain hole of the Coupling 4, and each Bolt has a Washer placed under its head. Two 1½"×½" Double Angle Strips 5 are next bolted to the Angle Brackets 2, thus forming two channel-shaped "shoes" that slide on the crosshead guides 6.

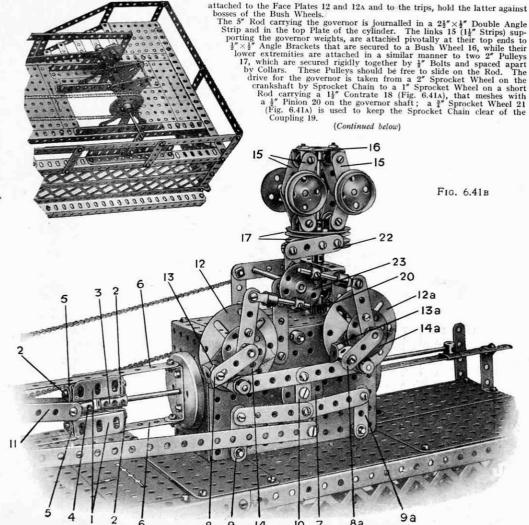

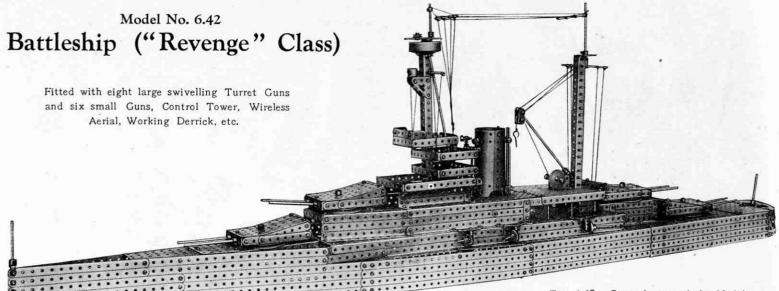


Fig. 6.42. General view of the Model.

## Parts required:

								12772000											
30	of	No.	1	1 7	of	No	10	1 1	of	No.	24	1 4	of	No.	52A	1 6	of	No.	. 103F
6	,,	,,	1 A	4	.,,	**	11	1	,,	.,	27	5	**		53	1	.,		109
6 7	,,	"	1в	27	**	**	12	2	,,		29	4	,,		53A	3			111
10	,,		2	- 6	,,	,,	12A	1		,,	32	1	,,		54	6	,,		111A
4	,,		2A	2	**	- 11	12 <sub>B</sub>	19	,,	.,	35	1	,,	.,	57	6			111c
16	,,		3	3	**	,,	14	314		**	37	29	**		59	2	,,		115
11	,,		4	2		,,	15	6		,,	37A	3	.,		62	1	- 22		118
1	,,		5	6	.,	,,	15A	12	,,	.,	38	8	,,		63	2	**		133
16			6	7		,,	16	1	**	.,	40	1	,,		64	4	,,		136
12	**		6A	7		**	16A	3	,,		45	6	,,		70	1	94		143
18			8	2	•••	11	16в	2 2	,,		46	1			72	2	**		147B
6	,,	,,	8A	9	,,	,,	17	2		**	47	1	,,		81	1	.,,		160
6	,,		8в	4	,,	,,	18A	1	,,		48	6		.,,	90A	1			162A
11	,,	**	9	4	**		19 <sub>B</sub>	14	,,	**	48A	1	**		98	1			162в
2	,,	,,,	9A	4	22	**	20 B	6	,,	**	48в	1	,,		100	1	**		164
2 2 3	,,	**	9в	4	,,	,,	22	2	,,	,,,	48c	1	"	,,	102	1	,,	,,	165
3	,,		9 D	2	,,	**	23	4	,,	**	52								


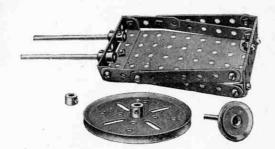


Fig. 6.42D. Underneath view of one of the Gun Turrets dismantled.

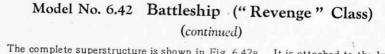

The complete superstructure is shown in Fig. 6.42B. It is attached to the hull section (Fig. 6.42A) by bolting Flat Brackets 1 to the side Girders 2 of the superstructure. Additional security is effected by attaching  $\frac{1}{2}'' \times \frac{1}{2}''$  Angle Brackets 3 and the flange of a Flanged Plate 4 to the front girder of the superstructure.

The control tower (Fig. 6.42c) is secured in place by bolting the Double Bent Strip at the foot of the tower to a transverse 7½" Strip 5 in the hull. It is additionally supported by a ½" ×½" Angle Bracket that is attached to the front of the tower and to the Flanged Plate 6 (Fig. 6.42b). The fire control station (a Boiler End) is secured to a Double Bent Strip that is fixed to the top of the tower.

Fig. 6.42p gives an underneath view of one of the 15"
gun turrets, all of which are constructed in the
same manner. It is mounted in place by
passing a Rod up through the deck
and through the boss of a 3"

Pulley, then
placing the turret
over the end of the Rod,
and securing it finally by a
Collar on the Rod.

Set-screws serve to secure the
Coupling 7 to the tower (Fig. 6.42B)
and the Collar supporting the centre
escape pipe is secured in the same manner to
the funnel. Set-screws are also used to attach to
the funnel the Coupling that carries the "branch
pipe" on the ends of which the two syrens are mounted.

Fig. 6.42B. The Superstructure, with Foremast and top forward Gun Turret removed.

Fig. 6.42a. Semi-plan view of Hull, with Superstructure and Gun Turrets removed.

Fig. 6.42c. Control Tower.

ea.

## Model No. 6.43 Single Cylinder Horizontal Steam Engine


Models of steam engines are always very popular with Meccano boys. This particular model is an exceptionally fine one, and it looks splendid when in motion. All necessary instructions for building the engine, together with sectional illustrations that make every detail clear, are contained in a special leaflet included in the Outfit. This Leaflet (No. 11) may also be obtained from your dealer, price 2d., or direct from Meccano Ltd., Old Swan, Liverpool, price 2d., post free. Model No. 6.44 Stone-Sawing Machine

This is a very interesting model to construct and operate. The saw is represented by two Rack Strips, but if desired these may be substituted by a hack saw blade. The model includes a trolley that runs on overhead rails and carries a selfsustaining chain hoist. The elevation of the sawing table is adjusted by means of a hand wheel. Full instructions for building the model, together with sectional illustrations that make every detail clear, are contained in a special leaflet included in the Outfit. This Leaflet (No. 12) may also be obtained from your dealer, price 2d., or direct from Meccano Ltd., Binns Road, Old Swan, Liverpool, price 2d., post free.

## Model No. 6.45 Log Saw

In addition to the operation of the saw, the movements of this model include the vertical adjustment of the saw frame and the to-and-fro movement of the feed carriage. Several sectional views are necessary in order to explain the construction of the Log Saw. These are included in a special instruction leaflet contained in the Outfit. The Leaflet (No. 10) may also be obtained from your dealer, price 2d., or direct from Meccano Ltd., Old Swan, Liverpool, price 2d., post free.


## Model No. 6.46 Bagatelle Table

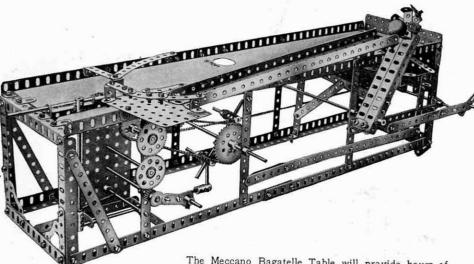

The Meccano Bagatelle Table will provide hours of fun for all members of the family. The game is played merely by turning the Handle. The ball or marble is struck automatically and rolled toward the end of the table (which consists of a sheet of cardboard cut to the required shape). A number of holes are pierced in the end of the table and the score is made according to the particular hole through which the ball falls. The ball is afterwards returned to the playing end automatically. A detailed explanation of this model would require much space, and full instructions have therefore been prepared in the form of a special leaflet, which is included in the Outfit. The Leaflet (No. 9) may also be obtained from your dealer, price 2d., or direct from Meccano Ltd., Old Swan, Liverpool, price 2d., post free.

It should be noted that the ball and strip of cardboard forming the table are not included in the Meccano Outfit

## Model No. 6.47 Howitzer and Tractor

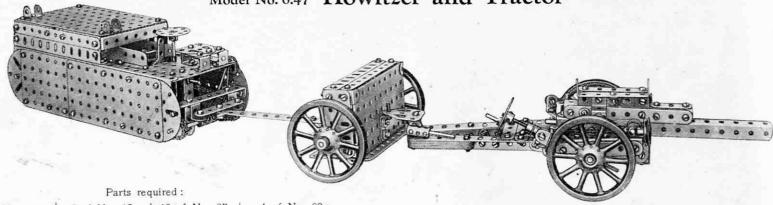

5	of	No.	1в	5	of	No.	12A	1 10	of	No.	37A	1 of	№. 80в
	,,	,,	2	1	,,		12 <sub>B</sub>	20		**	38	50" ,,	., 94
3 4 2	,,		2A	2	,,		13A	1	.,		43	2 ,,	,, 95
4	,,	,,	3	1	.,		14	2	,,	**	48	1 .,	,, 96
2		,,	4	1			16	3		**	48A	3 .,	,, 96A
22	,,		5 -	3	**		16A	4			48в	2 ,,	" 103F
22 3	,,		6	8		.,	17	1	,,	,,	52A	4 ,,	., 109
1	"		6A	3	,,		18A	5	**		53	5 ,,	111
			8 A	4	23	**	19A	3	,,	,,	53A	6 ,, 5 ,,	" 111A
2 6 2 2	,,		8в	2	,,	4.	22	29	,,	. ,,	59		" 111c
6	,,	.,	9	2	.,		24	4	,,	**	62	2 ,,	,, 115
2	,,	.,,	9A	2			25	6		**	63	4 ,,	,, 125
2	,,		9в	2		.,	26	3		**	64	4 .,,	" 126A
6			9 D	2			27	4	2.5	22	70	2 .,	., 136
4	,,		9F	3	,,	**	27A	2			72	Elect	
6	"		10	7			35	2		.,,	77		included in
8	,,		11	165	,,	.,,	37	2	**	**	A 08		Outfit)
	9 177	1.00											


The illustration shows an accurate reproduction of a big gun with its ammunition carriage, or "limber," and tractor. The gun fires ammunition in the shape of Washers for a considerable distance with a remarkable degree of accuracy. It is fitted with brakes on the road wheels, fixing spade, recoil cylinder that actually functions, training apparatus and sights. The Washers used in the gun are carried in racks in the limber. The tractor, which is fitted with endless tracks and may be steered in any desired direction, is driven by an Electric Motor, making the whole a self-contained and mobile unit. There is far too much detail in the model to permit of a proper description in this Manual, and a special Instruction Leaflet has therefore been prepared. This leaflet, which describes every part of the model and is amply illustrated, is included in the No. 6 Outfit. It may also be obtained separately, price 2d., from any Meccano dealer or direct from Meccano Ltd., Old Swan, Liverpool, price 2d. post free. Please ask for Leaflet No. 37.

#### HOW TO CONTINUE

This completes our examples of models that may be made with MECCANO Outfit No. 6. The next models are a little more advanced, requiring a number of extra parts to construct them. The necessary parts are all contained in a No. 6A Accessory Outfit, the price of which may be obtained from any Meccano dealer.

#### Model No. 7.1 Motor Chassis


		1														P	arts	req	uired:																
11	of	No.	2	12	of	No.	10	5	of	No.	16	3	of	No.	22	1	2 0	of No	. 30A	1 9	of	No.	48A	1	of	No.	70	19	of N	Vo.	111c	4	of N	lo. 14	42R
9	,,,	,,,	2 <sub>A</sub>	8	,,	,,,	11	2	,,	,,	16A	2	,,	,,	23		2,	, ,,	30c	2	,,	,,	48в	5	,,	,,	89	1	,,		115	2		" Î4	
4	,,		3	24	,,,	,,	12	1	,,	,,	16в	1		,,	23A		4 .		31	4	,,	,,	48c	14			90	2			120в	1	"	,, 15	
6	,,		4	4	,,	,,	12A	5	,,	,,	17	2	**		25	17			37	1		**	53	2	"		90A	4	"		124	i	"	,, 15	
6	,,	.,,	5	4	,,	,,	12 <sub>B</sub>	5	,,	,,	18A	4	,,		26		8 ,		37A	1	**		55A	4	"	**	101	2	***		125	2	"	,, 16	
9	,,	,,,	6A	1	24	,,	13 <sub>A</sub>	3	,,	,,	18в	2	,,		27		0 .		38	3"		"	58	1	"	17.0	102	2	"		126	2	"	30	
4	,,	.,,	8	2	,,	,,	14	4	**		19B	1	,,		27A	1	1	, ,,	45	42	***	"	59	2	,,		109	1	,,		136	2	"		
2	,,	,,	84	2	,,	,,	15	1	- 22		20	1	"		28	13	1 "	,	46	5	,,		62	5	"	".	111	À	"			2	"	,, 30	
2	,,	**	9	1			15A	1	,,		20 A	4	,,	"	30	1 3	2 "		47	9	"	"	63	0	"	"	111.	2	"		137	2	"	,, 30	
									,,,			-	"	**	00		٠,,	- 33		1	"	**	00	0	"	**	111A	2	"	,,	140	2	2)	,, 30	)5

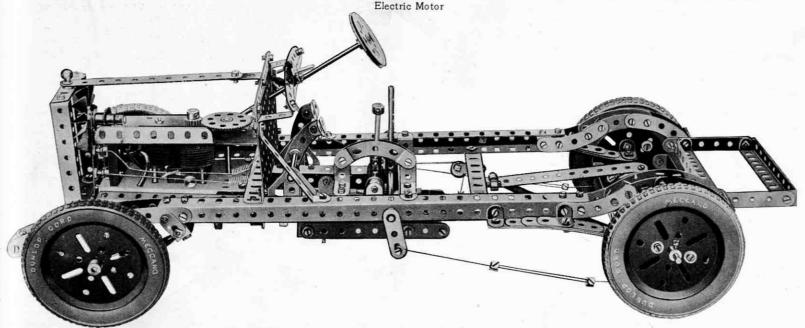

The Meccano Motor Chassis is a model of exceptional interest, for it provides a complete demonstration of the principles of a real motor chassis. It is equipped with differential, Ackermann steering gear, and gear box giving three forward speeds and a reverse with central change lever. It is provided also with a clutch, internal expanding brakes on the rear wheels, and foot brake on the cardan shaft. The frame is suspended at the front on semi-elliptic leaf springs and at the rear on cantilever springs. In order to make the construction of the model quite clear a number of sectional photographs and drawings are necessary and it is impossible to find space for these and the instructions which go with them, in this Manual. We therefore have compiled a leaflet, printed on art paper, containing full instructions and clear illustrations. A copy of this leaflet is included in every No. 7 Outfit. It may also be purchased from any Meccano dealer, price 3d., or direct from Meccano Ltd., Old Swan, Liverpool, price 3d., post free. Please ask for Leaflet No. 1.

on ra on tus tor,

too cial part be Old

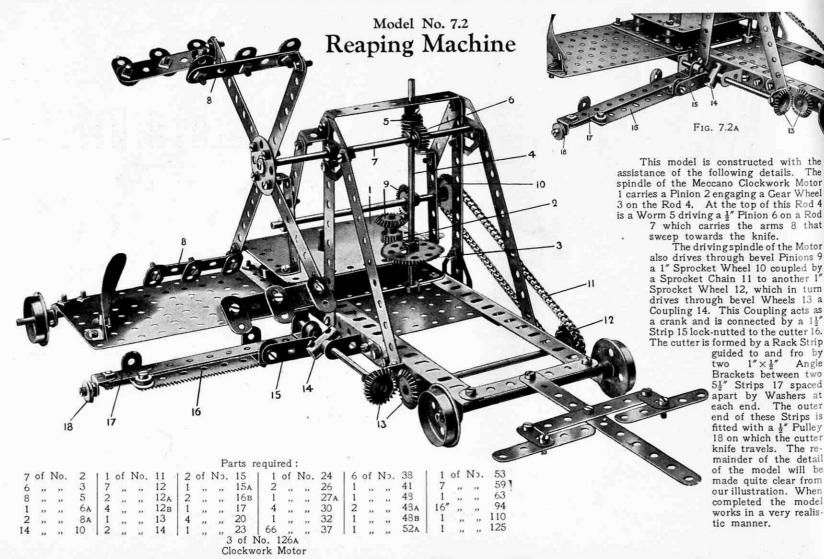

## Model No. 7.3 Wire Covering Machine

Parts	AND HAVE A	

	1191			requi	164		
1		No.	2	2	of	No	. 27A
7		,,	3	2	,,,	,,	30
2	,,,	,,	4	2	- ,,	,,	32
2 2 1	23	,,	5	41	,,	,,	37
2	**	22	6A	17	,,	,,	38
2	.,,	,,	8	2	**		44
1	,,	,,,	10	1	.,	,,	46
2	.,,	,,	12	1	,,	,,	48
3	**	,,	12 <sub>A</sub>	- 2	,,	,,	50
1 3	"	**	13	4	,,	,,	53
3	,,	,,	15	12	.,,	,,	59
4	**	**	15A	2	,,	,,	62
1	**	,,	21	1	,,		63
	.,,	"	22	1	,,		81
2	,,	,,	24	1			106
4	,,	,,	26	1	,,	**	301
						-	

d at or

rn as 1½" 16.

rip by gle

wo

ced

at

iter

s is

lley

tter

re-


etail

be

rom hen

odel


alis-

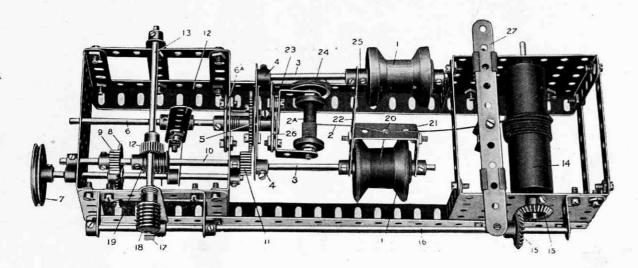

The bobbins 1, carrying the thread by means of which the wire 2 is covered, are carried in a yoke consisting of two Rods 3, secured in Cranks 4, between a  $2\frac{1}{2}$ " and  $1\frac{1}{2}$ " Strip, and bolted to a 57-toothed Gear Wheel 5, rotatable loosely on a fixed 5" Rod 6. On the Rod 6 is a Bush Wheel 6A, bolted thereto and to the frame. This holds the Rod against rotation. The bobbin 2A is carried in the two 1" Angle Brackets, forming a frame which is bolted to the Bush Wheel 26, the latter 9, on an upper 4" Rod 10, another  $\frac{1}{2}$ " Pinion 11, on the end of which engages and drives the Gear Wheel 5; this rotates the yoke. The Gear 8 is caused to engage the wire 2, and in order to ensure an even wrapping of the thread on the wire, the take-up roller 14, is provided, on to which the wire as it is covered is on the Rod 13. Consequently, the rotary movement of the Rod 10, drives the bobbin yoke and also operates the Worm 19 and engages the Pinion 12. The of a  $1\frac{1}{2}$ " Double Angle Strip and carried from the yoke arm 22.

In order to prevent the wire 2 unwinding too freely from its bobbin 2a, a brake is provided, consisting of a cord 23, passing round a Pulley 24, on the spindle of the bobbin 2a, and connected to a Flat Bracket bolted on the Bush Wheel 26.

It will be noticed that a Collar 25 is placed on one side of the yoke Strip 22, which has the effect of setting one of the bobbins slightly to the rear of the other, and the effect of this is to give two windings round the wire, one over the other. The thread on the bobbins may be of different colours, which would give of a Strip 27, beneath which is bolted a Double Bracket through which the covered wire passes. By moving the Strip 27 from one side to the other, the wire winds evenly on the Roller 14.

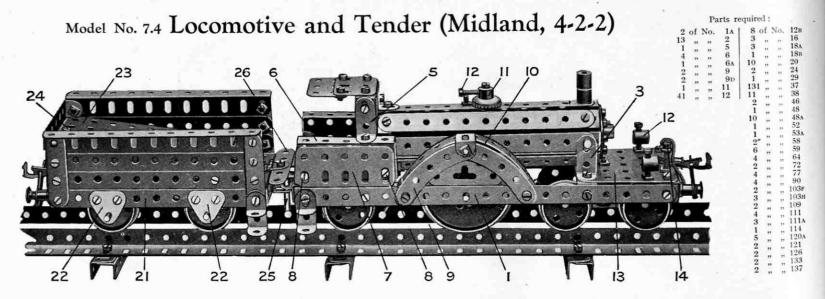

This is a well-proportioned model of an old-style Midland "single-wheeler" locomotive. The engine frame is built up from two 9½" Strips I joined at the points 2 (Fig. 7.4a) by  $2\frac{1}{2}" \times \frac{3}{2}"$  Double Angle Strips, and further strengthened at each end by  $2\frac{1}{2}"$  Angle Girders. The boiler is composed of seven  $5\frac{1}{2}"$  Strips bolted at either end to a Bush Wheel by means of Angle Brackets. It is supported by  $1" \times \frac{1}{2}"$  Angle Brackets 3, and an Angle Bracket secured to the lowest hole of the rear Bush Wheel is bolted at 4 (Fig. 7.4a) to the floor of the cab.

of the rear Bush Wheel is bolted at 4 (Fig. 7.44) to the floor of the cab.

The cab roof consists of 1½" Flat Girders bolted by Angle Brackets to 1"×½" Brackets 5.

2½"×1" Double Angle Strips 6 and Flat Girders 7 bolted together by Angle Brackets at 8 form the sides, which, in turn, are bolted by Angle Brackets to the footplate.

The wheel covers for the main drivers are each constructed from two 2½" Curved Strips 9 and a 5½" Strip 10 bent to the same curvature. A Corner Bracket is secured in the centre as shown.

A safety valve in the centre of the boiler consists of a Contrate Wheel 11, secured by means of a \$\frac{3}^{\pi}\$ Bolt and carrying a further \$\frac{1}{2}^{\pi}\$ Bolt 12. The smookstack is composed of two threaded bosses mounted on the shank of a \$\frac{3}^{\pi}\$ Bolt passing through the top Strip of the boiler. Two lamps are carried on the front of the engine-frame and consist of Threaded Bosses 12 mounted on the upturned shanks of \$\frac{1}{2}^{\pi}\$ Bolts secured in the 2\$\frac{1}{2}^{\pi}\$ × 2\$\frac{1}{2}^{\pi}\$ Flat Plate 13, and gripped in position by 7/32" Bolts inserted in the tops of the bosses. A piece of Spring Cord, secured to a \$\frac{1}{2}^{\pi}\$ Bolt 14, represents the front vacuum brake pipe connection.


It will be noticed from Fig. 7.4A that the front bogic consists of two 24" Strips 15, bolted to a Double Bracket 16. It is attached to the locomotive frame by means of a 2" Bolt, secured by two nuts on its end to the Flat Plate 13. A small Compression Spring (Meccano Part No. 120n) is placed on the Bolt between the Double Bracket and the Base Plate. The rear trailing Wheels 17 are mounted on a 14" Rod passed through two Trunnions 18 bolted to the underside of the footblate. The Wheels are retained in their correct position by means of a Collar 19, spaced between two Washers.

The driving wheels are built up from Face Plates and Wheel Flanges, and are secured to a of Rod 20. They are spaced in the correct position in the centre of the frame by means of three Washers placed between the boss of each Face Plate and the sides I of the engine.


three Washers placed between the boss of each Face Plate and the sides I of the engine.

A 5½" × 2½" Flanged Plate 21 forms the base of the tender and the sides are each built up from two 5½" Strips and one 5½" Angle Girder. The back consists of four 2½"×½" Double Angle Strips. The Wheels are carried on axles journalled in I" Triangular Plates 22 bolted to the Base Plate 21. A 4½"×2½" Flat Plate 23 is secured inside the tender by means of an Angle Bracket bolted to the back at 24, and a 2½"×½" Double Angle Strip at the other end of the plate. The loco and tender are coupled together by means of a 1" Rod 25, passed through two Angle

The loco and tender are coupled together by means of a 1" Rod 25, passed through two Angle Brackets. An extension of the footplate consists of a  $1\frac{1}{2}$ " Flat Girder and a  $2\frac{1}{2}$ " Strip 26, bolted by means of a hinge to the tender.

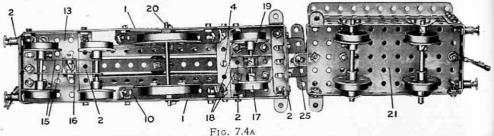

## Model No. 7.5 Rotary Truck Tipper

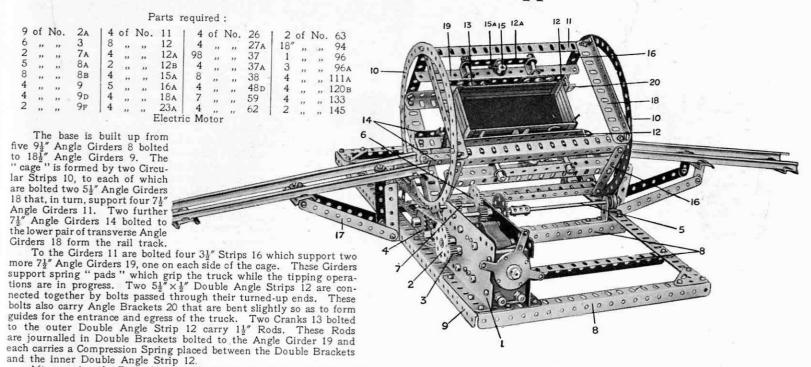

After passing the Rods through the Double Brackets a  $3\frac{1}{2}$ " Strip 12a is placed over their ends. A Bolt 15 passed through the Girder 19 is held loosely in position by a nut and carries an Angle Bracket locked on the bolt by a second nut. A Collar is then secured to the bolt and carries a  $\frac{1}{2}$ " Bolt 15a as shown. This completes the "gripping" device, and it will now be found that the Double Angle Strips 12 are forced by the Springs against the side of the truck. Using the Bolt 15a as a lever to turn the Bolt 15 the corner of the Angle Bracket may be brought into contact with the Strip 12a, thus drawing the "pad" 12 inwards and releasing the truck. The gripping device is duplicated on the other side of the care.

The cage rests on four Pulleys that are mounted on Rods 5 (two 4½" Rods coupled together) and journalled in 1"×1" Angle Brackets bolted to the

The Electric Motor is mounted on the base of the model, and a ½" Pinion 3 on the armature spindle engages a 57-teeth Gear, the spindle of which carries on the other side of the Motor a ½" Pinion engaging a further 57-teeth Gear. The Rod of this latter Gear carries a ½" Pinion meshing with another 57-teeth Gear 6, on the Rod of which is a further ½" Pinion 7 engaging a third 57-teeth Gear carried on a Rod journalled in the Motor framework. On this Rod is a ¾" Sprocket Chain to a ½" Sprocket Wheel 4 on one of the Rods 5. The latter carries also a ¾" Sprocket Wheel 4 connected by Sprocket Chain to a ½" Sprocket Wheel 4 connected by Sprocket Wheel 4 connected by

Parts

required:

This Model can be built with MECCANO Outfit No. 7 (or No. 6 and No. 6A)

1 of No. 64

,, ,,

Model No. 7.6

#### Motor Breakdown Crane

The jib is pivoted on a  $4\frac{1}{2}$ " Rod 12 that passes through holes in the  $12\frac{1}{2}$ " Angle Girders 10.

The movement of the jib is controlled from a hand-wheel 7 secured to a 5" Threaded Rod that passes through a Threaded Boss pivotally secured between right and left-hand Corner Angle Brackets that in turn are bolted to a  $3\frac{1}{2}$ " Angle Girder 20 at the rear end of the jib.

The lower end of the Threaded Rod passes through a Collar pivotally secured between  $1\frac{1}{2}''$  Angle Girders 4, and is held in position in the Collar by means of another Collar and two lock-nuts, the former being placed on the Rod against the upper face of the pivoted Collar while the nuts are placed against the lower face. When the hand-wheel 7 is turned the Threaded Boss is caused to rise or fall, carrying the jib with it, the jib being guided by the Eye Pieces 9 sliding on the Curved Strips 8. Short lengths of Sprocket Chain 21 secured to the rear of the jib carry Threaded Pins which may

be placed in holes in the Curved Strips 8 and used to hold the jib securely in the required position.

The hoisting pulley block 15 is carried on the end of a  $5\frac{1}{2}$ " Rod 14 journalled in a Double Bracket 17 and in a Cranked Bent Strip, the latter being secured to a  $2\frac{1}{2}$ " Strip bolted to the underside of the  $5\frac{1}{2}$ " Angle Girders 13. The jib head Pulley is supported on a  $\frac{3}{4}$ " Bolt passed through two Corner Brackets and held in position by a nut. Collars are placed on the bolt each side the jib head pulley. A  $\frac{1}{2}$ " Pulley 15A is journalled in a similar manner to the 1" Pulley, but a 1" Rod is used in place of the  $\frac{3}{4}$ " Bolt. The whole pulley block is attached to the Rod 14 by a large Fork Piece.

The load is raised or lowered by turning the handles 1, which are constructed as shown and secured to a  $5\frac{1}{2}$  Rod carrying a  $\frac{1}{2}$  Pinion 2 and a Ratchet Wheel 2A. The Pinion 2 engages a  $3\frac{1}{2}$  Gear Wheel 3 secured to a  $3\frac{1}{2}$  Rod 6 that is journalled in Double Brackets secured to the Angle Girders 10. The Rod of the Pinion 2 is journalled likewise. The winding cord is attached to the Rod 6 and passes thence over a  $\frac{1}{2}$  Pulley (carried on a 2" Threaded Rod 14A) and over the 1" jib head Pulley, then round a  $\frac{1}{2}$  Pulley on the Pin 16 and back over the Pulley 15A. It is attached finally to the hoisting block, which is constructed from two Single Bent Strips. A Pawl 5 is pivoted in a Double Bracket bolted to one of the Girders 10 and serves to hold the load suspended.

Model No. 7.7 Boat-Lowering Gear

								Par	ts	requ	uired	:							
10	of	No.	1 A	12	of	No.	12	6	of	No.	23	2	of	No.	48B	3	of	No.	109
2	. ,	,,,	2A	1	,,	,,	12 <sub>A</sub>	4	,,	,,	26	5	,,	,,	52A	1	,,	,,,	115
6	,	, ,,	3	2	,,	**	12 <sub>B</sub>	2	,,	,,	27A	6	,,		53	2	,,	"	126
7		. ,,	5	1	,,	,,	13	2	,,	.,,	31	2	,,	.,	57	2		,,	126A
8	,,	.,-	6	2	,,,	,,	13a	2	,,		32	13	,,	,,	59	4			129
2	,,	. ,,	7 A	1	,,	,,	15	142	,,	,,	37	2		,,	62	4			147в
2	,,	.,	9	3	,,	.,	16	14	,,	,,	38	2	,,	.,	63				
2	,,	,,,	9D	2		,,,	16A	1	,,		40	8	"	,,	90				
3	,,	.,	11	1			18a	5	-		48A	4		100	102				

st ed ed ib

21 ay he

ed

to

ley

ion

ley

ace

ork

ted

2A.

lled


n 2


nce

ley,

hed


rips.

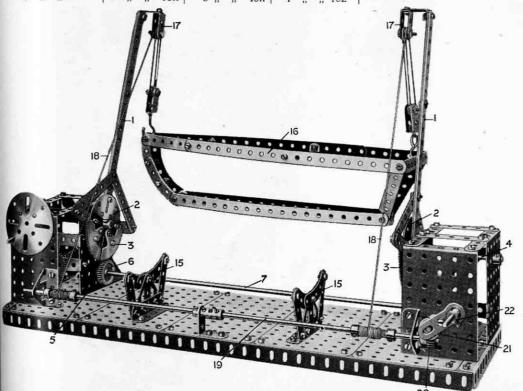

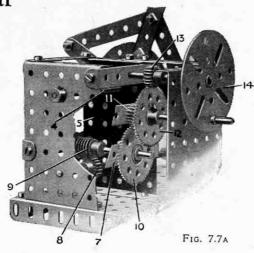

The davit aims 1 are connected to Face Plates 2 to which are bolted two Rack Segments 3 forming the usual geared quadrants. The davit arms are secured to Rods 4 journalled in the Flanged Plates 5, the Rack Segments 3 being engaged and driven by 1" Gear Wheels 6 on an Axle Rod 7. This Rod 7 carries a Pinion 8, Fig. 7.7A, driven by a worm 9 and a Rod, to which is secured a 1½" Gear Wheel 10. This is driven by a ½" Pinion 11 on a Rod to which is also secured a 1½" Gear Wheel 12 driven by a ½" Pinion 13 rotated by a hand wheel formed by a Face Plate 14. As the hand wheel is rotated, the davit arms are raised outward when launching the boat 16 or inward when it is desired to deposit the boat on the chocks 15.

The boat 16 is raised or lowered from the blocks 17 by the ropes 18 which wind on to a Rod 19. On this Rod is secured a ½" Pinion 20 engaged by a Worm 21 which is rotated by the Crank Handle 22 formed of two Cranks bolted together, and in this way the boat may be lowered over the ship's side.

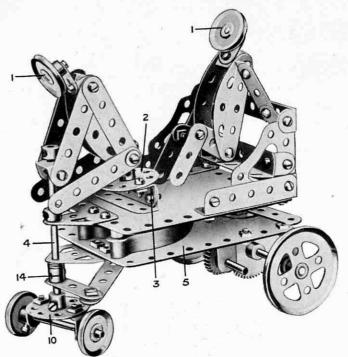

#### Model No. 7.8 Crazy Driver

The Strips forming the body and legs of the "driver" are bolted to a Fork Piece secured to a short Rod which, in turn, is secured to the boss of a Bush Wheel. This Bush Wheel is connected to the Motor by means of two 3\frac{1}{3}" Angle Girders bolted together as shown.

The Motor actuates the rear wheels through a Bevel Wheel 6 secured to the driving spindle of the Motor and engaging the Bevel 7 on the Rod 8 (Fig. 7.8a). This Rod also carries a  $\frac{3}{4}$ " Pinion engaging a 50-teeth Gear


Wheel 9 secured to the axle of the rear wheels.


The steering column 4 carries at its lower end a Bush Wheel 10 to which is secured a  $1\frac{1}{2}'' \times \frac{1}{2}''$  Double Angle Strip that forms a support for the  $2\frac{1}{2}''$  front axle. The steering is controlled as follows: two  $1\frac{1}{2}''$  Strips 11 are bolted together by three bolts, and two Washers are placed on each bolt between the Strips for spacing purposes. The link thus formed fits over the Motor key shaft, and when the Motor is set in motion the link will be rotated slowly with the keyshaft. One end of the link carries a Collar 13 which is secured on the link bolt in place of a nut. A 3'' Strip 12 is pivoted on a bolt that is secured in one of the tapped holes in the Collar 13 and its other end

is attached pivotally to the end of a Crank 14 that is secured to

the steering column. Hence, when the Motor is started, the link 11 rotates slowly and imparts motion to the Strip 12 which, in turn, influences the steering column, resulting in the front wheels being turned first to the right and then to the left alternately, so causing the model to perform some very amusing antics.

								Pa	rts	requ	ired:								
1	of	No.	4	4	of	No.	11	1 1			18в		of	No.	30	3	of	No.	59
8		,,	5	1	,,		12	2	,,		20A	44	,,	,,	37	1	,,	27	62
7	,,	,,	6A	4	,,	2)	12A	4	,,		22	4	,,		37a	4	,,	,,	90 A
1	,,	,,,	9в	1	,,	,,,	15A	3	,,	,,	24	13	,,	,,	38	2	,,	,,	108
4	,,	,,	9D	2	,,		16	1	,,		25	1	,,	,,	48	6	,,	,,	111c
3	,,	,,,	10	1	,,	,,	16A	1	"		27	3	,,		48в	2	,,	**	126A
4								Cloc	kw	ork l	Motor								

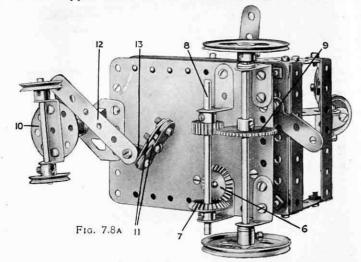

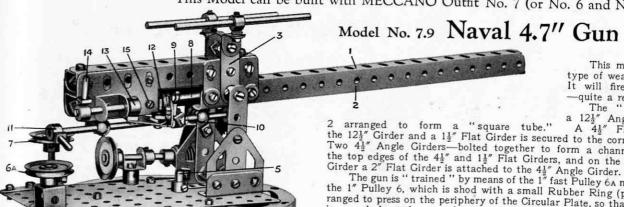

This model represents a small but formidable type of weapon to be found on most ships of war. It will fire "shells"—in the form of Washers -quite a respectable distance.

The "barrel" of the gun is composed of a 121" Angle Girder 1 and a 91" Angle Girder 2 arranged to form a "square tube." A 41" Flat Girder is bolted to one end of the 12½" Girder and a 1½" Flat Girder is secured to the corresponding end of the 9½" Angle Girder. Two 41 Angle Girders-bolted together to form a channel-section girder-are next secured to the top edges of the 41 and 11 Flat Girders, and on the same side of the barrel as the 11 Flat

The gun is "trained" by means of the 1" fast Pulley 6a mounted at the top end of a Rod carrying the 1" Pulley 6, which is shod with a small Rubber Ring (part No. 155). The Rubber Ring is arranged to press on the periphery of the Circular Plate, so that by turning the Pulley 6 the entire gun is moved about the central pivot 5. Two 3½" Rods—representing the telescopic sights—are mounted in Collars that are secured to Angle Brackets bolted to the top ends of the Cranks 3. The barrel of the gun is elevated or depressed by means of the simple mechanism that is controlled from the Pulley 4.

The firing mechanism is arranged as follows. An 11½" Rod 8 is placed inside the barrel and attached to the rear end by means of a Coupling. This Coupling is secured to the 2" and  $4\frac{1}{2}$ " Flat


Girders by bolts that are passed through the holes of the Flat Girders and inserted in the tapped holes of the Coupling, and the latter is spaced from the Flat Girders by two Washers on each retaining bolt. The loading mechanism consists of a Bolt 10 locked by a nut in the tapped hole of a Collar, which is secured to a Rod that is free to turn and slide in its bearings (formed by two Handrail Supports). The Rod is fitted with a handle 11.

The trigger mechanism is assembled as follows. A Hinge secured by the Bolt 15 to the front hole of the 2" Flat Girder has a Flat Bracket secured to it by the slotted hole, two Washers being placed on the retaining bolt between the Flat Bracket and the Hinge. A  $\frac{1}{2}'' \times \frac{1}{2}''$ Angle Bracket 12 is secured in the round hole of the Flat Bracket, and is connected pivotally by means of a second Flat Bracket to the Collar 13. This Collar is secured to a short Rod carrying the handle 14, by means of which the Rod may be moved to and fro in the Double Bracket forming its bearings.


To load the gun, the Washer forming the projectile is placed on the front end of the 111 Rod 8 and the barrel of the gun tilted up to allow it to slide down the Rod to the Compression Springs 9. Next the handle 11 is pushed away from the operator, turned so that the head of the Bolt 10 engages with the Washer, and then pulled back-or toward the operator-so that the Washer compresses the Spring 9. Previous to this, however, the handle 14 controlling the trigger should be pulled toward the operator. The handle may now be pushed outward so that the Flat Bracket engages with the Washer. The gun is now ready for firing.

#### Parts required:

2	of	No.	5 6A	2	of	No.	11	1	of	No.	18A	16	of	No.	. 38	1	of	No.	103g	1	of	No.	120в
1	"	"	OA	3	"	"	12	0	"	**	IOB	1			45	1			103н	2			1264
1	"	"	8	1	"	**	13	4	,,	"	22	1	-	1000	524	1		,,	111A	1	"	,,	1204
1	,,,	,,,	8A	1	,,		15A			,,	24	10	"	"	50	1	"	"	IIIA	1	"	"	129
2			9A	12			16		"	"	32		"	,,	59	1	23	**	111c	6	,,	"	136
2		"	9F	1	"		14.	F2	"	"	32	4	"	27		1	,,	,,	114	1		1902	146
2	,,			1 1	33	,,	16A	53	"	,,	37	1	,,	22	00	1 4			115 1				155
2	"	"	10	1	,,	,,	17	2	"		37A	1	,,	,,	103c	1	"	"	118	•	,,	"	100

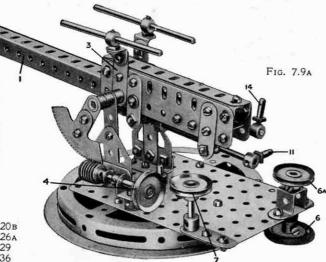

## Model No. 7.10 Clockwork Pacific Tank Locomotive

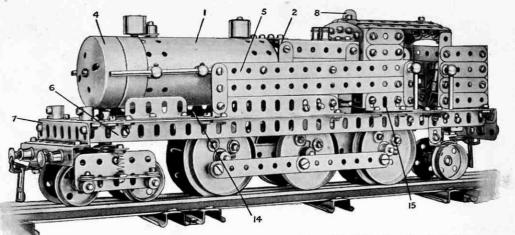

The frame of the locomotive is shown in Fig. 7.10a and it will be seen that each side member comprises a  $12\frac{1}{2}$ " Angle Girder extended by a  $3\frac{1}{2}$ " Girder, while  $3\frac{1}{2}$ " Girders are bolted to the ends, additional Girders 7 being attached at the front of the frame to form the front buffer beam. The buffer beam at the rear of the engine comprises a  $3\frac{1}{2}$ " Flat Girder.

A  $7\frac{1}{2}''$  Angle Girder 14 is bolted to the right-hand side of the main frame and to each of its ends a  $1\frac{1}{2}''$  Strip is secured in a vertical position. Two  $7\frac{1}{2}''$  Strips bolted to these complete the right-hand side tank. The left-hand tank 5 is constructed similarly, with the exception that  $4\frac{1}{2}''$  and 2'' Girders are used in place of the  $7\frac{1}{2}''$  Girder, so that an aperture is formed to receive the winding key of the Clockwork Motor.

To complete the cab, Angle Girders 16 (Fig. 7.10a) are bolted to the Girders 14 and 15, and  $2\frac{1}{2}$  Strips are secured two holes further back, while  $1\frac{1}{2}$  Strips hold the Strips and Girders the correct distance apart. The roof is composed of four  $3\frac{1}{2}$  Double Angle Strips and one  $3\frac{1}{2}$  Strip bolted to two  $2\frac{1}{2}$  large radius curved Strips, one of which is bolted between the tops of the

girders 16 whilst the other is bolted across two 3'' Girders 17. The  $3\frac{1}{2}''$  Strip in the centre of the roof is supported by Angle Brackets; this Strip is so arranged to obtain a slot through which may protrude the reversing lever 8 of the Clockwork Motor. Four 2'' Strips form each side of the coal bunker and two Girder Brackets bolted to their ends form the rear, the space between these Girders being filled in by a 2'' Strip.


The firebox top consists of two 3" Angle Girders 2 spaced apart by 2" Strips. Two 3" Strips are secured to the latter between the Girders and on these is mounted the Ross pop safety valve, which consists of two outer "sleeves" removed from Meccano Spring Buffers, and held in place by means of Pivot Bolts. Each side of the firebox consists of two horizontal 3" Strips secured at their ends to vertical 1½" Strips which, in turn, are bolted to the Girders 2. The completed firebox is held in position by means of an Angle Bracket bolted to the cab, and Flat Brackets secured to the Boiler 1.

The Boiler is secured in position by bolts passed through the side tanks, and rests on two 2" Angle Girders bolted to 3" Flat Girders that, in turn, are secured to the side frames of the locomotive. Two

5	,,,	,,	3	4	,,	,,	17	3	11	,,	111	
5 7 5	,,	,,	4	4 5	,,	,,	18A	1	,,	**	111A	
5	,,	,,	5	6	,,	,,	20	1	,,	**	111c	
11	**	**	6	6	,,	,,	24	1	,,	**	115	
9	,,	"	6A	1	,,	,,	25	6	,,	,,	120 A	
9	,,	,,	8	156	,,	,,	37	2	**	,,	120B	
1		,,	8в	8	,,	,,	37A	2	,,	,,	121	
1 3 6 2 2 2 3	,,	,,	9	25	,,	,,	38	8	"	,,	136	
6	,,	,,	9в	5	,,	,,	48в	6		,,	137	
2	,,	,,	9c	2	,,	,,	50 A	8	,,	,,	147B	
2	,,	,,	9 D	25	,,	,,	59	2	,,	,,	161	
2	,,		9E	5	.,	**	62B	1			162	
3	,,		10	2	,,	,,	64	2		**	164	
8		,,	12	3	,,	,,	90	1	,,	.,	166	
		,,	12A	1	,,	,,	103p				ork	
1 2	,,	,,	12в	2	,,		103E			loto		
4	,,	,,	16	2	"		103F		.,	1010		

Parts required:

4 of No. 1B | 2 of No. 16A | 4 of No. 109

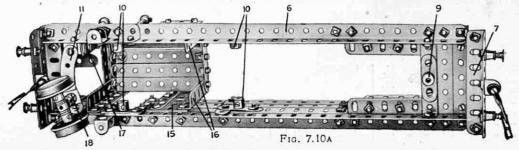


## Model No. 7.10 Clockwork Pacific Tank



Chimney Adaptors are mounted on the Boiler, one being inverted to form the steam dome while the other, which represents the chimney, is secured to the Boiler by a Flat Bracket and  $\frac{1}{2}$ " Bolt carrying a Collar. The smoke-box 4 is formed from two Boiler Ends held together by a  $\frac{3}{4}$ " Bolt passed through their centres.

Fig. 7.10B shows the power unit. This consists of a Clockwork Motor, the drive being taken from the pinion on the driving shaft by a \( \frac{3}{4}\)" Pinion 12 on the Axle of the rear pair of driving wheels. A \( 7\frac{1}{2}\)" Strip is bolted to each side plate of the Motor to form a journal for the axle of the front driving wheels, and two \( 5\frac{1}{2}\)" Angle Girders are also secured in position to give extra strength. The centre pair of wheels are not provided with flanges, Bush Wheels being substituted for the Face Plates, thus allowing the loco to negotiate sharper curves than would otherwise be possible. The Motor is held in position by Axle Rods passed through the Double Arm Cranks 10 (Fig. 7.10A) so that the reversing lever 8 (Fig. 7.10) passes through the cab top. A \( 1\frac{1}{2}\)" Strip is bolted to the brake lever and an End Bearing connected pivotally to its extremity carries an Axle Rod which, after passing through a \( 1'' \times 1'' \) Angle Bracket secured to the coal bunker, is fitted with a Collar to form a control knob.

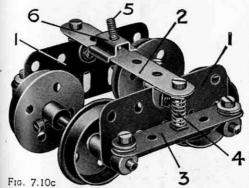

ich

of

ion

gle


wo

The rear pony truck consists of two 11" Flanged Wheels mounted on a 13" Rod that is passed through a Collar. A Threaded Pin gripped in the tapped hole of this Collar is secured in the boss of an Eye Piece 18 (Fig. 7.10a) and is spaced from same by a Collar. The Eye Piece slides on the 21" Curved Strip 11. The front bogie forms the subject of Standard Mechanism No. 219, which is reproduced at Fig. 7.10c. This illustration shows an old style Eye Piece at 6, but a new part should be used. The improved pattern is shown in Fig. 7.10.

Model No. 7.11

Level Luffing Automatic Grabbing Crane

The special Geared Roller Bearing Unit (part No. 167) incorporated in this model is not included in the No. 7 Outfit, but it may be substituted, if desired, by the Meccano built-up roller bearing (see Standard Mechanism No. 131).

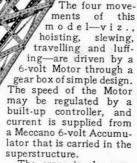

The crane is also provided with level luffing gear, by means of which

the load maintains a constant height when the jib is luffed. The latter operation is carried out by means of a system of cranks and

links. The model also is fitted with a grab that may be opened and closed automatically, although it is suspended by a single fall of cord.


Full instructions for building the model are incorporated in Instruction Leaflet No. 35 included in the No. 7 Outfit. It may also be obtained from any Meccano dealer, price 3d., or direct from Meccano Ltd., Old Swan, Liverpool, price 3d., post free.

# Model No. 7.12 Funicular Railway sets of 24½" Angle Girders and 9½" Girders butted e loading platform consists of three 5½"×3½" Flat upported by the 12½" Girders 6 and uprights 7. The

The inclined rails are made from four sets of  $24\frac{\pi}{2}$ " Angle Girders and  $9\frac{\pi}{2}$ " Girders butted together and connected by 3" Strips. The loading platform consists of three  $5\frac{\pi}{2}$ "  $\times 3\frac{\pi}{2}$ " Flat Plates and one  $5\frac{\pi}{2}$ "  $\times 2\frac{\pi}{2}$ " Flat Plate, and is supported by the  $12\frac{\pi}{2}$ " Girders 6 and uprights 7. The side girders 2 in the base of the model are each formed from one  $24\frac{\pi}{2}$ ", one  $12\frac{\pi}{2}$ " and one 3" Girders overlapped two holes each.

The cars 8 are connected to the Chains 9 which pass over Sprocket Wheels 10, 2" diameter at the top and 1" at the bottom. They move in opposite directions so that the weight of the

descending car assists the other car to ascend. This is effected by driving a 3" Sprocket Wheel 11, Fig. 7.12A, from the Motor, the 8" Rod 12 of the Sprocket Wheel 11 carrying a 1" Sprocket 13 which is coupled by the Chain 14 to a similar Sprocket 15 on the 3" Rod 16. The Rod 12 is coupled to another 8" Rod 17 by a pair of 3" Pinions 18 in order to obtain a reversed rotation, and a 1" Sprocket Wheel 19 on the Rod 17 is coupled by a Chain 20 to another 1" Sprocket Wheel 21 on a 3" Rod 22 which drives the Chain of the In this other car. way, opposite movement of the two cars is always

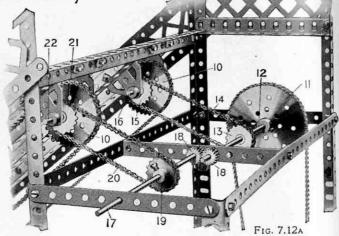

#### taking place. The cars, having reached their destinations, are re-8 turned by reversing the Motor. Parts required:

## Model No. 7.13 Automatic Fire Escape

The fire escape proper is constructed from four  $12\frac{1}{2}$ " Angle Girders 13, which are connected in pairs by  $2\frac{1}{2}$ " Strips placed as shown, with Meccano Cord threaded through the holes in the Girders to form the rungs. The escape pivots at its lower end on a  $4\frac{1}{2}$ " Rod 22, and the upper pair of Girders 13 slide in four Double Brackets 16 bolted to the lower pair.

A Meccano Clockwork Motor 1 (Fig. 7.13a) is attached to the underside of the chassis and its driving spindle carries a Worm 2 engaging with a  $\frac{1}{2}$ " Pinion on a Rod that is journalled in a  $2\frac{1}{2}$ "  $2\frac{1}{2}$ " Double Angle Strip. This Rod carries a Bevel Wheel 3 engaging a further Bevel 4 carried on the Axle Rod of the front wheels. The Motor may be reversed by means of the lever 7 and may be started or stopped by pulling or pushing on the handle 5. The Strip 12 is bolted to the Motor casing, and to prevent nuts obstructing the action of the lever 7, it is necessary to space the Strip from the Motor by means of a Collar that is placed on the securing bolt at each end of the Strip. The Double Angle Strip carrying the Rod of Bevel 3 is bolted at one end to the Motor casing (from which it also is spaced by a Collar) and at the other end to a  $3\frac{1}{2}$ " Strip. One end of the latter is bolted to the  $4\frac{1}{2}$ " Strip 12, while the other end is attached to the Motor and spaced by a Collar in the manner already described.

In action, the escape is run up to the wall of the "burning building" until the ½" Pulley 17 touches the wall, when it is forced back, releasing by its movement the catch 18 from the Double Angle Strip that is bolted across the Flat Plate of the chassis. The bottom portion of the ladder is then raised by the Springs connected to the ladder by the cord 23 and the 2" Threaded Rod 21. Simultaneously the ladder is extended by means of the cord 15 fixed at the points A (on the moving part of the ladder) and B (on the body of the fire engine). This cord passes over the ½" Pulley 14, which is carried in a Single Bent Strip attached to the bottom portion of the ladder by an Angle Bracket. The ½" Pulley 6 is a "stop" to hold the engine from the wall while the ladder is rising.


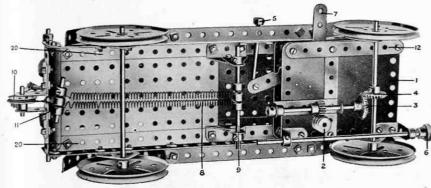


FIG. 7.13A

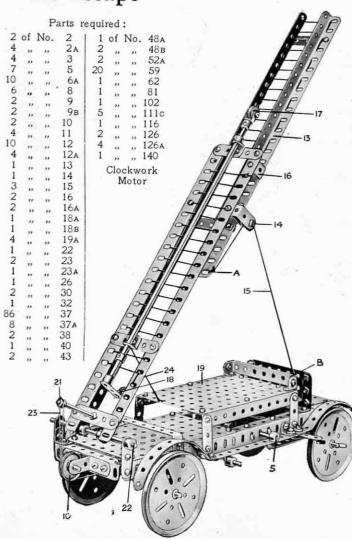

#### Model No. 7.14 Warehouse

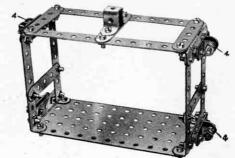


FIG. 7.14A

Commence this model by building the framework.  $24\frac{1}{2}$ " Angle Girders are used to form the corner uprights 1 with  $5\frac{1}{2}$ " Angle Girders overlapped eight holes at the top. Two  $24\frac{1}{2}$ " Angle Girders 2 are also used to carry the front portion of the warehouse floors, the latter being bolted to two  $5\frac{1}{2}$ " Angle Girders 3 overlapped eight holes and connected across to the two inner Angle Girders 2. Two similar  $5\frac{1}{2}$ " Angle Girders are bolted to the back of the framework, to carry the other end of each of the floors. The floor is formed of four  $5\frac{1}{2}$ "  $2\frac{1}{2}$ " Flat Plates butted together and bolted in the centre to a  $2\frac{1}{2}$ " Flat Girder on the underside—the two outer ends being bolted to the Angle Girders 3. The horizontal sidestrips are formed of  $12\frac{1}{2}$ " Strips to which are bolted the braced Girder Strips.

Fig. 7.14A shows the construction of the cage. This is guided by bolt heads 4, at each side riding along the inwardly turned flanges of the Angle Girders 2. The bolts are attached to Angle Brackets, which are secured to a 1½" Strip, this latter being secured to the side-strips of the cage, spaced with three Washers to take up the play between the cage and the upright Girders 2.

Fig. 7.14B shows the position of the Motor, and this may be started and stopped from the control Crank Handles 5, one on each floor of the warehouse. These Crank Handles are fixed on a vertical Rod 6 composed of two 11½" Rods connected by a Coupling. A Crank

7 is secured to the upper end of this Rod and is connected by a 5½" Angle Girder and Strip 8 to the operating lever of the Motor.

1" Brackets secured to the sides of the warehouse by Strips form the bearings for the upper and lower ends of the vertical Rod.

When the Motor is wired up to the Accumulator, the elevator is ready to be operated.

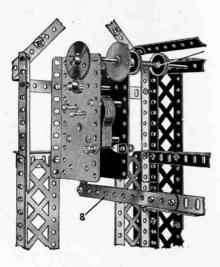


Fig. 7.14B

#### Parts required:

18	of	No.	1	2	of	No.	13	1	of	No.	59
21	,,	23	2	- 1	,,	,,	14	4	,,	,,	62
9	,,	., .	5	1	,,	,,	16	1	,,	**	63
1	,,,	,,,	6	3	,,	,,,	22	3	,,	,,	70
4	,,,	**	6A	2	,,	,,	35	18	,,	***	99
6	,,,	,,	7	240	"	**	37	4	,,	,,	100
6	,,	,,	8	30	,,		38	2	,,	,,	103
23	,,	**	9	1	,,	"	45	4	,,	3.7	108
16	,,	11:	12	1	,,	"	46	4	,,,	,,	115
2	.,,,	,,,	12a	8	"	"	52A	- 3			

Electric Motor


#### Parts required:


1	of	No.	2	2	of	No.	11	52	of	No.	37	4	of	No.	103	
24	,,	"	3	9	,,	"	12	4	٠,,	,,	37A	6	,,		111c	
2	,,	**	4	1	,,	,,,	12 <sub>A</sub>	20	,,	n	38	1	"	,,	114	
1	22	**	5	1	,,	,,	14	2	,,	,,,	43	2	,,		115	
1	,,	"	6	4	,,	,,	17	9	,,	n	59	1	,,	,,	116A	
1	**	"	6A	2	,,	.,,	18в	1	,,	,,	63	2	**	,,	118	
4	22	**	8в	5	"	,,	24	1	,,	,,	64	1			160	
2	11	21	9	1	"	,,	26	4	,,	,,	72					
4	27	"	9F	1	,,	,,,	27A	1	,,	,,	81					

This gun has a quick-firing action and will fire twelve Meccano Steel Balls at one loading. Fig. 7.15A shows the barrel and firing mechanism, with one side removed.

Each side of the magazine chamber is built up from two  $2\frac{1}{2}'' \times 2\frac{1}{2}''$  Flat Plates with corners overlapping. The two upper Plates have two  $1\frac{1}{2}''$  Angle Girders 10 and one Channel Bearing 1 bolted to them and the bottom Plates are joined together by a Double Bracket. The barrel consists of two  $7\frac{1}{2}''$  Angle Girders secured together to form a

channel by two bolts in the two end inner holes only. The end bolt secures a Double Bracket inside the barrel and the recoil chamber 11 is held rigidly by the other.

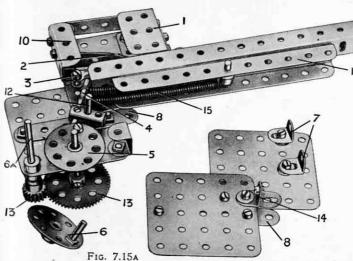

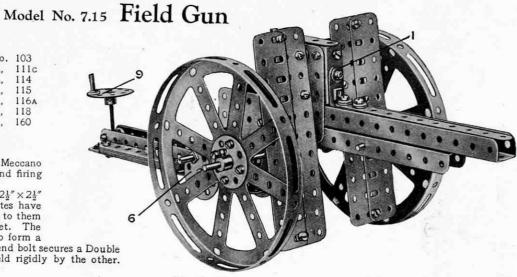


The Double Bracket inside the barrel carries a 2'' Rod on which is secured a Small Fork Piece 3 carrying a  $\frac{3}{3}''$  Bolt. A second 2'' Rod 4, working freely in the jaws of the Small Fork Piece, is secured to a Coupling that is pivoted on the Rod 12. The action of the model is as follows. On turning the Bush Wheel 6, which is secured to the Rod 6A, the Bush Wheel 5 is rotated through the gears 13. The latter Bush Wheel carries in one of its holes a  $\frac{3}{3}''$  Bolt that catches the Rod 4 and pulls back the Small Fork Piece 3, with the plunger attached, against the action of the Springs 15. The plunger is now

clear of the space formed by the 2" Strip 2 and the end of the Channel Bearing 1 and this movement allows a single Steel Ball to fall from the magazine chamber to a position directly in front of the plunger. On continuing the movement of the hand wheel 6 the bolt in the Bush Wheel 5 disengages itself from the Rod 4, thereby allowing the plunger to strike the "shell" and so shoot it from the gun.

The 8" Rod that carries the road wheels is journalled in the end holes of the 3" Strips 8, and axle covers are provided by bolting a  $1\frac{1}{2}$ " Angle Girder on each side of the gun to the  $\frac{1}{2}$ "  $\times \frac{1}{2}$ " Angle Brackets 14. The Angle Brackets 7 form supports for the shields, which are built up from  $5\frac{1}{2}$ " Flat Girders,


The trailing girder is built up from two  $7\frac{1}{2}$ " Angle Girders joined together at the far end by means of a  $1\frac{1}{2}$ " Strip and secured at the near end to the lower holes of the magazine chamber. A 2" Threaded Rod surmounted by the Bush Wheel 9 and working in a Threaded Boss, which is secured to the  $7\frac{1}{2}$ " Angle Girders by Bolts and spaced by Washers, forms the elevating apparatus. When the gun is assembled a  $5\frac{1}{2}$ " Strip should be placed along the top of the barrel and secured to the magazine chamber by a  $1^* \times 1^*$  Angle Bracket.

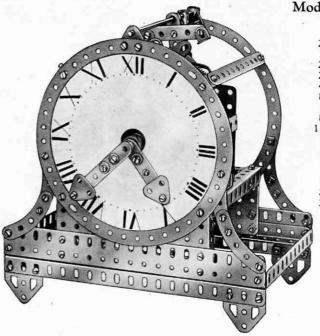

#### Model No. 7.16 Mantel Clock

					-							
2	of	No.	2	. 3	of	No.	25	3	of	No.	62	
1	,,	,,	3	2	,,	,,	26	2	,,	,,	63	
2	,,	,,	4		,,	,,	27	2	,,,	,,	70	
2 4	,,	,,	5	3	,,	,,	27A	4	,,	,,	77	
	,,	,,	8A	1	,,	,,	30A	8	,,	,,	90	
8	,,,	,,	9	1	,,	,,	30c	2	,,	,,	103A	
1	,,	,,	9F	4	,,	,,	31	1	,,	,,	109	
8	,,	"	10	1	,,	,,	32	2	,,	,,	111c	
11	,,	,,	12	1	,,	,,	35	6	,,	,,	126A	
1	,,	,,	13A	95	,,	,,	37	1	,,	,,	136	
1	**	"	14	2	,,	**	37A	2	,,	**	145	
1	,,	"	15	13	,,	22	38	1	,,	,,,	171	
1	,,	"	16	2	,,,	,,	48				vork	
1	,,	"	16в	1	,,,	,,	52		I	Moto	r	
3	,,	**	17	1	,,	"	52A					

Parts required:

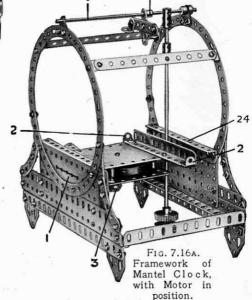

together by two  $1\frac{1}{2}'' \times \frac{1}{2}''$  Double Angle Strips and secured to the  $5\frac{1}{2}''$  Angle Girders 6 by the Angle Brackets 7 and Girder 8.

Fig. 7.16B. Mechanism of Mantel Clock.

A ¾ Pinion on the Motor driving shaft engages with the 50-teeth Gear 9 secured to a 6" Rod 10. This Rod is journalled at its lower end in the centre hole of the Flat Trunnion 3 and carries a Worm 11 (Fig. 7.16c) and a 1½ Bevel Gear 12.½ The latter meshes with a ½ Bevel Gear secured to a short rod that is journalled in the Handrail Support 13 and in the mechanism side plate, and the 57-teeth Gear on this Rod meshes with a ½ Pinion on the escapement shaft. The escapement consists of a Face Plate with Flat Brackets set round its circumference as shown in the illustration.

The Worm 11 engages with the 57-teeth Gear 14. This is free on the Rod 21, and has bolted


This clock will keep good time for four hours at a single winding of the Clockwork Motor. The framework of the model will be seen fairly clearly in Fig. 7.16a. The Clockwork Motor is secured rigidly to the  $5\frac{1}{2}'' \times 2\frac{1}{2}''$  Flanged Plate 1 by means of a  $5\frac{1}{2}''$  Angle Girder. A second  $5\frac{1}{2}''$  Angle Girder, shown fitted with Angle Brackets 2 and bolted to the rear edge of the Motor, will be secured later to the mechanism framework. The Motor is also fitted with a Flat Trunnion 3, which is secured so as to allow the three centre holes to be in alignment with the Motor driving shaft.

The pendulum is weighted with two 1" Gears and is attached to the Rod 4 by a Coupling. Rod 4 also carries the pallet, which consists of a Crank 5 that carries a  $2\frac{1}{2}$ " Strip fitted with Angle Brackets.


The mechanism housing (Fig. 7.16B) is composed of one  $5\frac{1}{2}'' \times 2\frac{1}{2}''$  and one  $5\frac{1}{2}'' \times 3\frac{1}{2}''$  Flat Plate connected

#### Model No. 7.16 Mantel Clock (continued)

to it an Angle Bracket, the flat edge of which engages with the arms of the Spring Clip 15. In this way is obtained a neat friction clutch that enables the hands of the clock to be set without the gears moving. A 1" Gear also secured to the clutch Rod 21 engages with a second 1" Gear on the Rod 16. This Rod carries a \frac{3}{4}" Finion that engages with the 50-teeth Gear 17 on the Rod 18. A further reduction Gear consisting of a \frac{3}{4}" Pinion and a 50-teeth Gear connects this Rod to the shaft 19, which carries a \frac{1}{2}" Pinion 20 outside

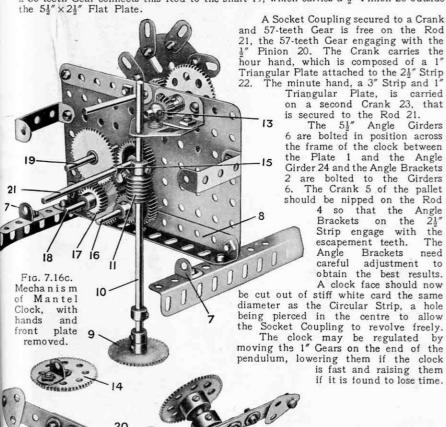

#### Model No. 7.17 Clockwork Motor Tractor

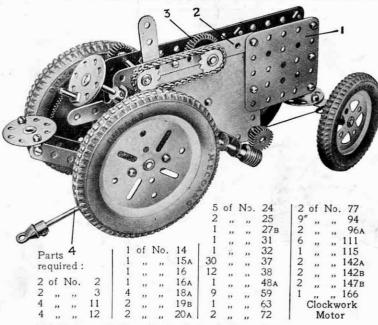



This tiny tractor is driven by the Clockwork Motor and is capable of exerting tremendous power. It has been tested to pull 10 stone a distance of 8 to 10 feet.

The front axle (a  $2\frac{1}{2}'' \times \frac{1}{2}''$  Double Angle Strip) is pivoted on a  $2\frac{1}{2}''$  Rod that is carriel in Double Brackets attached to the Motor by means of the  $2\frac{1}{2}'' \times 2\frac{1}{2}''$  Flat Plates 1 and the  $5\frac{1}{2}''$  Strips 2. The steering is similar to Standard Mechanism No. 168 except that cord is used instead of Sprocket Chain. The driver's seat is a Bush Wheel secured by Angle Brackets to two  $3\frac{1}{2}''$  Strips that in turn are attached to the Motor side plates by 1" Triangular Plates.


The drive for the rear wheels is taken from a 1" Gear 3 meshing with the main driving gear of the Motor and carried on a 1½" Rod journalled in the Motor side plates. This Rod carries a 4" Sprocket Wheel connected by Sprocket Chain to a second 4" Sprocket that is nipped on a short Rod carrying a 4" Pinion. The latter engages with a 3½" Gear that is secured by double set-screws to the rear axle. It should be noted that to secure a more positive grip on the rear axle the 3" Pulleys, in addition to being secured by set-screws, are each connected by two 4" Bolts to a Bush Wheel that also is secured to the Rod by two set-screws.

The draw-bar is composed of a 4½" Rod 4 carrying an End Bearing and pivoted on a short Rod in the bottom row of holes in the side plates.

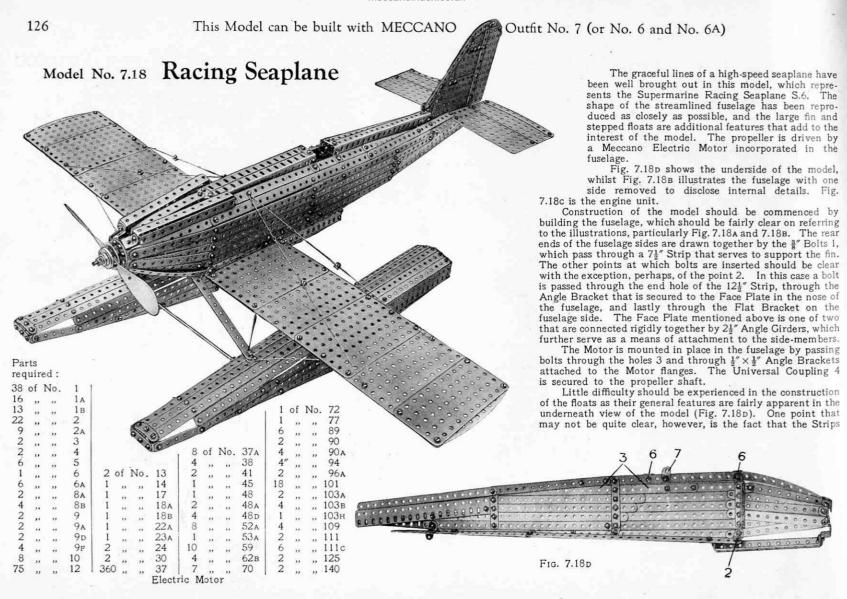

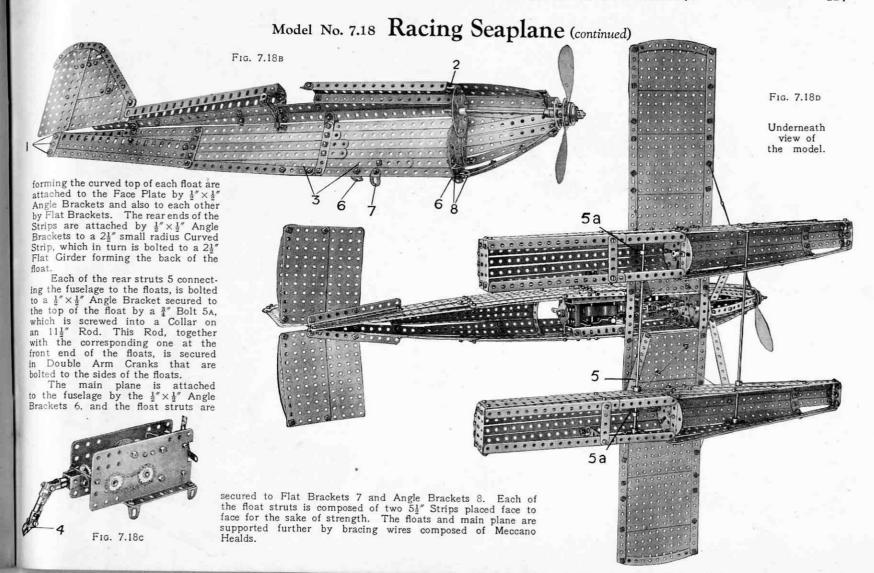

## Model No. 7.19 4-2-2 Locomotive and Tender

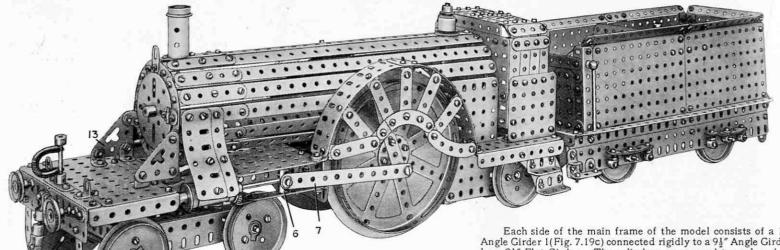

Parts required:


13 of No.

Fig. 7.19A

6	of	No.	6A	1 0	of :	No.	23 A	4	of l	No.	90
4	,,	,,	8	2	,,	.,,	24	10	.,	,,	90 A
2	-		8A	2	**	**	26	7	**	**	103
	30	,,	9	2	,,		27A	2	.,		103в
B 7	**	,,	9A	1		,,	27в	4			103c
4	.,,	,,	9в	443		30	37	1			103p
2	**	,,	90	40	,,	,,	38	6		. 0	103E
2		.,	9p	4	**	,,	43	7	24		103F
4	,,	.,	9F	2	**		48в	11	**	,,	109
9	**	**	10	1	**		50 A	3		,,	111
2	**		11	7	,,		52A	12	.,	**	111A
4	,,		12	6	**		53A	10		"	111c
4	,,	,,	15A	2	,,		55A	1			114
2		.,	16	25		**	59	5	**	.,	115
1			16A	2			62	4			116A
1		**	16в	1	**	**	62B	2	**	"	118
3		100	17	4	**		63	3	**	**	125
3			18a	1	,,	.,	70	2			126
1	**		20		,,	**	72	2			126A
5		ä	20в	2	,,		81	2	**	.,	133
5	"	"	22	i	"	**	89	2	,,	,,	136
5.7	755	1.5	-	. 5	7.7	2.5		-	.,,	111	12 (200)

Each side of the main frame of the model consists of a 124" Angle Girder 1(Fig. 7.19c) connected rigidly to a 9½" Angle Girder 2 by a 2½" Flat Girder. The cylinders are secured to each end of a 51" Curved Strip, upon which slides an Eye Piece 3.

The bottom crosshead guide comprises a 3" Strip and a Flat Bracket 4, and is attached by a 3" Bolt to the boss of the 3" Flanged Wheel forming one of the cylinder covers, and also to a transverse 5½" Angle Girder. Five Washers are used to space the guide the correct distances from the Flanged Wheel, and two

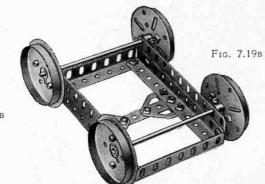

10 of No. 137 2 ,, ,, 146 2 " " 164

Electric Motor

Model No. 7.19 4-2-2 Locomotive and Tender (continued)

Washers space the  $5\frac{1}{2}$ " Angle Girder from each of the Angle Brackets by which it is attached to the main frame. The top crosshead guide is formed by the end of a  $5\frac{1}{2}$ "  $\times 3\frac{1}{2}$ " Flat Plate 5, which is bolted across the top of the main frame and is packed up therefrom by five  $3\frac{1}{2}$ " Strips on each side. A Coupling 6, which is secured to the end of the piston rod and slides freely between the crosshead guides, represents the crosshead, to one end of which the connecting rod 7 (Fig. 7.19) is attached.

The Motor is held in place in the main frame by bolts, which pass through holes 8 in  $4\frac{1}{2}'' \times 2\frac{1}{2}''$  Flat Plates 9 and through the ends of  $3\frac{1}{2}'' \times \frac{1}{2}''$  Double Angle Strips on the Motor. When the Motor is secured

in place, the  $\frac{1}{2}$ " Pinion 10 (Fig. 7.19a) should mesh with the  $3\frac{1}{2}$ " Gear Wheel on the driving wheel axle. The steps 11 are secured in place by  $\frac{3}{8}$ " Bolts and are spaced away from the Girder to which they are attached, by Collars on the shanks of the Bolts.

The construction of the bogic should be quite plain from Fig. 7.19E. It is mounted pivotally on the bogic pin (a 1" Rod), which is secured in the boss of the Eye Piece 3, and the lateral movement of the latter upon the Curved Strip is controlled by means of Springs. The trailing wheels are secured to an axle that is journalled freely in the slotted holes of 2" Slotted Strips 12.

The smokebox end of the boiler is attached to Corner Brackets 13 and the firebox end is secured to the  $4\frac{1}{2}$ "  $\times 2\frac{1}{2}$ " Flat Plates 9. Before mounting the boiler in position, the chimney and the safety valve should be attached. In the case of the former, a Chimney Adaptor is secured to the top of the smokebox by a 2" Screwed Rod. The Sleeve Piece forming the chimney is then pushed on to the Chimney Adaptor, and a  $\frac{3}{4}$ " Flanged Wheel is fixed on the end of the Screwed Rod to form the chimney cap. The tender is shown dismantled in Fig. 7.19p; one side has been removed and reversed (Fig.7.19e) to show its


Fig. 7.19c


interior construction. The two portions may be constructed as indicated and then placed together so that the lettered holes coincide (a with a', b with b', and so on). The front plate of the tender has a sliding door, which consists of a 2½" Flat Girder 14 sliding between two


pairs of 2½" Flat Girders, each pair being spaced apart by a 2½" Strip. The locomotive and tender are

connected together by passing a short Rod through the Double Brackets 15, 15A. This Rod is held in place by Collars. The 6-volt Accumulator may be accommodated in the tender, thus making the model entirely self-contained; the bottom of the Accumulator rests on the Angle Girders 16.




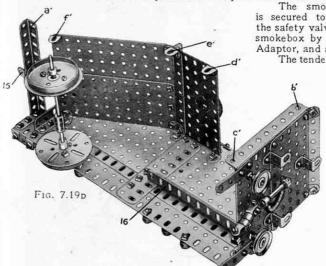

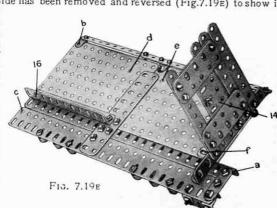

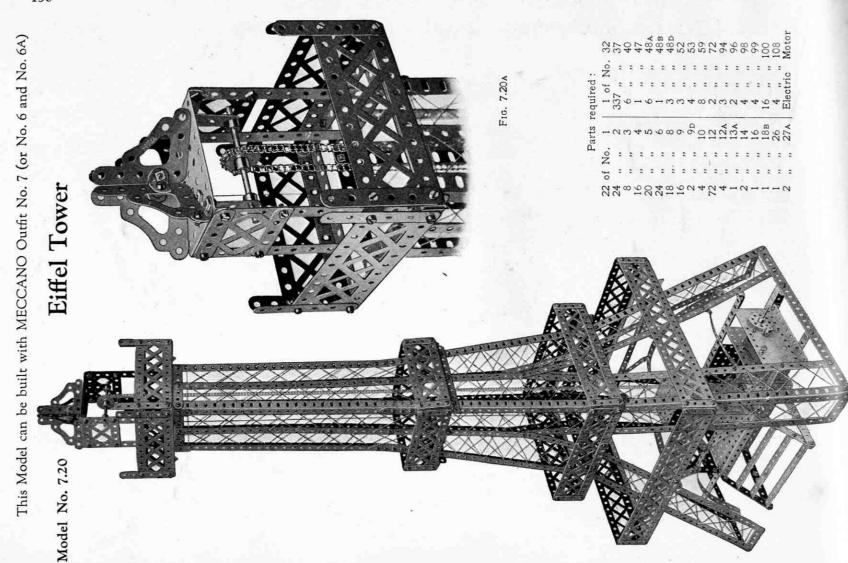

#### Model No. 7.20 Eiffel Tower (continued)

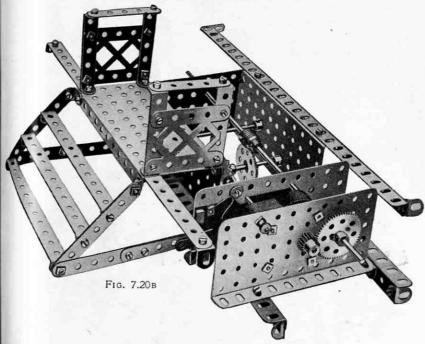


The construction of the tower may be followed from the illustrations. The lift carriage is built up from two  $3\frac{1}{2}'' \times 2\frac{1}{2}''$  Flanged Plates and two  $2\frac{1}{2}'' \times 2\frac{1}{2}''$  Flat Plates and runs on a length of cord which acts as a guide line. This cord is secured to the top of the tower and to a transverse Rod in the base, and passes through holes in the Plates of the lift. The operation of the lift is effected by means of a length of Sprocket Chain passing mund the 1" Sprocket Wheel situated in the top of the tower, Fig. 7.20A, and round a similar wheel in the base, Fig. 7.20B. The ends of the chain are secured to the lift. The lower Sprocket Wheel is operated through worm gearing from the Electric Motor, Fig. 7.20B.


## Model No. 7.21 Revolving Crane

An interesting feature of this crane is the luffing mechanism, which makes use of a Threaded Rod engaging the threaded bore of a Coupling attached to the jib. The crane is realistic in appearance and very efficient in operation.


Full particulars for building the Revolving Crane, together with sectional illustrations that make every detail clear, are contained in a special leaflet included in the Outfit. This Leaflet (No. 18) may also be obtained

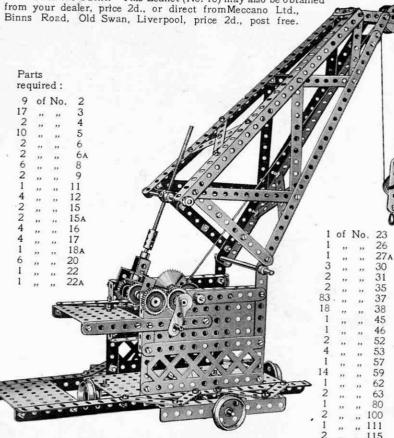

## Model No. 7.22 Hydraulic Crane

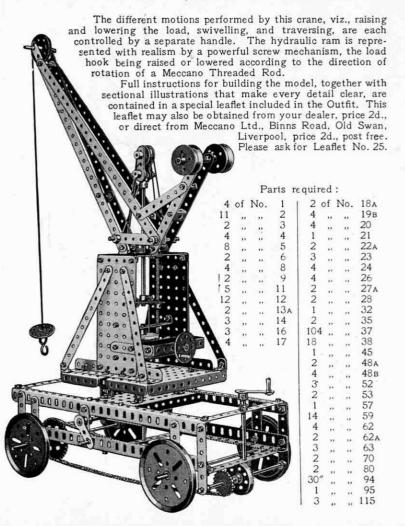

## Model No. 7.23 Planing Machine

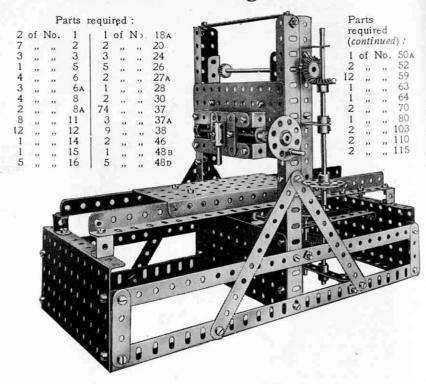

The movements in this model comprise the reciprocating motion of the work table and the vertical and horizontal movements of the tool.

Full instructions for building the model, together with sectional illustrations that make every detail clear, are contained in a special leaflet included in the Outfit. This Leaflet (No. 17) may also be obtained from your dealer. price 2d., or direct from Meccano Ltd., Binns Road, Old Swan, Liverpool, price 2d., post free.

#### Model No. 7.24 Loom

The Meccano Loom, which is considered by many to be the greatest of all the Meccano super models, has recently been re-built and re-designed, so that it is now easier to construct and even more reliable in operation. The process of weaving is entirely automatic; after the model has been completed it is only necessary to turn the handle in order to produce beautiful hat bands, neck-ties, and other practical articles that compare favourably with actual machine-woven material. The model operates exactly like a real loom, the shedding motion of the heald frames, the rocking of the slay and reed, the oscillation of the picking sticks, and the "take-up" of the woven material all taking place with perfect accuracy.

It is not possible to describe the construction of the model adequately in the space provided in this Manual, and we have therefore prepared a special Instruction Leaflet that describes lucidly the construction and operation of every portion of the model. The leaflet is illustrated with beautiful half-tone reproductions of the various portions of the Loom so that everything is made perfectly simple. Full constructional details are also included of a new and improved Beaming Frame for loading the beam of the loom preparatory to weaving. A copy of the Leaflet is included in the No. 7 Outfit and it may also be obtained from any Meccano dealer, price 3d., or direct from Meccano Ltd., Binns Road, Old Swan, Liverpool, price 3d., post free. This leaflet is known as No. 16A.


#### Model No. 7.25 The Tilters


#### Parts required:


The lances 1 pivoted at 2 are raised into position by the Cords 3 and the figures caused to advance together by the Chains 4 on turning the Handle 5.

The Cords 3, instead of being tied where indicated in the illustration, should, after aim, be made fast to some part of the moving figures.

	of	No.	3	1	of	No.	15A
4	.,,	,,	4 5	5	,,		16
22	,,,	**	5	1	,,	.,	19
22 2 2	,,	"	7	10	,,		22
2	,,	"	8в	2 2	,,	,,,	22A
10	,,,	,,	10	2	.,	,,	31
2	"	**	11	73 2	**	,,	37
10	,,		12	2	**	,,	37A
2	"	,,	13	4	,,	**	38
				1	**	,,	46
-	8	2		1	,,	,,	47

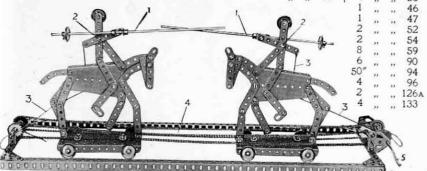


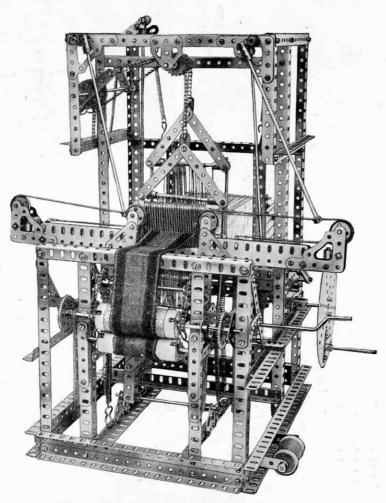

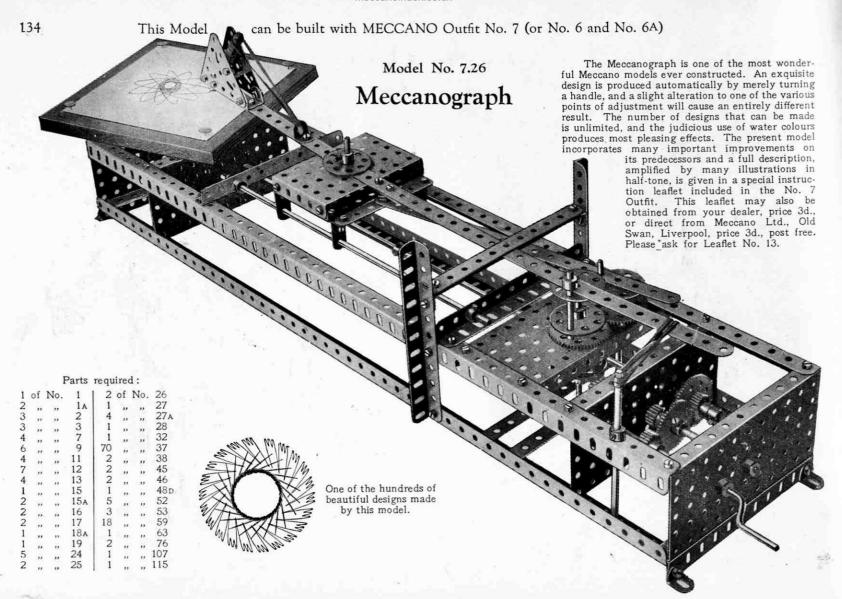

## Model No. 7.27 Vertical Log Saw

## Model No. 7.28 Ship Coaler

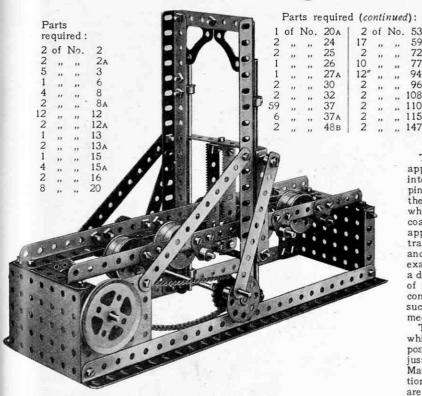



This is a model of a machine used in sawmills for sawing logs into planks. Timber fed lengthwise into one end is automatically carried along on rollers and brought into contact with the saw blades. The vertical reciprocating motion of the blades enables them to cut their way easily through the timber, which emerges from the other end of the machine in the form of planks.

Full instructions for building the model, together with sectional illustrations that make every detail clear, are contained in a special leaflet included in the Outfit. This leaflet may also be obtained from your dealer, price 2d., or direct from Meccano Ltd., Binns Road, Old Swan, Liverpool, price 2d., post free. Please ask for Leaflet No. 23.

This model will appeal to most boys interested in shipping, as showing the manner in which ships can be coaled quickly. The apparatus is centrally controlled and is a good example of the adaptability of Meccano to the construction such complicated mechanical models.

This is a model to which it is not possible to in justice Manual. Instructions for making it are contained in a special leaflet included in the Outfit. This Leaflet (No. 2) may also be purchased from your Meccano dealer, price 3d., or from Meccano Ltd., Old Swan, Liverpool, price 3d., post free.

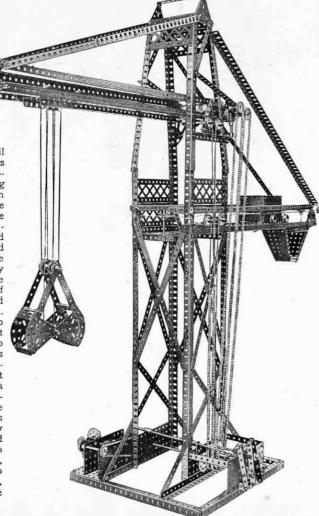

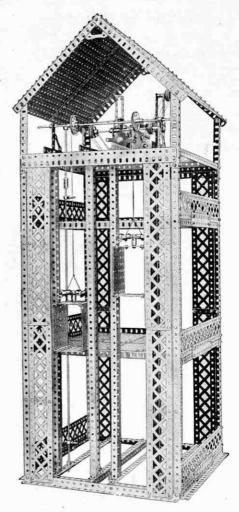

## Model No. 7.29 Automatic Warehouse Lift


This is a model of unique interest. It incorporates two cages which are operated automatically in such a way that, as one rises, the other falls. The cages move with maximum rapidity at about the centre of their travel and the speed decreases towards the top and bottom positions, where the cages pause realistically before returning. The winding gear comprises a specially designed mechanism that is quite different to anything previously constructed in Meccano. A safety device is fitted to each cage so that, should the hoisting cord break, the lifts are promptly locked in position in the lift shaft.

Full instructions for building the model, together with a brief description of lifts in general, are given in a special leaflet which contains numerous half-tone illustrations printed on art paper. A copy of this leaflet is included in the No.7 Outfit, and it may also be obtained from any Meccano dealer, price 3d., or direct from Meccano Ltd., Binns Road, Old Swan, Liverpool, price 3d., post free. Please ask for Leaflet No. 31.


#### Parts required:

38	of	No.	1	4	of	No.	9F	4	of	No.	24	2	of	No.	53A	4	of I	٧o.	108	
2	21	,,,	1 A	2	,,,	.,,	10	- 4		.,	26	6"	,,	,,	58	5	.,,	,,	115	
4	,,		2	2	,,	,,	11	2	,,	,,	27A	28	,,	,,	59	4	,,,	,,	126	
1		,,,	2 <sub>A</sub>	1	,,,	.,	12	2	.,	,,	32	1	,,	,,	62	2	**	,,	133	
9	,,		5	3	,,,	,,	13	424	**	,,	37	4	,,	,,	63	2	,,,		140	
12	**		6a	1			14	2	,,	"	37A	6	,,	,,,	70	4	,,	,,	147A	
12		**	7	2	,,	,,	15A	8	,,	,,	38	4	,,	,,	72	4			147B	
26	,,		8	2	,,	,,	17	1	,,	.,	40	14	,,	"	99			ect		
4	,,	**	8A	2	,,		18A	1	,,	,,	48	4	,,	,,	102		N	loto	r	
6	,,		9	2	.,		21	8	,,	,,,	52A	6	,,	,,	103					
4	,,		9B	8	,,,		22A	4	,,	990	53	2	,,	. ,,	103в					

## Model No. 7.30 Railway Island Platform

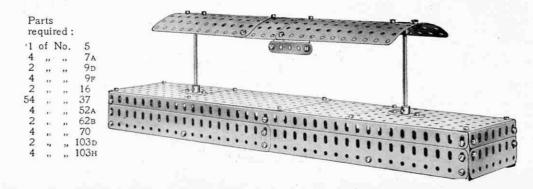


## Model No. 7.31 Stiff-Leg Derrick

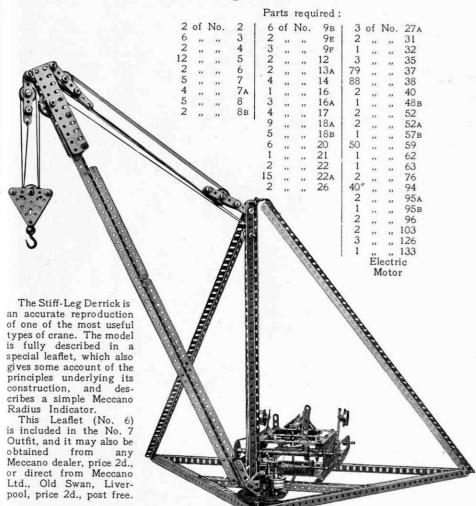


Model No. 7.32 Improved Grandfather Clock


This new Meccano model of a Grandfather Clock is a great improvement on that shown in previous editions of the Instructions Manual. It stands over 6ft. in height, keeps perfect time, and runs for eighteen hours without rewinding. With the exception of the 18 lb. weight which drives it and the dial or face (which may easily be fashioned from a sheet of cardboard, etc.), the model is made entirely from standard Meccano parts. It would take up too much space to describe the construction of the Clock in detail in this Manual and we have therefore prepared a special leaflet in which the model is fully described and illustrated. The Leaflet (No. 14A) is included in the No. 7 Outfit. It may also be purchased either from any Meccano dealer, price 3d., or from Meccano Ltd., Old Swan, Liverpool, price 3d., post free.


It should be noted that in constructing the clock frame exactly as shown in the illustration, 20 12½" and 22 9½" Braced Girders are required in addition to the No. 7 Outfit. These Girders are only ornamental, however, and they can be dispensed with if necessary.

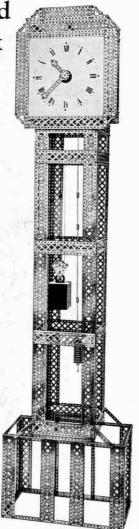

## Model No. 7.33 Motor Cycle and Sidecar

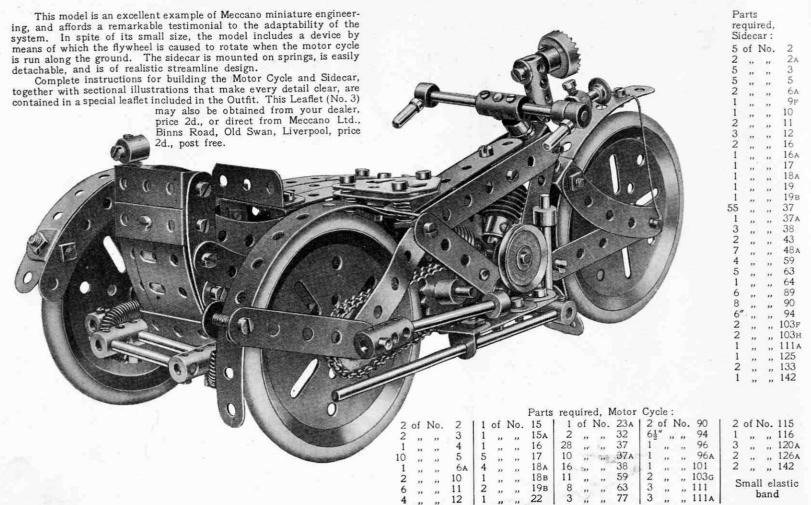

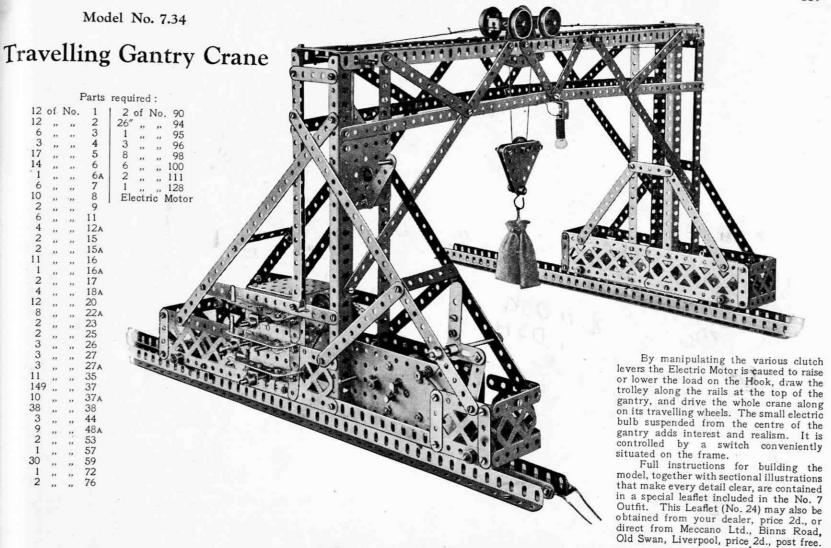


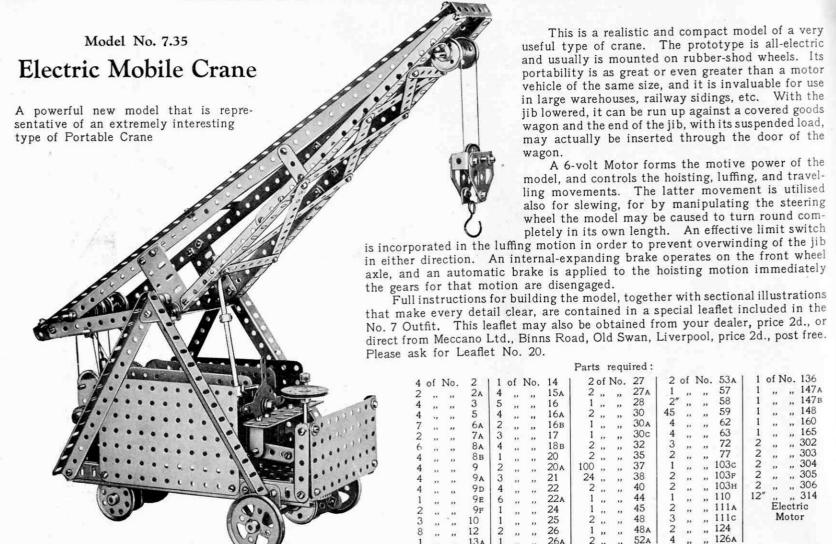


free. When ordering please ask for Leaflet No. 21,

#### Parts required:

				quire			
4	of	No.	1в	1	of	No	
8	,,	,,	2	1	,,	**	32
18	,,	,,	3	26	,,	,,	35
12	,,	,,	5	507	,,	,,	37
14	,,	**	6	162	,,	,,	38
6 10	,,	22	6A	8	,,	**	40
10	,,	**	7	1	,,	,,	35 37 38 40 43
26	**	,,	5 6 6 7 8 8 8 8 9 9	1 2	,,	,,	45 48
10 4	,,	**	8A	4 17 3 3 2 2 4	**	,,	48
4	,,	,,	8в	17	,,	,,	48A
22	"	,,	9	3	,,	,,,	48в
8	,,	,,	9A	3	,,	,,	48c
8 4 4 2	,,	,,	9в	2	,,	,,	52 52 <sub>A</sub> 53
4	,,	. ,,	9D	2	,,	,,,	52A
2	,,	,,	9E	4	**	22	53
6	,,	**	10	28 2 7 4 10' 1 2 3 6 2	,,	,,	59 62 63 70 94 95
6	,,	15	11	2	,,	,,	62
22	,,	,,	12 12 <sub>A</sub> 12 <sub>B</sub> 13	7	**	,,	63
1 8 3 3 2	,,	,,,	12 <sub>A</sub>	4	**		70
8	,,	**	12в	10'	,,	,,	94
3	,,	,,	13	1	,,	**	95
3	,,	,,	13A	2	,,	,,	96
2	,,	.,,	14	3			96A
4	,,	**	15	6	**	,,	99
2	,,	**	15 <sub>A</sub>	2	,,	"	99A
3	,,	***	16A	6	**	,,	100
1	,,	**	16в	20 2 2 4 2	.,	.,,	101
2	,,	,,	17	2	,,	,,	103g
4	,,	,,	18A	2	,,	,,	103ĸ
1	,,	39	19	4	**	"	108
4	,,	:00	20в	2	,,	**	115
4		,,	22	4	"	,,	126A
4	,,	"	23A	4 4 2	,,	,,	136
4 4 1 3	,,	,,	25A	2	22.	,,	165
3	,,	"	26 27		Ele	ectr	ic
1	"	.,,	27		M	loto	r

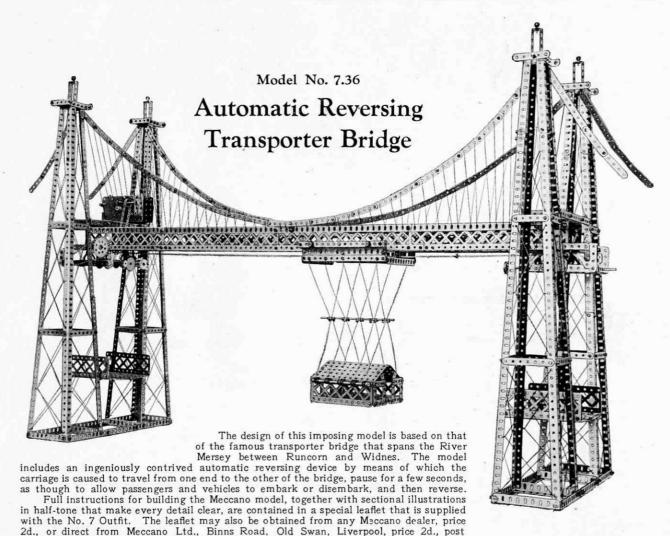


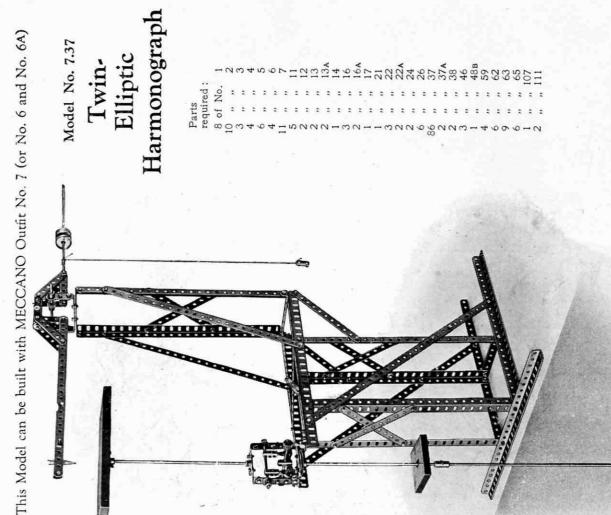

The Twin-elliptic Harmonograph is a model of very great interest. If the pendulum is caused to swing from side to side, or to describe a circular movement, the pencil executes a beautiful design on a sheet of paper. This design varies according to the manner in which the weight is swung, and is an index of its movement. The designs that may be produced are equal in beauty to those made by the Meccanograph, but unlike the latter model, the Harmonograph cannot be made to produce the designs according to a pregranged plan.

Full instructions for building the model, together with a description of its use, are given in a special leaflet, in which the various details are made clear by means of sectional illustrations in half-tone. A copy of the Leaflet (No. 26) is included in the No. 7 Outfit. Copies may also be obtained from any Meccano dealer, price 2d., or direct from Meccano Ltd., Binns Road, Old Swan, Liverpool, price 2d., post free,

### Model No. 7.38 Electrically-driven Traction Engine

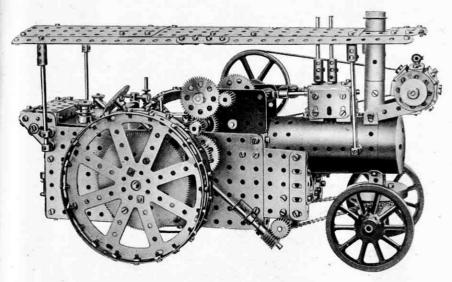


This compact and easily built model is undoubtedly one of the finest in the Meccano range. It is extremely powerful, as will be realised when it is learned that it will easily haul a load more than ten times its own weight! The drive is taken from a 6-volt Electric Motor that is mounted in the position occupied by the fire-box in the prototype.

The novel gear box included in the design provides two speeds forward, and the model will also travel in reverse. A realistic worm-operated chain steering gear, crankshaft, pisten and valve unit, and a dummy electric dynamo are further important features.


Full instructions for building the Meccano Traction Engine, together with sectional illustrations that make every detail clear, are contained in a special leaflet, which may be obtained from your dealer, price 2d., or direct from Meccano Ltd., Old Swan, Liverpool, price 2d., post free. Please ask for Leaflet No. 22.

#### Parts required:


4	of	No.	1B	6	of	No.	17	15	of	No.	37в	1	of	No.	109
6	,,	***	4	3	,,		18A	31	,,	,,	38	6	,,	,,	111
1	***		5	1	.,,	33	18в	1	,,	.,	45	10		**	111c
6	,,	,,	6	2	,,	,,	19A	4	,,,		48	2	**	**	114
13		:.	6A	1		,,	19B	7	,,	,,	52A	5	,,,	**	115
2	. ,,		9	3	,,		20B	17	,,	**	58	1			116A
4	- 22	,,	9в	3	,,	,,	21	28	**		59	4			118
4 2		,,	9c	5	,,	**	24	11	,,		63	.1	**		125
. 4	,,	,,	9D	2	,,	,,	25	1	,,	.,	64	1		,,	132
4	**	- 11	9F	- 3	**	,,	26	4			72	4			133
6	,,	.,,	10	1	,,	.,	26A	3		.,	77	2			136
6	- 22	,,,	11	1	.,,	***	27	1	***	**	80a	1			137
33	,,	,,	12	4	,,	,,	27 A	18"	,,		94	1	- 21		162
1	,,	,,	13A	1	,,	**	27в	1			95	3			163
1	,,	- 20	14	3	,,		31	1	,,		103p	1	,,		164
1		- 22	15	1	,,		32	1	,,		103E	1			165
9	,,	,,	16	248	,,		37	2	**		103g	2			166
1	. ,,	.,,	16A	6			37A	6	**		103н	1			170
						El	ectric	Mot							

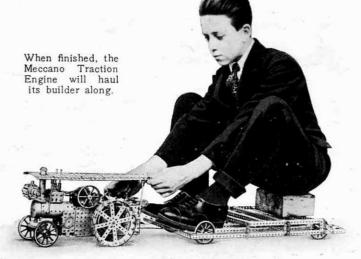

#### This Model can be built with MECCANO Outfit No. 7 (or No. 6 and No. 6A)

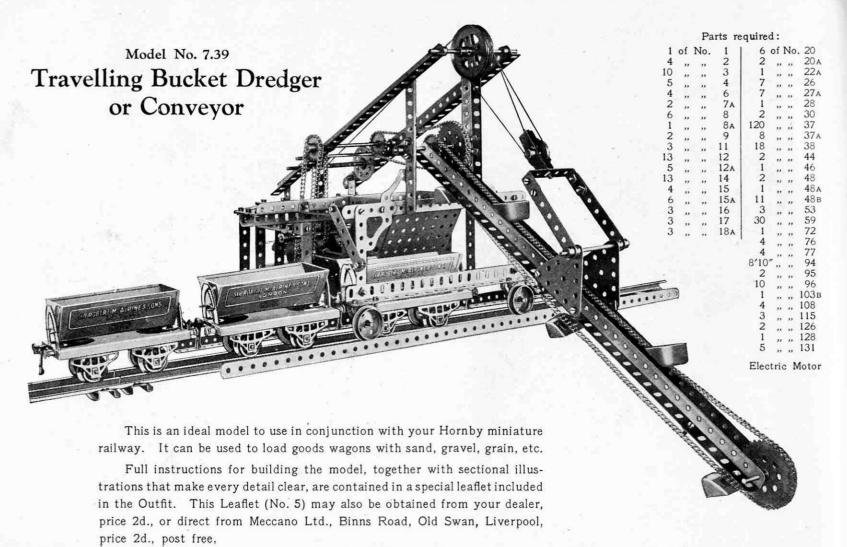

#### Model No. 7.40 Steam Shovel

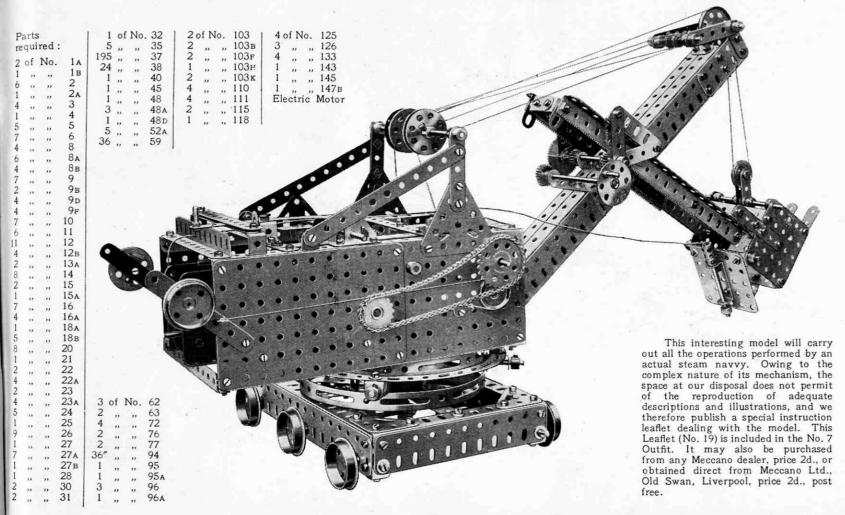

#### Model No. 7.42 Pontoon Crane

11	f No.	2						-	(Alle											
12				01	No.			-			-									
17	22	2A	3	"	11	18A			17			1	-							
	" "	3	8	22	27	20			11	-		7	=	-						
15	,, ,,	4	2	"	"	22			11		W					-				
4 ,	n n	5	7	.,	,,	22A			11			-	1		10		3			
1 ,	,, ,,	6	1	11	"	23			77				4		N.	60		7	4	
	n n	6A	- 5	**	2)	24			100	ì				M				100		1
11 ,	" "	7 A	4	**	22	26			W	,					- Q	10		40	1	100
8 ,	,, ,,	8	5	**	"	27A			- 73							1	all n		1	African
8 ,	n n	8A	4	"	"	30			~	20.						-111	74	10	38.0	300
6 ,	93 31:	8в	3	>>	"	31											Г.	4	CAO.	- 8
2 ,	n n:	9	1	22	22	32	1	of	No.		1	of	No.		4	2000	4876		`অ	
10 ,	,, ,,	9A	135	**	.,	37	1	"	**	57	2	**	,,	99	1	A.	H			100
1 ,	,, ,,	9в	58	**	11	38	1	"	**	57в	4	**	**	103A		Mile	W			3
1 ,	n n	9D	1	,,	23	40	62	"	22	59	4	**	22	103в		107	,			6
	n n	12A	1	22	211	45	3	22		62	1	22	22	103F		H				6
16,	,, ,,	12в	1	**	"	48	6	"	"	63	3	"	33	111		9	•			
2 ,	,, ,,	13A	1	,,	,,,	48A	4	**	.,,	70	16	"	,,	119		(	1			
2 ,		15	4	**	**	48в	3	**	**	76	2	- 33	,,	126						
		15A	2	"	**	48p	2		22	80	2	2.5	22	126A						
6,	, ,,	16	2	21	0	52	1	.,,	225	94	5	"	22	133						
13 ,	,, ,,	16A	2	**	,,	52A	1	"	**	96										
					2 E	Electric	c Mo	tors	5											
	06.41	e abov	or = ora					0.04.5						o to severe ex-	maeces					carr.

This is a model of a giant floating crane of the type used in docks and harbours, etc. The model is equipped with two Electric Motors, one of which controls the swivelling and luffing movements while the other controls the two pulley blocks. The luffing movement is carried out by a powerful screw mechanism, which is connected to the jib by a system of levers and exactly reproduces the actual mechanism used on the prototype. When swivelling, the entire crane with its motors, gear boxes, etc., turns about a built-up roller bearing mounted on the pontoon.


Chain gearing.

Full instructions for building the model are contained in Special Instruction Leaflet No. 28 included in the Outfit. This leaflet may also be obtained from your dealer, price 2d., or direct from Meccano Ltd., Old Swan, Liverpool, price 2d., post free.

being made by exthe Motor 5 throused in docks ectric Motors, ents while the ent is carried to the jib by a mused on the motors, gear the pontoon.

#### This Model can be built with MECCANO Outfit No. 7 (or No. 6 and No. 6A)

# Model No. 7.43 Railway Breakdown Crane

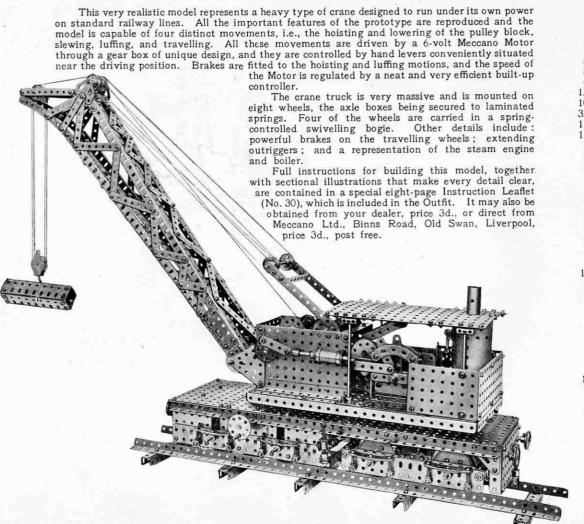

				Part	S	requ	ired:		
2	of	No.	1в	110	f I	Vo.	27в	2	of No. 95A
3	,,,	,,	2	1	,,	,,	28	2	., ,, 96
8520251252248864	.,	,,	2 2 <sub>A</sub> 3 4	1	,,	,,	29	2 2 2 2	" " 96A
2	,,	,,	3	1	,,	,,	30 A	2	" " 103A
)	,,	,,	4	1	,,	,,	30c	2	" " 103F
2	,,		5	1	,,	,,	32	2	., " 103к
5	,,	.,,	6	342	,,	,,	37	8	,, ,, 109
1	,,	,,	6A	62	,,	11	37A	18	,, ,, 111
2	,,		7	82	,,	,,	38	24	., ., 111A
6	,,	,,	7A	2	,,	,,	43	6	" " 111c
2		,,	8	2 2	,,	,,	45	9	,, ,, 115
2	"		8A	1			47	4	" " 116A
1	,,	"	8в	i	,,	"	47A	1	1204
à	"	"	9	i	"	"	48	2	125
2	"	, "	9A	i	**	"	48A	4	1264
6	"	**	9в	3	,,	"	48в	2 4 2	133
A	"		9p	2	,,	22	48c	4	136
7	"	"	9F	1	"	"	50 A	8	127
2	"		10	11	,,,	**	52A	2	1470
8	,,		11	4	,,	"	53 53	1	152
6	"	33			**	"		- 1	162
0	21	**	12	2	"	**	53A	1	163
1			12в	63	**	"	59	2	
5	,,	,,,	14	1	**	**	62	1	,, ,, 164
1		,,	15	6	"	**	62в	1	,, ,, 166
5	,,	,,,	15A	9	"	**	63	1	" "168a
1573322		,,,	16	2	"	**	64	1	"_ " 168в
3	,,		16A	4	,,	**	70	7	6 B.A.
3			17	4	,,	,,	72		Screws
2		, ,,	18A	2	,,	2)	76	14	6 B.A. Nuts
2		, ,,	20в	2	**	,,	77	7	Insulating
0	,		22	2	,,	,,	80a		Bushes
5	,		22A	2	,,	,,	81	7	Insulating
3	,		23	4 4 2 2 2 2 2 3	,,	,,	82		Washers
2	,		23 <sub>A</sub>	3	,,	,,	89	1	Terminal
5	,		24	6	,,	,,	90	1	Electric
053259	, '		26	2 2'	,,	,,	90 A		Motor
6			27A	2'	"	,,	94		
-	, ,	, ,,		-	2.2	,,	15.00		

The special Pulley Block (part No. 152) is not included in the No. 7 Outfit, but it may be substituted if desired by a built-up pulley block (see Standard Mechanisms Nos. 32-36, etc.).


#### This Model can be built with MECCANO Outfit No. 7 (or No. 6 and No. 6A)

Model No. 7.44 Hammerhead Crane


This is a powerful model of a type of massive crane used in shippards and harbours. The movements of the model comprise the rotation of the boom, the traversing of the crane trolley or traveller, and the hoisting and lowering of the pulley block, and all are operated by the Electric Motor mounted on the shorter arm of the boom. The boom is supported by a built-up roller bearing and the movements of the crane are controlled by levers conveniently situated on the gear box.

Full instructions for building this model, together with sectional illustrations that make every detail clear, are contained in Special Instruction Leaflet No. 29 included in the Outfit. This leaflet may also be obtained from your dealer, price 2d., or direct from Meccano Ltd., Old Swan, Liverpool,

price 2d., post free.

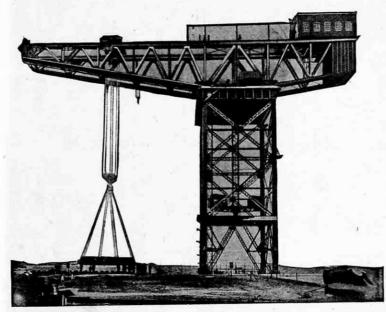

A Giant Hammerhead Crane at work.

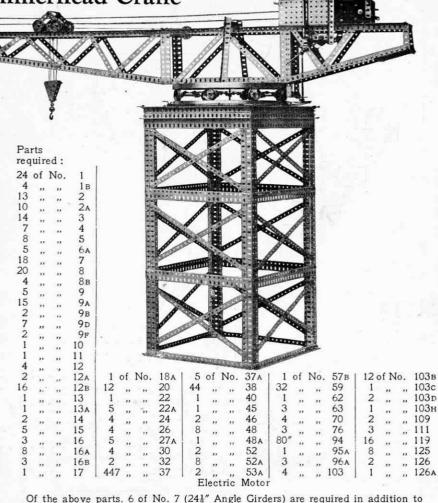

Of the above parts, 6 of No. 7 (24½" Angle Girders) are required in addition to Outfit No. 7, but if desired these parts may be substituted by six 18½" Angle Girders each bolted to one 9½" Angle Girder, the two parts being overlapped 7 holes.

# CONTENTS OF OUTFITS

Preferented Strips, 227  *** *** *** *** *** *** *** *** *** *	-				2									-					-		-	-	tr-													4			-				_				m								_		_															-		40
### 15   15   15   15   15   15   15   1	Perfora	•	:					"		"	Angle (				"		:				:				Double	Angle	- Comment			0	"		"	и	u						Crank		Wheels		Flange	Pulley	Flange	Pulley		"	"	2	Bush W	Pinion		u		Gear W	u	Contract	anna .	Bevel	No. of the last	100	Gear W	Worms	Spanne	Spring	Screw I		Nuts ar	Nuts	Washer	Hanks
1						ř.					irders						:		:		:	:	:	ackets	Brack	racke							:								Jandle	=	å	Wheels	Whee	Wheels	Whee	Wheels		:	*		heels.	Wheels	"	:	:	heels,		" TATA	100	efre "		11	heels.		9	Clips .	rivers	:	d Bolt	:	:: 5	f Cord
1	ips,			,				:			244	183	121	16	1 0	-	C.	4	31	3,	24	2	13		ste	1	-	-	* **		0	200	2		31,	21.	3.	5,4	-		s (5°				ls, 1	2.	Is. 3	7	1,	1,	-	in	:	**	À .	101	-	50-te	70	2 -	, ens,				1.3				·	(spe	8,7/	:	:	ľ
1	121,"	-F6	73.	51"	44	31,	3,	200	15	13																5	*	17	00	:	:	:		:	:	:	:	:	:	:	sha		:	:	*				(fast	(1008	*	(fast		dian				eth.			2 12				8-tee					cial)	32"	:	:	
											:	:			:	:	:	:	:	:	:	:	:							:	:	***	***		:	:	:	:	:	:	(t)		:	:					_	(e)	o o		:	1., 4	-104	+0				(C)	:				th				:			:	:	
	1:	:	:		:	:	:		:		:				:	:	:		:	:	:	:					:		:	:	:	:	:		:	1	:	:	:	:	:		:	:	:			:				:	:	biw.						mann									:	:		:		
			:	:	:	:	:		:		:				:	:	:		:	:	:	:	:				:		:		:				:	:	:	:	:	:	:			:	:			:					:		,	•	•			. (.									:	:		:	:	
	1	:	:	:	:		:	1	:		:				:	:	:	:			:	:					:			:	:	:	:		:	:				:		:		:	:			:	:			:	:	:	:	:	:	:	:										:	:	:		:	
	1:	:	:				:		:		:				:	:	:		:	:	:	:							:		:		:		:	:	:			:		:	:		:				:			:		:			:		:		:											:		
	1 :	:	:	:	:	:	:	3	1,	1	:	1	1		:	:	:	:	;	;	:	1	1			:	:	-	:	:	:	:	:	:	:	:	:	:	1	:	:	:	:	:	:	1	1	1	:	:	:	:	:	:	1	1	:	:	:	:	:		1	- 1	1				:	:	ř	:	:	
	1.1	1	1	4	1	1	1	9	1	1	1	1	1	1		1	1	1	1	1	1	1	1	1		or	_		1 9		1	1	1	1	2	1	1	-	1	1	10	-	1	1	1	1	1	1	1	1	1	7	1	1	1		1	1					1	1	1 Y	1	- 1	-	1	1	3	-	1	7.
4	1	1	1	1	1	1	1	00	1	1	1	1	1	1		1	1	1	1	1	1	1	1	1	2	1 1	-	1	1 1			1	1	1	1	1	1	1	1	1	- 6	1	1	1	1	1	-	1	-	1	-	1	1	1	1	1	1	1	1	1		-	1	1	1	1	_			1	-		1	
4       8       1	1	1	1	4	1	1	1	6	1	1	1	1	1	1		1	1	I	1	1	1	1	1	4	- 6	1 00	,				1	1	1	1	61	1	1	5	1	1	1	-	-1	1	1	1	1	1	4	1	-	1	-	1	1	1	1	1	1	1		1	1	1	1	1	_	9	-	1	-	-	1	,
0   0   1   1   2   2   4   1   1   1   1   1   1   2   2   1   1	4	ī	1	4	1	-	1	I	1	1	1	1	1	1		1	1	Ī	1	1	1	1	1	-	1	1		1			1	1	1	1	-	1	1	1	2	1	1	1	1	4	1	1	1	1	-1	1	1	1	ī	-1	1	1	1	1	1	1		1	1	1	1	1	1	2	1	1		1	8	-
0	4	1	1	œ	1	-	1	6	1	1	1	1	1	1		1	1	1	1	1	1	1	1	10	6	000	, 1	1			1	1	T	1	8	1	1	61	2	1	1	-	1	7	1	1	1	1	4	1	-	1	-	1	1	1	1	I	ı	1		1	1	1	1	-	-			1	-	1000	8	
	9	1	1	9	1	-	1	es	1	67	1	1	4	1		I	1	1	1	1	1	1	1	.00	6	1 4		1			1	1	C1	-	-	1	1	1	63	1	-	1	1	1	1	1	4	1	1	64	1	1	1	1	1	1	1	1	1	1			1	- 1	1	1	I	9	1	1	24	1	9	
1	10	1	1	14	1	61	1	12	1	7	1	I	4	. 1		1	1	1	1	1	1	1	1	oc	4	. 61		1		•	1	1	61	-	4	1	1	7	4	1	-	-	1	4	1	1	4	1	4	61	-	1	-	I	1	1	1	1	1	ı		1	1	1	1	1	-	14	-	1	09	9	14	
	1	1	1	4	1	7	67	1	1	1	1	1	4	1		1	1	1	1	1	1	1	1	1	1	6	1 0	1			1	1	1	61	1	1	1	1	1	1	1	1	1	1	1	2	1	-	1	1	1	1	1	1	1	61	1	1 .	-	1		1	1	1	1	-	1	1	1	1	34	1	1	
1	10	1	1	18	1	9	7	12	1	<b>C1</b>	1	1	00	1		1	1	1	1	1	1	1	1	oc	4	. 1	. 7	1		•	1	1	01	8	4	1	1	61	+	1	-	1	1	4	1	2	4	-	4	63	-	1	-	1	1	61	1	1	-	1		1	1	1	1	-	-	41	-	1	94	9	14	
0	1	1	1	3	7	1	4	9	1	1	1	1	-	1		1	4	1	1	1	1	1	1	-	-	. 0		ij			- 0	2	63	61	-	1	1	8	1	1	1	1	1	1	4	67	-1	1	1	-	63	-	-	1	1	1	1	1	-		- 0	1	-	1	1	-		10	1	1	32	1	10	
1	10	1	1	21	61	9	9	18	1	c1	1	1	6	1		1	4	1	1	1	1	1	1	6	ır	66	2 0	1	c	١.		2	4	o	0	1	1	10	4	1	-	-	1	4	4	4	7	-	4	8	3	-	61	1	1	61	1	1	24	١.		1	-1	1	1	2		18	-	-	26	9	24	
1	9	1	2	10	67	9	63	18	4	4	1	1	10	4		.4	1	1	1	1		1	1	e		7	:			1	1.	1	1	1	1	3	1	1	1	1	1	1	7	1	1	1	1	-	1	1	1	1	1	Î	1	-	1	1	1	1	1		1	1	1	1	1	1	1	1	43	1	1	-
0	16	T	67	26	4	12	œ	36	4	9	1	1	7			N	4	1	1	1	-	-1	-	0	0	8	3 4			١.	-	3	4	0	0	3	1	0	4	1	-	1	4	4	4	4	4	61	4	3	8	-	73	1	1	8	1	1	61	١.	٠ ،	1	1	-1	-1	67		0 0	-		69	9	24	1
80 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0	1	9	ø	5	1	12	4	I	50	00	1	1	12			1	7	63	61	1	10	1	4	4	. 1	10	:	*		• 0	2	2	i	-	67	4	23	4	1	21	61	1	1	1	4	1	1	1	61	-	-	1	3	61	1	63	1	01	-		-		1	1	1	1	1	ıc	1	1	45	1	12	
	30	9	10	28	4	24	12	36	24	14	1	-	26	2	0 0	71	18	53	2	1	9	1	4	16	o o	9	2 4	, -	. 0	, ,	*	9	4	9	7	7	2	8	4	2	3	-	4	4	8	4	4	67	9	4	4	-	10	61	1	c	1	21	3	1 9	4 0	1	-	-1	1	6		24	-				36 1	-
888 888	oo	10	8	12	00	1	12	8	9	1	12	9	1	0	0 0	9	9	13	10	8	-	67	1	7		. 00	3 4	10	1 "	0 0	0	7	67	1	ıc	9	3	3	10	10	1	1	1	1	4	. 1	9	63	4	=		200					22			0 9	1					. 7.	1			1			- 65	

7	1	0 0	0 0	9	4	63	01	œ	18	12	4	ıo	c	1 1	`;	= '	7	9	4	67	1	1	-	-	-	-	. 4			- :	7	63	14	67	9	13		1 -	+ 0	0 1		4	oo :	9	61	61	61	61	63	8	9	16	10	20,	3 44	61	0,4	0 10	00	18	21 -	16	09	41	٠,	12	4	0 0	0 1	63	9	c1 -	٠,-	- 63	-	- (	9:	: 4	18
64			-	I	1	1	1	4	4	0	-	-	1		1	,	1	7	5	2	1	1	-	-	1	1	œ	1		1 5	7	34	2	1	4	4	.				٠,	27	9	9	63	67	1	1	-	8	1		67		Zilli Sin		9+	100	Flygy	10	1-	- oc	09	011	- 0	12	4	0 0	•	2	io	c1 ·		- 67	-	-,	2112	- 61	6
9	1	N	N (	9 .	4	61	01	4	4	7	8	4	6	1 1		+ 1	7	4	61	1	1	Ī	-	-	1	-	9			•	1	53	4	2	2	6		4 0	0 0	4 (	9	27	C1	4	1	1	61	63	-	1	9	16	œ	òo o	۰.	1	4 -	. 4	00	00	7	00	1	61	10	1	1	1	-	٠ ۱	-	1	1 1	1	ŀ	1.	4 4	+ 01	6
5A	1	-	- 0	00	1	-	1	21	4	-	3	1	1		0	1 '	67	67	1	1	1	1	-	-	1	1	4		٠,		1	01	67	67	1	8		4 0	۰,		0	27	C1	63	1	1	-	67	-	1	9	10	4	ò.		1	040	0 4	7	4	21	-	1	-	10	1	1	1	۱ «	1	-	1	11	1	1	15	616	4 64	9
10		-	٠.	· .	4	-	C1 (	77	0	9	1	4			4 -	+ 1	0	2	23	1	1	-1	-	-	-		6	-			1	13	67	1	2	9	1		ŗ,		-	1	1	2	1	1	-	1	1	1	1	9	4	, 4 <sub>0</sub>	4	1	c1 -	- 1	-	4	1	1	1	-	1	-1	1	1	1	1	1	1	11	1	1	15	010	4	3
44		1	1	1 '	24	-	C4	1	1	1	1	2	-		ν.	+	1	67	1	1	1	1	1	1	-	1	-	.			1	6	I	1	63	1	1		1	1 -	-	1	1	1	1	1	1	1	1	1	1	67	1	1	11	1	1	11	1	1	1	-	1	-	1.1	1	1	1	10	1	1	1	1 1	1	1	1	1-	٠,	1
শ		•	- 0	9	21	1	1	77	10	9	1	61	1	c	1	1	0	1	2	1	1	1	-	-	1	-	-	. 1		1	1	10	C4	1	1	9	1			•	1	1	1	63	1	1	-	1	1	1	1	4	4	,04	4	1	01-	٠,	-	4	1	9	1	1	1 1	1	1	1	10	1	1	1	1 1	1	1	1	N -	٠ ا	3
34		1	١.	٠.	-	1	1	1	1	4	1	62	1		1	1 '	67	1	1	1	1	1	1	1	1	1	1				1	9	1	1	1	ıo	1		١.	•	I	1	1	61	1	1	-	1	1	1	1	23	1	200	4	1	c1 -	٠,	1	67	1	4	1	1	1 1	1	1	1	١,	1	1	1	1 1	1	1	15	21-	٠,	-
8	.		- 0		-	1	1 '	27	10	23	1	1	1	•	14	1 '	က	1	67	1	1	1	-	1	١	-	-	1			1	4	67	1	1	-	• 1		0	1	1	1	1	1	1	1	1	1	1	1	1	67	4	1	11	1	1	1 1	-	61	1	100	1	1	1	1	1	1	1 1	1	1	1	11	1	1	1	11	11	63
24		-			-	1	1	-	21	7	1	1	1	•	-	1	က	ļ	1	1	1	1	1	1	1	-	1	1		1	1	4	I	1	1	-	1		1	1	1	1	I	1	1	1	1	1	1	1	1	2	1	1	11	1	1	1	-	1	1	1	1	1	1	1	1	1	1 1	1	1	1	11	1	1	1	1 1	1 1	23
04		1 .	٠,	-	1	1	1	-	20	1	1	1	1	•	-	1	1	1	63	1	1	1	-	1	1	1	-	•	ı	1	1	1	5	1	1	!	1	le le	1	1	1	1	1	1	1	1	1	1	1	1	1	1	4	1	11	1	1	11	1	67	1	100	1	1	1	1	1	1	1 1	1	1	1	11	1	1	1	11	1 1	1
1,		1		-	1	1	1	1	67	l	1	1	1		1	1	1	1	1	1	1	1	1	1	1	1	1		1	1	1	1	63	1	1	1	1		1	1	1	1	1	1	1	1	1	1	1	1	1	1	1	1	1.1	1	1	11	1	7	1	1	1	1	1 1	1	1	1	1 1	1	1	1	11	1	1	1	1.1	11	1
-		1 .	-	1	1	1	1	-	9	1	1	1	1	•	-	1	1	I	23	1	1	1	-	I	-	1	-	•	I	1	1	1	1	1	1	1			1	1	İ	1	1	1	1	1	1	1	1	1	1	1	4	1	11	1	1	11	1	1	1	0	1	1	1	1	1	1	1	1	1	1	11	1	1	1	1.	1	1
vo		1	1	1	1	1	1	-	4	1	1	1	1		1	1	1	1	63	1	1	1	-	1	1	1	1		1	I	1	1	1	ţ	1	1			1	ı	1	I	ı	Ţ	1	I	1	1	1	1	1	1	1	1	1.1	1	1	11	1	1	1	0	1	1	1	1	1	1	1	1	1	I	11	1	1	1	1 !	11	1
0		1 .	-	1	1	1	1	1	7	1	1	1	1	•	-	1	1	I	1	1	1	-	1	1	1	1	-	•	1	1	1	1	1	Ţ	1	1	1		1	1	1	1	L	Į,	Ĺ	1	1	1	1	1	1	1	4	1	11	1	1	11	1	1	1	11	1	1	1	1	1	1	1	1	1	1	11	1	1	1	1 1	1 1	1
00v	1	1	1	1	1	1	1	1	1	1	1	1	1		1	1	1	i	i	1	1	-	1	1	1	1	1		ĺ	I	ĺ.	1	I	1	1	1	I		1	l	1	I	İ	Ī	1	1	1	Ī	1	1	1	1	63	1	1 1	1	1	11	1	1	1	11	1	1	1	1	1	1	l l	1	1	1	11	1	1	1	1.	H	1
3		1.	-	1	1	I	1	1	C1	1	1	1	1	•	7	1	1	1	1	1	-	1	1	1	1	1	-	•	1	1	1	1	1	1	1	1			1	1	1	1	I	1	1	1	1	1	1	1	1	1	21	1	11	1	1	1 1	1	1	1	11	1	1	1	1	1	1	1	1	1	1	11	1	1	1	1	1	1
		:	:	:	:	:	:	:	:	:	:	:		:	:	:	:	:	:	:	:	:				•	:	:	÷	i	:	÷	:	:			:	i	:	i	i	÷	i	:	i	:	:	:	:				:	i	1		:	:		:	:	:		:	:	:	:	:	:	: :	:	:	i	: :		:	:	:	:
		:	:	:	•	:	•		:	•		:		:	:	:	:	:		:		:			s		:	:	:	:	:	:	:	:			:	:	:	:	:	:	:	:	:	:	:	:	:	:	_		: :	:	: :	:	:	:	: :	:	:	:	:	:	:	:	:	:	:	: :	:	:	:	: :		÷	:	:	:
		•	:	•	1	•	:	1	:	:	:	:			(08	•	t rice	•	:		:	:	:		anna		:	•	:	:	:	:	:	:			:	:	:	:	:	:	:	:	:	:	:	•	i	1			:	i	1 1	1	:	:	: :	:	:	:	1	:	i	:	:	:	:	: :	:	:	:	:	:	:	:	: :	:
PART.		:	:	:	:		:	:	:	:	:	:			X	100	×2	:	ates.	:	:	:			M SI		:	:	:	١,	pro	:	:	:			:	:	:	:	:	÷	:	:	1	:	:	:	:				:	:	: :	:	:	:	:	:	:	:	:	:	:	:	:	:	:	: :	:	:	:	: :	:	:	:	:	:
OF		•	:		×	24"×14	*I×	14"×4"	×	×	XX	**X		: 5	S, o	:	s, 31	:	Sector Pla	1, 2"		:	:		Mechanism	arte		:	:	: 1	ig C	:	:	:			:	:	:	:	:	:	:	:	:	:	:	:	:	:	dius		: :	:	1	1	:	:		:	:	:	•	:	:	:	:	:	:	: :	:	:	:	: :	:	:	:	: :	:
DESCRIPTION		:	:			21	3	1	75	31	4	54"	. ,	2 5	Plates,	:	Plate		Secto	ottec	TS:	als			fechi	d o			:	nengru	Spri	SWS	:	:				:	:	:	:	į	e in		i	:	:	:	:	:	. 10" radiu	arge	24", 23"	40	.,,	:	:	:	: :	:	:	:	:	:	:	:	:	:	:		:	:	:	1		:	:	: :	:
CRIP			sdin .	rips	Strips,		=		=		:		h hose			St × St	ged	44"×24"	page	is, si	Polde	Manuals	٠	•	rd N	Meccano		:	١.	Tell	s for	Ser	:	.:	anks		:	:	:	: ;	v	×24	88, 2	_	11}	2,0	34	4	5	1,			2				7.5	31,	21.0	121	6	15	us su	bs	:	: ,	:	:	:	: :	:	:	SILLS	: :	:	8	:	:	:
DES		: :	Sins	it St	gle S			ı				-	with		Flanged	FC.	Flan	44.	Flan	Strip	ion F	-			Standard	Me		100	deal)	1, 40	rews	Set	:	rank	n Cra			eg.	osse	83	- FC	21	Plate	:				:			Strips, 54			Chain	wneers,	: :	£		2	: :			s for Looms	Stri	s, 04	121	4	500	0 6	1,51	13	7	TOOE	: 2	-	Tables	:6	17 CH	:
		: :	ğ,	Ber	An								Diane		nted .	ates	ated	ates	ated	ted	ruct			: :	o St	950 0		:: 1/	(roanea)	100	18 S	wit	:	ed C	Arn	Sat	000	dno	2 .	ror.	ates,		ular		d Re						Stri				•			Girden					for	Bent	rder	: :	: :	:		. :			s for	Rolle	:	ng 7	aves	trip	
		Springs	Стапке	Double Bent Strips	Double Angle	:	:	:		:				200	Perforated	Flat Plates,	Perforated Flanged Plates, 31	Flat Plates,	Perforated Flanged	Perforated Strips, slotted,	00 Instruction Folders	0	က္		car	How to	Hooke	2000	" (roanea)	Sunde	Coupling Screws for Spring	Collars with Set Screws	Cranks	Threaded Cranks	Double Arm Cranks	Couplings	Strip Complines	out to	Inreaded bosses	Centre Forks	Flat Plates, 54" >		Triangular Plates,		Screwed Rods,	ı		2		: :	Curved		: :	Sprocket	: :		2	Braced			ı		Healds for	Single	riat G		: :	ı		. :	: :		Shuttles for Lo	Wood	Sand	Design	Architraves	Rack S	Bolts,
No.	1	£ :	‡ :	45	46	47	47A	48	48v	48B	48c	48b	203	200	70	2ZA	53	53A	54	55A		56в	56A	56	56c		57	57.	9/18	000	VSC	29	82	32A	32B	63	630	900	*	2 8	2 :	7.5	92	77	18	90	80v	80B	81	82	68	06	V06	94	95A	95в	96	V06	86	66	V66		11	25	13.	38 B	13c	350	35	36	Эн	)3к	4 4	99	)6A	12	89	00	_

	inue	
	cont	
	S	
	Ħ	
(	ວົ	
	ot	
	ts	
	ten	
	d	
(	ŭ	

7	50000445040404004400-8-8501-844004800101-00000017575840001	
у9	@4/   @8@@4/4   @   4   @     4 @4/2   4     44/4       44/4	
9	a [uua   u   4440 u   u     x-44       4       uu u	11111=====1111111111111111111111
5A	-   -	
10	a   a==               44x=   a	- []][[][[][[][][][][][][][][][][][][][]
44		
4	α[α      4+4  α       4          α-α-	- 1111111111111111111111111111111111111
34		
8	0   0	111111111111111111111111111111111111111
24		
62	Φ   -               4 0 0	
7	11-111111121112111111111111111111111111	11111111111111111111111111111111111
-	©         aaa	
٧0		
0	©[        aaa	
V00	#	
00	4	1111111111111111111111111111111111111
PART.	11111111111111111111111111111111111111	Instruction Leallets figh-speed Ship-Coaler redger remember and Side-ar redger remembe
OF P	Holts ##  Hinges  Threaded Pins  Fork Pheces  Small Fork Pheces  Small Fork Pheces  Hub Discs (5½" diam.)  Channel Segments (8 to circle)  Spring Buffers  Compression Springs  Truminons  Flat Truminons  Boss Bell Cranks  Boss Bell Cranks  Flat Truminons  Boss Bell Cranks  Flat Truminons  Boss Bell Cranks  Corner Brackets  Theodolite Protractors  Handrail Supports  Wheel Flanges  Universal Couplings  Wheel Flanges  Universal Couplings  Wheel Flanges  Universal Couplings  Wheel Flanges  Circular Silves  Rubber Rugs, 3″ diam.  Dong Clutches.  Circular Strips (1½" diam. overal Circular Pates, 6″.  Pawls  Pivot Bolts with two nuts  Rubber Rugs, 4″.  Rubber Rugs, 4″.  Rubber Rugs, 4″.  Salvether Weets, 2″. x 1″. x 4 diam.  Circular Saws  Salvete Pheces  Columer Adaptors  Savete Pheces  Columer Adaptors  Savete Pheces  Columer Adaptors  Savete Pheces  Columer Screws  Columer Screws  Gall Rushes, Insulating 4″.  Hendulum Connection  Bubbins, Insulating 4″.  Bubbies, Insulating 4″.  Hendulum Connection  Bubbies, Insulating 4″.  Bubbies, In	Instruction Leallets Motor Chassis High-speed Ship-Coaler Dredger Cycle and Side-ar Dredger Cycle and Side-ar Stiff Leg Derrick Platform Scales Bagaetler Table Og Saw Mecanograph New Loon Stone-sawing Machine Stone-sawing Machine Stone-sawing Machine Stone-sawing Machine Stone-sawing Machine Stone-sawing Machine Stone-sawing Machine Stone-sawing Machine Stone-sawing Machine Stone-sawing Machine Stone-sawing Cara Flaning Machine Staning Machine Stone-sawing Machine Stone-sawing Machine Tanasporter Bridge Transporter Transporter Transporter Bridge Transporter Tra
	and the second s	struction Leadled state control of the control of t
DESCRIPTION	Pins	Chassis puped Shin Cycle an Cy
ESCE	December 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1	Instruction Chastuce
D	olts \$\frac{\pi}{\pi}\$ medel Pins medel Pins medel Pins mall Fork Pieces pring Buffers on properties (\$\frac{\pi}{\pi}\$ diam.).  In Couplings man Couplings man Couplings man Couplings made Segments (\$\frac{\pi}{\pi}\$ diam.) made segments (\$\frac{\pi}{\pi}\$ diam.) made segments (\$\frac{\pi}{\pi}\$ diam.) made segments (\$\frac{\pi}{\pi}\$ diam.) made segments (\$\frac{\pi}{\pi}\$ diam.) made segments (\$\frac{\pi}{\pi}\$ diam.) made segments (\$\frac{\pi}{\pi}\$ diam.) made segments (\$\frac{\pi}{\pi}\$ diam.) mulop Tyres, \$\frac{\pi}{\pi}\$ diam. mulop Tyres, \$\frac{\pi}{\pi}\$ miversal Couplings mineral Supports mineral Supports mineral Supports mineral Supports mineral Supports miner Supports mineral Supp	Instruction Lealie Instruction Lealie 1—Motor Chaesis 2—High-speed Ship-Coal 3—Motor Cycle and Side 5—Dreager 6—Stiff Log Derrick 6—Stiff Log Derrick 6—Stiff Log Derrick 6—Stiff Log Derrick 6—Stiff Log Derrick 6—Stone-sawing Machin 7—Horizontal Steam Eng 7—Horizontal Steam Eng 7—Horizontal Steam Eng 7—Horizontal Steam Eng 7—Planing Machin 7—Planing Machine 7—Planing Machine 7—Planing Machine 7—Planing Machine 7—Planing Machine 7—Planing Machine 7—Planing Machine 7—Planing Machine 7—Planing Machine 7—Planing Grane 7—Planing Grane 7—Hydraulic Grane
	aded if Pieces and a part of the pieces and a part of pieces and a part of pieces and a part of pieces and a	ALL HALL STATES AND ALL HALL HAVE AND ALL HALL HAVE AND ALL HALL HAVE AND ALL HALL HAVE AND ALL HALL HALL HAVE AND ALL HAVE AND ALL HALL HAVE AND ALL HAVE AND ALL HALL HAVE AND ALL
	Bolts 4*  Hinged Pins  Threaded Pins  Fork Pieces  Small Fork Pieces  Small Fork Pieces  Small Fork Pieces  Small Fork Pieces  Small Fork Pieces  Compression Springs  Train Couplings  Train Couplings  Train Couplings  Train Couplings  Train Couplings  Train Couplings  Boss Bell Cranks  Boss Bell Cranks  Boss Bell Cranks  Border Buckets  Threodolite Protractors  Wheels, 2#  Handrail Supports  Wheel Fanges  Universal Couplings  Rubber Rings, 3*  Circular Girders (54* diam.)  Dog Cuttcher Strips (74* diam.)  Circular Strips (74* diam.)  Circular Surps (74* diam.)  Circular Bates, 2* x1 x y y diam.  Circular Bates, 4*  Rubber Rings, 4*  Rubber Rings, 4*  Sale Generics, 7* throw  Socket Couplings  Forminals  Contact Screws  Coul Cheeks  Lamp Holders  Lamp Holders  Lamp Holders  Lamp Socket Wire, 4 yels, coll Cheeks  Lamp Holders	38.89.29.25.25.25.25.25.25.38.39.39.39.39.39.39.39.39.39.39.39.39.39.
	HELENSONOLM HARMHOLOMAND DANG CONTRACTOR AND CONTRACTOR CANADA CONTRACTOR CON	8
No.	27.00.00.00.00.00.00.00.00.00.00.00.00.00	
4	11111111111111111111111111111111111111	

Descr	iption.			Model N
Aeroplane,	Revolving			6.12
Alternating				4.9
Ancient Mo				4.5
Anti-Airora	ft Cun		***	4.53
Armoured l	Motor Car		***	
Armoured 1	" Tric	ycle		5.42
Ash Tray a	nd Match	Holder		6.36
Automatic		pe	***	7-13
n	Gong	***	***	4.51
n <b>b</b>	Racer			5.25
p"	Reversing			7 20
Bridge Automatic	C	***	***	7·36 4·20
	Warehous	- Titt	***	7.29
.,			•••	6.32
"	Weighing	Machin		6.18
n	,,,	Bracini		0.10
Bagatelle T	able			6.46
Bale Lifter			***	4.42
Press	•••	•••	•••	4.26
Band Saw	***			4.3
Battle Cruis	ser			5.44
Battleship	***			6.42
Beam Scale	s	***		5.38
Beam Scale Belgian Wa Big Wheel	ter Wheel			5.33
				6.21
Box Ball Al	ing Gear	***		7.7
Box Ball Al	ley	***		6.24
Breast Drill		•••	***	4·15 5·5
Brewer's Dr		***		
Bridge, Can Butter Chu	mever	***	•••	6·6 4·23
Butter Chui	m	***	•••	4.20
Cabin Mono	plane			5.3
Cable Ploug				5.37
Railw	ay			4.29
Cake Walk	***	***		4.48
Cantilever I	Bridge		***	6.6
Cart, Fertili	ser Distrib	outing.	•••	5.10
Catapult		•••		4.32
Char-à-Ban		***	***	5.13
Clay Modell				4.25
Clockwork	Motor 1ra Pacific Ta	olor		7.17
mo'tive			co-	7.10
Conductor's	Punch	•••	12000	4.19
Crane	- 411011			6.22
" Auto	matic Wei	ghing		6.32
" Elev		-		4.58
" Gant	гу			4.62
" Hand	1 Operated	Gantry	y	5.31
. Hydr	raulic			7.22
" Leve	Luffing A	Automa	tic	2 20
Gr	abbing			7.11
	Luffing J			4.40
" Moto	r Breakdo			.44; 7.6
" Porta	ible			6.1
" Radi	al Travelli			6.39
	lving	***	***	7-21
" Rota	ting	otrio D		4.52
	h type Ele			
Trans	elling and			4·47 5·26
Crazy Drive		•••	•••	7.8
Cracy Dalle	r	***	***	, 0

# INDEX TO MODELS

Description.			Model No.	Desc
Delivery Van			5.40	Locomotiv
Derricking Grab Diplodocus Distance Indicator			6.14	
Diplodocus				Tank
Distance Indicator			4.7; 5.4	Locomotiv
Orop Hammer			6.11	Log Saw
Outch Windmill			6-10	Locomotiv
				" Rocke
Eiffel Tower			7.20	Loom
Electrically-driven	Trac	tion	. 20	
Engine	****		7.38	Machine G
Engine Elliptical Lathe	•••			Mantel Clo
Electric Locomotive			0 10	Map Measi
		***		Measuring
Tratation Committee		•••		Meccanogr
Tanan Can		•••		Mechanica
levated Jib Crane	***			Mill Engin
Equatorial Mounting			0.00	Motor Bre
equatorial mounting	•••		0.00	
2				370
ertiliser Distributing	Ca		5-10	" Cha
field Gun	***		7.15	,, C
" " and Carria	ige	•••		T
ire Escape, Automat	ıc	***	7-13	" Dla
" Watertower	•••	***	5.8	
ly Boats		***	6.8	Mouse Tra
Tying Boat		***		Naval 4.7
" Machine			4.46	01
ret Saw			5.12	" Qui
unicular Railway			7.12	OH 117-11 F
				Oil Well I
antry Crane		***	4.62	Opisomete
eometrical Apparatu	15	***	4.28	
iant Auto Swing			5.29	Penny-in-t
			4.39	Periscope
randfather Clock. In	npro	ved	7.32	Pistol, Spr. Pit Head (
un. Anti-Aircraft			4.53	Pit Head (
un, Anti-Aircraft "Naval 4.7"			7.9	Planing Ma
" Naval Quick-firi	ng		4.50	Platform S
"	-0			Pontoon C
Hammerhead Crane			7.44	Portable C
Hand Operated Gantr	v C	ane	5.31	Potato Cho
leald-making Machin			6.34	" Rea
Jelicopter Toy		•••	5.24	Power Pres
lelicopter Toy Iowitzer and Tractor	•••	***	6.47	Punching 1
Iydraulic Crane			7.22	_ "
lydraune Crane	•••	•••	1.22	Puzzle
	- 61		7 00	
mproved Grandfathe	r CI		7.32	Racing Sea
nclined Delivery Chu	te	***	4.12	Racing Sea Radial Tra
nvalid Chair	***	***	5.16	Railway B
				" Is
ack	•••	•••	6.26	Reaping M
" Knife Bridge			6.23	Revolving
oy Wheel			6.16	
			10000	Robot
Cearney's Monorail			6.29	Rotary Tru
			ASSESSMENT OF THE PARTY OF THE	Rotating C
athe			6.37	Roundabou
athe evel Luffing Jib Cran	 ie		4.40	2104444001
" Automa	tic	Grab-		Saw Bench
Line Comme			7-11	
inen Winder		:::	6.31	Searchlight Scotch type

Descrip	tion.			Model :	No
Locomotive				7.4; 7	. 15
Tanta	Clockwo	IK P		7-10	
Locomotive,	Flootric	***	•••	6.19	
Log Saw	Electric		•••		
Locomotive.	Stephen	son's	•••	6.45	
Locomotive,	o replica	3011.3		4.38	
Loom				7.24	
	100	,			
Machine Gun			***	6.30	
Mantel Clock	2**	•••	***	7-16	
Map Measurin		ument	***	5.36	
Measuring Ma		***	***	5.15	
Meccanograph Mechanical C	· ···	***		7.26	
Mechanical C	ross Bo	w		4.55	
Mill Engine		***	***	6.41	10-01
Motor Break		ane	***	4·44; 5·2;5	7 • 6
" Car	•••		•••	5.2; 5	18
	rmoured		•••	5.6	
" Chassis	and Side		•••	7.1	
" Cycle a	and Side	ecar	•••	7.33	
" Lorry	•••		***	4.30	
" Plough		***	***	5.7	
Mouse Trap	•••	***	***	5.23	
Naval 4 . 7" G				7.0	
	firing G		***	7.9	
" Quick-	ming G	un	•••	4.50	
Oil Well Dril	ling An	naratu	s	5.34	
Opisometer	9.r.b	paratu		4.45	
-1		•••	•••	4 10	
Penny-in-the-	Slot Ma	chine		6-15	
Periscope				4.1	
Pistol, Spring				5.9	
Pit Head Gea	r			5-17	
Planing Mach	ine			7.23	
Platform Scal Pontoon Cran	es			6.9	
Pontoon Cran	e			7.42	
Portable Cran	e		***	6-1	
Potato Chopp	er	***	***	4.54	
" Reape				5.35	
Power Press	•••	•••	***	4.43	
Punching Mad	chine			6.4	
" Pre	ss		•••	6.28	
Puzzle	•••			4.13	
Racing Seapla	ne			7.18	
Radial Travel	ling Cra	ne	•••	6.39	
Railway Brea	kdown	Crane	•••	7.43	
	d Platfe	orm		7.30	
Reaping Mach		***	•••	7.2	
Revolving Aer			•••	6.12	
_ , Cra	ne	***	•••	7-21	
Robot				6-3	"
Rotary Truck	Tipper			7.5	
Rotating Cran	e			4.52	
Roundabout	***	•••	•••	6.13	
Cam Banch				4.10	
Saw Bench	•••	•••	•••	4.10	
Searchlight Scotch type El	ectric D	errick	Cran	4-18: 6	- 4

Description	n.		N	fodel No.	
Sextant and Th	codolii			4.35	
				4.21	
Ship Coaler				7.28	
Shunting Locon	notive			4.33	
Sighting Appara	tne			5.22	
Single Cylinder	Horizo			0 22	
				6-43	
Skein Winder	***	***	***	5.14	
Speed Indicator		***	***	4.31	
Spooling Machin		***	***	5.1	
Spring Release	16	***	***	4.49	
Spring Balance	•••	***	•••		
" Pistol		***	•••	5·9 5·20	
St. Malo Transp		2-14	***	6.7	
Steam Changl	orter			50. 7. 10	
Steam Shovel		•••		59 ; 7.40	
" Ing Doa		***		6.20	
" Wagon	•••	•••		60; 5.41	
C. Winch	··· .			4.2	
" Wagon Winch Stephenson's "	Rocke	t" Lo	co-		
motive		•••		4.38	
Stiff Leg Derrick	κ	***	***	7.31	
Stone Sawing M	achine	***	***	6-44	
Submarine	***	***		4.56	
Swing Bridge		•••		4.37	
" Saw		***		4.8	
Swivelling and L	uffing	Jib Cra	ane	4 · 47	
Table Croquet				4.22	
Treadle Hamme		•••		4.4	
		•••		7.25	
Theodolite	•••	•••			
THEOGOTTE	· ·	***	***	6-17	
Three-arm Signa		•••		4.14	
Timber Carriage		•••	•••	5.27	
Tipping Motor V	vagon			4.34	
Traction Engin	e, Ele	ectrical	ıy-		
driven	•••	•••	•••	7.38	
		***	***	4.61	
Tram Car, Elect	ric	•••		5.43	
Travelling Buck	et Dr	edger	or		
Conveyor	•••	•••	•••	7.39	
Conveyor Travelling Crane		•••		5.26	
(vanti	TU ( Tat	1e	5.	19; 7.34	
Trip Hammer				4.36	
Trotting Car				4.16	
Trotting Car Truck Weighing	Machi	ne		5.21	
Twin Elliptic Ha	rmono	graph		7.37	
Universal Radial	Drillin	ng Mac	hine	6.25	
Undertype Stear	n Engi	ne	•••	4.41	
Vertical Drill				5.28	
Lifting	Bridge	•••		6.33	
" Lifting Log Sav	bridge		•••	7.27	
FIG. 17 - 2 - 2 - 2 - 2 - 2 - 2 - 2 - 2 - 2 -			•••	5.30	4
2 100		×	•••	0.30	-
Walking Tractor				6.5	
Warehouse .			4 - 1	7; 7.14	
Watt's Beam En	gine			6.35	
Weather Vane				4.27	
Weighbridge .				6.27	
Wire Covering M	lachine			7.3	
" Rope-maki	ng Ma	chine		4.57	
,	9			- 0,	

#### Patents and Designs Great Britain

250,378 671,485 253,236 671,534 290,121 671,790 648,958 680,416 671,484 682,208

# MECCANO

#### THE TOY THAT MADE ENGINEERING FAMOUS

Millions of boys in every country throughout the world play with Meccano.

These are the Meccano Factories and distributing centres.

Patents and Designs

Great Britain 682,209 718,404 682,934 718,731 683,011 733,541

686,112 733,542 698,054 740,413

740,723

London Office and Warehouse:

Meccano Ltd.,

Walnut Tree Walk,


Kennington Road, London, S.E.11.



London Service and Repair Depot:

Meccano Ltd.,

5/6, Marshall Street,
London, W.1.

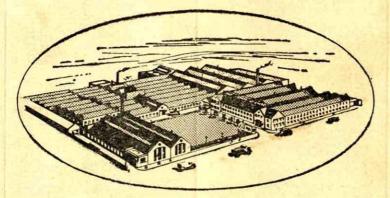

Head Office and Factory: OLD SWAN, LIVERPOOL.

#### Meccano Agencies:

Alexandria, Algiers, Amsterdam, Auckland, Barcelona, Basle, Bogota, Bombay,

Brussels,
Buenos Aires,
Cairo,
Calcutta,
Cape Town,
Caracas,
Constantinople,
Durban,

Hong Kong, Iquitos, Johannesburg, Karachi, Mexico City, Monte Video, Oslo,

Genoa,

Para, Rio de Janeiro, Santiago, San Paulo, Stockholm, Sydney, Tampico, Tanga. Meccano G.m.b.H., Berlin SW.68, Alte Jakobetrasse 20-22.

Canadian Office and Warehouse:

Meccano Ltd.,

34, St. Patrick Street, Toronto.



Meccano (France) Ltd., 78-80, Rue Rébeval, Paris XIXeme.